

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2274
SCHOOL NAME: North Lawndale College Prep/Catalyst
CharterSchool
ADDRESS OF SCHOOL: 1616 S. Spaulding
CITY: Chicago, IL, 60623

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/25/2010

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/2/2013 ENROLLMENT 0
IDPH INSPECTOR LICENSE NUMBER: 100-09725
IDPH LICENSED INSPECTOR NAME (Please Print): Patrick Hrycyk
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



4/2/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

North Lawndale College Prep/Catalyst CharterSchool

1616 S. Spaulding
Chicago, IL, 60623

Unit: 23861
Building ID: 4070

IDPH ID Number: 14-016-2990-2274

REPORT DATE:

Tuesday, April 02, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 7, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23861 Region: 03 IDPH ID: 14-016-2990-2274

School: North Lawndale College Prep/Catalyst CharterSchool Building ID: 4070

Address: 1616 S. Spaulding
Chicago, IL, 60623

Building Contact: Contact Phone:


Current Building Owners: Chicago Public Schools

Review Date: 4/2/2013

Inspector: Patrick Hrycyk Inspector IDPH License: 100-09725
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

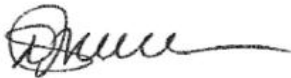

Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 07, 2013

RE: North Lawndale College Prep/Catalyst CharterSchool, Unit 23861
1616 S. Spaulding
Chicago, IL, 60623

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at North Lawndale College Prep/Catalyst CharterSchool , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at North Lawndale College Prep/Catalyst CharterSchool, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: North Lawndale College Prep/Catalyst CharterSchool Unit: 23861 Region: 03
Address: 1616 S. Spaulding Chicago, IL, 60623
IDPH ID: 14-016-2990-2274 Building ID: 4070
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 0

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Patrick Hrycyk


Inspector IDPH license # 100-09725

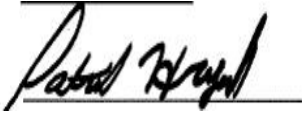Signature: 
Date: 3/7/2013

6. Management Planner

Management Planner Name: Daniel Juneau


Management Planner IDPH license # 100-03613

Signature: 
Date: 4/2/2013

7. Review Date: 4/2/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/2/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the North Lawndale College Prep/Catalyst Charter School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4070:

B. The following new homogenous areas have been identified for Building 4070:

84	12" X 12" White W/Brown & Grey Floor Tile 1893 bldg
84M	12" X 12" White W/Brown & Grey Floor Tile Mastic
85	12" X 12" Yellow Floor Tile
85M	12" X 12" Yellow Floor Tile Mastic
86	2 X 2 Tan W/White & Grey Floor Tile
86M	2 X 2 Tan W/White & Grey Floor Tile Mastic
87	12" X 12" Cream W/Tan Floor Tile
87M	12" X 12" Cream W/Tan Floor Tile Mastic
88	12" X 12" Lt Blue W/Dark Blue Floor Tile
88M	12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic
89	12" X 12" White W/Grey Floor Tile
89M	12" X 12" White W/Grey Floor Tile Mastic
90	12" X 12" Dark Red W/Lt Red Streak Floor Tile
90M	12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic
91	12" X 12" Dark Red W/Blue Streak Floor Tile
91M	12" X 12" Dark Red W/Blue Streak Floor Tile Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

12.1.2	12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic
16.1.2	9"x9" Mastic for Gray VFT w/Wht., Brn & Red Speckl
46	12" x 12" White w/Red & Blue Specks Floor Tile
47	12" x 12" White w/Red & Blue Specks FT Mastic
48	Green Linoleum
49	Green Linoleum Mastic
50	Gray/Green/Brown Mix Carpet Adhesive
51	12" x 12" Red w/Blue & Black Specks FT
52	12" x 12" Red w/Blue & Black Specks FT Mastic
53	Hard Elbows in Fiberglass Insulation Pipes
54	12" x 12" Dark Green Floor Tile
55	12" x 12" Dark Green Floor Tile Mastic
56	12"X12" White w/Multi Colored Floor Tile
57	12"X12" White w/Multi Colored Floor Tile Mastic
58	12"X12" Red w/Blk+Wht Floor Tile
59	12"X12" Red w/Blk+Wht Floor Tile Mastic
60	2'X2' Tan w/Wht +Gry Floor Tile
61	2'X2' Tan w/Wht +Gry Floor Tile Mastic
62	2'X4' Ceiling Tile
63	12"X12" White w/Tan Floor Tile
64	12"X12" White w/Tan Floor Tile Mastic
65	12"X12" White w/ Wht and Brn Floor Tile
66	Mastic on 12"X12" White w/ Wht and Brn Floor Tile
67	2'X2' White w/ Lt Gry and DK Gry Floor tile
68	2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic
69	2'X2' Lt. Blue w/White + Dk Blue Floor Tile
70	2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic
71	12"X12" Lt Blue w/Dk Blue Floor Tile
72	12"X12" Lt Blue w/Dk Blue Floor Tile Mastic
73	Grey Carpet Adhesive
74	White, Black Terrazo Flooring and Bases
75	Brown Terrazo Stairs
76	Blue, White Ceramic Flooring Grout
77	Blue, White Ceramic Flooring Ahesive
78	White Ceramic Floor Tile Grout
79	White Ceramic Flooring Adhesive
80	Tan, White Ceramic Flooring Grout
81	Tan, White Ceramic Flooring Adhesive
82	12" x 12" Beige Floor Tile
83	12" x 12" Beige Floor Tile Mastic
84	12" X 12" White W/Brown & Grey Floor Tile 1893 bldg
84M	12" X 12" White W/Brown & Grey Floor Tile Mastic

85	12" X 12" Yellow Floor Tile
85M	12" X 12" Yellow Floor Tile Mastic
86	2 X 2 Tan W/White & Grey Floor Tile
86M	2 X 2 Tan W/White & Grey Floor Tile Mastic
87	12" X 12" Cream W/Tan Floor Tile
87M	12" X 12" Cream W/Tan Floor Tile Mastic
88	12" X 12" Lt Blue W/Dark Blue Floor Tile
88M	12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic
89	12" X 12" White W/Grey Floor Tile
89M	12" X 12" White W/Grey Floor Tile Mastic
90	12" X 12" Dark Red W/Lt Red Streak Floor Tile
90M	12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic
91	12" X 12" Dark Red W/Blue Streak Floor Tile
91M	12" X 12" Dark Red W/Blue Streak Floor Tile Mastic
H.0.3	Cardboard Pipe Fitting
J.0.2	Aircell Pipe Fitting
L.0.3	Aircell Pipe Fitting
R.0.2	Cardboard Fitting
S.0.1	Cardboard Fitting
T.0.1	Aircell Fitting

The following areas were deemed to be inaccessible:

10.2.3	12"x12" Gray VFT w/Wht. & Gray Speckles Mastic
12.2.2	12"x12" Brn. VFT w/Wht. & Brn & Red Speckles Mastic
17.2.2	9"x9" Gray VFT w/Blk, Wht. & Red Speckles
49	Green Linoleum Mastic
5.3.1	12"x12" Brown VFT w/Wht + Brn + Red Speckles Mastic
52	12" x 12" Red w/Blue & Black Specks FT Mastic
55	12" x 12" Dark Green Floor Tile Mastic
57	12"X12" White w/Multi Colored Floor Tile Mastic
59	12"X12" Red w/Blk+Wht Floor Tile Mastic
61	2'X2' Tan w/Wht +Gry Floor Tile Mastic
64	12"X12" White w/Tan Floor Tile Mastic
66	Mastic on 12"X12" White w/ Wht and Brn Floor Tile
68	2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic
70	2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic
72	12"X12" Lt Blue w/Dk Blue Floor Tile Mastic
77	Blue, White Ceramic Flooring Adhesive
79	White Ceramic Flooring Adhesive
81	Tan, White Ceramic Flooring Adhesive
83	12" x 12" Beige Floor Tile Mastic
84M	12" X 12" White W/Brown & Grey Floor Tile Mastic
85M	12" X 12" Yellow Floor Tile Mastic
86M	2 X 2 Tan W/White & Grey Floor Tile Mastic

87M	12" X 12" Cream W/Tan Floor Tile Mastic
88M	12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic
89M	12" X 12" White W/Grey Floor Tile Mastic
90M	12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic
91M	12" X 12" Dark Red W/Blue Streak Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Patrick Hrycyk, IDPH License # 100-09725. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The North Lawndale College Prep/Catalyst CharterSchool Building 4070 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070
 Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building										
22.2.2	Exterior Window Caulk Casing			Exterior, 1912 Building	NO_ACBM	MISC								
22.3.3	Exterior Window Caulk			Exterior, 1924 Building	NO_ACBM	MISC								
23.1.1	Exterior Window Glaze			Exterior, 1893 Building	NO_ACBM	MISC								
23.2.2	Exterior Window Glaze - Non AHERA			Exterior, 1912 Building	CHR	MISC								
23.3.3	Exterior Window Glaze			Exterior, 1924 Building	NO_ACBM	MISC								
24.1.1	12"x12" Blue Speckled Floor Tile			Room 005, 1893 Building	NO_ACBM	MISC								
24.1.2	12"x12" Blue Speckled Floor Tile			Basement Band Room and Teacher's Lunchroom, 1912 building	NO_ACBM	MISC								
25.1.1	12"x12" Blue Speckled Floor Tile Mastic			Room 005, 1893 Building	NO_ACBM	MISC								
25.1.2	12"x12" Blue Speckled Floor Tile Mastic			Basement Band Room and Teacher's Lunchroom, 1912 Building	NO_ACBM	MISC								
26.1.1	Drywall			Throughout Building, 1893 Building	NO_ACBM	MISC								
26.1.2	Drywall			Basement Band Room, 1912 Building, 1912 Building	NO_ACBM	MISC								
27.1.1	Black Vinyl Floor Covering			Basement Dance Room, 1893 Building	NO_ACBM	MISC								
28.1.1	4" Brown Vinyl Baseboard			1st Floor Teacher's Washroom, 1893 Building	NO_ACBM	MISC								
29.1.1	4" Brown Vinyl Baseboard Adhesive			1st Floor Teacher's Washroom, 1893 Building	NO_ACBM	MISC								
3.1.1	9"x9" Painted Black VFT - ABATED			Service Area Lunchroom- 1893 Bldg.	ABATED	MISC					No			
3.2.1	12" X 12" Light Blue VFT w/Dark Blue Streaks	700	SF	Room 010 - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070
 Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
3.3.1	9"x9" Green VFT - Removed			2nd Floor Teacher's Washroom - 1893	NO_ACBM	MISC								
30.1.1	Interior Window Glaze			Throughout building interior, 1893 building	NO_ACBM	MISC								
30.1.2	Interior Window Glaze			Throughout building interior, 1912 building	NO_ACBM	MISC								
30.1.3	Interior Window Glaze			Throughout the 1924 building	NO_ACBM	MISC								
31.1.1	4" Black Vinyl Baseboard			Rooms 111 & 211, 1893 Building	NO_ACBM	MISC								
32.1.1	4" Black Vinyl Baseboard Adhesive			Rooms 111 & 211, 1893 Building	NO_ACBM	MISC								
33.1.1	12"x12" Beige w/Brown & Black Specks Floor Tile			Rooms 111 & 211, 1893 building	NO_ACBM	MISC								
34.1.1	12"x12" Beige w/rn & Blk Specks Floor Tile Mastic			Rooms 111 & 211, 1893 Building	NO_ACBM	MISC								
35.1.1	Light Brown/Beige Carpet Mastic			2nd Floor Teacher's Office, 1893 Building	NO_ACBM	MISC								
36.1.1	Red/Gray Mixed Carpet Mastic			Room 212, 1893 Building	NO_ACBM	MISC								
36.1.2	2'x4' White/Yellow Ceiling Tile			Basement on wall in the Band room, 1912 Building	NO_ACBM	MISC								
37.1.2	Blue Carpet Mastic			Room 213, 1912 Building	NO_ACBM	MISC								
38.1.2	Greenish Blue Carpet Mastic			Room 214, 1912 Building	NO_ACBM	MISC								
39.1.2	9"x9" Gray Floor Tile w/White & Black Streaks			Assistant Principal's Office, 1912 Building	ABATED	MISC								
40.1.2	9"x9" Gray FT w/White & Black Streaks Mastic			Assistant Principal's Office, 1912 Building	ABATED	MISC								
41.1.2	Orange Carpet Mastic			1st Floor School Manager's Office, 1912 Building	NO_ACBM	MISC								
42.1.2	Black Floor Border Tile			Assistant Principal's Office, 1912 Building	ABATED	MISC		None						Low
43.1.2	Black Floor Border Tile Mastic			Assistant Principal's Office, 1912	ABATED	MISC		None						Low

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070
 Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building										
44.1.3	Black Board Adhesive			Throughout Classrooms, 1924 Building	NO_ACBM	MISC								
45.1.3	Wall Board			Classrooms 201, 202, 203 and 204, 1924 Building	NO_ACBM	MISC								
46	12" x 12" White w/Red & Blue Specks Floor Tile	2,800	SF	Rms 103, 104, 201, 204 - 1924 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	12" x 12" White w/Red & Blue Specks FT Mastic	2,800	SF	Rms 103, 104, 201, 204 - 1924 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	Green Linoleum	2,000	SF	Rms 202 and 203 - 1924 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Green Linoleum Mastic	2,000	SF	Rms 202 and 203 - 1924 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5.1.1	12"x12" Green VFT w/Wh. & Brn. Speckles Mastic			3rd Flr., Jan. Clst., 2nd Flr. Teacher's WR Rm. 107, 1893 Building	NO_ACBM	MISC								
5.2.1	12"x12" Green/Wh/Brn Speckled VFT Mastic	750	SF	Room 107, 3rd Flr. Jan. Clst.,	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5.3.1	12"x12" Brown VFT w/Wh + Brn + Red Speckles Masti	1,500	SF	Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5.4.1	12"x12" Cream VFT w/Blk & White Streaks Mastic			Test Room (N. of Rm #010), 1893 Building- ABATED	ABATED	MISC								
50	Gray/Green/Brown Mix Carpet Adhesive	900	SF	Rms 102 and 107 - 1924 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12" x 12" Red w/Blue & Black Specks FT	4,000	SF	Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12" x 12" Red w/Blue & Black Specks FT Mastic	4,000	SF	Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Hard Elbows in Fiberglass Insulation Pipes	15	LF	Fan Room - 1924 Bldg	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12" x 12" Dark Green Floor Tile	4,500	SF	Auditorium and Auditorium Foyer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12" x 12" Dark Green Floor Tile Mastic	4,500	SF	Auditorium & Auditorium Foyer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070

Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
56	12"X12" White w/Multi Colored Floor Tile	4,500	SF	Ground Floor Hall, 1893 Bldg 1st Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	12"X12" White w/Multi Colored Floor Tile Mastic	4,500	SF	Ground Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	12"X12" Red w/Blk+Wht Floor Tile	4,500	SF	Ground Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	12"X12" Red w/Blk+Wht Floor Tile Mastic	4,500	SF	Ground Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
6.1.1	9"x9" Black Painted VFT Mastic			Service Area of the 1893 Building - ABATED	ABATED	MISC								
6.2.1	9"x9" Green VFT w/Wht. Streaks, Mastic			Rm. #010 of the 1893 Building	CHR	MISC		None						
6.3.1	9"x9" VFT Mastic			2nd Floor Teacher's Washroom, 1893 building	NO_ACBM	MISC								
60	2'X2' Tan w/Wht +Gry Floor Tile	11,000	SF	1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	2'X2' Tan w/Wht +Gry Floor Tile Mastic	11,000	SF	1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	2'X4' Ceiling Tile	4,000	SF	001, 002, Lunchroom and Basement Office	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
63	12"X12" White w/Tan Floor Tile	3,800	SF	Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	12"X12" White w/Tan Floor Tile Mastic	3,800	SF	Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	12"X12" White w/ Wht and Brn Floor Tile	900	SF	3rd Floor Staf Washroom and Washroom Adj to Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070

Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
66	Mastic on 12"X12" White w/ Wht and Brn Floor Tile	900	SF	3rd Floor Staf Washroom and Washroom Adj to Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	2'X2' White w/ Lt Gry and DK Gry Floor tile	1,800	SF	1924 Ground Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic	1,800	SF	1924 Ground Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	2'X2' Lt. Blue w/White + Dk Blue Floor Tile	500	SF	1924 Ground Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic	500	SF	1924 Ground Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	12"X12" Lt Blue w/Dk Blue Floor Tile	800	SF	Rooms 019 and Elevator Service Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
72	12"X12" Lt Blue w/Dk Blue Floor Tile Mastic	800	SF	Rooms 019 and Elevator Service Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	Grey Carpet Adhesive	120	SF	Room 110	ASSUMED	MISC								
74	White, Black Terrazo Flooring and Bases	11,000	SF	1st,2nd,3rd Floors Base, Landings	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
75	Brown Terrazo Stairs	3,000	SF	1st, 2nd, 3rd Floors Stairs and Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
76	Blue, White Ceramic Flooring Grout	1,500	SF	1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	Blue, White Ceramic Flooring Ahesive	1,500	SF	1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	White Ceramic Floor Tile Grout	900	SF	2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
79	White Ceramic Flooring Adhesive	900	SF	2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8.0.3	Drywall			Throughout the 1924 Building.	NO_ACBM	MISC								
80	Tan, White Ceramic Flooring Grout	625	SF	2nd Floor Girls Wash Rooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	Tan, White Ceramic Flooring Adhesive	626	SF	2nd Floor Girls	ASSUMED	MISC	N	None	0		No	ACBM with the		LOW

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool Unit 23861 Building ID 4070
Address 1616 S. Spaulding Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/7/2013
Inspector Name Patrick Hrycyk
100-09725 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1.1.1	
1.2.2	
1.3.3	
10.1.3	
10.2.3	
11.1.2	
11.2.2	
11.3.2	
11.4.2	Material abated
11.5.2	
11.6.2	Material not observed
12.1.2	
12.2.2	
12.3.2	
12.4.2	
12.5.2	
12.6.2	Material not observed/abated
16.1.2	Material not observed - 2013
16.2.2	Material not observed - 2013
17.1.2	
17.2.2	
18.0.3	
19.0.3	
2.1.1	

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool **Unit** 23861 **Building ID** 4070
Address 1616 S. Spaulding **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
2.2.1	
2.3.1	
2.4.1	
20.1.1	
20.2.2	
20.3.3	
21.1.1	
21.2.2	
21.3.3	
22.1.1	
22.2.2	
22.3.3	
23.1.1	
23.2.2	
23.3.3	
24.1.1	
24.1.2	
25.1.1	
25.1.2	
26.1.1	
26.1.2	
27.1.1	
28.1.1	
29.1.1	
3.1.1	Material not observed/abated
3.2.1	
3.3.1	Material not observed - 2013
30.1.1	
30.1.2	

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool **Unit** 23861 **Building ID** 4070
Address 1616 S. Spaulding **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
30.1.3	
31.1.1	
32.1.1	
33.1.1	
34.1.1	
35.1.1	
36.1.1	
36.1.2	
37.1.2	
38.1.2	
39.1.2	Material not observed - 2013
40.1.2	Material not observed/abated - 2013
41.1.2	
42.1.2	Material abated - Replaced with new material
43.1.2	Material abated - Replaced with new material
44.1.3	
45.1.3	
46	
47	
48	
49	
5.1.1	
5.2.1	
5.3.1	
5.4.1	Material abated
50	
51	
52	
53	

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool **Unit** 23861 **Building ID** 4070
Address 1616 S. Spaulding **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
54	
55	
56	
57	
58	
59	
6.1.1	Material abated
6.2.1	Material not observed - 2013
6.3.1	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	Material not observed - Hard wood installed
74	
75	
76	
77	
78	
79	

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool **Unit** 23861 **Building ID** 4070
Address 1616 S. Spaulding **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
8.0.3	
80	
81	
82	
83	
84	
84M	
85	
85M	
86	
86M	
87	
87M	
88	
88M	
89	
89M	
9.1.3	
9.2.3	
90	
90M	
91	
91M	
F.1.1	
F.2.2	
F.3.3	
G.0.3	Material not observed - 2013
H.0.3	Material not observed - 2013
I.0.3	Material not observed - 2013

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool **Unit** 23861 **Building ID** 4070
Address 1616 S. Spaulding **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
J.0.2	Material not observed - 2013
K.0.2	Material not observed - 2013
L.0.3	Material not observed - 2013
O.0.2	Material not observed - 2013
P.0.1	Material not observed - 2013
Q.0.2	Material not observed - 2013
R.0.2	Material not observed - 2013
S.0.1	Material not observed - 2013
T.0.1	Material not observed - 2013
U.0.1	Material not observed - 2013

Table II

Management Planner's Review

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1.1.1	Hard Coat Plaster			Throughout the 1893 Building	No ACBM	SURFACE					
1.2.2	Hard Coat Plaster			Throughout the 1912 Building	No ACBM	SURFACE					
1.3.3	Hard Coat Plaster			Throughout the 1924 Building	No ACBM	SURFACE					
10.1.3	12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic	5,500	SF	Rms. 101, 102, 103, 104, 201, 202, 203, 204, auditorium & engineer's office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
10.2.3	12"x12" Gray VFT w/Wht. & Gray Speckles Mastic	0	SF	Gym & Store Rooms of the 1924 Building (ABATED)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11.1.2	12"x12" Off-Wht. & Brn. VFT w/Brn & Wht. Speckles			2nd & 3rd Floors Corridors of the 1912 Building	No ACBM	MISC					
11.2.2	12"x12" Brn. VFT w/Wht. & Brn & Red Speckles			Rooms 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building	No ACBM	MISC					
11.3.2	12"x12" VFT Grn & Wht. Speckles			Rms 119, Main Office, 220, 314, 315, 316 & 317 of the 1912 Building	No ACBM	MISC					
11.4.2	12"x12" Brn VFT w/ Wht. & Brn. Speckles(ABATED)			Lunchroom & Kitchen of the 1912 Building	Abated	MISC					
11.5.2	12"x12" Brn. VFT w/Wht. & Brn. Speckles			Room 019 of the 1912 Building and Elevator Service Room	No ACBM	MISC					
11.6.2	2nd Layer of Floor Tile(ABATED)		SF	3rd Floor Corridor of the 1912 Building	Abated	MISC			SF		
12.1.2	12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic	11,500	SF	2nd & 3rd Floors of the 1912 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12.2.2	12"x12" Brn. VFT w/Wht. & Brn & Red Speckles Mastic	6,000	SF	Rms. 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12.3.2	12"x12" Grn & Wht. & Brn. Speckles Mastic			Rms. 119, Main Office, 220, 314, 316 & 317 of the 1912 Building	No ACBM	MISC					
12.4.2	12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic			Lunchroom & Kitchen of the 1912 Building	No ACBM	MISC					
12.5.2	12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic			Rooms 019 of the 1912 Building and Elevator Service Room	No ACBM	MISC					
12.6.2	2nd Layer VFT Mastic			3rd Floor Corridor, 1912 building	Abated	MISC					
16.1.2	9"x9" Mastic for Gray VFT w/Wht., Brn & Red Speckl	4,500	SF	1st Floor Corridor of the 1912 Building	Assumed	MISC			SF		
16.2.2	9"x9" Gray VFT w/Blk., Wht. & Red Speckles Mastic			Room 117 of the 1912 Building	Chrysotile	MISC					
17.1.2	9"x9" Gray VFT w/Wht., Brn. & Red Speckles	1,000	SF	1st Floor Corridor, 1912 building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17.2.2	9"x9" Gray VFT w/Blk, Wht. & Red Speckles	900	SF	Room 117 of the 1912 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
18.0.3	Roof field			Exterior, 1924 building Non-AHERA	No ACBM	MISC					
19.0.3	Roof Flashing - Non AHERA			Exterior, 1924 Building	Chrysotile	MISC					
2.1.1	12"x12" Green/Wht/Brn Speckled VFT			Room 107, 3rd Flr. Jan. Clst., 2nd Flr.	No ACBM	MISC					
2.2.1	12"x12" Crm. VFT w/wht/brn Speckles			Rm 212 + Rm. N. of 212 - 1893 Bldg.	No ACBM	MISC					
2.3.1	12"x12" Brn. VFT w/wht.& brn & red Speckles			Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.	No ACBM	MISC					
2.4.1	12"x12" Blk. VFT w/Blk & Wht. Speckles			Test Rm. N. of 010 - 1893 Bldg.	No ACBM	MISC					
20.1.1	Exterior Original Brick			Exterior, 1893 Building	No ACBM	MISC					
20.2.2	Exterior Original Brick			Exterior, 1912 Building	No ACBM	MISC					
20.3.3	Exterior Original Brick			Exterior, 1924 Building	No ACBM	MISC					
21.1.1	Exterior Original Brick Mortar			Exterior, 1893 Building	No ACBM	MISC					
21.2.2	Exterior Original Brick Mortar			Exterior, 1912 Building	No ACBM	MISC					
21.3.3	Exterior Original Brick Mortar			Exterior, 1924 Building	No ACBM	MISC					
22.1.1	Exterior Window Caulk-Casing			Exterior, 1893 Building	No ACBM	MISC					
22.2.2	Exterior Window Caulk Casing			Exterior, 1912 Building	No ACBM	MISC					
22.3.3	Exterior Window Caulk			Exterior, 1924 Building	No ACBM	MISC					
23.1.1	Exterior Window Glaze			Exterior, 1893 Building	No ACBM	MISC					
23.2.2	Exterior Window Glaze - Non AHERA			Exterior, 1912 Building	Chrysotile	MISC					
23.3.3	Exterior Window Glaze			Exterior, 1924 Building	No ACBM	MISC					
24.1.1	12"x12" Blue Speckled Floor Tile			Room 005, 1893 Building	No ACBM	MISC					
24.1.2	12"x12" Blue Speckled Floor Tile			Basement Band Room and Teacher's Lunchroom, 1912 building	No ACBM	MISC					
25.1.1	12"x12" Blue Speckled Floor Tile Mastic			Room 005, 1893 Building	No ACBM	MISC					
25.1.2	12"x12" Blue Speckled Floor Tile Mastic			Basement Band Room and Teacher's Lunchroom, 1912 Building	No ACBM	MISC					
26.1.1	Drywall			Throughout Building, 1893 Building	No ACBM	MISC					
26.1.2	Drywall			Basement Band Room, 1912 Building, 1912 Building	No ACBM	MISC					
27.1.1	Black Vinyl Floor Covering			Basement Dance Room, 1893 Building	No ACBM	MISC					
28.1.1	4" Brown Vinyl Baseboard			1st Floor Teacher's Washroom, 1893 Building	No ACBM	MISC					
29.1.1	4" Brown Vinyl Baseboard Adhesive			1st Floor Teacher's Washroom, 1893 Building	No ACBM	MISC					

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
3.1.1	9"x9" Painted Black VFT - ABATED			Service Area Lunchroom- 1893 Bldg.	Abated	MISC					
3.2.1	12" X 12" Light Blue VFT w/Dark Blue Streaks	700	SF	Room 010 - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
3.3.1	9"x9" Green VFT - Removed			2nd Floor Teacher's Washroom - 1893	No ACBM	MISC					
30.1.1	Interior Window Glaze			Throughout building interior, 1893 building	No ACBM	MISC					
30.1.2	Interior Window Glaze			Throughout building interior, 1912 building	No ACBM	MISC					
30.1.3	Interior Window Glaze			Throughout the 1924 building	No ACBM	MISC					
31.1.1	4" Black Vinyl Baseboard			Rooms 111 & 211, 1893 Building	No ACBM	MISC					
32.1.1	4" Black Vinyl Baseboard Adhesive			Rooms 111 & 211, 1893 Building	No ACBM	MISC					
33.1.1	12"x12" Beige w/Brown & Black Specks Floor Tile			Rooms 111 & 211, 1893 building	No ACBM	MISC					
34.1.1	12"x12" Beige w/rn & Blk Specks Floor Tile Mastic			Rooms 111 & 211, 1893 Building	No ACBM	MISC					
35.1.1	Light Brown/Beige Carpet Mastic			2nd Floor Teacher's Office, 1893 Building	No ACBM	MISC					
36.1.1	Red/Gray Mixed Carpet Mastic			Room 212, 1893 Building	No ACBM	MISC					
36.1.2	2'x4' White/Yellow Ceiling Tile			Basement on wall in the Band room, 1912 Building	No ACBM	MISC					
37.1.2	Blue Carpet Mastic			Room 213, 1912 Building	No ACBM	MISC					
38.1.2	Greenish Blue Carpet Mastic			Room 214, 1912 Building	No ACBM	MISC					
39.1.2	9"x9" Gray Floor Tile w/White & Black Streaks			Assistant Principal's Office, 1912 Building	Abated	MISC					
40.1.2	9"x9" Gray FT w/White & Black Streaks Mastic			Assistant Principal's Office, 1912 Building	Abated	MISC					
41.1.2	Orange Carpet Mastic			1st Floor School Manager's Office, 1912 Building	No ACBM	MISC					
42.1.2	Black Floor Border Tile			Assistant Principal's Office, 1912 Building	Abated	MISC					
43.1.2	Black Floor Border Tile Mastic			Assistant Principal's Office, 1912 Building	Abated	MISC					
44.1.3	Black Board Adhesive			Throughout Classrooms, 1924 Building	No ACBM	MISC					
45.1.3	Wall Board			Classrooms 201, 202, 203 and 204, 1924 Building	No ACBM	MISC					
46	12" x 12" White w/Red & Blue Specks Floor Tile	2,800	SF	Rms 103, 104, 201, 204 - 1924 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
47	12" x 12" White w/Red & Blue Specks FT Mastic	2,800	SF	Rms 103, 104, 201, 204 - 1924 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
48	Green Linoleum	2,000	SF	Rms 202 and 203 - 1924 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	Green Linoleum Mastic	2,000	SF	Rms 202 and 203 - 1924 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5.1.1	12"x12" Green VFT w/Wht. & Brn. Speckles Mastic			3rd Flr., Jan. Clst., 2nd Flr. Teacher's WR Rm. 107, 1893 Building	No ACBM	MISC					
5.2.1	12"x12" Green/Wht/Brn Speckled VFT Mastic	750	SF	Room 107, 3rd Flr. Jan. Clst.,	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5.3.1	12"x12" Brown VFT w/Wht + Brn + Red Speckles Masti	1,500	SF	Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5.4.1	12"x12" Cream VFT w/Blk & White Streaks Mastic			Test Room (N. of Rm #010), 1893 Building- ABATED	Abated	MISC					
50	Gray/Green/Brown Mix Carpet Adhesive	900	SF	Rms 102 and 107 - 1924 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	12" x 12" Red w/Blue & Black Specks FT	4,000	SF	Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52	12" x 12" Red w/Blue & Black Specks FT Mastic	4,000	SF	Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	Hard Elbows in Fiberglass Insulation Pipes	15	LF	Fan Room - 1924 Bldg	Assumed	TSI	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
54	12" x 12" Dark Green Floor Tile	4,500	SF	Auditorium and Auditorium Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
55	12" x 12" Dark Green Floor Tile Mastic	4,500	SF	Auditorium & Auditorium Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
56	12"X12" White w/Multi Colored Floor Tile	4,500	SF	Groung Floor Hall, 1893 Bldg 1st Floor Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
57	12"X12" White w/Multi Colored Floor Tile Mastic	4,500	SF	Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
58	12"X12" Red w/Blk+Wht Floor Tile	4,500	SF	Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
59	12"X12" Red w/Blk+Wht Floor Tile Mastic	4,500	SF	Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6.1.1	9"x9" Black Painted VFT Mastic			Service Area of the 1893 Building - ABATED	Abated	MISC					
6.2.1	9"x9" Green VFT w/Wht. Streaks, Mastic			Rm. #010 of the 1893 Building	Chrysotile	MISC					
6.3.1	9"x9" VFT Mastic			2nd Floor Teacher's Washroom, 1893 building	No ACBM	MISC					
60	2'X2' Tan w/Wht +Gry Floor Tile	11,000	SF	1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
61	2'X2' Tan w/Wht +Gry Floor Tile Mastic	11,000	SF	1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
62	2'X4' Ceiling Tile	4,000	SF	001, 002, Lunchroom and Basement Office	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
63	12"X12" White w/Tan Floor Tile	3,800	SF	Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
64	12"X12" White w/Tan Floor Tile Mastic	3,800	SF	Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
65	12"X12" White w/ Wht and Brn Floor Tile	900	SF	3rd Floor Staf Washroom and Washroom Adj to Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
66	Mastic on 12"X12" White w/ Wht and Brn Floor Tile	900	SF	3rd Floor Staf Washroom and Washroom Adj to Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
67	2'X2' White w/ Lt Gry and DK Gry Floor tile	1,800	SF	1924 Ground Floor Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
68	2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic	1,800	SF	1924 Ground Floor Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
69	2'X2' Lt. Blue w/White + Dk Blue Floor Tile	500	SF	1924 Ground Floor Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
70	2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic	500	SF	1924 Ground Floor Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
71	12"X12" Lt Blue w/Dk Blue Floor Tile	800	SF	Rooms 019 and Elevator Service Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
72	12"X12" Lt Blue w/Dk Blue Floor Tile Mastic	800	SF	Rooms 019 and Elevator Service Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
73	Grey Carpet Adhesive	120	SF	Room 110	Assumed	MISC			SF		
74	White, Black Terrazo Flooring and Bases	11,000	SF	1st,2nd,3rd Floors Base, Landings	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
75	Brown Terrazo Stairs	3,000	SF	1st, 2nd, 3rd Floors Stairs and Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
76	Blue, White Ceramic Flooring Grout	1,500	SF	1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
77	Blue, White Ceramic Flooring Ahesive	1,500	SF	1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
78	White Ceramic Floor Tile Grout	900	SF	2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
79	White Ceramic Flooring Adhesive	900	SF	2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
8.0.3	Drywall			Throughout the 1924 Building.	No ACBM	MISC					
80	Tan, White Ceramic Flooring Grout	625	SF	2nd Floor Girls Wash Rooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School North Lawndale College Prep/Catalyst CharterSchool
Address 1616 S. Spaulding Chicago, IL, 60623
Unit 23861 **Building ID** 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
81	Tan, White Ceramic Flooring Adhesive	626	SF	2nd Floor Girls Wash Rooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
82	12" x 12" Beige Floor Tile	150	SF	Assistant Principal Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
83	12" x 12" Beige Floor Tile Mastic	150	SF	Assistant Principal Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
84	12" X 12" White W/Brown & Grey Floor Tile 1893 bldg	4,444	SF	Teachers Washroom 2nd floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
84M	12" X 12" White W/Brown & Grey Floor Tile Mastic	4,444	SF	2nd Floor Teachers Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
85	12" X 12" Yellow Floor Tile	180	SF	Office 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
85M	12" X 12" Yellow Floor Tile Mastic	180	SF	Office of 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
86	2 X 2 Tan W/White & Grey Floor Tile	1,200	SF	Room 117 of 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
86M	2 X 2 Tan W/White & Grey Floor Tile Mastic	1,200	SF	Room 117 of 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
87	12" X 12" Cream W/Tan Floor Tile	660	SF	Room 010	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
87M	12" X 12" Cream W/Tan Floor Tile Mastic	660	SF	Room 010	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
88	12" X 12" Lt Blue W/Dark Blue Floor Tile	360	SF	Test Room 010	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
88M	12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic	360	SF	Test Room 010	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
89	12" X 12" White W/Grey Floor Tile	1,950	SF	Main Office of 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
89M	12" X 12" White W/Grey Floor Tile Mastic	1,950	SF	Main Office of 1912 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
9.1.3	12"x12" Brown VFT w/Wht. & Brn. Specks			Rms. 101, 102, 103, 104, 201, 202, 203, 204, Auditorium	No ACBM	MISC					
9.2.3	12"x12" Gray VFT w/Wht. & Gray Speckles			Gym, Store Rooms of the 1924 Building.	No ACBM	MISC					
90	12" X 12" Dark Red W/Lt Red Streak Floor Tile	70	SF	Main Office 1912 Spot Tile	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
90M	12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic	70	SF	Main Office of 1912 Bldg Spot Tile	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
91	12" X 12" Dark Red W/Blue Streak Floor Tile	370	SF	Main Office Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
91M	12" X 12" Dark Red W/Blue Streak Floor Tile Mastic	370	SF	Main Office Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
F.1.1	Fiberglass Pipe fitting			Basement Corridors of the 1893 Building	No ACBM	MISC					
F.2.2	Fiberglass on Pipe Fitting			Basement Corridor of the 1912 Building	No ACBM	MISC					
F.3.3	Fiberglass on Pipe Fitting			Basement Boiler Rm., Coal rm., E/W Cdr. Engineer's Office, 1st + 2nd Floors 1924 Bldg.	No ACBM	MISC					
G.0.3	Cardboard Pipe Run Insulation			Basement Janitor Closet, Eng. Rm.,	Chrysotile	TSI					

Chicago Public Schools

North Lawndale College
Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Cordr, Fan Rm #3 - 1924							
H.0.3	Cardboard Pipe Fitting			Basement Janitor Closet, Engine Rm, Cordr., + Fan Room #3 - 1924 Bldg.	Assumed	TSI					
I.0.3	Aircell Pipe Insulation Run			Rm 209	Chrysotile	TSI					
J.0.2	Aircell Pipe Fitting			Basement Cordr. Rm. 016A, Kitchen of the 1912 Bldg.	Assumed	TSI					
K.0.2	Duct Wrap Aircell			Basement Corridor of the 1912 Bldg.	Chrysotile	TSI					
L.0.3	Aircell Pipe Fitting			Basement Cordr. A, Engine Rm., Fan Rm. #3 of the 1924 Bldg.	Assumed	TSI					
O.0.2	Aircell Pipe Run			Basement cordr., Rm. 016, Kitchen - 1912 Bldg.	Chrysotile	TSI					
P.0.1	Cardboard Pipe Run			Pump and Tank Rooms, Area South of Lunchroom, Small Room Adjacent to the kitchen/Lunchroom 1893	Chrysotile	TSI					
Q.0.2	Cardboard Pipe Run			Receiving Rm. - 1912 Bldg.	Chrysotile	TSI					
R.0.2	Cardboard Fitting			Receiving Area and Pipe Chases - 1912 Bldg.	Assumed	TSI					
S.0.1	Cardboard Fitting			Pump and Tank Rooms, the Area S. of Lunchrm and Small Rm Adjacent to the kitchen/Lunchrm- 1893 Bldg.	Assumed	TSI					
T.0.1	Aircell Fitting			Pump and Tank Rooms, Area S. of Lunchrm., Small Rm Adjacent to kitchen/Lunchrm. -1893 Bldg.	Assumed	TSI					
U.0.1	Aircell Pipe Run			Bsmnt., Cordr., StoreRm., Hallway by Rm. 06, 1st + 2nd Flr. WRs -1893 Bldg.	Chrysotile	TSI					

Chicago Public Schools

North Lawndale College
 Prep/Catalyst
School CharterSchool
Address 1616 S. Spaulding

Unit 23861
 Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
 600 West Van Buren St., Ste 500
 Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/2/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1.1.1	
1.2.2	
1.3.3	
10.1.3	
10.2.3	
11.1.2	
11.2.2	
11.3.2	
11.4.2	
11.5.2	
11.6.2	
12.1.2	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
12.2.2	
12.3.2	
12.4.2	
12.5.2	
12.6.2	
16.1.2	
16.2.2	
17.1.2	
17.2.2	
18.0.3	
19.0.3	
2.1.1	
2.2.1	
2.3.1	
2.4.1	
20.1.1	
20.2.2	
20.3.3	
21.1.1	
21.2.2	
21.3.3	
22.1.1	
22.2.2	
22.3.3	
23.1.1	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
23.2.2	
23.3.3	
24.1.1	
24.1.2	
25.1.1	
25.1.2	
26.1.1	
26.1.2	
27.1.1	
28.1.1	
29.1.1	
3.1.1	
3.2.1	
3.3.1	
30.1.1	
30.1.2	
30.1.3	
31.1.1	
32.1.1	
33.1.1	
34.1.1	
35.1.1	
36.1.1	
36.1.2	
37.1.2	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
38.1.2	
39.1.2	
40.1.2	
41.1.2	
42.1.2	
43.1.2	
44.1.3	
45.1.3	
46	
47	
48	
49	
5.1.1	
5.2.1	
5.3.1	
5.4.1	
50	
51	
52	
53	
54	
55	
56	
57	
58	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
59	
6.1.1	
6.2.1	
6.3.1	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
8.0.3	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
80	
81	
82	
83	
84	
84M	
85	
85M	
86	
86M	
87	
87M	
88	
88M	
89	
89M	
9.1.3	
9.2.3	
90	
90M	
91	
91M	
F.1.1	
F.2.2	
F.3.3	

Chicago Public Schools

School North Lawndale College
Prep/Catalyst
CharterSchool
Address 1616 S. Spaulding

Unit 23861
Chicago, IL, 60623

Building ID 4070
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
G.0.3	
H.0.3	
I.0.3	
J.0.2	
K.0.2	
L.0.3	
O.0.2	
P.0.1	
Q.0.2	
R.0.2	
S.0.1	
T.0.1	
U.0.1	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1.1.1**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1893 Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

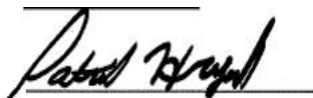

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1.1.1**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout the 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1.2.2**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

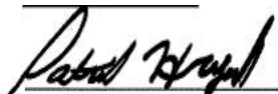

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1.2.2**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1.3.3**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout the 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

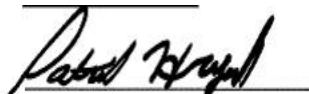

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1.3.3**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout the 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10.1.3**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Rms. 101, 102, 103, 104, 201, 202, 203, 204, auditorium & engineer's office**

MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

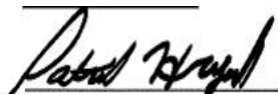

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **10.1.3**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
MATERIAL LOCATION: **Rms. 101, 102, 103, 104, 201, 202, 203, 204, auditorium & engineer's office**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10.2.3**
MATERIAL DESCRIPTION: **12"x12" Gray VFT w/Wht. & Gray Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Gym & Store Rooms of the 1924 Building (ABATED)**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

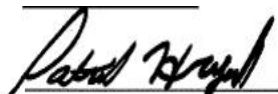

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **10.2.3**
MATERIAL DESCRIPTION: **12"x12" Gray VFT w/Wht. & Gray Speckles Mastic**
MATERIAL LOCATION: **Gym & Store Rooms of the 1924 Building (ABATED)**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.1.2**
MATERIAL DESCRIPTION: **12"x12" Off-Wht. & Brn. VFT w/Brn & Wht. Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd & 3rd Floors Corridors of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

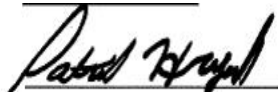

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **11.1.2**
MATERIAL DESCRIPTION: **12"x12" Off-Wht. & Brn. VFT w/Brn & Wht. Speckles**
MATERIAL LOCATION: **2nd & 3rd Floors Corridors of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.2.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn & Red Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

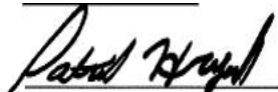

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **11.2.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn & Red Speckles**
MATERIAL LOCATION: **Rooms 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.3.2**
MATERIAL DESCRIPTION: **12"x12" VFT Grn & Wht. Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rms 119, Main Office, 220, 314, 315, 316 & 317 of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

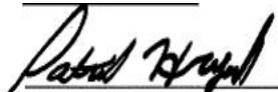

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **11.3.2**
MATERIAL DESCRIPTION: **12"x12" VFT Grn & Wht. Speckles**
MATERIAL LOCATION: **Rms 119, Main Office, 220, 314, 315, 316 & 317 of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.4.2**
MATERIAL DESCRIPTION: **12"x12" Brn VFT w/ Wht. & Brn. Speckles(ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Lunchroom & Kitchen of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material abated**

Inspector's Signature:

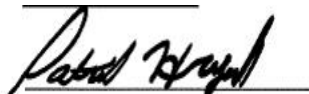

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11.4.2**
MATERIAL DESCRIPTION: **12"x12" Brn VFT w/ Wht. & Brn. Speckles(ABATED)**
MATERIAL LOCATION: **Lunchroom & Kitchen of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.5.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 019 of the 1912 Building and Elevator Service Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

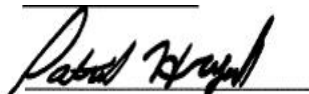

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11.5.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles**
MATERIAL LOCATION: **Room 019 of the 1912 Building and Elevator Service Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11.6.2**
MATERIAL DESCRIPTION: **2nd Layer of Floor Tile(ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **3rd Floor Corridor of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Material not observed**

Inspector's Signature:

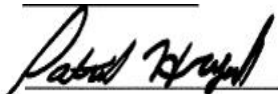

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **11.6.2**
MATERIAL DESCRIPTION: **2nd Layer of Floor Tile(ABATED)**
MATERIAL LOCATION: **3rd Floor Corridor of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

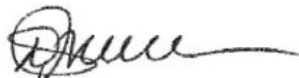

Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.1.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd & 3rd Floors of the 1912 Building**
MATERIAL QUANTITY: **11500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

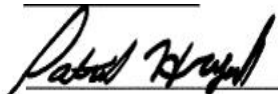

Date: 03/07/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12.1.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
MATERIAL LOCATION: **2nd & 3rd Floors of the 1912 Building**
MATERIAL QUANTITY: **11500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.2.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn & Red Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Rms. 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

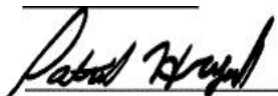

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12.2.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn & Red Speckles Mastic**
MATERIAL LOCATION: **Rms. 120, 218, 313, 317, 318, 319 & 320 of the 1912 Building**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.3.2**
MATERIAL DESCRIPTION: **12"x12" Grn & Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rms. 119, Main Office, 220, 314, 316 & 317 of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

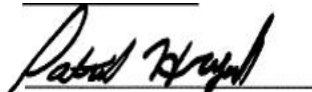

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12.3.2**
MATERIAL DESCRIPTION: **12"x12" Grn & Wht. & Brn. Speckles Mastic**
MATERIAL LOCATION: **Rms. 119, Main Office, 220, 314, 316 & 317 of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 04/02/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.4.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Lunchroom & Kitchen of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

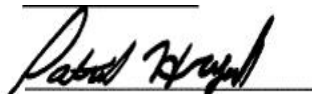

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **12.4.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
MATERIAL LOCATION: **Lunchroom & Kitchen of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.5.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 019 of the 1912 Building and Elevator Service Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

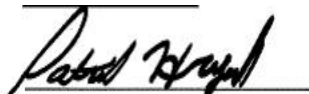

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12.5.2**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/Wht. & Brn. Speckles Mastic**
MATERIAL LOCATION: **Rooms 019 of the 1912 Building and Elevator Service Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12.6.2**
MATERIAL DESCRIPTION: **2nd Layer VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **3rd Floor Corridor, 1912 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed/abated**

Inspector's Signature:

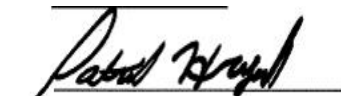

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12.6.2**
MATERIAL DESCRIPTION: **2nd Layer VFT Mastic**
MATERIAL LOCATION: **3rd Floor Corridor, 1912 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16.1.2**
MATERIAL DESCRIPTION: **9"x9" Mastic for Gray VFT w/Wht., Brn & Red Speckl**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor of the 1912 Building**

MATERIAL QUANTITY: **4500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

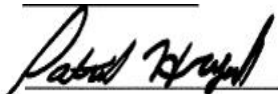

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **16.1.2**
MATERIAL DESCRIPTION: **9"x9" Mastic for Gray VFT w/Wh., Brn & Red Speckl**
MATERIAL LOCATION: **1st Floor Corridor of the 1912 Building**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16.2.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Blk., Wht. & Red Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 117 of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

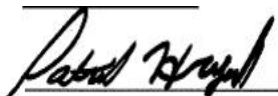

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **16.2.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Blk., Wht. & Red Speckles Mastic**
MATERIAL LOCATION: **Room 117 of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Wht., Brn. & Red Speckles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor, 1912 building**

MATERIAL QUANTITY: **1000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

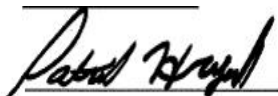

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **17.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Wht., Brn. & Red Speckles**
MATERIAL LOCATION: **1st Floor Corridor, 1912 building**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17.2.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Blk, Wht. & Red Speckles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Room 117 of the 1912 Building**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

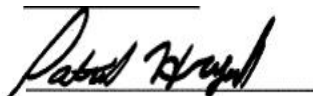

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **17.2.2**
MATERIAL DESCRIPTION: **9"x9" Gray VFT w/Blk, Wht. & Red Speckles**
MATERIAL LOCATION: **Room 117 of the 1912 Building**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18.0.3**
MATERIAL DESCRIPTION: **Roof field**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 building Non-AHERA**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

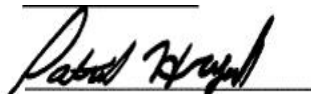

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **18.0.3**
MATERIAL DESCRIPTION: **Roof field**
MATERIAL LOCATION: **Exterior, 1924 building Non-AHERA**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19.0.3**
MATERIAL DESCRIPTION: **Roof Flashing - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

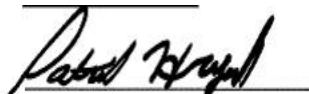

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **19.0.3**
MATERIAL DESCRIPTION: **Roof Flashing - Non AHERA**
MATERIAL LOCATION: **Exterior, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2.1.1**
MATERIAL DESCRIPTION: **12"x12" Green/Wht/Brn Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 107, 3rd Flr. Jan. Clst., 2nd Flr.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

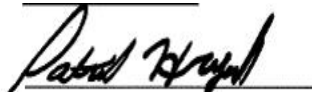

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **2.1.1**
MATERIAL DESCRIPTION: **12"x12" Green/Wht/Brn Speckled VFT**
MATERIAL LOCATION: **Room 107, 3rd Flr. Jan. Clst., 2nd Flr.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2.2.1**
MATERIAL DESCRIPTION: **12"x12" Crm. VFT w/wht/brn Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rm 212 + Rm. N. of 212 - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

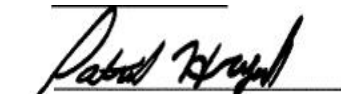

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **2.2.1**
MATERIAL DESCRIPTION: **12"x12" Crm. VFT w/wht/brn Speckles**
MATERIAL LOCATION: **Rm 212 + Rm. N. of 212 - 1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2.3.1**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/wht.& brn & red Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

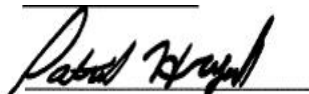

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **2.3.1**
MATERIAL DESCRIPTION: **12"x12" Brn. VFT w/wht.& brn & red Speckles**
MATERIAL LOCATION: **Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2.4.1**
MATERIAL DESCRIPTION: **12"x12" Blk. VFT w/Blk & Wht. Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Test Rm. N. of 010 - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

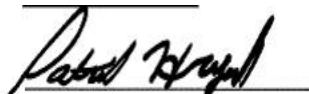

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **2.4.1**
MATERIAL DESCRIPTION: **12"x12" Blk. VFT w/Blk & Wht. Speckles**
MATERIAL LOCATION: **Test Rm. N. of 010 - 1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20.1.1**
MATERIAL DESCRIPTION: **Exterior Original Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

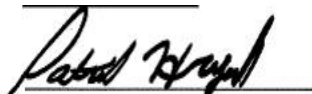

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **20.1.1**
MATERIAL DESCRIPTION: **Exterior Original Brick**
MATERIAL LOCATION: **Exterior, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20.2.2**
MATERIAL DESCRIPTION: **Exterior Original Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

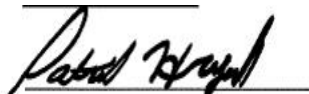

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **20.2.2**
MATERIAL DESCRIPTION: **Exterior Original Brick**
MATERIAL LOCATION: **Exterior, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20.3.3**
MATERIAL DESCRIPTION: **Exterior Original Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

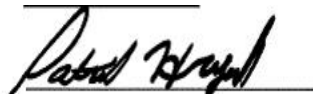

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **20.3.3**
MATERIAL DESCRIPTION: **Exterior Original Brick**
MATERIAL LOCATION: **Exterior, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21.1.1**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

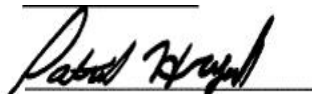

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **21.1.1**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
MATERIAL LOCATION: **Exterior, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21.2.2**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

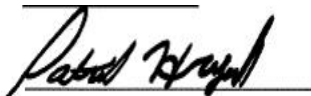

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **21.2.2**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
MATERIAL LOCATION: **Exterior, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21.3.3**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

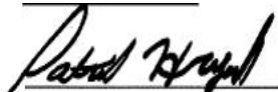

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **21.3.3**
MATERIAL DESCRIPTION: **Exterior Original Brick Mortar**
MATERIAL LOCATION: **Exterior, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22.1.1**
MATERIAL DESCRIPTION: **Exterior Window Caulk-Casing**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

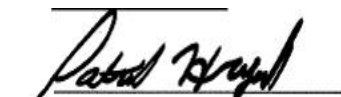

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **22.1.1**
MATERIAL DESCRIPTION: **Exterior Window Caulk-Casing**
MATERIAL LOCATION: **Exterior, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22.2.2**
MATERIAL DESCRIPTION: **Exterior Window Caulk Casing**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

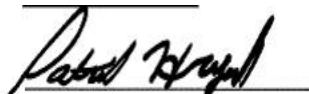

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **22.2.2**
MATERIAL DESCRIPTION: **Exterior Window Caulk Casing**
MATERIAL LOCATION: **Exterior, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22.3.3**
MATERIAL DESCRIPTION: **Exterior Window Caulk**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

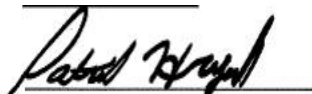

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **22.3.3**
MATERIAL DESCRIPTION: **Exterior Window Caulk**
MATERIAL LOCATION: **Exterior, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23.1.1**
MATERIAL DESCRIPTION: **Exterior Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

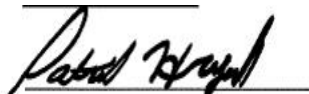

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **23.1.1**
MATERIAL DESCRIPTION: **Exterior Window Glaze**
MATERIAL LOCATION: **Exterior, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23.2.2**
MATERIAL DESCRIPTION: **Exterior Window Glaze - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

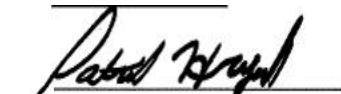

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **23.2.2**
MATERIAL DESCRIPTION: **Exterior Window Glaze - Non AHERA**
MATERIAL LOCATION: **Exterior, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23.3.3**
MATERIAL DESCRIPTION: **Exterior Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Exterior, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

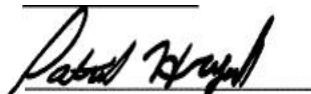

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **23.3.3**
MATERIAL DESCRIPTION: **Exterior Window Glaze**
MATERIAL LOCATION: **Exterior, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24.1.1**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 005, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

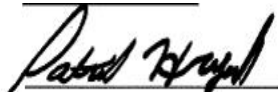

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **24.1.1**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile**
MATERIAL LOCATION: **Room 005, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24.1.2**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Band Room and Teacher's Lunchroom, 1912 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

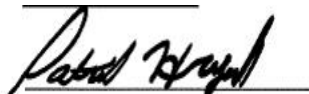

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **24.1.2**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile**
MATERIAL LOCATION: **Basement Band Room and Teacher's Lunchroom, 1912 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25.1.1**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 005, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

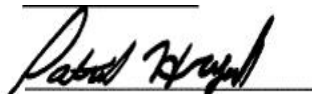

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **25.1.1**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile Mastic**
MATERIAL LOCATION: **Room 005, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25.1.2**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Band Room and Teacher's Lunchroom, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

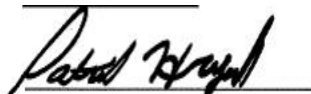

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **25.1.2**
MATERIAL DESCRIPTION: **12"x12" Blue Speckled Floor Tile Mastic**
MATERIAL LOCATION: **Basement Band Room and Teacher's Lunchroom, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26.1.1**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout Building, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

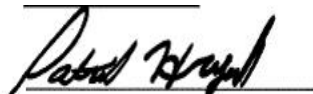

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **26.1.1**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Building, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 04/02/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26.1.2**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Band Room, 1912 Building, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

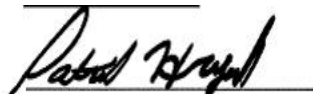

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **26.1.2**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Basement Band Room, 1912 Building, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27.1.1**
MATERIAL DESCRIPTION: **Black Vinyl Floor Covering**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Dance Room, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

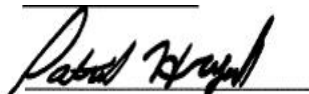

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **27.1.1**
MATERIAL DESCRIPTION: **Black Vinyl Floor Covering**
MATERIAL LOCATION: **Basement Dance Room, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28.1.1**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **1st Floor Teacher's Washroom, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

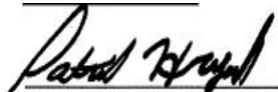

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **28.1.1**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
MATERIAL LOCATION: **1st Floor Teacher's Washroom, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29.1.1**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **1st Floor Teacher's Washroom, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

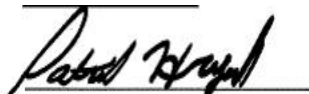

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **29.1.1**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **1st Floor Teacher's Washroom, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3.1.1**
MATERIAL DESCRIPTION: **9"x9" Painted Black VFT - ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Service Area Lunchroom- 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed/abated**

Inspector's Signature:

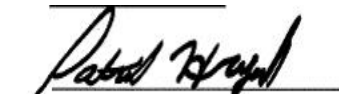

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **3.1.1**
MATERIAL DESCRIPTION: **9"x9" Painted Black VFT - ABATED**
MATERIAL LOCATION: **Service Area Lunchroom- 1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3.2.1**
MATERIAL DESCRIPTION: **12" X 12" Light Blue VFT w/Dark Blue Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 010 - 1893 Bldg.**

MATERIAL QUANTITY: **700**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

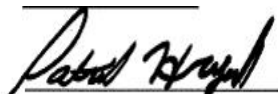

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **3.2.1**
MATERIAL DESCRIPTION: **12" X 12" Light Blue VFT w/Dark Blue Streaks**
MATERIAL LOCATION: **Room 010 - 1893 Bldg.**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3.3.1**
MATERIAL DESCRIPTION: **9"x9" Green VFT - Removed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd Floor Teacher's Washroom - 1893**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

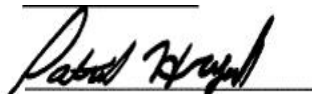

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **3.3.1**
MATERIAL DESCRIPTION: **9"x9" Green VFT - Removed**
MATERIAL LOCATION: **2nd Floor Teacher's Washroom - 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30.1.1**
MATERIAL DESCRIPTION: **Interior Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout building interior, 1893 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

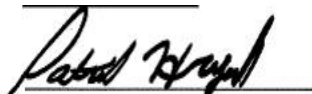

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **30.1.1**
MATERIAL DESCRIPTION: **Interior Window Glaze**
MATERIAL LOCATION: **Throughout building interior, 1893 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30.1.2**
MATERIAL DESCRIPTION: **Interior Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout building interior, 1912 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

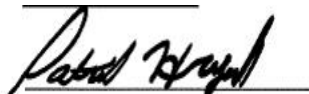

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **30.1.2**
MATERIAL DESCRIPTION: **Interior Window Glaze**
MATERIAL LOCATION: **Throughout building interior, 1912 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30.1.3**
MATERIAL DESCRIPTION: **Interior Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout the 1924 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

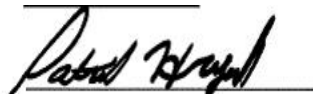

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **30.1.3**
MATERIAL DESCRIPTION: **Interior Window Glaze**
MATERIAL LOCATION: **Throughout the 1924 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 04/02/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31.1.1**
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

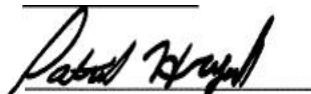

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **31.1.1**
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard**
MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32.1.1**
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

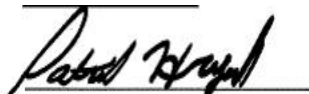

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **32.1.1**
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33.1.1**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & Black Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 111 & 211, 1893 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

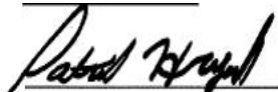

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **33.1.1**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & Black Specks Floor Tile**
MATERIAL LOCATION: **Rooms 111 & 211, 1893 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34.1.1**
MATERIAL DESCRIPTION: **12"x12" Beige w/rn & Blk Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

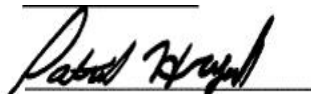

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **34.1.1**
MATERIAL DESCRIPTION: **12"x12" Beige w/rn & Blk Specks Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 111 & 211, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35.1.1**
MATERIAL DESCRIPTION: **Light Brown/Beige Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd Floor Teacher's Office, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

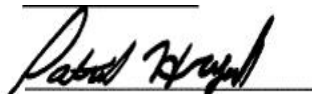

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **35.1.1**
MATERIAL DESCRIPTION: **Light Brown/Beige Carpet Mastic**
MATERIAL LOCATION: **2nd Floor Teacher's Office, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36.1.1**
MATERIAL DESCRIPTION: **Red/Gray Mixed Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 212, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

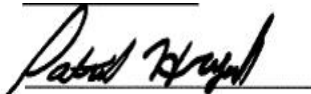

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **36.1.1**
MATERIAL DESCRIPTION: **Red/Gray Mixed Carpet Mastic**
MATERIAL LOCATION: **Room 212, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36.1.2**
MATERIAL DESCRIPTION: **2'x4' White/Yellow Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement on wall in the Band room, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

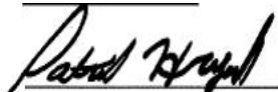

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **36.1.2**
MATERIAL DESCRIPTION: **2'x4' White/Yellow Ceiling Tile**
MATERIAL LOCATION: **Basement on wall in the Band room, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37.1.2**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 213, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

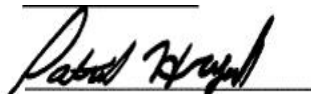

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **37.1.2**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Room 213, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38.1.2**
MATERIAL DESCRIPTION: **Greenish Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 214, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

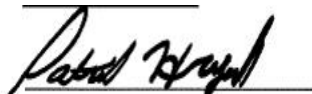

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **38.1.2**
MATERIAL DESCRIPTION: **Greenish Blue Carpet Mastic**
MATERIAL LOCATION: **Room 214, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray Floor Tile w/White & Black Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

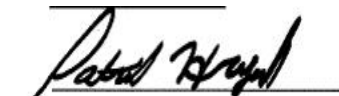

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **39.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray Floor Tile w/White & Black Streaks**
MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray FT w/White & Black Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed/abated - 2013**

Inspector's Signature:

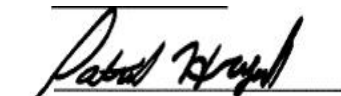

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **40.1.2**
MATERIAL DESCRIPTION: **9"x9" Gray FT w/White & Black Streaks Mastic**
MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41.1.2**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **1st Floor School Manager's Office, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

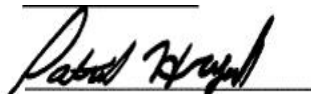

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **41.1.2**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
MATERIAL LOCATION: **1st Floor School Manager's Office, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42.1.2**
MATERIAL DESCRIPTION: **Black Floor Border Tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material abated - Replaced with new material**

Inspector's Signature:

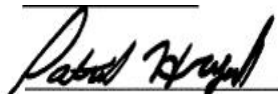

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **42.1.2**
MATERIAL DESCRIPTION: **Black Floor Border Tile**
MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43.1.2**
MATERIAL DESCRIPTION: **Black Floor Border Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material abated - Replaced with new material**

Inspector's Signature:

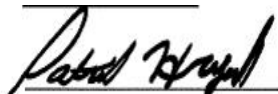

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **43.1.2**
MATERIAL DESCRIPTION: **Black Floor Border Tile Mastic**
MATERIAL LOCATION: **Assistant Principal's Office, 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44.1.3**
MATERIAL DESCRIPTION: **Black Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout Classrooms, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

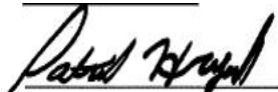

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **44.1.3**
MATERIAL DESCRIPTION: **Black Board Adhesive**
MATERIAL LOCATION: **Throughout Classrooms, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45.1.3**
MATERIAL DESCRIPTION: **Wall Board**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Classrooms 201, 202, 203 and 204, 1924 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

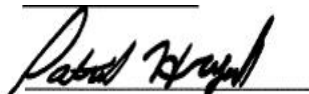

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **45.1.3**
MATERIAL DESCRIPTION: **Wall Board**
MATERIAL LOCATION: **Classrooms 201, 202, 203 and 204, 1924 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" White w/Red & Blue Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 103, 104, 201, 204 - 1924 Bldg**

MATERIAL QUANTITY: **2800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

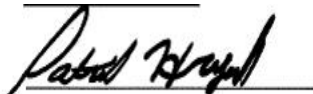

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" White w/Red & Blue Specks Floor Tile**
MATERIAL LOCATION: **Rms 103, 104, 201, 204 - 1924 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12" x 12" White w/Red & Blue Specks FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 103, 104, 201, 204 - 1924 Bldg**

MATERIAL QUANTITY: **2800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

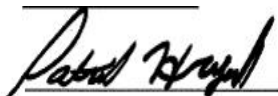

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12" x 12" White w/Red & Blue Specks FT Mastic**
MATERIAL LOCATION: **Rms 103, 104, 201, 204 - 1924 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Green Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 202 and 203 - 1924 Bldg**

MATERIAL QUANTITY: **2000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

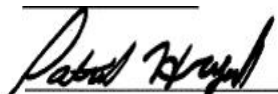

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Green Linoleum**
MATERIAL LOCATION: **Rms 202 and 203 - 1924 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Green Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 202 and 203 - 1924 Bldg**

MATERIAL QUANTITY: **2000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

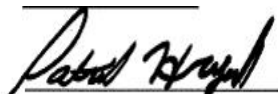

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Green Linoleum Mastic**
MATERIAL LOCATION: **Rms 202 and 203 - 1924 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5.1.1**
MATERIAL DESCRIPTION: **12"x12" Green VFT w/Wht. & Brn. Speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **3rd Flr., Jan. Clst., 2nd Flr. Teacher's WR Rm. 107, 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

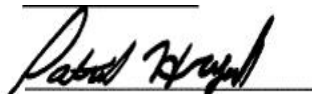

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **5.1.1**
MATERIAL DESCRIPTION: **12"x12" Green VFT w/Wh. & Brn. Speckles Mastic**
MATERIAL LOCATION: **3rd Flr., Jan. Clst., 2nd Flr. Teacher's WR Rm. 107, 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5.2.1**
MATERIAL DESCRIPTION: **12"x12" Green/Wht/Brn Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 107, 3rd Flr. Jan. Clst.,**

MATERIAL QUANTITY: **750**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

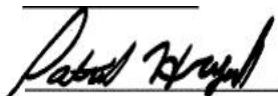

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **5.2.1**
MATERIAL DESCRIPTION: **12"x12" Green/Wht/Brn Speckled VFT Mastic**
MATERIAL LOCATION: **Room 107, 3rd Flr. Jan. Clst.,**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5.3.1**
MATERIAL DESCRIPTION: **12"x12" Brown VFT w/Wht + Brn + Red Speckles Masti**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

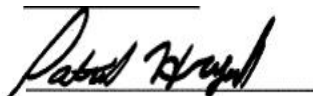

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **5.3.1**
MATERIAL DESCRIPTION: **12"x12" Brown VFT w/Wht + Brn + Red Speckles Masti**
MATERIAL LOCATION: **Rm 212 + Rm. N. of 212, Rm 106 Wardrobe Closet - 1893 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5.4.1**
MATERIAL DESCRIPTION: **12"x12" Cream VFT w/Blk & White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Test Room (N. of Rm #010), 1893 Building- ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material abated**

Inspector's Signature:

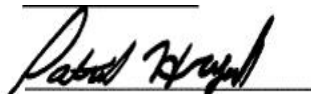

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **5.4.1**
MATERIAL DESCRIPTION: **12"x12" Cream VFT w/Blk & White Streaks Mastic**
MATERIAL LOCATION: **Test Room (N. of Rm #010), 1893 Building- ABATED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Gray/Green/Brown Mix Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 102 and 107 - 1924 Bldg**

MATERIAL QUANTITY: **900**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

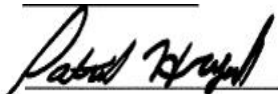

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Gray/Green/Brown Mix Carpet Adhesive**
MATERIAL LOCATION: **Rms 102 and 107 - 1924 Bldg**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12" x 12" Red w/Blue & Black Specks FT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

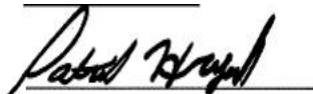

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12" x 12" Red w/Blue & Black Specks FT**
MATERIAL LOCATION: **Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Red w/Blue & Black Specks FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

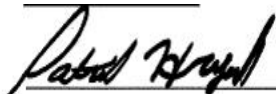

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Red w/Blue & Black Specks FT Mastic**
MATERIAL LOCATION: **Service Area Lunchroom, Lunchroom (#05)- 1893 Bldg**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Hard Elbows in Fiberglass Insulation Pipes**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Fan Room - 1924 Bldg**

MATERIAL QUANTITY: **15**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

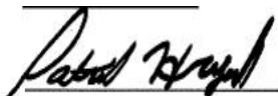

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Hard Elbows in Fiberglass Insulation Pipes**
MATERIAL LOCATION: **Fan Room - 1924 Bldg**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium and Auditorium Foyer**

MATERIAL QUANTITY: **4500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

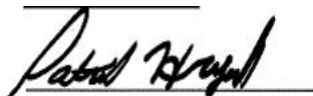

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile**
MATERIAL LOCATION: **Auditorium and Auditorium Foyer**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium & Auditorium Foyer**

MATERIAL QUANTITY: **4500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

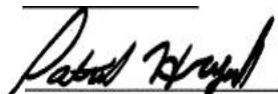

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile Mastic**
MATERIAL LOCATION: **Auditorium & Auditorium Foyer**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12"X12" White w/Multi Colored Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Ground Floor Hall, 1893 Bldg 1st Floor Hall**

MATERIAL QUANTITY: **4500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

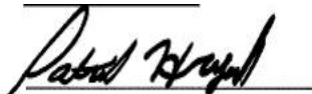

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12"X12" White w/Multi Colored Floor Tile**
MATERIAL LOCATION: **Ground Floor Hall, 1893 Bldg 1st Floor Hall**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12"X12" White w/Multi Colored Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Ground Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

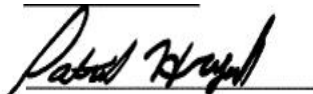

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12"X12" White w/Multi Colored Floor Tile Mastic**
MATERIAL LOCATION: **Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12"X12" Red w/Blk+Wht Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Grong Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

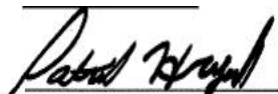

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12"X12" Red w/Blk+Wht Floor Tile**
MATERIAL LOCATION: **Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12"X12" Red w/Blk+Wht Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Grong Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

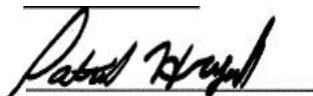

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12"X12" Red w/Blk+Wht Floor Tile Mastic**
MATERIAL LOCATION: **Groung Floor Hall, 1893 Bldg 1st Floor Hall 1912 Bldg**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6.1.1**
MATERIAL DESCRIPTION: **9"x9" Black Painted VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Service Area of the 1893 Building - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material abated**

Inspector's Signature:

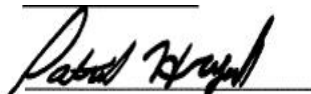

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **6.1.1**
MATERIAL DESCRIPTION: **9"x9" Black Painted VFT Mastic**
MATERIAL LOCATION: **Service Area of the 1893 Building - ABATED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6.2.1**
MATERIAL DESCRIPTION: **9"x9" Green VFT w/Wh. Streaks, Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rm. #010 of the 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

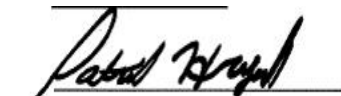

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **6.2.1**
MATERIAL DESCRIPTION: **9"x9" Green VFT w/Wht. Streaks, Mastic**
MATERIAL LOCATION: **Rm. #010 of the 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6.3.1**
MATERIAL DESCRIPTION: **9"x9" VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd Floor Teacher's Washroom, 1893 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

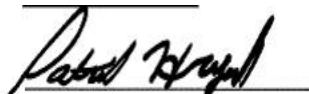

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **6.3.1**
MATERIAL DESCRIPTION: **9"x9" VFT Mastic**
MATERIAL LOCATION: **2nd Floor Teacher's Washroom, 1893 building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **2'X2' Tan w/Wht +Gry Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom**

MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

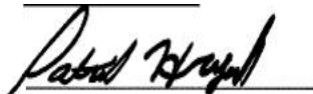

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **2'X2' Tan w/Wht +Gry Floor Tile**
MATERIAL LOCATION: **1924 1st-3rd FI Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom**
MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **2'X2' Tan w/Wht +Gry Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **1924 1st-3rd Fl Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom**

MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

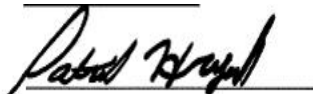

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **2'X2' Tan w/Wht +Gry Floor Tile Mastic**
MATERIAL LOCATION: **1924 1st-3rd FI Halls, 107, 117, 119, 214, 212, 212A, 306, 305, 311, and Lunchroom**
MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **2'X4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **001, 002, Lunchroom and Basement Office**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

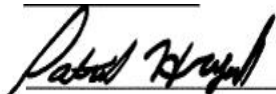

Date: 03/07/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **2'X4' Ceiling Tile**
MATERIAL LOCATION: **001, 002, Lunchroom and Basement Office**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12"X12" White w/Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211**

MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

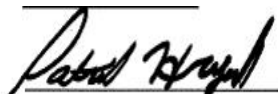

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12"X12" White w/Tan Floor Tile**
MATERIAL LOCATION: **Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"X12" White w/Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211**

MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

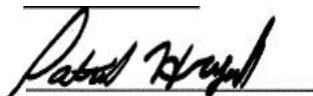

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"X12" White w/Tan Floor Tile Mastic**
MATERIAL LOCATION: **Principals Office, Main Office, Assist Principal's Office, rooms 111 and 211**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"X12" White w/ Wht and Brn Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **3rd Floor Staf Washroom and Washroom Adj to Room 201**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

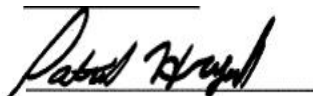

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"X12" White w/ Wht and Brn Floor Tile**
MATERIAL LOCATION: **3rd Floor Staf Washroom and Washroom Adj to Room 201**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Mastic on 12"X12" White w/ Wht and Brn Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **3rd Floor Staf Washroom and Washroom Adj to Room 201**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

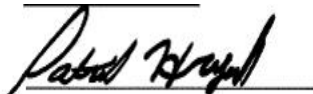

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Mastic on 12"X12" White w/ Wht and Brn Floor Tile**
MATERIAL LOCATION: **3rd Floor Staf Washroom and Washroom Adj to Room 201**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **2'X2' White w/ Lt Gry and DK Gry Floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1924 Ground Floor Hall**

MATERIAL QUANTITY: **1800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

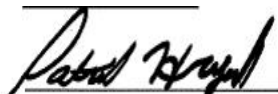

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **2'X2' White w/ Lt Gry and DK Gry Floor tile**
MATERIAL LOCATION: **1924 Ground Floor Hall**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1924 Ground Floor Hall**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

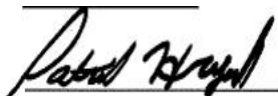

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **2'X2' White w/ Lt Gry and DK Gry Floor tile Mastic**
MATERIAL LOCATION: **1924 Ground Floor Hall**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **2'X2' Lt. Blue w/White + Dk Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1924 Ground Floor Hall**

MATERIAL QUANTITY: **500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

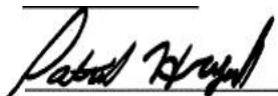

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **2'X2' Lt. Blue w/White + Dk Blue Floor Tile**
MATERIAL LOCATION: **1924 Ground Floor Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1924 Ground Floor Hall**

MATERIAL QUANTITY: **500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

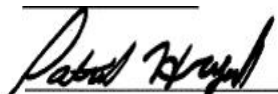

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **2'X2' Lt. Blue w/White + Dk Blue Floor Tile Mastic**
MATERIAL LOCATION: **1924 Ground Floor Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"X12" Lt Blue w/Dk Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 019 and Elevator Service Room**

MATERIAL QUANTITY: **800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

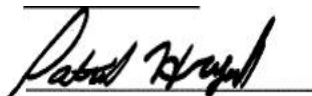

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"X12" Lt Blue w/Dk Blue Floor Tile**
MATERIAL LOCATION: **Rooms 019 and Elevator Service Room**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"X12" Lt Blue w/Dk Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 019 and Elevator Service Room**

MATERIAL QUANTITY: **800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

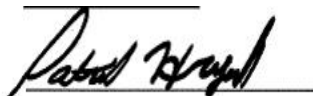

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"X12" Lt Blue w/Dk Blue Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 019 and Elevator Service Room**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Grey Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 110**

MATERIAL QUANTITY: **120**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - Hard wood installed**

Inspector's Signature:

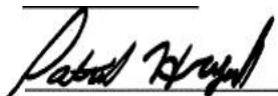

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Grey Carpet Adhesive**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **White, Black Terrazo Flooring and Bases**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd,3rd Floors Base, Landings**

MATERIAL QUANTITY: **11000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

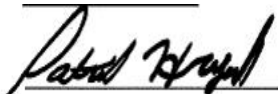

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **White, Black Terrazo Flooring and Bases**
MATERIAL LOCATION: **1st,2nd,3rd Floors Base, Landings**
MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Brown Terrazo Stairs**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd, 3rd Floors Stairs and Basement**

MATERIAL QUANTITY: **3000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

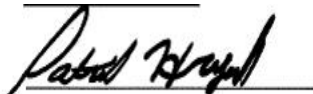

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Brown Terrazo Stairs**
MATERIAL LOCATION: **1st, 2nd, 3rd Floors Stairs and Basement**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Blue, White Ceramic Flooring Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

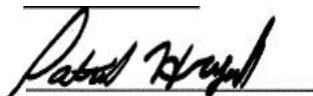

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Blue, White Ceramic Flooring Grout**
MATERIAL LOCATION: **1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Blue, White Ceramic Flooring Ahesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

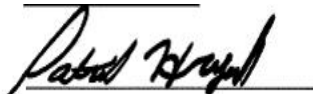

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Blue, White Ceramic Flooring Ahesive**
MATERIAL LOCATION: **1st Floor Boys/Girls Wash Room, 3rd Floor Boys Wash Room**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

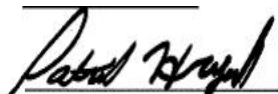

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile Grout**
MATERIAL LOCATION: **2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **White Ceramic Flooring Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

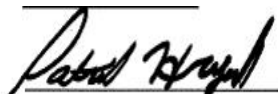

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **White Ceramic Flooring Adhesive**
MATERIAL LOCATION: **2nd Floor Boys Wash Room, 3rd Floor Girls Wash Room**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8.0.3**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout the 1924 Building.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

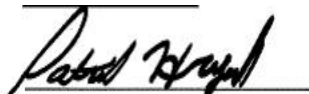

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **8.0.3**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout the 1924 Building.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Tan, White Ceramic Flooring Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Girls Wash Rooms**

MATERIAL QUANTITY: **625**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

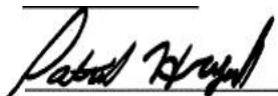

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Tan, White Ceramic Flooring Grout**
MATERIAL LOCATION: **2nd Floor Girls Wash Rooms**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **Tan, White Ceramic Flooring Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Girls Wash Rooms**

MATERIAL QUANTITY: **626**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

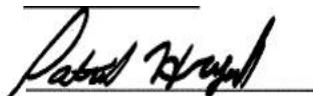

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **Tan, White Ceramic Flooring Adhesive**
MATERIAL LOCATION: **2nd Floor Girls Wash Rooms**
MATERIAL QUANTITY: **626** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assistant Principal Office**

MATERIAL QUANTITY: **150**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

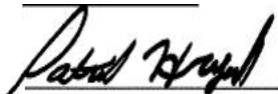

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
MATERIAL LOCATION: **Assistant Principal Office**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assistant Principal Office**

MATERIAL QUANTITY: **150**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

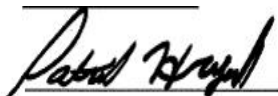

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
MATERIAL LOCATION: **Assistant Principal Office**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9.1.3**
MATERIAL DESCRIPTION: **12"x12" Brown VFT w/Wh. & Brn. Specks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rms. 101, 102, 103, 104, 201, 202, 203, 204, Auditorium**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

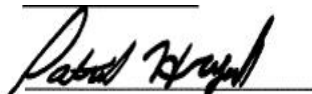

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **9.1.3**
MATERIAL DESCRIPTION: **12"x12" Brown VFT w/Wh. & Brn. Specks**
MATERIAL LOCATION: **Rms. 101, 102, 103, 104, 201, 202, 203, 204, Auditorium**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9.2.3**
MATERIAL DESCRIPTION: **12"x12" Gray VFT w/Wht. & Gray Speckles**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Gym, Store Rooms of the 1924 Building.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

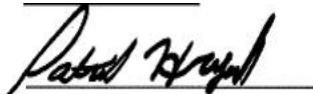

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **9.2.3**
MATERIAL DESCRIPTION: **12"x12" Gray VFT w/Wht. & Gray Speckles**
MATERIAL LOCATION: **Gym, Store Rooms of the 1924 Building.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F.1.1**
MATERIAL DESCRIPTION: **Fiberglass Pipe fitting**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Corridors of the 1893 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

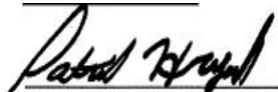

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **F.1.1**
MATERIAL DESCRIPTION: **Fiberglass Pipe fitting**
MATERIAL LOCATION: **Basement Corridors of the 1893 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F.2.2**
MATERIAL DESCRIPTION: **Fiberglass on Pipe Fitting**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Corridor of the 1912 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

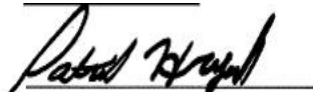

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **F.2.2**
MATERIAL DESCRIPTION: **Fiberglass on Pipe Fitting**
MATERIAL LOCATION: **Basement Corridor of the 1912 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F.3.3**
MATERIAL DESCRIPTION: **Fiberglass on Pipe Fitting**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Boiler Rm., Coal rm., E/W Cordr. Engineer's Office, 1st + 2nd Floors 1924 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

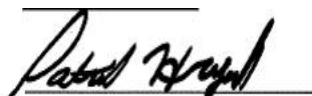

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **F.3.3**

MATERIAL DESCRIPTION: **Fiberglass on Pipe Fitting**

MATERIAL LOCATION: **Basement Boiler Rm., Coal rm., E/W Cordr. Engineer's Office, 1st + 2nd Floors 1924 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G.0.3**
MATERIAL DESCRIPTION: **Cardboard Pipe Run Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Janitor Closet, Eng. Rm., Cordr, Fan Rm #3 - 1924**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

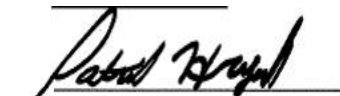

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **G.0.3**
MATERIAL DESCRIPTION: **Cardboard Pipe Run Insulation**
MATERIAL LOCATION: **Basement Janitor Closet, Eng. Rm., Cordr, Fan Rm #3 - 1924**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H.0.3**
MATERIAL DESCRIPTION: **Cardboard Pipe Fitting**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Janitor Closet, Engine Rm, Cordr., + Fan Room #3 - 1924 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

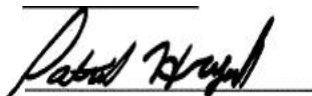

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **H.0.3**
MATERIAL DESCRIPTION: **Cardboard Pipe Fitting**
MATERIAL LOCATION: **Basement Janitor Closet, Engine Rm, Cordr., + Fan Room #3 - 1924 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I.0.3**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation Run**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rm 209**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

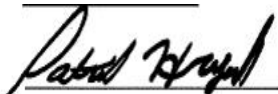

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **I.0.3**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation Run**
MATERIAL LOCATION: **Rm 209**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J.0.2**
MATERIAL DESCRIPTION: **Aircell Pipe Fitting**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Cordr. Rm. 016A, Kitchen of the 1912 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

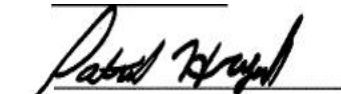

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **J.0.2**
MATERIAL DESCRIPTION: **Aircell Pipe Fitting**
MATERIAL LOCATION: **Basement Cordr. Rm. 016A, Kitchen of the 1912 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K.0.2**
MATERIAL DESCRIPTION: **Duct Wrap Aircell**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Corridor of the 1912 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

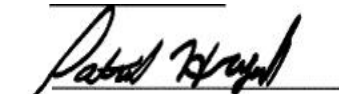

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **K.0.2**

MATERIAL DESCRIPTION: **Duct Wrap Aircell**

MATERIAL LOCATION: **Basement Corridor of the 1912 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L.0.3**
MATERIAL DESCRIPTION: **Aircell Pipe Fitting**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Cordr. A, Engine Rm., Fan Rm. #3 of the 1924 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

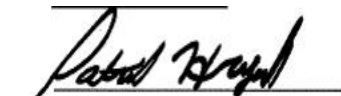

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **L.0.3**
MATERIAL DESCRIPTION: **Aircell Pipe Fitting**
MATERIAL LOCATION: **Basement Cordr. A, Engine Rm., Fan Rm. #3 of the 1924 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **O.0.2**
MATERIAL DESCRIPTION: **Aircell Pipe Run**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement cordr., Rm. 016, Kitchen - 1912 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

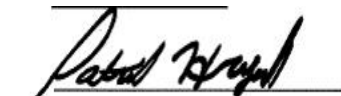

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **O.0.2**
MATERIAL DESCRIPTION: **Aircell Pipe Run**
MATERIAL LOCATION: **Basement cordr., Rm. 016, Kitchen - 1912 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P.0.1**
MATERIAL DESCRIPTION: **Cardboard Pipe Run**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Pump and Tank Rooms, Area South of Lunchroom, Small Room Adjacent to the kitchen/Lunchroom 1893**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

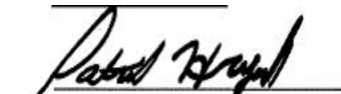

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **P.0.1**
MATERIAL DESCRIPTION: **Cardboard Pipe Run**
MATERIAL LOCATION: **Pump and Tank Rooms, Area South of Lunchroom, Small Room Adjacent to the kitchen/Lunchroom 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

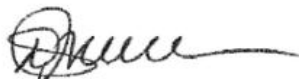

Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q.0.2**
MATERIAL DESCRIPTION: **Cardboard Pipe Run**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Receiving Rm. - 1912 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

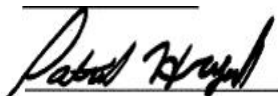

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **Q.0.2**
MATERIAL DESCRIPTION: **Cardboard Pipe Run**
MATERIAL LOCATION: **Receiving Rm. - 1912 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R.0.2**
MATERIAL DESCRIPTION: **Cardboard Fitting**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Receiving Area and Pipe Chases - 1912 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

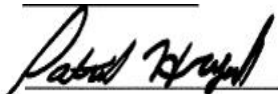

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **R.0.2**
MATERIAL DESCRIPTION: **Cardboard Fitting**
MATERIAL LOCATION: **Receiving Area and Pipe Chases - 1912 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S.0.1**
MATERIAL DESCRIPTION: **Cardboard Fitting**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Pump and Tank Rooms, the Area S. of Lunchrm and Small Rm Adjacent to the kitchen/Lunchrm- 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

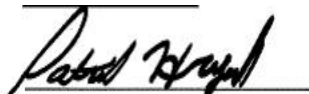

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **S.0.1**
MATERIAL DESCRIPTION: **Cardboard Fitting**
MATERIAL LOCATION: **Pump and Tank Rooms, the Area S. of Lunchrm and Small Rm Adjacent to the kitchen/Lunchrm-1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T.0.1**
MATERIAL DESCRIPTION: **Aircell Fitting**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Pump and Tank Rooms, Area S. of Lunchrm., Small Rm Adjacent to kitchen/Lunchrm. -1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

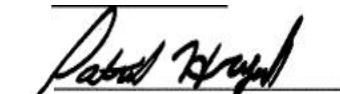

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **T.0.1**
MATERIAL DESCRIPTION: **Aircell Fitting**
MATERIAL LOCATION: **Pump and Tank Rooms, Area S. of Lunchrm., Small Rm Adjacent to kitchen/Lunchrm. -1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **U.0.1**
MATERIAL DESCRIPTION: **Aircell Pipe Run**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Bsmnt., Corder., StoreRm., Hallway by Rm. 06, 1st + 2nd Flr. WRs -1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

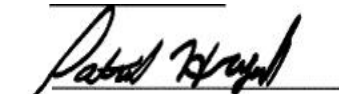

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUIDLING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale
College Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **U.0.1**
MATERIAL DESCRIPTION: **Aircell Pipe Run**
MATERIAL LOCATION: **Bsmnt., Cordr., StoreRm., Hallway by Rm. 06, 1st + 2nd Flr. WRs -1893 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **85M**
MATERIAL DESCRIPTION: **12" X 12" Yellow Floor Tile Mastic**
MATERIAL LOCATION: **Office of 1912 Bldg**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

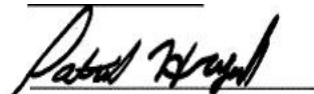

Date: 03/07/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **85M**
MATERIAL DESCRIPTION: **12" X 12" Yellow Floor Tile Mastic**
MATERIAL LOCATION: **Office of 1912 Bldg**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

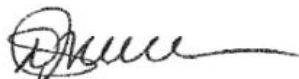

Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-85Mastic Associated with 12"x 12" Yellow Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-85M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-85M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **86M**
MATERIAL DESCRIPTION: **2 X 2 Tan W/White & Grey Floor Tile Mastic**
MATERIAL LOCATION: **Room 117 of 1912 Bldg**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

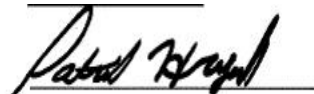

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **86M**

MATERIAL DESCRIPTION: **2 X 2 Tan W/White & Grey Floor Tile Mastic**

MATERIAL LOCATION: **Room 117 of 1912 Bldg**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

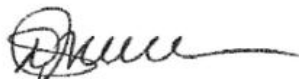


Date: **04/02/2013**


KCPSS 2011.0303 Three Year's Good Inaugural Region 3/N/North Lamdale College Prep -Catalyst Charter School/Howland First Floor.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-86Mastic Associated with 12"x 12" Tan with White and Grey Floor Tile

North Lawndale College Prep (Howland) First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) First Floor -
HA-86M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com



CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER

HA-86M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **2 X 2 Tan W/White & Grey Floor Tile**
MATERIAL LOCATION: **Room 117 of 1912 Bldg**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

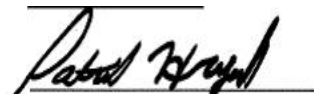

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **2 X 2 Tan W/White & Grey Floor Tile**

MATERIAL LOCATION: **Room 117 of 1912 Bldg**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **04/02/2013**


KCPSS 20110203 Three Year's Good Brwings Region 3/N/ North Lawndale College Prep -Catalyst Charter School/ North Lawndale College Prep (Howland) First Floor.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-86 12"x 12" Tan with White and Grey Floor Tile

North Lawndale College Prep (Howland) First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) First Floor - HA-86
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER

**CARNOW
CONIBEAR** HA-86

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **12" X 12" White W/Grey Floor Tile**
MATERIAL LOCATION: **Main Office of 1912 Bldg**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

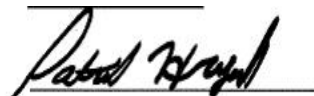

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **89**

MATERIAL DESCRIPTION: **12" X 12" White W/Grey Floor Tile**

MATERIAL LOCATION: **Main Office of 1912 Bldg**

MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-89 12"x 12" White with Grey Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-89
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-89

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Blue Streak Floor Tile**
MATERIAL LOCATION: **Main Office Entrance**
MATERIAL QUANTITY: **370** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

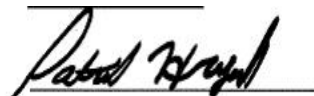

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **91**

MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Blue Streak Floor Tile**

MATERIAL LOCATION: **Main Office Entrance**

MATERIAL QUANTITY: **370** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

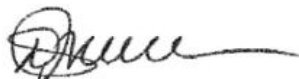

Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-91 12"x 12" Red with Blue Streaks Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-91
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

INSPECTED BY:
Pat Hrycyk

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-91

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **12" X 12" Yellow Floor Tile**
MATERIAL LOCATION: **Office 1912 Bldg**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

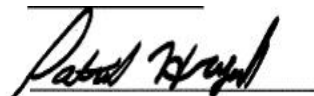

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **85**

MATERIAL DESCRIPTION: **12" X 12" Yellow Floor Tile**

MATERIAL LOCATION: **Office 1912 Bldg**

MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **04/02/2013**


K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-85 12"x 12" Yellow Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-85
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com



CCA PROJECT NUMBER A320130001-81
DATE 03/07/2013
SHEET NUMBER HA-85

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Lt Red Streak Floor Tile**
MATERIAL LOCATION: **Main Office 1912 Spot Tile**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

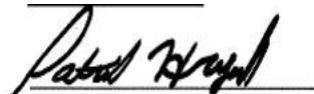

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **90**

MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Lt Red Streak Floor Tile**

MATERIAL LOCATION: **Main Office 1912 Spot Tile**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

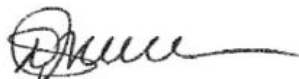

Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-90 12"x 12" Dark Red with Light Red Streaks Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-90
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

INSPECTED BY:
Pat Hrycyk

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-90

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90M**
MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic**
MATERIAL LOCATION: **Main Office of 1912 Bldg Spot Tile**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

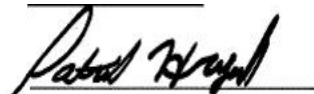

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **90M**

MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Lt Red Streak Floor Tile Mastic**

MATERIAL LOCATION: **Main Office of 1912 Bldg Spot Tile**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

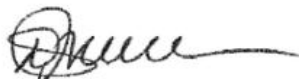

Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-90M Mastic Associated with 12"x 12" Dark Red with Light Red Streaks Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-90M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #: 100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-90M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **84M**
MATERIAL DESCRIPTION: **12" X 12" White W/Brown & Grey Floor Tile Mastic**
MATERIAL LOCATION: **2nd Floor Teachers Washroom**
MATERIAL QUANTITY: **4444** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

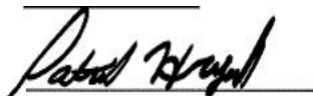

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **84M**
MATERIAL DESCRIPTION: **12" X 12" White W/Brown & Grey Floor Tile Mastic**
MATERIAL LOCATION: **2nd Floor Teachers Washroom**
MATERIAL QUANTITY: **4444** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____

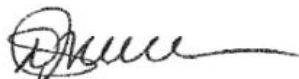

Date: **04/02/2013**

KCPSS 2011-2013 Three Year AHERA Region 3 N/ North Lawndale College Prep - Catalyst Charter School/ North Lawndale College Prep (Howland) Second Floor.dwg

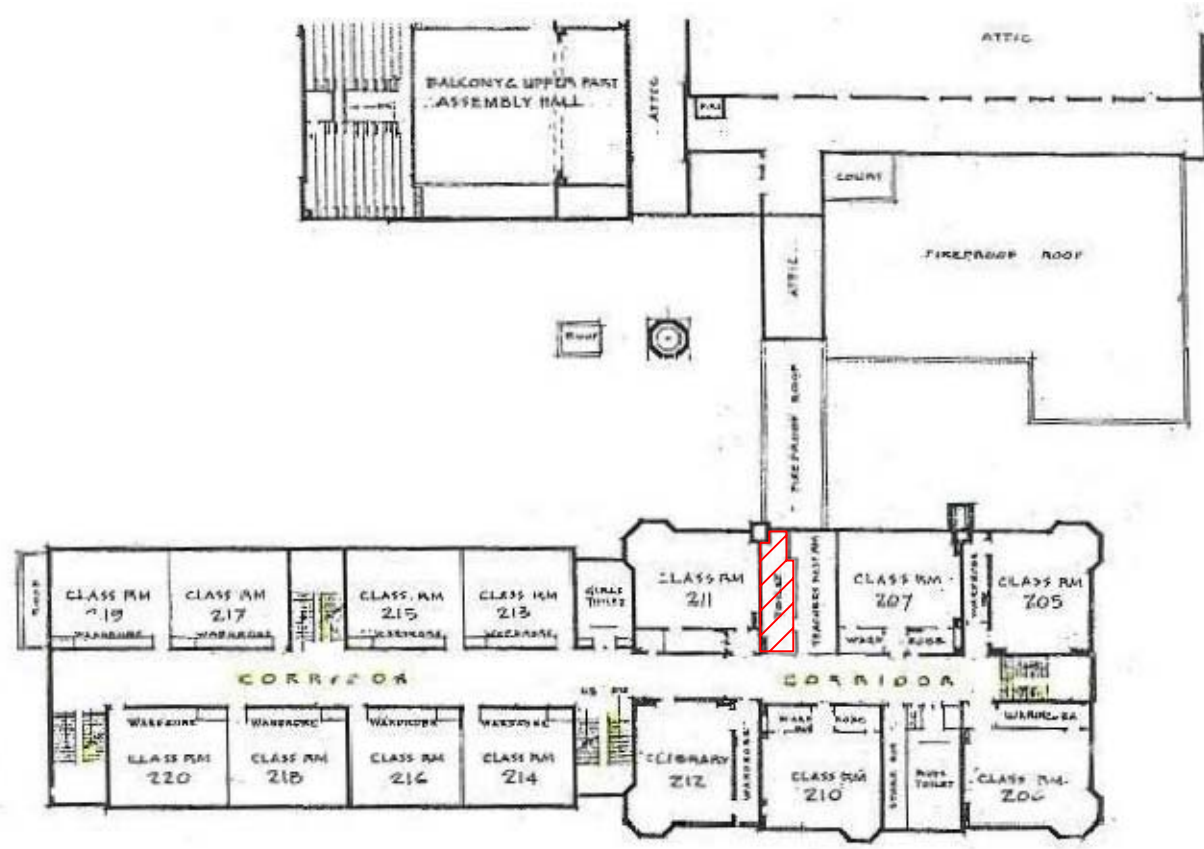


ASBESTOS REINSPECTION KEY NOTES:



HA-84M Mastic Associated with 12"x 12" White with Brown and Grey Floor Tile

North Lawndale College Prep (Howland) Second Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Second Floor -
HA-84M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #: 100-09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-84M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **12" X 12" Lt Blue W/Dark Blue Floor Tile**
MATERIAL LOCATION: **Test Room 010**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

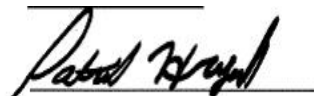

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **88**

MATERIAL DESCRIPTION: **12" X 12" Lt Blue W/Dark Blue Floor Tile**

MATERIAL LOCATION: **Test Room 010**

MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

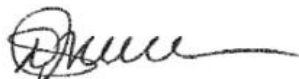


Date: **04/02/2013**


K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-88 12"x 12" Light Blue with Dark Blue Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-88
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-88

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **88M**
MATERIAL DESCRIPTION: **12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic**
MATERIAL LOCATION: **Test Room 010**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

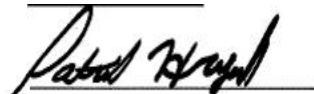

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **88M**

MATERIAL DESCRIPTION: **12" X 12" Lt Blue W/Dark Blue Floor Tile Mastic**

MATERIAL LOCATION: **Test Room 010**

MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-88Mastic Associated with 12"x 12" Light Blue with Dark Blue Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-88M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-88M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **12" X 12" White W/Brown & Grey Floor Tile 1893 bldg**
MATERIAL LOCATION: **Teachers Washroom 2nd floor**
MATERIAL QUANTITY: **4444** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

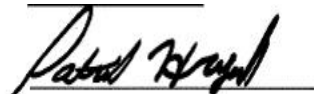

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **12" X 12" White W/Brown & Grey Floor Tile 1893 bldg**

MATERIAL LOCATION: **Teachers Washroom 2nd floor**

MATERIAL QUANTITY: **4444** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____

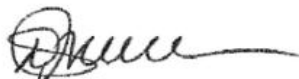


Date: **04/02/2013**


KCPSS 20110303 Three Year/Good Drawings/Region 3/N/North Lawndale College Prep -Catalyst Charter School/Howland Second Floor.dwg

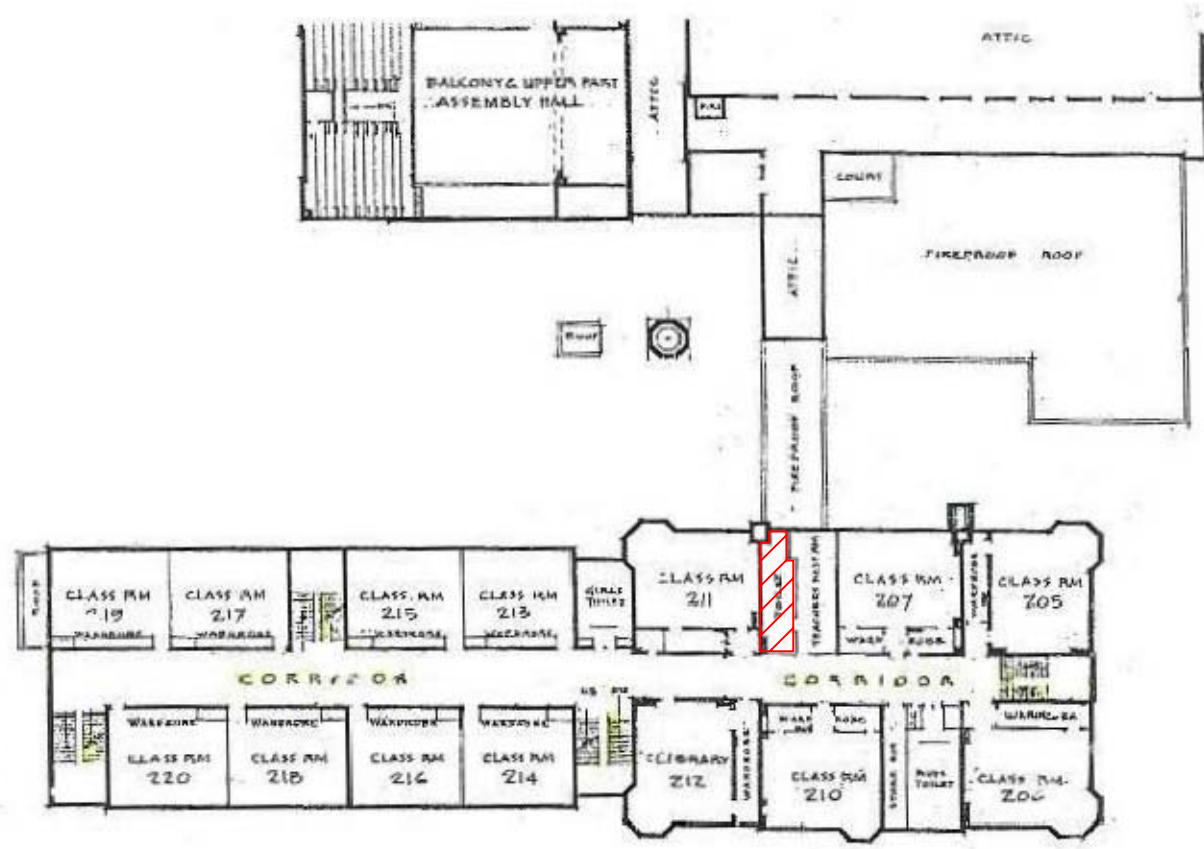

ASBESTOS REINSPECTION KEY NOTES:

 HA-84 12"x 12" White with Brown and Grey Floor Tile

North Lawndale College Prep (Howland) Second Floor
 2013 Asbestos Reinspection



CLIENT:
 Chicago Public Schools
 125 South Clark Street,
 Chicago, Illinois 60603

PROJECT NAME:
 2013 AHERA Reinspection
 North Lawndale College Prep Charter -
 Christiana
 1616 S Spaulding Ave
 Chicago, IL 60623

SHEET NAME:
 North Lawndale College Prep
 (Howland) Second Floor -
 HA-84
DESIGNED BY:
 Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
 Environmental Consulting Services
 600 W. Van Buren St., Suite 500, Chicago, IL 60607
 t: 312.782.4486 f: 312.782.5145
 www.ccaofd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER A320130001-81
DATE 03/07/2013
SHEET NUMBER HA-84

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **12" X 12" Cream W/Tan Floor Tile**
MATERIAL LOCATION: **Room 010**
MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

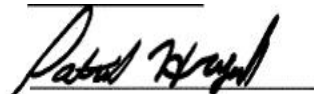

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**

ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **12" X 12" Cream W/Tan Floor Tile**

MATERIAL LOCATION: **Room 010**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

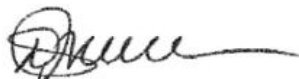

Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-87 12"x 12" Cream with Tan Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement - HA-87
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

INSPECTED BY:
Pat Hrycyk

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-87

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **87M**
MATERIAL DESCRIPTION: **12" X 12" Cream W/Tan Floor Tile Mastic**
MATERIAL LOCATION: **Room 010**
MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

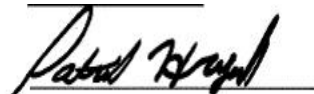

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **87M**

MATERIAL DESCRIPTION: **12" X 12" Cream W/Tan Floor Tile Mastic**

MATERIAL LOCATION: **Room 010**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-87Mastic Associated with 12"x 12" Cream with Tan Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-87M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-87M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **91M**
MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Blue Streak Floor Tile Mastic**
MATERIAL LOCATION: **Main Office Entrance**
MATERIAL QUANTITY: **370** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

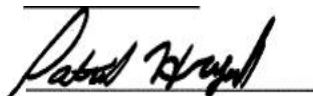

Date: **03/07/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College Prep/Catalyst Charter School** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **91M**

MATERIAL DESCRIPTION: **12" X 12" Dark Red W/Blue Streak Floor Tile Mastic**

MATERIAL LOCATION: **Main Office Entrance**

MATERIAL QUANTITY: **370** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

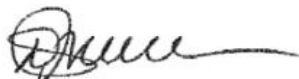

Date: **04/02/2013**


K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-91M Mastic Associated with 12"x 12" Red with Blue Streaks Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-91M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #: 100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-91M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
Charter School** INSPECTION DATE: **3/7/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89M**
MATERIAL DESCRIPTION: **12" X 12" White W/Grey Floor Tile Mastic**
MATERIAL LOCATION: **Main Office of 1912 Bldg**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

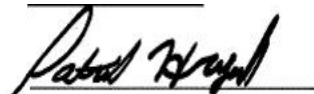

Date: 03/07/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23861** BUILDING ID: **4070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **North Lawndale College
Prep/Catalyst
CharterSchool** REVIEW DATE: **4/2/2013**
ADDRESS: **1616 S. Spaulding** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **89M**
MATERIAL DESCRIPTION: **12" X 12" White W/Grey Floor Tile Mastic**
MATERIAL LOCATION: **Main Office of 1912 Bldg**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/02/2013**

K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\N\North Lawndale College Prep -Catalyst Charter School\North Lawndale College Prep (Howland) Basement.dwg




ASBESTOS REINSPECTION KEY NOTES:



HA-89M Mastic Associated with 12"x 12" White with Grey Floor Tile

North Lawndale College Prep (Howland) Basement
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
North Lawndale College Prep Charter -
Christiana
1616 S Spaulding Ave
Chicago, IL 60623

SHEET NAME:
North Lawndale College Prep
(Howland) Basement -
HA-89M
DRAWN BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/28/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-81
DATE
03/07/2013
SHEET NUMBER
HA-89M

APPENDIX B

Inspector and Management Planner Licenses

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/9/2012
PROJECT MANAGER	11/2/2012
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.


Illinois Department of
PUBLIC HEALTH

ASBESTOS PROFESSIONAL LICENSE

ID NUMBER	ISSUED	EXPIRES
100 - 09725	5/31/2012	05/15/2013

PATRICK L HRYCIK
2942 N. MASON AVE
CHICAGO, IL 60634

Environmental Health



CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PATRICK HRYCYK
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 12/07/2012 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools;
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Penoff

12/07/2012

Course Dates:

12/07/2013

Expires:

1212BIR02

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Penoff

Doctor of Public Health

FORM # A-010



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

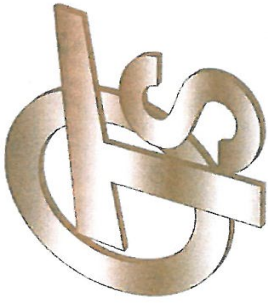

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

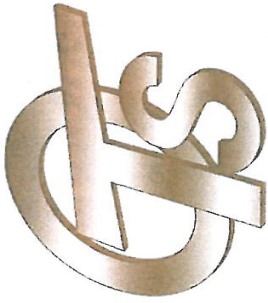

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

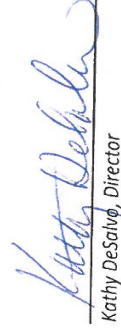

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed