

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-3534
SCHOOL NAME: Youth Connection - Ada McKinley Lakeside
ADDRESS OF SCHOOL: 2920 S. Wabash Ave.
CITY: Chicago, IL, 60616

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/15/2013 ENROLLMENT 42
IDPH INSPECTOR LICENSE NUMBER: 100-18099
IDPH LICENSED INSPECTOR NAME (Please Print): Rondell Adams
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



5/15/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Youth Connection - Ada McKinley Lakeside

2920 S. Wabash Ave.
Chicago, IL, 60616

Unit: 66107
Building ID: 1121G

IDPH ID Number: 14-016-2990-3534

REPORT DATE:

Wednesday, May 15, 2013

Prepared for:

**Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

May 15, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66107 Region: IDPH ID: 14-016-2990-3534

School: Youth Connection - Ada McKinley Lakeside Building ID: 1121G

Address: 2920 S. Wabash Ave.
Chicago, IL, 60616

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 5/15/2013

Inspector: Rondell Adams Inspector IDPH License: 100-18099
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: May 15, 2013

RE: Youth Connection - Ada McKinley Lakeside, Unit 66107
2920 S. Wabash Ave.
Chicago, IL, 60616

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Youth Connection - Ada McKinley Lakeside , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Youth Connection - Ada McKinley Lakeside, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Youth Connection - Ada McKinley Lakeside
Address: 2920 S. Wabash Ave.
IDPH ID: 14-016-2990-3534
Contact: Unit: 66107 Chicago, IL, 60616
Building ID: 1121G
Phone: Region:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 42

3. LEA Designated Person

Contact: Ms. Lynn Crivello
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603
Phone: (773) 553-3113


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900
Fax: (312) 782-5145

5. Inspector

Inspector Name: Rondell Adams


Inspector IDPH license # 100-18099

Signature: 
Date: 5/15/2013

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

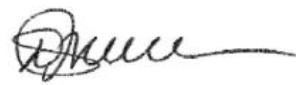Signature: 
Date: 5/15/2013

7. Review Date: 5/15/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/15/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Youth Connection - Ada McKinley Lakeside. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1121G:

B. The following new homogenous areas have been identified for Building 1121G:

1	12" x 12" Teal Floor Tile
10	9" x 9" Beige w/ White Streaks Floor Tile Mastic
11	9" x 9" Green w/ White and Black Streaks Floor Tile
12	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
13	9" x 9" Dark Green w/ White Streaks Floor Tile
14	9" x 9" Dark Green w/ White Streaks Floor Tile Mastic
15	9" x 9" White w/ Black Floor Tile
16	9" x 9" White w/ Black Floor Tile Mastic
17	12" x 12" White w/ Brown Floor Tile
18	12" x 12" White w/ Brown Floor Tile Mastic
19	12" x 12" Green w/ White Streaks Floor Tile
2	12" x 12" Teal Floor Tile Mastic
20	12" x 12" Green w/ White Streaks Floor Tile Mastic
21	6" Vinyl Baseboard
22	6" Vinyl Baseboard Mastic
23	1' x 1' Ceiling Tile
24	1' x 1' Ceiling Tile w/ Fissures
25	Carpet Mastic
26	Drywall
27	TSI on Water Heater
28	Hard Elbows on Fiberglass Pipe Insulation
29	Roofing Material- Not AHERA
3	9" x 9" Green w/ Beige Floor Tile

30	12" x 12" Teal Floor Tile
31	12" x 12" Teal Floor Tile Mastic
32	12" x 12" Beige Mix Floor Tile
33	12" x 12" Beige Mix Floor Tile Mastic
34	9" x 9" Dark Green w/ Beige Floor Tile
35	9" x 9" Dark Green w/ Beige Floor Tile Mastic
36	9" x 9" Beige w/ Green Specks Floor Tile
37	9" x 9" Beige w/ Green Specks Floor Tile Mastic
38	9" X 9" Brown w/ Tan Floor Tile
39	9" X 9" Brown w/ Tan Floor Tile Mastic
4	9" x 9" Green w/ Beige Floor Tile Mastic
40	9" x 9" Tan w/ Brown Floor Tile
41	9" x 9" Tan w/ Brown Floor Tile Mastic
42	9" x 9" Red Floor Tile
43	9" x 9" Red Floor Tile Mastic
44	9" x 9" Grey w/ Black Streaks Floor Tile
45	9" x 9" Grey w/ Black Streaks Floor Tile Mastic
46	12" x 12" White w/ Green Specks Floor Tile
47	12" x 12" White w/ Green Specks Floor Tile Mastic
48	12" x 12" Light Brown Mix Floor Tile
49	12" x 12" Light Brown Mix Floor Tile Mastic
5	9" x 9" Beige w/ Green Specks Floor Tile
50	12" x 12" White w/ Black Specks Floor Tile
51	12" x 12" White w/ Black Specks Floor Tile Mastic
52	12" x 12" Pink Mix Floor Tile
53	12" x 12" Pink Mix Floor Tile Mastic
54	9" x 9" Beige w/ Black and Brown Floor Tile

55	9" x 9" Beige w/ Black and Brown Floor Tile Mastic
56	9" x 9" Blue w/ White Floor Tile
57	9" x 9" Blue w/ White Floor Tile Mastic
58	9" x 9" Green w/ White and Black Streaks Floor Tile
59	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
6	9" x 9" Beige w/ Green Specks Floor Tile Mastic
60	9" x 9" Beige w/ White Streaks Floor Tile
61	9" x 9" Beige w/ White Streaks Floor Tile Mastic
62	9" x 9" Brown w/ Red and White Floor Tile
63	9" x 9" Brown w/ Red and White Floor Tile Mastic
64	Carpet Mastic
65	1' x 1' Ceiling Tile
66	Drywall
67	Plaster
68	Aircell Pipe Insulation
69	Aircell Pipe Fitting Insulation
7	12" x 12" Beige Mix Floor Tile
70	Fittings on Fiberglass Pipe Insulation
71	Vault Door Insulation
72	Roofing Material- Not AHERA
73	Plaster
8	12" x 12" Beige Mix Floor Tile Mastic
9	9" x 9" Beige w/ White Streaks Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

- 1 12" x 12" Teal Floor Tile
- 10 9" x 9" Beige w/ White Streaks Floor Tile Mastic
- 11 9" x 9" Green w/ White and Black Streaks Floor Tile
- 12 9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
- 13 9" x 9" Dark Green w/ White Streaks Floor Tile
- 14 9" x 9" Dark Green w/ White Streaks Floor Tile Mastic
- 15 9" x 9" White w/ Black Floor Tile
- 16 9" x 9" White w/ Black Floor Tile Mastic
- 17 12" x 12" White w/ Brown Floor Tile
- 18 12" x 12" White w/ Brown Floor Tile Mastic
- 19 12" x 12" Green w/ White Streaks Floor Tile
- 2 12" x 12" Teal Floor Tile Mastic
- 20 12" x 12" Green w/ White Streaks Floor Tile Mastic
- 21 6" Vinyl Baseboard
- 22 6" Vinyl Baseboard Mastic
- 23 1' x 1' Ceiling Tile
- 24 1' x 1' Ceiling Tile w/ Fissures
- 25 Carpet Mastic
- 26 Drywall
- 27 TSI on Water Heater
- 28 Hard Elbows on Fiberglass Pipe Insulation
- 29 Roofing Material- Not AHERA
- 3 9" x 9" Green w/ Beige Floor Tile
- 30 12" x 12" Teal Floor Tile
- 31 12" x 12" Teal Floor Tile Mastic
- 32 12" x 12" Beige Mix Floor Tile
- 33 12" x 12" Beige Mix Floor Tile Mastic
- 34 9" x 9" Dark Green w/ Beige Floor Tile
- 35 9" x 9" Dark Green w/ Beige Floor Tile Mastic
- 36 9" x 9" Beige w/ Green Specks Floor Tile
- 37 9" x 9" Beige w/ Green Specks Floor Tile Mastic
- 38 9" X 9" Brown w/ Tan Floor Tile
- 39 9" X 9" Brown w/ Tan Floor Tile Mastic
- 4 9" x 9" Green w/ Beige Floor Tile Mastic
- 40 9" x 9" Tan w/ Brown Floor Tile
- 41 9" x 9" Tan w/ Brown Floor Tile Mastic
- 42 9" x 9" Red Floor Tile
- 43 9" x 9" Red Floor Tile Mastic
- 44 9" x 9" Grey w/ Black Streaks Floor Tile
- 45 9" x 9" Grey w/ Black Streaks Floor Tile Mastic
- 46 12" x 12" White w/ Green Specks Floor Tile
- 47 12" x 12" White w/ Green Specks Floor Tile Mastic

48	12" x 12" Light Brown Mix Floor Tile
49	12" x 12" Light Brown Mix Floor Tile Mastic
5	9" x 9" Beige w/ Green Specks Floor Tile
50	12" x 12" White w/ Black Specks Floor Tile
51	12" x 12" White w/ Black Specks Floor Tile Mastic
52	12" x 12" Pink Mix Floor Tile
53	12" x 12" Pink Mix Floor Tile Mastic
54	9" x 9" Beige w/ Black and Brown Floor Tile
55	9" x 9" Beige w/ Black and Brown Floor Tile Mastic
56	9" x 9" Blue w/ White Floor Tile
57	9" x 9" Blue w/ White Floor Tile Mastic
58	9" x 9" Green w/ White and Black Streaks Floor Tile
59	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
6	9" x 9" Beige w/ Green Specks Floor Tile Mastic
60	9" x 9" Beige w/ White Streaks Floor Tile
61	9" x 9" Beige w/ White Streaks Floor Tile Mastic
62	9" x 9" Brown w/ Red and White Floor Tile
63	9" x 9" Brown w/ Red and White Floor Tile Mastic
64	Carpet Mastic
65	1' x 1' Ceiling Tile
66	Drywall
67	Plaster
68	Aircell Pipe Insulation
69	Aircell Pipe Fitting Insulation
7	12" x 12" Beige Mix Floor Tile
70	Fittings on Fiberglass Pipe Insulation
71	Vault Door Insulation
72	Roofing Material- Not AHERA
73	Plaster
8	12" x 12" Beige Mix Floor Tile Mastic
9	9" x 9" Beige w/ White Streaks Floor Tile

The following areas were deemed to be inaccessible:

10	9" x 9" Beige w/ White Streaks Floor Tile Mastic
12	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
14	9" x 9" Dark Green w/ White Streaks Floor Tile Mastic
16	9" x 9" White w/ Black Floor Tile Mastic
18	12" x 12" White w/ Brown Floor Tile Mastic
2	12" x 12" Teal Floor Tile Mastic
20	12" x 12" Green w/ White Streaks Floor Tile Mastic
22	6" Vinyl Baseboard Mastic
25	Carpet Mastic
31	12" x 12" Teal Floor Tile Mastic
33	12" x 12" Beige Mix Floor Tile Mastic

35	9" x 9" Dark Green w/ Beige Floor Tile Mastic
37	9" x 9" Beige w/ Green Specks Floor Tile Mastic
39	9" X 9" Brown w/ Tan Floor Tile Mastic
4	9" x 9" Green w/ Beige Floor Tile Mastic
41	9" x 9" Tan w/ Brown Floor Tile Mastic
43	9" x 9" Red Floor Tile Mastic
45	9" x 9" Grey w/ Black Streaks Floor Tile Mastic
47	12" x 12" White w/ Green Specks Floor Tile Mastic
49	12" x 12" Light Brown Mix Floor Tile Mastic
51	12" x 12" White w/ Black Specks Floor Tile Mastic
53	12" x 12" Pink Mix Floor Tile Mastic
55	9" x 9" Beige w/ Black and Brown Floor Tile Mastic
57	9" x 9" Blue w/ White Floor Tile Mastic
59	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic
6	9" x 9" Beige w/ Green Specks Floor Tile Mastic
61	9" x 9" Beige w/ White Streaks Floor Tile Mastic
63	9" x 9" Brown w/ Red and White Floor Tile Mastic
64	Carpet Mastic
71	Vault Door Insulation
8	12" x 12" Beige Mix Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Rondell Adams, IDPH License # 100-18099. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Youth Connection - Ada McKinley Lakeside Building 1121G Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G

Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	12" x 12" Teal Floor Tile	220	SF	North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
10	9" x 9" Beige w/ White Streaks Floor Tile Mastic	6	SF	North Building- Rm. 12	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
11	9" x 9" Green w/ White and Black Streaks Floor Tile	90	SF	North Building- Rm. 14 and Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
12	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic	90	SF	North Building- Rm. 14 and Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
13	9" x 9" Dark Green w/ White Streaks Floor Tile	8	SF	North Building- Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
14	9" x 9" Dark Green w/ White Streaks Floor Tile Mastic	8	SF	North Building- Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
15	9" x 9" White w/ Black Floor Tile	8	SF	North Building- Rm. 10	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
16	9" x 9" White w/ Black Floor Tile Mastic	8	SF	North Building- Rm. 10	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
17	12" x 12" White w/ Brown Floor Tile	20	SF	North Building- Custodian Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
18	12" x 12" White w/ Brown Floor Tile Mastic	20	SF	North Building- Custodian Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
19	12" x 12" Green w/ White Streaks Floor Tile	25	SF	North Building- Custodian Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
2	12" x 12" Teal Floor Tile Mastic	220	SF	North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
20	12" x 12" Green w/ White Streaks Floor Tile Mastic	25	SF	North Building- Custodian Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
21	6" Vinyl Baseboard	955	LF	North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
22	6" Vinyl Baseboard Mastic	955	LF	North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
23	1' x 1' Ceiling Tile	3,800	SF	North Building- Throughout	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
24	1' x 1' Ceiling Tile w/ Fissures	1,000	SF	North Building- Rm.	ASSUMED	MISC	Y	NONE	0			Any remaining friable		LOW

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G

Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				13								ACBM or friable suspect ACBM		
25	Carpet Mastic	300	SF	North Building- Rm. 17	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
26	Drywall	500	SF	North Building- Rm. 16 and 17 Washrooms, Storage, and Custodian Closet	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
27	TSI on Water Heater	15	SF	North Building- Storage/Mechanical Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
28	Hard Elbows on Fiberglass Pipe Insulation	3	EA	North Building- Storage/ Mechanical Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
29	Roofing Material- Not AHERA			North Building- Exterior Roof	ASSUMED									
3	9" x 9" Green w/ Beige Floor Tile	3,000	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
30	12" x 12" Teal Floor Tile	280	SF	South Building- Entry Foyer and Janitor's Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
31	12" x 12" Teal Floor Tile Mastic	280	SF	South Building- Entry Foyer and Janitor's Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
32	12" x 12" Beige Mix Floor Tile	250	SF	South Building- Entry Foyer	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
33	12" x 12" Beige Mix Floor Tile Mastic	250	SF	South Building- Entry Foyer	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
34	9" x 9" Dark Green w/ Beige Floor Tile	1,540	SF	South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
35	9" x 9" Dark Green w/ Beige Floor Tile Mastic	1,540	SF	South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G
 Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
36	9" x 9" Beige w/ Green Specks Floor Tile	450	SF	South Building- Reception Area and Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
37	9" x 9" Beige w/ Green Specks Floor Tile Mastic	450	SF	South Building- Reception Area and Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
38	9" X 9" Brown w/ Tan Floor Tile	1,560	SF	South Building- Office and Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
39	9" X 9" Brown w/ Tan Floor Tile Mastic	1,560	SF	South Building- Office and Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
4	9" x 9" Green w/ Beige Floor Tile Mastic	3,000	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
40	9" x 9" Tan w/ Brown Floor Tile	80	SF	South Building- Office and Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
41	9" x 9" Tan w/ Brown Floor Tile Mastic	80	SF	South Building- Office and Science Classroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
42	9" x 9" Red Floor Tile	850	SF	South Building- Math/Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
43	9" x 9" Red Floor Tile Mastic	850	SF	South Building- Math/Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
44	9" x 9" Grey w/ Black Streaks Floor Tile	80	SF	South Building- Computer Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
45	9" x 9" Grey w/ Black Streaks Floor Tile Mastic	80	SF	South Building- Computer Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
46	12" x 12" White w/ Green Specks Floor Tile	210	SF	South Building- Hallway and Foyer	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
47	12" x 12" White w/ Green Specks Floor Tile Mastic	210	SF	South Building- Hallway and Foyer	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
48	12" x 12" Light Brown Mix Floor Tile	8	SF	South Building- Janitor's Closet	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
49	12" x 12" Light Brown Mix Floor Tile Mastic	8	SF	South Building- Janitor's Closet	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
5	9" x 9" Beige w/ Green Specks Floor Tile	3,570	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
50	12" x 12" White w/ Black Specks Floor Tile	290	SF	South Building- South Social Science	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G

Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room and Office										
51	12" x 12" White w/ Black Specks Floor Tile Mastic	290	SF	South Building-South Social Science Room and Office	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
52	12" x 12" Pink Mix Floor Tile	660	SF	South Building-South Social Science Room and Office	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
53	12" x 12" Pink Mix Floor Tile Mastic	660	SF	South Building-South Social Science Room and Office	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
54	9" x 9" Beige w/ Black and Brown Floor Tile	80	SF	South Building-South Social Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
55	9" x 9" Beige w/ Black and Brown Floor Tile Mastic	80	SF	South Building-South Social Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
56	9" x 9" Blue w/ White Floor Tile	15	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
57	9" x 9" Blue w/ White Floor Tile Mastic	15	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
58	9" x 9" Green w/ White and Black Streaks Floor Tile	10	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
59	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic	10	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
6	9" x 9" Beige w/ Green Specks Floor Tile Mastic	3,570	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
60	9" x 9" Beige w/ White Streaks Floor Tile	6	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
61	9" x 9" Beige w/ White Streaks Floor Tile Mastic	6	SF	South Building-Hallway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
62	9" x 9" Brown w/ Red and White Floor Tile	10	SF	South Building-Math/Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
63	9" x 9" Brown w/ Red and White Floor Tile Mastic	10	SF	South Building-Math/Science Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
64	Carpet Mastic	1,000	SF	South Building-Office by Reception, Washroom in Office, and Math Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
65	1' x 1' Ceiling Tile	720	SF	South Building-Hallway	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G

Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
66	Drywall	1,225	SF	South Building- Office and Washroom in Office next to Reception Area	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
67	Plaster	6,680	SF	South Building- Throughout	ASSUMED	SURFACE	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		MODERATE
68	Aircell Pipe Insulation	15	LF	South Building- Safe Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
69	Aircell Pipe Fitting Insulation	6	EA	South Building- Safe Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
7	12" x 12" Beige Mix Floor Tile	1,200	SF	North Building- Rm. 11, Hallway, and 13	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
70	Fittings on Fiberglass Pipe Insulation	35	EA	South Building- Office by Reception, Math/Science Room, Computer Room, Boys and Girls Washroom, Math Room, Science Walls, South Social Science, Office, and North Social Science Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
71	Vault Door Insulation	35	SF	South Building- Safe Room	ASSUMED	TSI	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
72	Roofing Material- Not AHERA			South Building- Exterior Roof	ASSUMED									
73	Plaster	13,680	SF	Church- Main Floor	ASSUMED	SURFACE	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
8	12" x 12" Beige Mix Floor Tile Mastic	1,200	SF	North Building- Rm. 11, Hallway, and 13	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
9	9" x 9" Beige w/ White Streaks Floor Tile	6	SF	North Building- Rm. 12	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside Unit 66107 Building ID 1121G
Address 2920 S. Wabash Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 5/15/2013
Inspector Name Rondell Adams
100-18099 5/15/2014
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
3	
30	

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside **Unit** 66107 **Building ID** 1121G
Address 2920 S. Wabash Ave. **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
31	
32	
33	
34	
35	
36	
37	
38	
39	
4	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
53	
54	
55	
56	
57	

Chicago Public Schools

School Youth Connection - Ada McKinley Lakeside **Unit** 66107 **Building ID** 1121G
Address 2920 S. Wabash Ave. **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
58	
59	
6	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
7	
70	
71	
72	
73	
8	
9	

Table II

Management Planner's Review

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	12" x 12" Teal Floor Tile	220	SF	North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
10	9" x 9" Beige w/ White Streaks Floor Tile Mastic	6	SF	North Building- Rm. 12	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11	9" x 9" Green w/ White and Black Streaks Floor Tile	90	SF	North Building- Rm. 14 and Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic	90	SF	North Building- Rm. 14 and Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
13	9" x 9" Dark Green w/ White Streaks Floor Tile	8	SF	North Building- Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
14	9" x 9" Dark Green w/ White Streaks Floor Tile Mastic	8	SF	North Building- Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
15	9" x 9" White w/ Black Floor Tile	8	SF	North Building- Rm. 10	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	9" x 9" White w/ Black Floor Tile Mastic	8	SF	North Building- Rm. 10	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17	12" x 12" White w/ Brown Floor Tile	20	SF	North Building- Custodian Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
18	12" x 12" White w/ Brown Floor Tile Mastic	20	SF	North Building- Custodian Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19	12" x 12" Green w/ White Streaks Floor Tile	25	SF	North Building- Custodian Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
2	12" x 12" Teal Floor Tile Mastic	220	SF	North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
20	12" x 12" Green w/ White Streaks Floor Tile Mastic	25	SF	North Building- Custodian Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
21	6" Vinyl Baseboard	955	LF	North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
22	6" Vinyl Baseboard Mastic	955	LF	North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
23	1' x 1' Ceiling Tile	3,800	SF	North Building- Throughout	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
24	1' x 1' Ceiling Tile w/ Fissures	1,000	SF	North Building- Rm. 13	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
25	Carpet Mastic	300	SF	North Building- Rm. 17	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	Drywall	500	SF	North Building- Rm. 16 and 17 Washrooms, Storage, and Custodian Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	TSI on Water Heater	15	SF	North Building- Storage/Mechanical Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
28	Hard Elbows on Fiberglass Pipe Insulation	3	EA	North Building- Storage/ Mechanical Room	Assumed	TSI	Yes	0	EA	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
29	Roofing Material- Not AHERA			North Building- Exterior Roof	Assumed						
3	9" x 9" Green w/ Beige Floor Tile	3,000	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
30	12" x 12" Teal Floor Tile	280	SF	South Building- Entry Foyer and Janitor's Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31	12" x 12" Teal Floor Tile Mastic	280	SF	South Building- Entry Foyer and Janitor's Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
32	12" x 12" Beige Mix Floor Tile	250	SF	South Building- Entry Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
33	12" x 12" Beige Mix Floor Tile Mastic	250	SF	South Building- Entry Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
34	9" x 9" Dark Green w/ Beige Floor Tile	1,540	SF	South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
35	9" x 9" Dark Green w/ Beige Floor Tile Mastic	1,540	SF	South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
36	9" x 9" Beige w/ Green Specks Floor Tile	450	SF	South Building- Reception Area and Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
37	9" x 9" Beige w/ Green Specks Floor Tile Mastic	450	SF	South Building- Reception Area and Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
38	9" X 9" Brown w/ Tan Floor Tile	1,560	SF	South Building- Office and Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	9" X 9" Brown w/ Tan Floor Tile Mastic	1,560	SF	South Building- Office and Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
4	9" x 9" Green w/ Beige Floor Tile Mastic	3,000	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	9" x 9" Tan w/ Brown Floor Tile	80	SF	South Building- Office and Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
41	9" x 9" Tan w/ Brown Floor Tile Mastic	80	SF	South Building- Office and Science Classroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	9" x 9" Red Floor Tile	850	SF	South Building- Math/Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	9" x 9" Red Floor Tile Mastic	850	SF	South Building- Math/Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
44	9" x 9" Grey w/ Black Streaks Floor Tile	80	SF	South Building- Computer Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	9" x 9" Grey w/ Black Streaks Floor Tile Mastic	80	SF	South Building- Computer Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
46	12" x 12" White w/ Green Specks Floor Tile	210	SF	South Building- Hallway and Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
47	12" x 12" White w/ Green Specks Floor Tile Mastic	210	SF	South Building- Hallway and Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
48	12" x 12" Light Brown Mix Floor Tile	8	SF	South Building- Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	12" x 12" Light Brown Mix Floor Tile Mastic	8	SF	South Building- Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5	9" x 9" Beige w/ Green Specks Floor Tile	3,570	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
50	12" x 12" White w/ Black Specks Floor Tile	290	SF	South Building- South Social Science Room and Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	12" x 12" White w/ Black Specks Floor Tile Mastic	290	SF	South Building- South Social Science Room and Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52	12" x 12" Pink Mix Floor Tile	660	SF	South Building- South Social Science Room and Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	12" x 12" Pink Mix Floor Tile Mastic	660	SF	South Building- South Social Science Room and Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
54	9" x 9" Beige w/ Black and Brown Floor Tile	80	SF	South Building- South Social Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
55	9" x 9" Beige w/ Black and Brown Floor Tile Mastic	80	SF	South Building- South Social Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
56	9" x 9" Blue w/ White Floor Tile	15	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
57	9" x 9" Blue w/ White Floor Tile Mastic	15	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
58	9" x 9" Green w/ White and Black Streaks Floor Tile	10	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
59	9" x 9" Green w/ White and Black Streaks Floor Tile Mastic	10	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6	9" x 9" Beige w/ Green Specks Floor Tile Mastic	3,570	SF	North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
60	9" x 9" Beige w/ White Streaks Floor Tile	6	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
61	9" x 9" Beige w/ White Streaks Floor Tile Mastic	6	SF	South Building- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
62	9" x 9" Brown w/ Red and White Floor Tile	10	SF	South Building- Math/Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
63	9" x 9" Brown w/ Red and White Floor Tile Mastic	10	SF	South Building- Math/Science Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
64	Carpet Mastic	1,000	SF	South Building- Office by Reception, Washroom in Office, and Math Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
65	1' x 1' Ceiling Tile	720	SF	South Building- Hallway	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
66	Drywall	1,225	SF	South Building- Office and Washroom in Office next to Reception Area	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
67	Plaster	6,680	SF	South Building- Throughout	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
68	Aircell Pipe Insulation	15	LF	South Building- Safe Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
69	Aircell Pipe Fitting Insulation	6	EA	South Building- Safe Room	Assumed	TSI	Yes	0	EA	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
7	12" x 12" Beige Mix Floor Tile	1,200	SF	North Building- Rm. 11, Hallway, and 13	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
70	Fittings on Fiberglass Pipe Insulation	35	EA	South Building- Office by Reception, Math/Science Room, Computer Room, Boys and Girls Washroom, Math Room, Science Walls, South Social Science, Office, and North Social Science Room	Assumed	TSI	Yes	0	EA	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
71	Vault Door Insulation	35	SF	South Building- Safe Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
72	Roofing Material- Not AHERA			South Building- Exterior Roof	Assumed						
73	Plaster	13,680	SF	Church- Main Floor	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
8	12" x 12" Beige Mix Floor Tile Mastic	1,200	SF	North Building- Rm. 11, Hallway, and 13	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
9	9" x 9" Beige w/ White Streaks Floor Tile	6	SF	North Building- Rm. 12	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	5/15/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
25	
26	
27	
28	
29	
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
4	
40	
41	
42	
43	
44	
45	
46	
47	
48	

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
49	
5	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
6	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
7	
70	
71	

Chicago Public Schools

School Youth Connection - Ada
McKinley Lakeside

Unit 66107

Building ID 1121G

Address 2920 S. Wabash Ave.

Chicago, IL, 60616

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
72	
73	
8	
9	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 11, Hallway, and 13**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**

MATERIAL LOCATION: **North Building- Rm. 11, Hallway, and 13**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 11, Hallway, and 13**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 11, Hallway, and 13**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **TSI on Water Heater**
MATERIAL LOCATION: **North Building- Storage/Mechanical Room**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **TSI on Water Heater**

MATERIAL LOCATION: **North Building- Storage/Mechanical Room**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **9" x 9" Green w/ White and Black Streaks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 14 and Storage**
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **9" x 9" Green w/ White and Black Streaks Floor Tile Mastic**

MATERIAL LOCATION: **North Building- Rm. 14 and Storage**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

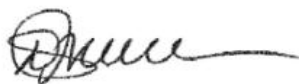

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **9" x 9" White w/ Black Floor Tile**

MATERIAL LOCATION: **North Building- Rm. 10**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **North Building- Rm. 17**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **North Building- Rm. 17**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **North Building- Rm. 16 and 17 Washrooms, Storage, and Custodian Closet**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **North Building- Rm. 16 and 17 Washrooms, Storage, and Custodian Closet**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **9" x 9" Blue w/ White Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **9" x 9" Blue w/ White Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **South Building- Office by Reception, Washroom in Office, and Math Room**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **South Building- Office by Reception, Washroom in Office, and Math Room**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **South Building- Office by Reception, Math/Science Room, Computer Room, Boys and Girls Washroom, Math Room, Science Walls, South Social Science, Office, and North Social Science Room**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **EA**

MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**

ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **South Building- Office by Reception, Math/Science Room, Computer Room, Boys and Girls Washroom, Math Room, Science Walls, South Social Science, Office, and North Social Science Room**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **9" x 9" Green w/ Beige Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **9" x 9" Green w/ Beige Floor Tile Mastic**

MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ White Streaks Floor Tile**
MATERIAL LOCATION: **North Building- Storage**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ White Streaks Floor Tile**
MATERIAL LOCATION: **North Building- Storage**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **6" Vinyl Baseboard**
MATERIAL LOCATION: **North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms**
MATERIAL QUANTITY: **955** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **6" Vinyl Baseboard**

MATERIAL LOCATION: **North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms**

MATERIAL QUANTITY: **955** MATERIAL UNITS: **LF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **6" Vinyl Baseboard Mastic**
MATERIAL LOCATION: **North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms**
MATERIAL QUANTITY: **955** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **6" Vinyl Baseboard Mastic**

MATERIAL LOCATION: **North Building- Rm. 11, 12, Hallway, Rm. 13, 16, and Girls' and Boys' Washrooms**

MATERIAL QUANTITY: **955** MATERIAL UNITS: **LF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

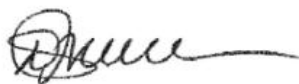

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUIDLING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ Brown Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Office and Science Classroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **9" x 9" Tan w/ Brown Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Office and Science Classroom**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **9" x 9" Grey w/ Black Streaks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Computer Room**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12" x 12" White w/ Black Specks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- South Social Science Room and Office**
MATERIAL QUANTITY: **290** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12" x 12" White w/ Black Specks Floor Tile Mastic**

MATERIAL LOCATION: **South Building- South Social Science Room and Office**

MATERIAL QUANTITY: **290** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **9" x 9" Blue w/ White Floor Tile**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **9" x 9" Blue w/ White Floor Tile**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**
MATERIAL LOCATION: **South Building- Entry Foyer**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**

MATERIAL LOCATION: **South Building- Entry Foyer**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **9" x 9" Green w/ White and Black Streaks Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Hallway**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile**

MATERIAL LOCATION: **South Building- Hallway**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom**
MATERIAL QUANTITY: **220** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom**
MATERIAL QUANTITY: **220** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Green w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Custodian Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Green w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Custodian Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **North Building- Throughout**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/15/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Hard Elbows on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **North Building- Storage/ Mechanical Room**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **EA**
MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Hard Elbows on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **North Building- Storage/ Mechanical Room**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **EA**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Roofing Material- Not AHERA**
MATERIAL LOCATION: **North Building- Exterior Roof**
MATERIAL QUANTITY: MATERIAL UNITS:
MATERIAL CATEGORY: FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Roofing Material- Not AHERA**

MATERIAL LOCATION: **North Building- Exterior Roof**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12" x 12" White w/ Black Specks Floor Tile**
MATERIAL LOCATION: **South Building- South Social Science Room and Office**
MATERIAL QUANTITY: **290** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **12" x 12" White w/ Black Specks Floor Tile**

MATERIAL LOCATION: **South Building- South Social Science Room and Office**

MATERIAL QUANTITY: **290** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Black and Brown Floor Tile Mastic**
MATERIAL LOCATION: **South Building- South Social Science Room**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Black and Brown Floor Tile Mastic**
MATERIAL LOCATION: **South Building- South Social Science Room**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **South Building- Throughout**
MATERIAL QUANTITY: **6680** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **SURFACE** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **South Building- Throughout**

MATERIAL QUANTITY: **6680** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUIDLING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Church- Main Floor**
MATERIAL QUANTITY: **13680** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **SURFACE** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **73**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Church- Main Floor**

MATERIAL QUANTITY: **13680** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 12**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 12**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 12**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **9" x 9" Beige w/ White Streaks Floor Tile Mastic**

MATERIAL LOCATION: **North Building- Rm. 12**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **9" x 9" Green w/ White and Black Streaks Floor Tile**

MATERIAL LOCATION: **North Building- Rm. 14 and Storage**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ Brown Floor Tile**
MATERIAL LOCATION: **South Building- Office and Science Classroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **9" x 9" Tan w/ Brown Floor Tile**

MATERIAL LOCATION: **South Building- Office and Science Classroom**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**
MATERIAL LOCATION: **South Building- Math/Science Room**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**

MATERIAL LOCATION: **South Building- Math/Science Room**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **9" x 9" Grey w/ Black Streaks Floor Tile**

MATERIAL LOCATION: **South Building- Computer Room**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12" x 12" White w/ Green Specks Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Hallway and Foyer**

MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Red and White Floor Tile**
MATERIAL LOCATION: **South Building- Math/Science Room**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Red and White Floor Tile**
MATERIAL LOCATION: **South Building- Math/Science Room**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile**
MATERIAL LOCATION: **South Building- Reception Area and Hallway**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile**

MATERIAL LOCATION: **South Building- Reception Area and Hallway**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom**
MATERIAL QUANTITY: **220** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 17, Patching in Hallway, Patching in Lunchroom**
MATERIAL QUANTITY: **220** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **9" x 9" Green w/ Beige Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **9" x 9" Green w/ Beige Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Storage, Library**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library**
MATERIAL QUANTITY: **3570** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library**
MATERIAL QUANTITY: **3570** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library**
MATERIAL QUANTITY: **3570** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **6**

MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile Mastic**

MATERIAL LOCATION: **North Building- Rm. 10, 11, 12, Hallway Rm. 15, 16, 14, Library**

MATERIAL QUANTITY: **3570** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

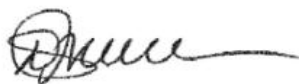

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Storage**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Floor Tile**
MATERIAL LOCATION: **North Building- Custodian Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/ Fissures**
MATERIAL LOCATION: **North Building- Rm. 13**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **9" X 9" Brown w/ Tan Floor Tile**
MATERIAL LOCATION: **South Building- Office and Science Classroom**
MATERIAL QUANTITY: **1560** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **9" X 9" Brown w/ Tan Floor Tile**

MATERIAL LOCATION: **South Building- Office and Science Classroom**

MATERIAL QUANTITY: **1560** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Custodian Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Math/Science Room**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Math/Science Room**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile**
MATERIAL LOCATION: **South Building- Janitor's Closet**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile**

MATERIAL LOCATION: **South Building- Janitor's Closet**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Janitor's Closet**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Janitor's Closet**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Pink Mix Floor Tile**
MATERIAL LOCATION: **South Building- South Social Science Room and Office**
MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12" x 12" Pink Mix Floor Tile**

MATERIAL LOCATION: **South Building- South Social Science Room and Office**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Red and White Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Math/Science Room**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **Aircell Pipe Fitting Insulation**
MATERIAL LOCATION: **South Building- Safe Room**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **EA**
MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **Aircell Pipe Fitting Insulation**

MATERIAL LOCATION: **South Building- Safe Room**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **Vault Door Insulation**

MATERIAL LOCATION: **South Building- Safe Room**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile**

MATERIAL LOCATION: **South Building- Entry Foyer and Janitor's Room**

MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Entry Foyer and Janitor's Room**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12" x 12" Teal Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Entry Foyer and Janitor's Room**

MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9" x 9" White w/ Black Floor Tile Mastic**
MATERIAL LOCATION: **North Building- Rm. 10**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **9" x 9" White w/ Black Floor Tile Mastic**

MATERIAL LOCATION: **North Building- Rm. 10**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Black and Brown Floor Tile**
MATERIAL LOCATION: **South Building- South Social Science Room**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Black and Brown Floor Tile**
MATERIAL LOCATION: **South Building- South Social Science Room**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **South Building- Safe Room**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ Beige Floor Tile**

MATERIAL LOCATION: **South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom**

MATERIAL QUANTITY: **1540** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **MODERATE** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ Beige Floor Tile**

MATERIAL LOCATION: **South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom**

MATERIAL QUANTITY: **1540** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

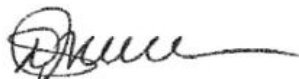

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ Beige Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom**
MATERIAL QUANTITY: **1540** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **9" x 9" Dark Green w/ Beige Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Entry Foyer, Under Bench, Reception Area, Safe, Hallway, Computer Room, and North Social Science Classroom**

MATERIAL QUANTITY: **1540** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

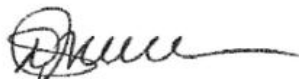

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Reception Area and Hallway**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9" x 9" Beige w/ Green Specks Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Reception Area and Hallway**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Green w/ White Streaks Floor Tile**
MATERIAL LOCATION: **North Building- Custodian Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12" x 12" Green w/ White Streaks Floor Tile**

MATERIAL LOCATION: **North Building- Custodian Room**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **9" X 9" Brown w/ Tan Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Office and Science Classroom**
MATERIAL QUANTITY: **1560** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **9" X 9" Brown w/ Tan Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Office and Science Classroom**

MATERIAL QUANTITY: **1560** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" White w/ Green Specks Floor Tile**
MATERIAL LOCATION: **South Building- Hallway and Foyer**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12" x 12" White w/ Green Specks Floor Tile**

MATERIAL LOCATION: **South Building- Hallway and Foyer**

MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

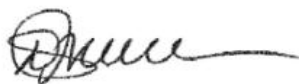

Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12" x 12" Pink Mix Floor Tile Mastic**

MATERIAL LOCATION: **South Building- South Social Science Room and Office**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **South Building- Office and Washroom in Office next to Reception Area**
MATERIAL QUANTITY: **1225** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **South Building- Office and Washroom in Office next to Reception Area**

MATERIAL QUANTITY: **1225** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **Roofing Material- Not AHERA**
MATERIAL LOCATION: **South Building- Exterior Roof**
MATERIAL QUANTITY: MATERIAL UNITS:
MATERIAL CATEGORY: FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 05/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **72**

MATERIAL DESCRIPTION: **Roofing Material- Not AHERA**

MATERIAL LOCATION: **South Building- Exterior Roof**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Rondell Adams**
SCHOOL NAME: **Youth Connection - Ada McKinley Lakeside** INSPECTION DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile Mastic**
MATERIAL LOCATION: **South Building- Entry Foyer**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**

ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile Mastic**

MATERIAL LOCATION: **South Building- Entry Foyer**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66107** BUILDING ID: **1121G**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Youth Connection - Ada
McKinley Lakeside** REVIEW DATE: **5/15/2013**
ADDRESS: **2920 S. Wabash Ave.** IDPH LICENSE NO: **100-18099**


HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **9" x 9" Green w/ White and Black Streaks Floor Tile**
MATERIAL LOCATION: **South Building- Hallway**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/15/2013**

APPENDIX B

Inspector and Management Planner Licenses



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 18099

ISSUED
3/4/2013

EXPIRES
05/15/2014

RONDELL ADAMS
1025 TANEY ST
GARY, IN 46404

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

2/27/2014

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

5/24/2013

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Rondell Adams

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1302270758

Exam Date: 2/27/2013

Course Date: 2/27/2013

Expiration Date: 2/27/2014


Kathy DeSalvo, Director

2013



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 18099

ISSUED
3/4/2013

EXPIRES
05/15/2014

RONDELL ADAMS
1025 TANEY ST
GARY, IN 46404

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

2/27/2014

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

5/24/2013

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Rondell Adams

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1302270758


Exam Date: 2/27/2013

Course Date: 2/27/2013

Expiration Date: 2/27/2014


Kathy DeSalvo, Director

2013

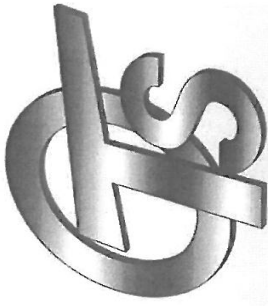

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

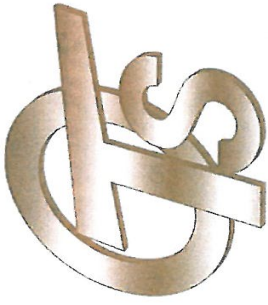

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

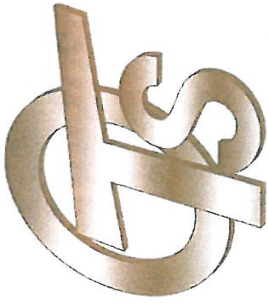

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

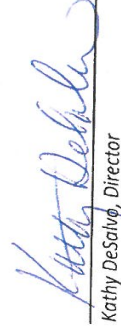

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed