

Facility Assessment Report

This report contains the detailed findings of the facility condition assessment completed on the date noted in the document footer. Assessors rate each facility item by visual observation only; they do not test the operation of equipment or perform destructive testing of walls, ceilings, or floors. Each facility item is ranked on a 7-point scale: a rank 7 means the item is new or in like-new condition and no work is required while rank 1 means the item has failed and has led to an immediate life safety condition¹. The remaining ranks generally mean that the item requires regular maintenance (rank 5 or 6) or full replacement (rank 2, 3 or 4). To enhance reporting and capital planning analysis, each assessed item must also be assigned a recommended replacement range (used to specify the time span, in years, before replacement is recommended). Definitions for Quantity and Unit of Measure (UOM) can be found at the end of this report.

For additional detail and definition on rank values as they relate to each assessed item or the recommended replacement range, please visit the "CPS Guide to Biennial Facility Assessments" found on the Facilities Standards webpage under CPS Policies and Guidelines at http://www.cps.edu/facilityassessment.

Campus Summary			
BuildingName	Year Constructed	Number of Floors	Building Area (Sq Ft)
Main-Building A	1973	3	245,084
Addition			
Linked Addition-Athletic Building B	1973	2	170,493
Campus Total			415,577

Catego	ry : Exterior	B					
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Entrance							
	Entrance Control - Audio and Video	10	1	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	10	1	EA	7	10+ years	
	Exterior Doors - Transom Lite	10	1	EA	7	10+ years	
	Exterior Stairs - Concrete	10	18	LF	6	10+ years	
	Stair Handrail - Steel_Stair Handrail	10	5	LF	6	10+ years	
	Exterior Doors - Overhead Rolling/ Garage Door	10.1 - Garage	1	EA	6	10+ years	
	Exterior Doors - Overhead Rolling/ Garage Door	10.2 - Loading Dock	2	EA	6	10+ years	
	Entrance Control - Audio and Video	6 - SW	1	EA	7	10+ years	
	Exterior Doors - Exterior FRP Door	6 - SW	4	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	6.1 - SW	1	EA	6	10+ years	
	Exterior Doors - Transom Lite	6.1 - SW	1	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	7 - SE	4	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	7.1 - SE	2	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	8	1	EA	6	10+ years	
	Exterior Doors - Overhead Rolling/ Garage Door	8.1- Automotive	3	EA	6	10+ years	
	Exterior Doors - Exterior Steel Door	9	1	EA	6	10+ years	
	Exterior Doors - Exterior Steel Door	Roof doors	4	EA	7	10+ years	
	Exterior Stairs - Steel or Aluminum	Roof doors	12	LF	6	10+ years	



Catego	ry : Exterior		Building : Main-Building A				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
oundat							
	Foundation - Concrete	Entire Building	1,078	LF	7	10+ years	
	Foundation - Concrete	Entire Building	80	LF	7	10+ years	
	Superstructure - Metal Deck/ Concrete	Entire Building	245,084	SF	7	10+ years	
	Topping						
ighting							
0 0	Exterior Lighting - Parapet or Roof Mounted	Entire Building	15	EA	7	10+ years	
	Exterior Lighting - Wall Mounted	Entire Building	11	EA	7	10+ years	
Roof Sv:	stom						
<u>1001 SY</u>	Access Ladder - Metal	A	1	EA	7	10+ years	
	Coping - Metal	A	1,918	LF	7	10+ years	
	Downspouts - Interior Downspouts	A	720	LF	6	10+ years	
			1,918	LF	7		
	Parapet - Parapet > 30"	A				10+ years	
	Roof - Modified Bitumen	A	80,728	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	A	80,728	SF	7	10+ years	
	Concrete Topping Coping - Metal	В	104	LF	7	10, 10000	
						10+ years	
	Downspouts - Interior Downspouts	В	2	LF	6	10+ years	
	Parapet - Parapet < 16" Height	В	104	LF	7	10+ years	
	Roof - Modified Bitumen	В	676	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	В	676	SF	7	10+ years	
	Concrete Topping	0. 114/	101	. –	-	10	
	Coping - Metal	C - NW	104	LF	7	10+ years	
	Downspouts - Interior Downspouts	C - NW	2	LF	6	10+ years	
	Parapet - Parapet < 16" Height	C - NW	104	LF	7	10+ years	
	Roof - Modified Bitumen	C - NW	676	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	C - NW	676	SF	7	10+ years	
	Concrete Topping						
	Coping - Metal	D	104	LF	7	10+ years	
	Downspouts - Interior Downspouts	D	2	LF	6	10+ years	
	Parapet - Parapet < 16" Height	D	104	LF	7	10+ years	
	Roof - Modified Bitumen	D	676	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	D	676	SF	7	10+ years	
	Concrete Topping			-		- ,	
	Chimney - Metal Flue	E	12	LF	7	10+ years	
	Coping - Metal	Ē	104	LF	7	6-10 years	
	Downspouts - Interior Downspouts	E	2	LF	6	6-10 years	
	Parapet - Parapet < 16" Height	E	104	LF	7	10+ years	
	Roof - Modified Bitumen	E	676	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	E	676	SF	7	10+ years	
		L	070	3F	'	IUT years	
	Concrete Topping						



oulogo	ry : Exterior		Building : Main-Building A				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Coping - Metal	F - Link Roof	56	LF	7	10+ years	
	Downspouts - Interior Downspouts	F - Link Roof	6	LF	6	10+ years	
	Parapet - Parapet < 16" Height	F - Link Roof	56	LF	7	10+ years	
	Roof - Modified Bitumen	F - Link Roof	196	SF	6	10+ years	
	Roof Structure - Steel / Metal Deck/	F - Link Roof	196	SF	7	10+ years	
	Concrete Topping						
Nalls							
	Canopy - Fabric	Entire Building	120	SF	7	10+ years	
	Exterior Walls - Brick	Entire Building	37,769	SF	6	6-10 years	
	Exterior Walls - Precast Panel Wall	Entire Building	2,000	SF	6	10+ years	
	Exterior Walls - Prefabricated Metal Panel	Entire Building	3,040	SF	6	10+ years	
	Wall	Linki o Ballanig	0,010	0.	Ũ	ior youro	
Window	3						
	Guard - Guards perforated	Entire Building	1,431	SF	6	10+ years	
	Lintels - Steel	Entire Building	1,785	LF	6	10+ years	
	Storefront Windows	Entire Building	120	SF	6	10+ years	
	Windows - Casement Aluminum	Entire Building	14,721	SF	6	10+ years	
					•		
	Windows - Casement Authinitian Windows - Louver	Entire Building	36	SF	6	10+ years	
Catego	Windows - Louver	•	36			2	
Catego		•	36			10+ years Building A Recommend	
	Windows - Louver	•	36			Building A	Comments
Group	Windows - Louver ry : Electrical Item - Type	Entire Building	36 B	uilding	: Main-E	Building A Recommend	Comments
Group	Windows - Louver ry : Electrical	Entire Building	36 B	uilding	: Main-E	Building A Recommend	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas	Entire Building	36 B Quantity	uilding UOM	: Main-E Rank	Building A Recommend Replacement	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of years
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch	Entire Building Location Basement Basement	36 B Quantity 1 4	uilding UOM EA	: Main-E Rank 2 7	Building A Recommend Replacement 0-1 year 10+ years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of year Quantity changed to match current
Group	Windows - Louver ry : Electrical Item - Type hey System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV	Entire Building Location Basement Basement Entire Building	36 B Quantity 1 4 245,084	UOM EA EA SF	: Main-E Rank 2 7 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of year Quantity changed to match current
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch	Entire Building Location Basement Basement	36 B Quantity 1 4	UOM EA EA	: Main-E Rank 2 7	Building A Recommend Replacement 0-1 year 10+ years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of year Quantity changed to match current observations.
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV Security System - Intrusion Detection Exit Signs - Corridors and Stairs	Entire Building Location Basement Basement Entire Building Entire Building Entire Building Entire Building	36 B Quantity 1 4 245,084 245,084 40	UOM EA EA SF SF	: Main-E Rank 2 7 6 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years 6-10 years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of years Quantity changed to match current observations.
Group	Windows - Louver ry : Electrical Item - Type hey System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV Security System - Intrusion Detection	Entire Building Location Basement Basement Entire Building Entire Building	36 B Quantity 1 4 245,084 245,084	EA EA SF SF EA	: Main-E Rank 2 7 6 6 6 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of years Quantity changed to match current observations.
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV Security System - Intrusion Detection Exit Signs - Corridors and Stairs Exit Signs - Lunchroom Emergency A/C Power - Corridors and Stairs	Entire Building Location Basement Basement Entire Building Entire Building Entire Building Entire Building Entire Building Entire Building	36 B Quantity 1 4 245,084 245,084 40 12 54,566	UOM EA EA SF SF EA EA SF	: Main-E Rank 2 7 6 6 6 6 6 6 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of years Quantity changed to match current observations.
Group	Windows - Louver ry : Electrical Item - Type ncy System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV Security System - Intrusion Detection Exit Signs - Corridors and Stairs Exit Signs - Lunchroom Emergency A/C Power - Corridors and	Entire Building Location Basement Basement Entire Building Entire Building Entire Building Entire Building Entire Building	36 B Quantity 1 4 245,084 245,084 40 12	EA EA EA SF SF EA EA	: Main-E Rank 2 7 6 6 6 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of years Quantity changed to match current observations. Quantity changed as total has beer
Group	Windows - Louver ry : Electrical Item - Type Day System Emergency Generator- Indoor- Natural Gas - 151 - 200 KW Automatic Transfer Switch Security System - CCTV Security System - Intrusion Detection Exit Signs - Corridors and Stairs Exit Signs - Lunchroom Emergency A/C Power - Corridors and Stairs Emergency A/C Power - Lunchrooms Emergency A/C Power - Students Toilets	Entire Building Location Basement Basement Entire Building	36 B Quantity 1 4 245,084 245,084 40 12 54,566 17,100	UOM EA EA SF EA EA SF EA SF SF	: Main-E Rank 2 7 6 6 6 6 6 6 6	Building A Recommend Replacement 0-1 year 10+ years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years	Serves Main and Linked Addition. Rank, Reason and Priority Rep changed as the unit has been nonfunctional for a number of year Quantity changed to match current observations.



Catego	ry : Electrical		В	uilding	: Main-E	Building A	4959 S Archer AVENUE, Chicago, IL 60632	
U	•			J		Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	emergency power							
	Main Electrical Service - 1200 A	Entire Building	1	EA	6	6-10 years	Quantity and Priority Rep changed to	
	277/480/3PH		_		_		match current observations.	
	Main Electrical Service - 800 A and	Entire Building	7	EA	6	6-10 years	Priority Rep adjusted based on	
	277/480/3PH			Ξ.	•	0.40	current observations.	
	Main Electrical Service - Greater than 3000	Entire Building	1	EA	6	6-10 years	Item Type and Priority Rep adjusted	
	A 120/208/3PH Main Electrical Service - Greater than 3000	Entire Building	1	EA	6	6-10 years	based on current observations. Priority Rep adjusted based on	
	A 120/208/3PH	Entite Building	I	LA	0	0-10 years	current observations.	
	PA System	Entire Building	245,084	SF	6	6-10 years	Serves Main and Addition.	
	1 / Cystem	Entire Building	240,004	01	0	o ro years	Cerves Main and Addition.	
Power D	Distribution							
	Lighting and Power Panels - 100 A	Entire Building	3	EA	7	10+ years	Quantity changed to match current	
							observations and as the total has	
					_		been divided/aggregated.	
	Lighting and Power Panels - 100 A	Entire Building	2	EA	6	10+ years	Quantity changed to match current	
							observations and as the total has	
	Lighting and Dower Danala 100 A	Entire Building	1	EA	4	0.1.000	been divided/aggregated.	
	Lighting and Power Panels - 100 A	Entire Building	I	EA	4	0-1 year	EM fuse panel. Open fuse receptacles expose live conductors	
							presenting a live front condition.	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	7	10+ years	Quantity changed to match current	
		Entrie Bananig		-/ (let years	observations.	
	Lighting and Power Panels - Above 100 A	Entire Building	41	EA	6	6-10 years	Priority Rep adjusted based on	
	5 5	č				2	current observations. Quantity	
							changed to match current and as tota	
							has been divided/aggregated.	
	Lighting and Power Panels - Above 100 A	Entire Building	2	EA	4	0-1 year	Missing interior cover plate exposes	
							live conductors presenting a live front	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	4	0.1.000	condition. Open breaker slot exposes live	
	Lighting and Power Panels - Above 100 A	Entire Building	I	EA	4	0-1 year	conductors presenting a live front	
							condition.	
	Lighting and Power Panels - Above 100 A	Entire Building	2	EA	4	0-1 year	Open breaker slot exposes live	
			-	_/ `		e i jea	conductors presenting a live front	
							condition.	
	Main Distribution Panels - 400 - 600 amp	Entire Building	24	EA	7	10+ years		
	Main Distribution Panels - Greater than 600	Entire Building	2	EA	7	10+ years		
	amp							
	Main Distribution Panels - Less than 400	Entire Building	7	EA	7	10+ years		
	amp			- -	_			
	Transformers - 277/480 - 120/208	Entire Building	3	EA	7	6-10 years	Quantity changed to match current	
							observations.	



Category : Fire P	Protection		E	Building	: Main-E	Building A	HOUSE AND A REPORT AVENUE, CHICAGO, IE 00032
						Recommend	
Group Item - Ty	pe	Location	Quantity	UOM	Rank	Replacement	Comments
Fire Alarm							
	m Anunciator	Entire Building	1	EA	6	6-10 years	No CPS Asset Tag present.
Fire Alarr		Entire Building	1	EA	6	6-10 years	
	n Strobe Lights	Entire Building	245,084	SF	6	6-10 years	
	n_System	Entire Building	245,084	SF EA	6 5	6-10 years	Dessen and Driarity Dan adjusted to
File Pulli	p Controller	Entire Building	1	EA	5	6-10 years	Reason and Priority Rep adjusted to match current observations.
Pump Room Assem	ably						
	p - 51-75hp	Mechanical Room	1	EA	6	6-10 years	
Jockey P		Mechanical Room	1	EA	6	6-10 years	
Sprinkler System							
Sprinkler	Heads	Entire Building	245,084	SF	7	6-10 years	Rank, Reason and Priority Rep changed as old heads were replaced since previous assessment.
Sprinkler	Piping	Entire Building	245,084	SF	6	10+ years	•
Wet Sprin	nkler System	Entire Building	245,084	SF	6	6-10 years	
Category : Mech	anical		E	Building	: Main-E	Building A	
Group Item - Ty	De	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
Air Conditioning	F.						
	ing Unit- Roof Mounted - 21-30	Roof	1	EA	7	10+ years	Associated with 10001-15000 cfm air handler. Location changed for clarification. Not directly accessible in a safe manner at the time of assessment due to unreliable climbing means. CPS Asset Tag not available.
Condensi than 5 tor	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	No CPS Asset Tag present.
	ing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	



Catego	ry : Mechanical		В	uilding	: Main-E	Building A		
Group	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments	
roup	than 5 tons	Location	Quantity	UOIWI	Rank	Replacement	Comments	
	Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years	Carrier unit; component of a ductless	
	than 5 tons						split system serving the fan coil unit i MDF Room 237.	
	Condensing Unit- Roof Mounted - Less than 5 tons	Roof	1	EA	7	10+ years		
	Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less	Roof	1	EA	7	10+ years		
	than 5 tons Condensing Unit- Roof Mounted - Less than 5 tons	Roof	1	EA	6	10+ years		
ir Hand	ling Systems							
	Fan Coil Unit- Celing Mounted - Electric	Entire Building	21	EA	6	6-10 years	Quantity changed as total has been divided/aggregated. No CPS Asset Tags present.	
	Air Handling Unit- Package Multi Zone- Indoor- Electric and DX Cooling Coil - 10001-15000 cfm	Mechanical Room	1	EA	6	6-10 years	Associated with the 21-30 ton condenser on the South Passage Roof.	
	Air Intake	Mechanical Room	1	EA	6	6-10 years		
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-17	
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-16	
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-15	
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-14	
	Roof Top Unit-Multi Zone-Roof Mounted-	Roof	1	EA	7	10+ years	AC-13	



Catego	ry : Mechanical		В	uilding	: Main-E	Building A	ACHER AVENUE, Chicago, ie 00032
0	Here Trees	Location	Owentline		Devil	Recommend	0
Group	Item - Type Gas Heating and DX Cooling - 31 - 45 tons	Location	Quantity	UOM	Rank	Replacement	Comments
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-12
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-11
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-10
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-9
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-8
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-7
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-6
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-5
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-4
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-3
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-2
	Roof Top Unit-Multi Zone-Roof Mounted- Gas Heating and DX Cooling - 31 - 45 tons	Roof	1	EA	7	10+ years	AC-1
	Make Up Air Unit- Roof Mounted- Gas Heating - 6000 - 10,000 cfm	Roof	1	EA	7	10+ years	
	VAV Box	VAV Boxes	10	EA	7	10+ years	Associated with AC-1. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
	VAV Box	VAV Boxes	6	EA	7	10+ years	Associated with AC-11. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
	VAV Box	VAV Boxes	9	EA	7	10+ years	Associated with AC-9. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of



Catego	ry : Mechanical		В	uildina	: Main-E	Building A	1939 3 AICHEL AVENUE, CHicago, IE 00032
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	VAV Box	VAV Boxes	9	EA	7	10+ years	appropriate climbing means. Associated with AC-6. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	8	EA	7	10+ years	appropriate climbing means. Associated with AC-14. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	9	EA	7	10+ years	appropriate climbing means. Associated with AC-8. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	9	EA	7	10+ years	appropriate climbing means. Associated with AC-15. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	8	EA	7	10+ years	assessment due to lack of appropriate climbing means. Associated with AC-12. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	10	EA	7	10+ years	appropriate climbing means. Associated with AC-4. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	8	EA	7	10+ years	appropriate climbing means. Associated with AC-7. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	7	EA	7	10+ years	appropriate climbing means. Associated with AC-10. Located



Catego	ory : Mechanical		В	uilding	: Main-E	Building A	
				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	VAV Box	VAV Boxes	7	EA	7	10+ years	throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means. Associated with AC-17. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of
	VAV Box	VAV Boxes	7	EA	7	10+ years	appropriate climbing means. Associated with AC-3. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
	VAV Box	VAV Boxes	7	EA	7	10+ years	Associated with AC-5. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
	VAV Box	VAV Boxes	4	EA	7	10+ years	Associated with AC-16. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
	VAV Box	VAV Boxes	7	EA	7	10+ years	Associated with AC-13. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
l lee de	VAV Box	VAV Boxes	6	EA	7	10+ years	Associated with AC-2. Located throughout the building above the suspended ceiling grid and inaccessible at the time of assessment due to lack of appropriate climbing means.
Heating				F ^		0.40	
	Unit Heater - Electric	Entire Building	1	EA	6	6-10 years	



Catego	ry : Mechanical		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Unit Heater - Electric	Entire Building	2	EA	5	6-10 years	Location, Reason and Priority Rep changed to match current observations. Quantity changed as total has been divided/aggregated.
	Unit Heater - Electric	Entire Building	2	EA	5	6-10 years	Priority Rep adjusted based on current observations.
	Unit Heater - Electric	Entire Building	1	EA	4	0-1 year	Vintage unit that is nonfunctional and has been abandoned in place.
	Unit Heater - Electric	Entire Building	1	EA	2	0-1 year	Rank adjusted as unit has failed and has been abandoned in place. Vintage equipment beyond repair.
	Unit Heater - Gas	Entire Building	1	EA	7	6-10 years	
	Fin Tube - Electric	Entire Building	2,722	LF	5	6-10 years	Item Type changed to match current observations.
	Duct Heater - Electric	Entire Building	56		7	10+ years	
	Cabinet Heaters - With Electric Coil	Entire Building	1	EA	6	6-10 years	Quantity changed to match current observations and as total has been divided/aggregated.
	Cabinet Heaters - With Electric Coil	Entire Building	1	EA	6	6-10 years	Located in the Door 7 vestibule.
	Cabinet Heaters - With Electric Coil	Entire Building	1	EA	4	0-1 year	Item Type changed to match current observations. Unit is nonfunctional and has been abandoned in place.
	Wall Heater - Electric	Entire Building	2	EA	6	6-10 years	Located in the Door 5 vestibule.
	Wall Heater - Electric	Entire Building	2	EA	6	6-10 years	Location changed for clarification. Located in staff restrooms.
Tempera	ature Control						
•	DDC System	Entire Building	245,084	SF	7	10+ years	
	Electric Thermostat	Entire Building	2	EA	7	6-10 years	
	Electric Thermostat	Entire Building	9	EA	7	6-10 years	Quantity and Priority Rep changed to match current observations.
	Electric Thermostat	Entire Building	1	EA	6	6-10 years	
	Electric Thermostat	Entire Building	4	EA	6	6-10 years	
	Electric Thermostat	Entire Building	1	EA	6	6-10 years	
	Pneumatic System	Entire Building	6,000	SF	6	6-10 years	Priority Rep adjusted based on current observations and per review with Building Engineer.
	Thermostats - DDC	Entire Building	131	EA	7	10+ years	
	Thermostats - Pneumatic	Entire Building	5	EA	6	6-10 years	Priority Rep adjusted based on current observations and per review with Building Engineer.
Ventilatio	on						
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	2	EA	7	6-10 years	



Catego	ry : Mechanical	Building : Main-Building A					
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	6	6-10 years	
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	6	6-10 years	
	Exhaust Fans- Indoor - Less than 500 CFM	Entire Building	2	EA	7	6-10 years	Location changed for clarification.
	Exhaust Fans- Indoor - Less than 500 CFM	Entire Building	4	EA	6	6-10 years	
	Exhaust Fans- Roof Mounted - 1501 - 8000 CFM	Entire Building	16	EA	7	6-10 years	
	Exhaust Fans- Roof Mounted - 1501 - 8000 CFM	Entire Building	1	EA	5	6-10 years	Housing is damaged with openings cut into the metal.
	Exhaust Fans- Roof Mounted - 500 - 1500 CFM	Entire Building	13	EA	7	6-10 years	Quantity changed as total has been divided/aggregated.
	Exhaust Fans- Roof Mounted - Greater than 8000 CFM	Entire Building	1	EA	7	10+ years	
	Exhaust Fans- Roof Mounted - Less than 500 CFM	Entire Building	1	EA	7	10+ years	
	Type I Exhaust Hood- Kitchen	Entire Building	10	EA	7	10+ years	Located in the kitchen spaces throughout the building.
	Type II Exhaust Hood- Warming Kitchen	Entire Building	1	EA	7	10+ years	Quantity changed to match current observations.


Category : Plumbing Building : Main-Building A Recommend Item - Type Location Quantity UOM Rank Replacement Comments Group Hot Water Gas Heater - 300001 - 600000 BTU/HR ΕA 6 Penthouse 1 6-10 years Gas Heater - Greater than 600000 BTU/HR 1 ΕA 6 6-10 years Item Type changed to match current Penthouse observations. Quantity changed as total has been divided/aggregated. Hot Water Storage Tank_Gas - 201 - 500 Penthouse 1 FΑ 7 10+ years Quantity changed as total has been Gallons divided/aggregated. Hot Water Storage Tank_Gas - 201 - 500 2 ΕA 7 Penthouse 10+ years Gallons Piping Domestic Piping-Hot Water Return Lines Entire Building 245,084 SF 4 2-5 years Pipes are galvanized material over 50 years old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life. 245,084 SF Pipes are galvanized material over 50 **Domestic Piping-Hot Water Return Risers** Entire Building 2-5 years 4 years old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life. Domestic Piping-Hot Water from Risers to Entire Building 245.084 SF 4 2-5 years Pipes are galvanized material over 50 Fixtures years old. Reason and Priority Rep changed to note that the piping has



Marie Sklodowska Curie Metropolitan High School 4959 S Archer AVENUE, Chicago, IL 60632

Catego	ory : Plumbing		B	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Domestic Piping-Hot/Cold Water Supply (Horizontal Lines)	Entire Building	245,084	SF	4	2-5 years	exceeded its anticipated service life. Pipes are galvanized material over 50 years old. Reason and Priority Rep changed to note that the piping has
	Domestic Piping-Hot/Cold Water Supply (Risers)	Entire Building	245,084	SF	4	2-5 years	exceeded its anticipated service life. Pipes are galvanized material over 50 years old. Reason and Priority Rep changed to note that the piping has
	Domestic Piping-Hot/Cold Water Supply (from Risers to Fixtures)	Entire Building	245,084	SF	4	2-5 years	exceeded its anticipated service life. Pipes are galvanized material over 50 years old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life.
	Sanitary Piping	Entire Building	245,084	SF	5	2-5 years	Rank and Reason adjusted to match Priority Rep.
	Storm Piping	Entire Building	245,084	SF	5	2-5 years	Rank and Reason adjusted to match Priority Rep.
	Vent Piping	Entire Building	245,084	SF	5	2-5 years	Rank and Reason adjusted to match Priority Rep.
Pumps							
rumps	Pumps - Domestic Booster Pump-Simplex	Entire Building	1	EA	4	1-2 years	Priority Rep adjusted as pump is generally operational despite its deteriorated condition.
	Pumps - Domestic Booster Pump-Simplex	Entire Building	1	EA	4	1-2 years	Priority Rep adjusted as pump is generally operational despite its deteriorated condition.
	Pumps - Domestic Booster Pump-Simplex	Entire Building	1	EA	2	0-1 year	Pump is nonfunctional and cannot be repaired.
	Pumps - Ejector-Simplex	Entire Building	1	EA	3	0-1 year	Pump has failed. No CPS Asset Tag present.
	Pumps - Sump-Duplex	Entire Building	1	EA	6	6-10 years	
	Pumps - Sump-Simplex	Entire Building	2	EA	6	6-10 years	Location changed for clarification. Elevator pit sump pump, not accessible at the time of assessment. CPS Asset Tag not available. Condition verified by the Building Engineer with Rank, Reason and Priority Rep adjusted accordingly.
	Pumps - Sump-Simplex	Entire Building	1	EA	6	6-10 years	Location changed for clarification. Elevator pit sump pump, not accessible at the time of assessment. CPS Asset Tag not available.

Condition verified by the Building

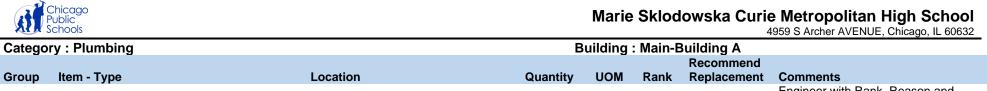

Engineer with Rank, Reason and Priority Rep adjusted accordingly.

Category : Room			Building : Main-Building A					
				Ŭ		Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
Adminis	trative Suites/Offices							
	Ceiling - Lay-in	126 - Guidance Office	114	SF	6	10+ years		
	Doors - Side-lite	126 - Guidance Office	12	SF	7	10+ years		
	Doors - Transom Window	126 - Guidance Office	5	SF	7	10+ years		
	Doors - Wood Doors inclu hw	126 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	126 - Guidance Office	114	SF	6	10+ years		
	Lighting - Pendent/Surface	126 - Guidance Office	4	EA	6	6-10 years		
	Lighting - Pendent/Surface	126 - Guidance Office	1	EA	6	1-2 years	Not working	
	Power Distribution	126 - Guidance Office	4	EA	7	10+ years		
	Walls - Concrete Block	126 - Guidance Office	120	SF	7	10+ years		
	Walls - Metal Panel	126 - Guidance Office	265	SF	6	10+ years		
	Ceiling - Lay-in	127 - Guidance Office	114	SF	7	10+ years		
	Doors - Side-lite	127 - Guidance Office	30	SF	7	10+ years		
	Doors - Transom Window	127 - Guidance Office	20	SF	7	10+ years		
	Doors - Wood Doors inclu hw	127 - Guidance Office	1	EA	7	10+ years		
	Floor - Tile	127 - Guidance Office	114	SF	7	10+ years		
	Lighting - Pendent/Surface	127 - Guidance Office	4	EA	7	6-10 years		
	Power Distribution	127 - Guidance Office	4	EA	7	10+ years		
	Walls - Metal Panel	127 - Guidance Office	360	SF	7	10+ years		
	Ceiling - Lay-in	128 - Guidance Office	114	SF	6	10+ years		
	Doors - Wood Doors inclu hw	128 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	128 - Guidance Office	114	SF	6	10+ years		
	Lighting - Pendent/Surface	128 - Guidance Office	4	EA	7	6-10 years		
	Power Distribution	128 - Guidance Office	4	EA	6	10+ years		
	Walls - Metal Panel	128 - Guidance Office	410	SF	6	10+ years		
	Ceiling - Lay-in	129 - Special Ed Office	114	SF	7	10+ years		
	Doors - Wood Doors inclu hw	129 - Special Ed Office	1	EA	7	10+ years		
	Floor - Tile	129 - Special Ed Office	114	SF	7	10+ years		
	Lighting - Pendent/Surface	129 - Special Ed Office	4	EA	7	6-10 years		
	Power Distribution	129 - Special Ed Office	4	EA	7	10+ years		
	Walls - Metal Panel	129 - Special Ed Office	410	SF	7	10+ years		
	Ceiling - Lay-in	130 - Guidance Office	114	SF	6	10+ years		
	Doors - Side-lite	130 - Guidance Office	30	SF	7	10+ years		
	Doors - Transom Window	130 - Guidance Office	20	SF	7	10+ years		
	Doors - Wood Doors inclu hw	130 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	130 - Guidance Office	114	SF	6	10+ years		
	Lighting - Pendent/Surface	130 - Guidance Office	2	EA	7	6-10 years		
	Lighting - Pendent/Surface	130 - Guidance Office	2	EA	6	1-2 years	Not working	
						2	č	



Catego	ery : Room		В	uilding	: Main-I	Building A	
Ŭ				Ŭ		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
-	Power Distribution	130 - Guidance Office	4	EA	7	10+ years	
	Walls - Metal Panel	130 - Guidance Office	360	SF	6	10+ years	
	Ceiling - Lay-in	131 - Guidance Office	114	SF	6	10+ years	
	Doors - Side-lite	131 - Guidance Office	30	SF	7	10+ years	
	Doors - Transom Window	131 - Guidance Office	20	SF	7	10+ years	
	Doors - Wood Doors inclu hw	131 - Guidance Office	1	EA	6	10+ years	
	Floor - Tile	131 - Guidance Office	114	SF	7	10+ years	
	Lighting - Pendent/Surface	131 - Guidance Office	3	EA	6	6-10 years	
	Lighting - Pendent/Surface	131 - Guidance Office	1	EA	6	1-2 years	Not working
	Power Distribution	131 - Guidance Office	4	EA	6	10+ years	
	Walls - Metal Panel	131 - Guidance Office	360	SF	6	10+ years	
	Ceiling - Lay-in	142B IT Office	817	SF	7	10+ years	
	Doors - Wood Doors inclu hw	142B IT Office	1	EA	6	10+ years	
	Floor - Tile	142B IT Office	817	SF	7	10+ years	
	Lighting - Pendent/Surface	142B IT Office	29	EA	6	6-10 years	
	Lighting - Pendent/Surface	142B IT Office	2	EA	5	1-2 years	Not working
	Power Distribution	142B IT Office	14	EA	7	10+ years	
	Walls - Metal Panel	142B IT Office	776	SF	6	10+ years	
	Walls - Plaster/Drywall	142B IT Office	333	SF	7	10+ years	
	Work SInk	142B IT Office	3	EA	7	6-10 years	
	Ceiling - Lay-in	148B Workroom (previously a	195	SF	6	10+ years	
		darkroom) 149			_		
	Doors - Wood Doors inclu hw	148B Workroom (previously a	1	EA	7	10+ years	
		darkroom) 149		~-	-		
	Floor - Terrazzo	148B Workroom (previously a	195	SF	6	10+ years	
		darkroom) 149	_			o 4 o	
	Lighting - Pendent/Surface	148B Workroom (previously a	5	EA	6	6-10 years	
		darkroom) 149	_		_		
	Power Distribution	148B Workroom (previously a	6	EA	7	10+ years	
		darkroom) 149		0-		4.0	
	Walls - Metal Panel	148B Workroom (previously a	574	SF	6	10+ years	
		darkroom) 149			_		
	Work SInk	148B Workroom (previously a	3	EA	7	6-10 years	
		darkroom) 149		0-	_	4.0	
	Ceiling - Plaster/Drywall	150B	142	SF	7	10+ years	
	Doors - Transom Window	150B	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	150B	1	EA	7	10+ years	
	Floor - Concrete	150B	142	SF	7	10+ years	
	Lighting - Pendent/Surface	150B	2	EA	7	6-10 years	
	Power Distribution	150B	2	EA	7	10+ years	
	Walls - Concrete Block	150B	140	SF	7	10+ years	
	Walls - Metal Panel	150B	320	SF	7	10+ years	
	Ceiling - Lay-in	154 Office	95	SF	6	10+ years	
	Doors - Side-lite	154 Office	17	SF	7	10+ years	



Category : Room **Building : Main-Building A** Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Doors - Wood Doors inclu hw 154 Office ΕA 10+ vears 7 1 95 SF 7 Floor - Tile 154 Office 10+ vears Lighting - Pendent/Surface 154 Office 1 EΑ 7 6-10 years Lighting - Pendent/Surface 154 Office 1 EΑ 6 6-10 years Not working 7 **Power Distribution** 154 Office 4 EΑ 10+ years 30 SF 7 Walls - Concrete Block 154 Office 10+ years Walls - Metal Panel 154 Office 390 SF 10+ years 6 SF Ceiling - Lay-in 154C 80 5 10+ years Doors - Wood Doors inclu hw 154C 1 EΑ 7 10+ years SF Floor - Tile 154C 80 7 10+ vears Lighting - Lav-in 154C 1 ΕA 7 10+ vears Lighting - Lay-in 154C 1 EΑ 6 1-2 years Not working **Power Distribution** 154C ΕA 7 10+ years 4 SF 7 Walls - Metal Panel 154C 120 10+ years 154C SF 7 Walls - Plaster/Drywall 120 10+ years SF 7 Ceiling - Lay-in 156 Space Studio 725 10+ years SF Floor - Tile 156 Space Studio 725 6 10+ years 7 Lighting - Pendent/Surface 156 Space Studio 12 EΑ 6-10 years Lighting - Pendent/Surface 156 Space Studio 1 ΕA 6 1-2 vears Not working Power Distribution 156 Space Studio 8 EΑ 7 10+ years Walls - Concrete Block 156 Space Studio 418 SF 7 10+ years SF 10+ years Walls - Metal Panel 156 Space Studio 355 6 157 ID Office SF 6 Ceiling - Lay-in 185 10+ years Doors - Wood Doors inclu hw 157 ID Office EΑ 6 10+ years 1 Floor - Tile SF 7 157 ID Office 185 10+ years Lighting - Pendent/Surface 157 ID Office 3 ΕA 6 6-10 vears 6 7 Power Distribution 157 ID Office EΑ 10+ years Walls - Metal Panel 157 ID Office 365 SF 7 10+ years SF Ceiling - Lay-in 158 Office 168 6 10+ years Doors - Wood Doors inclu hw 158 Office 1 ΕA 6 10+ years Floor - Tile 158 Office 168 SF 6 10+ vears Lighting - Lav-in 158 Office 2 EΑ 6 6-10 years Power Distribution 7 158 Office 6 FΑ 10+ years Walls - Masonrv 158 Office 180 SF 7 10+ years SF Walls - Metal Panel 158 Office 325 6 10+ years Ceiling - Lay-in SF 7 159A Office/Storage 218 10+ years SF Doors - Side-lite 159A Office/Storage 108 7 10+ years Doors - Wood Doors inclu hw 159A Office/Storage 1 EΑ 7 10+ years Floor - Tile 159A Office/Storage 218 SF 7 10+ years ΕA Lighting - Lav-in 159A Office/Storage 2 7 6-10 vears Power Distribution 159A Office/Storage 8 ΕA 7 10+ years SF 7 Walls - Concrete Block 159A Office/Storage 107 10+ vears Walls - Plaster/Drywall 159A Office/Storage 375 SF 7 10+ years SF Ceiling - Lay-in 165A Work Room 178 6 10+ years



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Doors - Side-lite	165A Work Room	12	SF	7	10+ years	
	Doors - Wood Doors inclu hw	165A Work Room	1	EA	6	10+ years	
	Floor - Tile	165A Work Room	178	SF	6	10+ years	
	Lighting - Lay-in	165A Work Room	3	EA	7	6-10 years	
	Power Distribution	165A Work Room	4	EA	7	10+ years	
	Walls - Concrete Block	165A Work Room	431	SF	7	10+ years	
	Walls - Plaster/Drywall	165A Work Room	132	SF	7	10+ years	
	Ceiling - Lay-in	165B Control Room	188	SF	7	10+ years	
	Doors - Steel Doors incl hw	165B Control Room	1	EA	7	10+ years	
	Floor - Tile	165B Control Room	188	SF	6	10+ years	
	Lighting - Lay-in	165B Control Room	3	EA	7	6-10 years	
	Power Distribution	165B Control Room	4	EA	7	10+ years	
	Walls - Concrete Block	165B Control Room	195	SF	7	10+ years	
	Walls - Plaster/Drywall	165B Control Room	368	SF	7	10+ years	
	Ceiling - Lay-in	167A - Office	166	SF	7	10+ years	
	Ceiling - Lay-in	167A - Office	24	SF	4	1-2 years	Missing
	Doors - Steel Doors incl hw	167A - Office	1	EA	7	10+ years	
	Floor - Carpet	167A - Office	190	SF	4	1-2 years	In poor condition
	Lighting - Lay-in	167A - Office	5	EA	6	6-10 years	
	Power Distribution	167A - Office	4	EA	7	10+ years	
	Walls - Concrete Block	167A - Office	5	SF	6	1-2 years	Cracks in wall
	Walls - Concrete Block	167A - Office	385	SF	6	10+ years	
	Walls - Metal Panel	167A - Office	188	SF	6	10+ years	
	Ceiling - Lay-in	168A Office/Storage	204	SF	6	10+ years	
	Ceiling - Lay-in	168A Office/Storage	3	SF	4	1-2 years	Not in grid
	Doors - Wood Doors inclu hw	168A Office/Storage	1	EA	7	10+ years	Not in grid
	Floor - Carpet	168A Office/Storage	207	SF	6	10+ years	
	Lighting - Lay-in	168A Office/Storage	5	EA	7	6-10 years	
	Lighting - Lay-in	168A Office/Storage	1	EA	5	1-2 years	Not working
	Power Distribution	168A Office/Storage	4	EA	7	10+ years	Not working
	Walls - Concrete Block	168A Office/Storage	273	SF	7	10+ years	
	Walls - Concrete Block	168A Office/Storage	30	SF	6	1-2 years	Cracks in block wall
	Walls - Metal Panel	168A Office/Storage	103	SF	7	10+ years	
	Walls - Plaster/Drywall	168A Office/Storage	200	SF	6	10+ years	
		169 - Dean's Office open area	200 594	SF	7	•	
	Ceiling - Lay-in Doors - Side-lite	169 - Dean's Office open area	12	SF	7	10+ years	
	Doors - Transom Window	169 - Dean's Office open area	12	SF	7	10+ years	
				EA	-	10+ years	
	Doors - Wood Doors inclu hw Floor - Tile	169 - Dean's Office open area	1 594	EA SF	7	10+ years	
		169 - Dean's Office open area			6	10+ years	
	Lighting - Lay-in	169 - Dean's Office open area	18	EA	7	6-10 years	
	Power Distribution	169 - Dean's Office open area	10	EA	7	10+ years	
	Walls - Concrete Block	169 - Dean's Office open area	190	SF	7	10+ years	
	Walls - Metal Panel	169 - Dean's Office open area	220	SF	6	10+ years	
	Walls - Plaster/Drywall	169 - Dean's Office open area	304	SF	6	10+ years	



Catego	ry : Room		B	uilding	: Main-B	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Lay-in	169B Camera Viewing Rm	145	SF	6	10+ years	
	Doors - Wood Doors inclu hw	169B Camera Viewing Rm	2	EA	7	10+ years	
	Floor - Tile	169B Camera Viewing Rm	145	SF	6	10+ years	
	Lighting - Lay-in	169B Camera Viewing Rm	2	EA	6	6-10 years	
	Power Distribution	169B Camera Viewing Rm	4	EA	6	10+ years	
	Walls - Concrete Block	169B Camera Viewing Rm	97	SF	6	10+ years	
	Walls - Metal Panel	169B Camera Viewing Rm	337	SF	6	10+ years	
	Ceiling - Lay-in	169B Police Office	146	SF	6	10+ years	
	Doors - Steel Doors incl hw	169B Police Office	1	EA	6	10+ years	
	Floor - Tile	169B Police Office	146	SF	6	10+ years	
	Lighting - Pendent/Surface	169B Police Office	3	EA	7	6-10 years	
	Power Distribution	169B Police Office	2	EA	6	10+ years	
	Walls - Concrete Block	169B Police Office	128	SF	7	10+ years	
	Walls - Metal Panel	169B Police Office	428	SF	6	10+ years	
	Ceiling - Plaster/Drywall	169C Copy/File Rm.	200	SF	6	10+ years	
	Doors - Wood Doors inclu hw	169C Copy/File Rm.	2	EA	7	10+ years	
	Floor - Tile	169C Copy/File Rm.	200	SF	6	10+ years	
	Lighting - Pendent/Surface	169C Copy/File Rm.	7	EA	7	10+ years	
	Power Distribution	169C Copy/File Rm.	4	EA	7	10+ years	
	Walls - Concrete Block	169C Copy/File Rm.	24	SF	7	10+ years	
	Walls - Metal Panel	169C Copy/File Rm.	298	SF	6	10+ years	
	Walls - Plaster/Drywall	169C Copy/File Rm.	244	SF	6	10+ years	
	Ceiling - Lay-in	169D Office	191	SF	6	10+ years	
	Doors - Wood Doors inclu hw	169D Office	1	EA	7	10+ years	
	Floor - Tile	169D Office	191	SF	6	10+ years	
	Lighting - Lay-in	169D Office	4	EA	7	6-10 years	
	Power Distribution	169D Office	4	EA	7	10+ years	
	Walls - Concrete Block	169D Office	50	SF	7	10+ years	
	Walls - Metal Panel	169D Office	150	SF	6	10+ years	
	Walls - Plaster/Drywall	169D Office	232	SF	7	10+ years	
	Ceiling - Lay-in	169E Conference Rm	155	SF	6	10+ years	
	Doors - Wood Doors inclu hw	169E Conference Rm	1	EA	7	10+ years	
	Floor - Tile	169E Conference Rm	155	SF	6	10+ years	
	Lighting - Lay-in	169E Conference Rm	3	EA	7	6-10 years	
	Power Distribution	169E Conference Rm	4	EA	7	10+ years	
	Walls - Concrete Block	169E Conference Rm	164	SF	6	10+ years	
	Walls - Plaster/Drywall	169E Conference Rm	203	SF	7	10+ years	
	Ceiling - Lay-in	170 Nurse's Office	316	SF	6	10+ years	
	Doors - Wood Doors inclu hw	170 Nurse's Office	1	EA	7	10+ years	
	Floor - Tile	170 Nurse's Office	316	SF	6	10+ years	
	Lighting - Lay-in	170 Nurse's Office	5	EA	7	10+ years	
	Power Distribution	170 Nurse's Office	4	EA	7	10+ years	
	Walls - Concrete Block	170 Nurse's Office	338	SF	7	10+ years	
	Walls - Metal Panel	170 Nurse's Office	298	SF	6	10+ years	



Category : Room **Building : Main-Building A** Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Walls - Plaster/Drvwall 170 Nurse's Office 145 SF 6 10+ vears Ceiling - Lav-in SF 6 170A 95 10+ years Doors - Side-lite 170A 12 SF 7 10+ years Doors - Transom Window 5 SF 7 170A 10+ years 2 Doors - Wood Doors inclu hw 170A EΑ 6 10+ years 95 SF Floor - Tile 170A 4 1-2 years Stained flooring Lighting - Lay-in 170A 2 ΕA 7 6-10 years Power Distribution 170A 4 ΕA 7 10+ years Walls - Concrete Block 170A 77 SF 7 10+ vears SF Walls - Metal Panel 170A 256 6 10+ years SF Ceiling - Lav-in 170B 146 6 10+ vears Doors - Side-lite 170B 50 SF 7 10+ years Doors - Steel Doors incl hw 170B ΕA 7 10+ years 1 Floor - Tile SF 170B 146 6 10+ years Lighting - Lay-in 170B ΕA 7 3 6-10 years Power Distribution 170B 8 ΕA 7 10+ years SF Walls - Metal Panel 170B 424 6 10+ years Ceiling - Lav-in SF 170C Office 198 6 10+ years Doors - Steel Doors incl hw 170C Office ΕA 7 10+ vears 1 Floor - Carpet 170C Office 198 SF 6 6-10 years Lighting - Lay-in 170C Office 4 ΕA 7 6-10 years Power Distribution 7 170C Office 16 ΕA 10+ years Walls - Concrete Block SF 7 170C Office 50 10+ years SF Walls - Metal Panel 170C Office 475 6 10+ years Ceiling - Lay-in 147 SF 6 170D Exam Room 10+ years Doors - Steel Doors incl hw 170D Exam Room 1 ΕA 6 10+ vears SF Floor - Tile 170D Exam Room 147 6 10+ years Lighting - Lay-in 170D Exam Room ΕA 6 6-10 years 3 **Power Distribution** 7 170D Exam Room 4 EΑ 10+ years Walls - Concrete Block 170D Exam Room 222 SF 7 10+ years SF Walls - Metal Panel 170D Exam Room 277 6 10+ vears SF Ceiling - Lav-in 171 Main Office 2.424 6 10+ vears Doors - Side-lite SF 7 171 Main Office 100 10+ years Doors - Steel Doors incl hw 171 Main Office EΑ 7 10+ years 4 7 Doors - Steel Doors incl hw 171 Main Office 1 EΑ 10+ years Doors - Transom Window 5 SF 7 171 Main Office 10+ years SF Floor - Carpet 171 Main Office 2,109 7 6-10 years Floor - Tile SF 171 Main Office 315 6 10+ years Lighting - Lay-in 171 Main Office 30 EΑ 6 6-10 years Power Distribution 7 171 Main Office 28 ΕA 10+ vears Storage/ Closet 171 Main Office 903 SF 5 10+ years SF 7 Walls - Concrete Block 171 Main Office 450 10+ vears Walls - Metal Panel 171 Main Office 726 SF 6 10+ years SF Walls - Plaster/Drywall 171 Main Office 50 7 10+ years



Catego	ry : Room		В	uilding	: Main-E	Building A	
	•					Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Lay-in	171A Conference Room	219	SF	6	10+ years	
	Doors - Side-lite	171A Conference Room	24	SF	7	10+ years	
	Doors - Steel Doors incl hw	171A Conference Room	1	EA	7	10+ years	
	Doors - Transom Window	171A Conference Room	20	SF	7	10+ years	
	Floor - Carpet	171A Conference Room	219	SF	6	6-10 years	
	Lighting - Pendent/Surface	171A Conference Room	7	EA	7	6-10 years	
	Lighting - Pendent/Surface	171A Conference Room	1	EA	6	1-2 years	Not working
	Walls - Concrete Block	171A Conference Room	100	SF	7	10+ years	
	Walls - Metal Panel	171A Conference Room	223	SF	7	10+ years	
	Walls - Plaster/Drywall	171A Conference Room	124	SF	6	10+ years	
	Work SInk	171A Conference Room	1	EA	7	10+ years	
	Ceiling - Plaster/Drywall	174 Storage	355	SF	6	10+ years	
	Doors - Side-lite	174 Storage	25	SF	7	10+ years	
	Doors - Transom Window	174 Storage	10	SF	7	10+ years	
	Doors - Wood Doors inclu hw	174 Storage	1	EA	7	10+ years	
	Floor - Concrete	174 Storage	355	SF	5	10+ years	
	Lighting - Pendent/Surface	174 Storage	8	EA	7	6-10 years	
	Power Distribution	174 Storage	6	EA	7	10+ years	
	Walls - Concrete Block	174 Storage	50	SF	6	10+ years	
	Walls - Metal Panel	174 Storage	450	SF	7	10+ years	
	Walls - Plaster/Drywall	174 Storage	124	SF	6	10+ years	
	Ceiling - Lay-in	176 Office	178	SF	6	10+ years	
	Doors - Side-lite	176 Office	17	SF	7	10+ years	
	Doors - Steel Doors incl hw	176 Office	1	EA	7	10+ years	
	Floor - Carpet	176 Office	178	SF	6	6-10 years	
	Lighting - Lay-in	176 Office	4	EA	6	6-10 years	
	Power Distribution	176 Office	8	EA	7	10+ years	
	Walls - Concrete Block	176 Office	278	SF	7	10+ years	
	Walls - Metal Panel	176 Office	124	SF	7	10+ years	
	Ceiling - Lay-in	177 Office	145	SF	6	10+ years	
	Doors - Side-lite	177 Office	35	SF	7	10+ years	
	Doors - Steel Doors incl hw	177 Office	1	EA	7	10+ years	
	Doors - Transom Window	177 Office	25	SF	7	10+ years	
	Floor - Carpet	177 Office	145	SF	6	6-10 years	
	Lighting - Lay-in	177 Office	3	EA	6	6-10 years	
	Power Distribution	177 Office	6	EA	7	10+ years	
	Walls - Concrete Block	177 Office	40	SF	7	10+ years	
	Walls - Metal Panel	177 Office	313	SF	6	10+ years	
	Ceiling - Lay-in	178 Principal Reception Area	390	SF	6	10+ years	
	Doors - Side-lite	178 Principal Reception Area	15	SF	7	10+ years	
	Doors - Steel Doors incl hw	178 Principal Reception Area	1	EA	7	10+ years	
	Floor - Carpet	178 Principal Reception Area	390	SF	6	6-10 years	
	Lighting - Lay-in	178 Principal Reception Area	8	EA	7	6-10 years	
	Power Distribution	178 Principal Reception Area	4	EA	7	10+ years	



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Concrete Block	178 Principal Reception Area	80	SF	7	10+ years	
	Walls - Metal Panel	178 Principal Reception Area	588	SF	6	10+ years	
	Walls - Plaster/Drywall	178 Principal Reception Area	90	SF	7	10+ years	
	Ceiling - Lay-in	180 Principal's Office	277	SF	6	10+ years	
	Doors - Side-lite	180 Principal's Office	24	SF	7	10+ years	
	Doors - Steel Doors incl hw	180 Principal's Office	2	EA	7	10+ years	
	Doors - Transom Window	180 Principal's Office	10	SF	7	10+ years	
	Doors - Wood Doors inclu hw	180 Principal's Office	1	EA	7	10+ years	
	Floor - Tile	180 Principal's Office	277	SF	6	10+ years	
	Lighting - Lay-in	180 Principal's Office	6	EA	6	6-10 years	
	Power Distribution	180 Principal's Office	8	EA	7	10+ years	
	Walls - Concrete Block	180 Principal's Office	70	SF	7	10+ years	
	Walls - Metal Panel	180 Principal's Office	404	SF	7	10+ years	
	Ceiling - Lay-in	182 Conference Room	257	SF	6	10+ years	
	Doors - Side-lite	182 Conference Room	12	SF	7	10+ years	
	Doors - Steel Doors incl hw	182 Conference Room	2	EA	7	10+ years	
	Doors - Transom Window	182 Conference Room	5	SF	7	10+ years	
	Floor - Tile	182 Conference Room	257	SF	6	10+ years	
	Lighting - Lay-in	182 Conference Room	5	EA	7	6-10 years	
	Power Distribution	182 Conference Room	8	EA	7	10+ years	
	Walls - Concrete Block	182 Conference Room	128	SF	7	10+ years	
	Walls - Metal Panel	182 Conference Room	413	SF	7	10+ years	
	Ceiling - Lay-in	183 Office	140	SF	6	10+ years	
	Doors - Side-lite	183 Office	12	SF	7	10+ years	
	Doors - Steel Doors incl hw	183 Office	1	EA	7	10+ years	
	Doors - Transom Window	183 Office	5	SF	7	10+ years	
	Doors - Wood Doors inclu hw	183 Office	1	EA	7	10+ years	
	Floor - Carpet	183 Office	140	SF	6	6-10 years	
	Lighting - Lay-in	183 Office	5	EA	6	6-10 years	
	Power Distribution	183 Office	4	EA	7	10+ years	
	Walls - Concrete Block	183 Office	80	SF	7	10+ years	
	Walls - Metal Panel	183 Office	352	SF	6	10+ years	
	Ceiling - Lay-in	184 Office	331	SF	6	10+ years	
	Doors - Side-lite	184 Office	12	SF	7	10+ years	
	Doors - Steel Doors incl hw	184 Office	1	ĒA	7	10+ years	
	Doors - Transom Window	184 Office	5	SF	7	10+ years	
	Doors - Wood Doors inclu hw	184 Office	1	ĒA	7	10+ years	
	Floor - Carpet	184 Office	331	SF	6	6-10 years	
	Lighting - Lay-in	184 Office	10	ĒA	7	6-10 years	
	Power Distribution	184 Office	6	EA	7	10+ years	
	Walls - Concrete Block	184 Office	360	SF	6	10+ years	
	Walls - Metal Panel	184 Office	343	SF	6	10+ years	
	Ceiling - Lay-in	185 Assistant Principals Office	192	SF	6	10+ years	
	Doors - Side-lite	185 Assistant Principals Office	12	SF	7	10+ years	
		100 Abbiotant 1 Anopaio Onice	12	01	'	ior yours	



Category : Room **Building : Main-Building A** Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Doors - Steel Doors incl hw 185 Assistant Principals Office EΑ 10+ vears 7 1 Doors - Transom Window 185 Assistant Principals Office 5 SF 7 10+ years Doors - Wood Doors inclu hw 185 Assistant Principals Office 1 FΑ 7 10+ years Floor - Carpet 185 Assistant Principals Office SF 192 6 6-10 years 7 Lighting - Lay-in 185 Assistant Principals Office 6 EΑ 6-10 years Lighting - Lay-in 185 Assistant Principals Office 1 EΑ 6 1-2 years Not working **Power Distribution** 185 Assistant Principals Office 6 ΕA 7 10+ years 79 SF Walls - Concrete Block 185 Assistant Principals Office 7 10+ years SF Walls - Metal Panel 185 Assistant Principals Office 452 6 10+ years SF Ceiling - Lay-in 186 Mail Room 146 6 10+ vears 186 Mail Room SF Doors - Side-lite 12 7 10+ vears Doors - Transom Window 186 Mail Room 5 SF 7 10+ years Doors - Wood Doors inclu hw 1 ΕA 6 10+ years 186 Mail Room SF 6 Floor - Tile 186 Mail Room 146 10+ years Lighting - Lay-in ΕA 7 186 Mail Room 3 6-10 years Power Distribution 2 FΑ 7 186 Mail Room 10+ years SF 7 Walls - Concrete Block 186 Mail Room 60 10+ years SF Walls - Metal Panel 186 Mail Room 308 6 10+ years SF Ceiling - Lay-in 187 Attendance Office 665 6 10+ vears Doors - Side-lite SF 187 Attendance Office 24 7 10+ years Doors - Steel Doors incl hw 187 Attendance Office 1 ΕA 7 10+ years Doors - Transom Window 187 Attendance Office SF 7 60 10+ years 2 ΕA Doors - Wood Doors inclu hw 187 Attendance Office 6 10+ years SF Floor - Tile 187 Attendance Office 665 6 10+ years Lighting - Lay-in ΕA 7 6-10 years 187 Attendance Office 12 Power Distribution 187 Attendance Office 6 ΕA 7 10+ vears 54 SF Storage/ Closet 187 Attendance Office 7 10+ years Walls - Concrete Block 187 Attendance Office 304 SF 7 10+ years SF Walls - Metal Panel 187 Attendance Office 719 6 10+ years Ceiling - Lay-in 190 Office 97 SF 6 10+ years Doors - Side-lite SF 190 Office 12 7 10+ vears Doors - Transom Window SF 190 Office 5 7 10+ vears 10+ years Doors - Wood Doors inclu hw 190 Office 1 FΑ 6 Floor - Tile 190 Office 97 SF 6 10+ vears 2 Lighting - Lay-in 190 Office EΑ 6 6-10 years ΕA 7 Power Distribution 190 Office 4 10+ years SF Walls - Concrete Block 190 Office 40 7 10+ years 190 Office SF Walls - Metal Panel 258 6 10+ years SF Ceiling - Lay-in 191 Office 144 6 10+ years Doors - Side-lite SF 7 191 Office 12 10+ vears Doors - Steel Doors incl hw 191 Office 1 ΕA 6 10+ years Doors - Transom Window 5 SF 7 191 Office 10+ vears Floor - Tile 191 Office 144 SF 6 10+ years ΕA Lighting - Lay-in 191 Office 3 6 6-10 years



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Power Distribution 191 Office 4 EΑ 10+ vears 7 160 SF 7 Walls - Concrete Block 191 Office 10+ years Walls - Metal Panel 191 Office 208 SF 6 10+ years SF 6 Ceiling - Lay-in 192 - Meeting Room 1.100 10+ years SF 5 Ceiling - Lay-in 192 - Meeting Room 4 1-2 years Tile out of place SF 192 - Meeting Room 7 Doors - Side-lite 24 10+ years Doors - Transom Window 192 - Meeting Room 30 SF 7 10+ years Doors - Wood Doors inclu hw 192 - Meeting Room 3 ΕA 6 10+ years Floor - Tile 192 - Meeting Room 1.104 SF 6 10+ years Lighting - Lay-in 192 - Meeting Room ΕA 7 6-10 years 21 Power Distribution 192 - Meeting Room 6 ΕA 7 10+ vears Storage/ Closet 192 - Meeting Room 53 SF 5 10+ years Walls - Concrete Block 192 - Meeting Room 160 SF 7 10+ years SF Walls - Metal Panel 192 - Meeting Room 636 6 10+ years 193 - Local School Council Office SF 6 Ceiling - Lay-in 122 10+ years Doors - Side-lite 193 - Local School Council Office SF 7 12 10+ years 5 SF 7 Doors - Transom Window 193 - Local School Council Office 10+ vears Doors - Wood Doors inclu hw 193 - Local School Council Office 1 EΑ 7 10+ years SF Floor - Carpet 193 - Local School Council Office 122 6 6-10 years Lighting - Lay-in 193 - Local School Council Office 2 EΑ 6 6-10 years Power Distribution 193 - Local School Council Office 6 ΕA 7 10+ years SF 7 Walls - Concrete Block 193 - Local School Council Office 40 10+ years SF Walls - Metal Panel 193 - Local School Council Office 308 6 10+ years SF Ceiling - Lay-in 195 Special Ed Office 120 6 10+ years Doors - Side-lite 195 Special Ed Office 37 SF 7 10+ years SF Doors - Transom Window 195 Special Ed Office 15 7 10+ vears Doors - Wood Doors inclu hw 195 Special Ed Office EA 6 10+ years 1 Floor - Tile 195 Special Ed Office 120 SF 6 10+ years Lighting - Pendent/Surface ΕA 7 195 Special Ed Office 2 6-10 years **Power Distribution** 195 Special Ed Office 2 ΕA 6 10+ years Walls - Concrete Block 195 Special Ed Office 30 SF 7 10+ vears SF Walls - Metal Panel 195 Special Ed Office 318 6 10+ vears FΑ 7 Work SInk 195 Special Ed Office 6-10 years 1 Ceiling - Lay-in 196 Conference Room 288 SF 6 10+ years SF Ceiling - Lay-in 196 Conference Room 8 4 1-2 years Minor displacement Doors - Wood Doors inclu hw ΕA 6 196 Conference Room 1 10+ years SF Floor - Tile 196 Conference Room 296 6 10+ years Lighting - Pendent/Surface 7 6-10 years 196 Conference Room 6 EA Power Distribution 196 Conference Room 6 EΑ 7 10+ years SF Walls - Concrete Block 196 Conference Room 60 7 10+ vears SF Walls - Metal Panel 196 Conference Room 353 6 10+ years SF 6 Ceiling - Lay-in 197 - Yearbook Office 190 10+ vears Doors - Side-lite 197 - Yearbook Office 75 SF 7 10+ years Doors - Transom Window SF 7 197 - Yearbook Office 45 10+ years



Catego	ry : Room		В	uilding	: Main-I	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Doors - Wood Doors inclu hw	197 - Yearbook Office	2	EA	7	10+ years	
	Floor - Tile	197 - Yearbook Office	190	SF	6	10+ years	
	Lighting - Pendent/Surface	197 - Yearbook Office	2	EA	6	6-10 years	
	Power Distribution	197 - Yearbook Office	10	EA	7	10+ years	
	Walls - Masonry	197 - Yearbook Office	40	SF	7	10+ years	
	Walls - Metal Panel	197 - Yearbook Office	78	SF	6	10+ years	
	Walls - Plaster/Drywall	197 - Yearbook Office	253	SF	6	10+ years	
	Ceiling - Plaster/Drywall	1st Floor School Store	264	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor School Store	2	EA SF	7	10+ years	
	Floor - Tile	1st Floor School Store	264		6	10+ years	
	Lighting - Pendent/Surface Power Distribution	1st Floor School Store 1st Floor School Store	6 8	EA EA	7 7	6-10 years 10+ years	
	Walls - Masonry	1st Floor School Store	100	SF	7	10+ years	
	Walls - Metal Panel	1st Floor School Store	460	SF	7	10+ years	
		1st flr Faculty Serving Area (158 on	460 360	SF	6	10+ years	
	Ceiling - Lay-in		300	SF	0	10+ years	
	Doors - Wood Doors inclu hw	plan) 1st flr Faculty Serving Area (158 on	3	EA	6	10+ years	
	Doors - wood Doors Inclu flw	plan)	5	EA	0	10+ years	
	Floor - Tile	1st flr Faculty Serving Area (158 on	356	SF	7	10+ years	
		plan)	550	51	1	IUT years	
	Floor - Tile	1st flr Faculty Serving Area (158 on	4	SF	4	1-2 years	Damaged tile
		plan)	•	01		1 2 youro	Damagoa liio
	Lighting - Pendent/Surface	1st flr Faculty Serving Area (158 on	9	EA	6	6-10 years	
		plan)	Ũ	-/ (U	o ro youro	
	Walls - Masonry	1st flr Faculty Serving Area (158 on	100	SF	7	10+ years	
	, see the second s	plan)		-		,	
	Walls - Metal Panel	1st flr Faculty Serving Area (158 on	260	SF	6	10+ years	
		plan)				,	
	Ceiling - Plaster/Drywall	1st flr Senior Office (east side of	120	SF	7	10+ years	
	·	elevator 'A')				•	
	Doors - Wood Doors inclu hw	1st flr Senior Office (east side of	1	EA	6	10+ years	
		elevator 'A')					
	Floor - Tile	1st flr Senior Office (east side of	120	SF	7	10+ years	
		elevator 'A')					
	Lighting - Pendent/Surface	1st flr Senior Office (east side of	1	EA	7	6-10 years	
		elevator 'A')					
	Power Distribution	1st flr Senior Office (east side of	4	EA	6	10+ years	
		elevator 'A')		~-	_		
	Walls - Concrete Block	1st flr Senior Office (east side of	212	SF	7	10+ years	
		elevator 'A')		0-			
	Walls - Concrete Block	1st flr Senior Office (east side of	20	SF	6	1-2 years	Cracking wall
		elevator 'A')	40	05	-	40.	
	Walls - Metal Panel	1st flr Senior Office (east side of	40	SF	7	10+ years	
		elevator 'A')					



Catego	ry : Room		Bi	uildina	: Main-F	Building A	1959 S Archer AVENUE, Chicago, IL 60632	
culoge	.,	Recommend						
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Walls - Plaster/Drywall	1st flr Senior Office (east side of	138	SF	7	10+ years		
		elevator 'A')						
	Ceiling - Lay-in	226 - Guidance Office	115	SF	6	10+ years		
	Doors - Transom Window	226 - Guidance Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	226 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	226 - Guidance Office	115	SF	6	10+ years		
	Lighting - Lay-in	226 - Guidance Office	4	EA	7	6-10 years		
	Power Distribution	226 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	226 - Guidance Office	350	SF	6	10+ years		
	Ceiling - Lay-in	227 - Guidance Office	115	SF	6	10+ years		
	Doors - Transom Window	227 - Guidance Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	227 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	227 - Guidance Office	115	SF	6	10+ years		
	Lighting - Lay-in	227 - Guidance Office	4	EA	7	6-10 years		
	Power Distribution	227 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	227 - Guidance Office	350	SF	7	10+ years		
	Ceiling - Lay-in	228 - Guidance Office	115	SF	6	10+ years		
	Doors - Wood Doors inclu hw	228 - Guidance Office	1	EA	7	10+ years		
	Floor - Tile	228 - Guidance Office	115	SF	6	10+ years		
	Lighting - Lay-in	228 - Guidance Office	4	EA	6	6-10 years		
	Power Distribution	228 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	228 - Guidance Office	350	SF	7	10+ years		
	Ceiling - Lay-in	229 - Guidance Office	115	SF	6	10+ years		
	Doors - Transom Window	229 - Guidance Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	229 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	229 - Guidance Office	115	SF	7	10+ years		
	Lighting - Lay-in	229 - Guidance Office	4	EA	6	6-10 years		
	Power Distribution	229 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	229 - Guidance Office	350	SF	6	10+ years		
	Ceiling - Lay-in	230 - IMBYB Office	115	SF	6	10+ years		
	Doors - Transom Window	230 - IMBYB Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	230 - IMBYB Office	1	EA	6	10+ years		
	Floor - Tile	230 - IMBYB Office	115	SF	6	10+ years		
	Lighting - Lay-in	230 - IMBYB Office	4	EA	6	6-10 years		
	Power Distribution	230 - IMBYB Office	2	EA	7	10+ years		
	Walls - Metal Panel	230 - IMBYB Office	350	SF	6	10+ years		
	Ceiling - Lay-in	231 - Guidance Office	115	SF	6	10+ years		
	Doors - Transom Window	231 - Guidance Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	231 - Guidance Office	1	EA	6	10+ years		
	Floor - Tile	231 - Guidance Office	115	SF	7	10+ years		
	Lighting - Lay-in	231 - Guidance Office	3	EA	6	6-10 years		
	Power Distribution	231 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	231 - Guidance Office	350	SF	6	10+ years		
	Ceiling - Lay-in	235B Library work room	142	SF	6	10+ years		



Catego	ry : Room		В	uilding	: Main-E	Building A	4959 S AICHELAVENCE, CHICAGO, IL 60632
				J		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Lay-in	235B Library work room	8	SF	4	0-1 year	Damaged
	Doors - Side-lite	235B Library work room	11	SF	6	10+ years	-
	Doors - Steel Doors incl hw	235B Library work room	1	EA	6	10+ years	
	Doors - Transom Window	235B Library work room	13	SF	6	10+ years	
	Floor - Tile	235B Library work room	150	SF	7	10+ years	
	Lighting - Lay-in	235B Library work room	3	EA	7	6-10 years	
	Power Distribution	235B Library work room	6	EA	7	10+ years	
	Walls - Metal Panel	235B Library work room	750	SF	6	10+ years	
	Ceiling - Lay-in	235C Media Viewing	550	SF	6	10+ years	
	Doors - Steel Doors incl hw	235C Media Viewing	1	EA	6	10+ years	
	Doors - Transom Window	235C Media Viewing	9	SF	6	10+ years	
	Floor - Tile	235C Media Viewing	550	SF	7	10+ years	
	Lighting - Lay-in	235C Media Viewing	11	EA	6	6-10 years	
	Power Distribution	235C Media Viewing	18	EA	7	10+ years	
	Walls - Concrete Block	235C Media Viewing	250	SF	6	10+ years	
	Walls - Metal Panel	235C Media Viewing	720	SF	6	10+ years	
	Ceiling - Lay-in	235D Computer Room in Library	625	SF	6	10+ years	
	Doors - Steel Doors incl hw	235D Computer Room in Library	1	EA	6	10+ years	
	Floor - Tile	235D Computer Room in Library	625	SF	7	10+ years	
	Lighting - Lay-in	235D Computer Room in Library	13	EA	6	6-10 years	
	Power Distribution	235D Computer Room in Library	64	EA	7	10+ years	
	Walls - Concrete Block	235D Computer Room in Library	300	SF	7	10+ years	
	Walls - Metal Panel	235D Computer Room in Library	720	SF	6	10+ years	
	Ceiling - Plaster/Drywall	236A-Library	2,596	SF	6	10+ years	
	Doors - Steel Doors incl hw	236A-Library	2	EA	7	10+ years	
	Doors - Transom Window	236A-Library	15	SF	6	10+ years	
	Doors - Wood Doors inclu hw	236A-Library	1	EA	6	10+ years	
	Floor - Tile	236A-Library	2,596	SF	7	10+ years	
	Lighting - Pendent/Surface	236A-Library	20	EA	6	6-10 years	
	Power Distribution	236A-Library	8	EA SF	6	10+ years	
	Walls - Concrete Block	236A-Library 236A-Library	930 1,300	SF	6 6	10+ years	
	Walls - Metal Panel Work SInk	236A-Library	1,300	EA	6 7	10+ years	
	Ceiling - Lay-in	236B Resource Area	225	SF	6	10+ years 10+ years	
	Doors - Steel Doors incl hw	236B Resource Area	225	EA	6	10+ years	
	Doors - Transom Window	236B Resource Area	18	SF	6	10+ years	
	Floor - Tile	236B Resource Area	225	SF	7	10+ years	
	Lighting - Lay-in	236B Resource Area	4	EA	6	6-10 years	
	Power Distribution	236B Resource Area	12	EA	7	10+ years	
	Walls - Metal Panel	236B Resource Area	847	SF	6	10+ years	
	Ceiling - Lay-in	236C	126	SF	6	10+ years	
	Doors - Steel Doors incl hw	236C 236C	2	EA	6	10+ years	
	Doors - Transom Window	236C 236C	6	SF	6	10+ years	
	Floor - Tile	236C	126	SF	7	10+ years	
		2000	120	0	'	ior years	



Category : Room **Building : Main-Building A** Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Lighting - Lay-in 236C 3 ΕA 6-10 years 7 Power Distribution 236C 6 ΕA 6 10+ vears Walls - Metal Panel 236C 400 SF 7 10+ years 236E SF Ceiling - Lay-in 266 6 10+ years SF Doors - Side-lite 236E 10 6 10+ years Doors - Steel Doors incl hw 236E EΑ 6 10+ years 1 Doors - Transom Window 236E 6 SF 6 10+ years SF 10+ years Floor - Tile 236E 266 7 Lighting - Lay-in 236E 6 EΑ 7 6-10 years Power Distribution 236E 8 EΑ 6 10+ years Walls - Metal Panel 236E 579 SF 6 10+ vears Ceiling - Lay-in 236F 171 SF 6 10+ years Doors - Side-lite 236F SF 6 10 10+ years 6 Doors - Steel Doors incl hw 236F 1 EA 10+ years Floor - Tile 236F SF 7 171 10+ years 236F EΑ 7 Lighting - Lay-in 4 6-10 years Power Distribution 236F 12 EΑ 6 10+ years Walls - Metal Panel 236F 515 SF 6 10+ years SF Ceiling - Lay-in 238 Office 172 6 10+ vears SF Ceiling - Lay-in 238 Office 8 4 0-1 year Water damage Doors - Side-lite 238 Office 10 SF 6 10+ years Doors - Steel Doors incl hw 238 Office 7 1 EΑ 10+ years 6 SF Doors - Transom Window 238 Office 6 10+ years SF Floor - Tile 238 Office 180 6 10+ years Lighting - Lay-in 238 Office ΕA 7 6-10 years 4 8 Power Distribution 238 Office ΕA 7 10+ vears SF Walls - Metal Panel 238 Office 380 6 10+ years Ceiling - Lay-in 239 / 242 open office 6,600 SF 6 10+ years SF 7 Doors - Side-lite 239 / 242 open office 15 10+ years Doors - Transom Window 239 / 242 open office 18 SF 6 10+ years Doors - Wood Doors inclu hw 239 / 242 open office 2 EΑ 7 10+ vears Floor - Tile 239 / 242 open office 6.580 SF 6 10+ vears SF Floor - Tile 239 / 242 open office 20 1-2 vears 4 Chipped Lighting - Lay-in 239 / 242 open office 132 EΑ 6 6-10 years Power Distribution 7 239 / 242 open office 60 EΑ 10+ years Storage/ Closet SF 5 239 / 242 open office 42 10+ years SF Walls - Metal Panel 239 / 242 open office 5,200 6 10+ years Ceiling - Plaster/Drywall 239A SF 6 276 10+ years SF Ceiling - Plaster/Drywall 239A 4 5 1-2 years Missing Doors - Transom Window 239A 6 SF 6 10+ vears Doors - Wood Doors inclu hw 239A 1 ΕA 7 10+ years 280 SF Floor - Concrete 239A 5 10+ vears Lighting - Pendent/Surface 239A EΑ 7 6-10 years 4 Power Distribution 239A 4 EA 6 10+ years



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Walls - Metal Panel 239A 650 SF 10+ vears 6 239B SE Corner SF 6 Ceiling - Lav-in 90 10+ years Doors - Side-lite 239B SE Corner 11 SF 7 10+ years Doors - Steel Doors incl hw ΕA 7 239B SE Corner 1 10+ years SF Floor - Tile 239B SE Corner 90 6 10+ years Lighting - Lay-in 239B SE Corner 4 EΑ 6 6-10 years **Power Distribution** 239B SE Corner 4 ΕA 7 10+ years SF Walls - Concrete Block 239B SE Corner 90 6 10+ years SF Walls - Metal Panel 239B SE Corner 205 6 10+ years Ceiling - Lav-in SF 240 710 6 10+ years Doors - Steel Doors incl hw 240 1 ΕA 7 10+ vears Doors - Transom Window 240 9 SF 6 10+ years Floor - Tile 240 710 SF 6 10+ years Lighting - Lay-in 6 240 14 EΑ 6-10 years **Power Distribution** 7 240 14 ΕA 10+ years 240 64 SF 5 Storage/ Closet 10+ years SF 7 Walls - Concrete Block 240 340 10+ years SF Walls - Metal Panel 240 630 6 10+ years Work SInk 240 EΑ 7 10+ vears 1 Ceiling - Lay-in 240B Office 81 SF 6 10+ years Doors - Steel Doors incl hw 240B Office 1 ΕA 6 10+ years Floor - Tile SF 240B Office 81 6 10+ years ΕA 6 Lighting - Lay-in 240B Office 4 6-10 years 2 Power Distribution 240B Office FΑ 6 10+ years Walls - Metal Panel 240B Office SF 6 180 10+ years SF Ceiling - Lav-in 241A 231 6 10+ vears Doors - Transom Window SF 241A 6 6 10+ years Doors - Wood Doors inclu hw 241A ΕA 6 1 10+ years SF Floor - Concrete 241A 231 4 0-1 year Need finishing Lighting - Lay-in 241A 4 ΕA 7 6-10 years Power Distribution 241A 4 ΕA 6 10+ vears Walls - Concrete Block 241A 438 SF 6 10+ vears SF Walls - Concrete Block 3 5 0-1 year 241A Cracked Ceiling - Plaster/Drywall 242A 180 SF 5 2-5 years Doors - Steel Doors incl hw 7 242A 1 EΑ 10+ years Doors - Transom Window SF 7 242A 6 10+ years SF Floor - Concrete 242A 180 5 10+ years ΕA 7 Lighting - Pendent/Surface 242A 3 10+ years Lighting - Pendent/Surface 242A 1 EΑ 6 6-10 years Relamp Power Distribution 7 242A 8 ΕA 10+ vears Walls - Metal Panel 242A 380 SF 7 6-10 years SF Ceiling - Lav-in 242C 6 10+ vears 81 Doors - Steel Doors incl hw 242C EΑ 7 10+ years 1 SF Floor - Tile 242C 81 6 10+ years



Category : Room			Building : Main-Building A					
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Lighting - Lay-in	242C	4	EA	7	6-10 years		
	Power Distribution	242C	4	EA	7	10+ years		
	Walls - Concrete Block	242C	70	SF	6	10+ years		
	Walls - Metal Panel	242C	185	SF	6	10+ years		
	Ceiling - Lay-in	246/247 Media Center Office	681	SF	6	10+ years		
	Doors - Side-lite	246/247 Media Center Office	10	SF	6	10+ years		
	Doors - Steel Doors incl hw	246/247 Media Center Office	2	EA	6	10+ years		
	Doors - Transom Window	246/247 Media Center Office	12	SF	6	10+ years		
	Floor - Tile	246/247 Media Center Office	681	SF	7	10+ years		
	Lighting - Lay-in	246/247 Media Center Office	14	EA	6	6-10 years		
	Power Distribution	246/247 Media Center Office	8	EA	7	10+ years		
	Walls - Metal Panel	246/247 Media Center Office	716	SF	6	10+ years		
	Ceiling - Lay-in	256 Office	120	SF	6	10+ years		
	Doors - Steel Doors incl hw	256 Office	1	EA	7	10+ years		
	Doors - Transom Window	256 Office	9	SF	7	10+ years		
	Floor - Tile	256 Office	120	SF	6	10+ years		
	Lighting - Lay-in	256 Office	4	EA	6	6-10 years		
	Power Distribution	256 Office	10	EA	6	10+ years		
	Walls - Metal Panel	256 Office	281	SF	6	10+ years		
	Ceiling - Lay-in	261A - Yearbook Office	270	SF	6	10+ years		
	Doors - Side-lite	261A - Yearbook Office	60	SF	7	10+ years		
	Doors - Steel Doors incl hw	261A - Yearbook Office	1	EA	6	10+ years		
	Doors - Transom Window	261A - Yearbook Office	9	SF	6	10+ years		
	Floor - Tile	261A - Yearbook Office	270	SF	6	10+ years		
	Lighting - Lay-in	261A - Yearbook Office	6	ĒA	6	6-10 years		
	Power Distribution	261A - Yearbook Office	3	EA	6	10+ years		
	Walls - Concrete Block	261A - Yearbook Office	42	SF	6	10+ years		
	Walls - Metal Panel	261A - Yearbook Office	350	SF	6	10+ years		
	Ceiling - Lay-in	276 - Coordinator Office	190	SF	6	10+ years		
	Doors - Side-lite	276 - Coordinator Office	11	SF	6	10+ years		
	Doors - Steel Doors incl hw	276 - Coordinator Office	1	EA	7	10+ years		
	Doors - Transom Window	276 - Coordinator Office	9	SF	6	10+ years		
	Floor - Tile	276 - Coordinator Office	190	SF	6	10+ years		
	Lighting - Lay-in	276 - Coordinator Office	4	EA	6	6-10 years		
	Power Distribution	276 - Coordinator Office	6	EA	6	10+ years		
	Walls - Metal Panel	276 - Coordinator Office	445	SF	6	10+ years		
	Ceiling - Lay-in	281 - IB Coordinator Office	190	SF	6	10+ years		
	Doors - Side-lite	281 - IB Coordinator Office	11	SF	6	10+ years		
	Doors - Steel Doors incl hw	281 - IB Coordinator Office	1	EA	7	10+ years		
	Doors - Transom Window	281 - IB Coordinator Office	9	SF	6	10+ years		
	Floor - Tile	281 - IB Coordinator Office	190	SF	6	10+ years		
	Lighting - Lay-in	281 - IB Coordinator Office	4	EA	6	6-10 years		
	Power Distribution	281 - IB Coordinator Office	4	EA	6	10+ years		
	Walls - Metal Panel	281 - IB Coordinator Office	445	SF	6	10+ years		
			440	36	0	IUT years		



Catego	ry : Room		В	uilding	: Main-I	Building A	
	•			-		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Lay-in	326 - Guidance Office	115	SF	6	10+ years	
	Doors - Transom Window	326 - Guidance Office	1	SF	7	10+ years	
	Doors - Wood Doors inclu hw	326 - Guidance Office	1	EA	6	10+ years	
	Floor - Tile	326 - Guidance Office	115	SF	6	10+ years	
	Lighting - Lay-in	326 - Guidance Office	3	EA	7	6-10 years	
	Lighting - Lay-in	326 - Guidance Office	1	EA	6	1-2 years	Not working
	Power Distribution	326 - Guidance Office	2	EA	7	10+ years	
	Walls - Metal Panel	326 - Guidance Office	350	SF	6	10+ years	
	Ceiling - Lay-in	327 Office	115	SF	7	10+ years	
	Doors - Wood Doors inclu hw	327 Office	1	EA	7	10+ years	
	Floor - Tile	327 Office	115	SF	7	10+ years	
	Lighting - Lay-in	327 Office	3	EA	7	6-10 years	
	Lighting - Lay-in	327 Office	1	EA	6	1-2 years	Not working
	Power Distribution	327 Office	2	EA	7	10+ years	
	Walls - Metal Panel	327 Office	350	SF	7	10+ years	
	Ceiling - Lay-in	328 - Guidance Office	115	SF	6	10+ years	
	Doors - Transom Window	328 - Guidance Office	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	328 - Guidance Office	1	EA	6	10+ years	
	Floor - Tile	328 - Guidance Office	115	SF	6	10+ years	
	Lighting - Lay-in	328 - Guidance Office	4	EA	7	6-10 years	
	Power Distribution	328 - Guidance Office	2	EA	7	10+ years	
	Walls - Metal Panel	328 - Guidance Office	350	SF	7	10+ years	
	Walls - Masonry	328 - Guidance Office	30	SF	7	10+ years	
	Ceiling - Lay-in	329 Speech/Language/Hearing	115	SF	7	10+ years	
		Office					
	Doors - Transom Window	329 Speech/Language/Hearing	9	SF	7	10+ years	
		Office					
	Doors - Wood Doors inclu hw	329 Speech/Language/Hearing	1	EA	7	10+ years	
		Office					
	Floor - Tile	329 Speech/Language/Hearing	115	SF	7	10+ years	
		Office					
	Lighting - Lay-in	329 Speech/Language/Hearing	4	EA	6	6-10 years	
		Office					
	Power Distribution	329 Speech/Language/Hearing	2	EA	7	10+ years	
		Office					
	Walls - Metal Panel	329 Speech/Language/Hearing	350	SF	7	10+ years	
		Office					
	Walls - Masonry	329 Speech/Language/Hearing	24	SF	7	10+ years	
		Office					
	Ceiling - Lay-in	330 - Guidance Office	115	SF	6	10+ years	
	Doors - Transom Window	330 - Guidance Office	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	330 - Guidance Office	1	EA	6	10+ years	
	Floor - Tile	330 - Guidance Office	115	SF	6	10+ years	
	Lighting - Lay-in	330 - Guidance Office	4	EA	6	6-10 years	



Category : Room			Building : Main-Building A					
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Power Distribution	330 - Guidance Office	2	EA	7	10+ years		
	Walls - Metal Panel	330 - Guidance Office	350	SF	6	10+ years		
	Walls - Masonry	330 - Guidance Office	24	SF	7	10+ years		
	Ceiling - Lay-in	331 Office	115	SF	7	10+ years		
	Doors - Transom Window	331 Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	331 Office	1	EA	7	10+ years		
	Floor - Tile	331 Office	115	SF	7	10+ years		
	Lighting - Lay-in	331 Office	1	EA	6	1-2 years	Not working	
	Lighting - Lay-in	331 Office	3	EA	6	6-10 years		
	Power Distribution	331 Office	2	EA	7	10+ years		
	Walls - Metal Panel	331 Office	350	SF	7	10+ years		
	Ceiling - Lay-in	333 Special Ed Department Office	1,040	SF	6	10+ years		
	Doors - Side-lite	333 Special Ed Department Office	10	SF	6	10+ years		
	Doors - Transom Window	333 Special Ed Department Office	6	SF	6	10+ years		
	Doors - Wood Doors inclu hw	333 Special Ed Department Office	1	EA	6	10+ years		
	Floor - Tile	333 Special Ed Department Office	1,040	SF	6	10+ years		
	Lighting - Lay-in	333 Special Ed Department Office	17	EA	6	6-10 years		
	Power Distribution	333 Special Ed Department Office	26	EA	7	10+ years		
	Walls - Concrete Block	333 Special Ed Department Office	157	SF	7	10+ years		
	Walls - Metal Panel	333 Special Ed Department Office	980	SF	6	10+ years		
	Ceiling - Plaster/Drywall	334A	136	SF	7	10+ years		
	Doors - Transom Window	334A	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	334A	1	EA	7	10+ years		
	Floor - Tile	334A	136	SF	7	10+ years		
	Lighting - Pendent/Surface	334A	2	EA	7	6-10 years		
	Power Distribution	334A	8	EA	7	10+ years		
	Walls - Concrete Block	334A	235	SF	7	10+ years		
	Walls - Metal Panel	334A	235	SF	7	10+ years		
	Ceiling - Lay-in	334B	136	SF	7	10+ years		
	Doors - Wood Doors inclu hw	334B	9	ĒA	7	10+ years		
	Doors - Wood Doors inclu hw	334B	1	EA	7	10+ years		
	Floor - Tile	334B	136	SF	7	10+ years		
	Lighting - Lay-in	334B	2	EA	7	6-10 years		
	Power Distribution	334B	6	EA	7	10+ years		
	Walls - Concrete Block	334B	135	SF	7	10+ years		
	Walls - Metal Panel	334B	335	SF	7	10+ years		
	Ceiling - Lay-in	341A/B Office	118	SF	7	10+ years		
	Ceiling - Plaster/Drywall	341A/B Office	98	SF	7	10+ years		
	Ceiling - Plaster/Drywall	341A/B Office	2	SF	5	1-2 years	Patch and paint	
	Doors - Side-lite	341A/B Office	40	SF	7	10+ years		
	Doors - Transom Window	341A/B Office	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	341A/B Office	1	EA	7	10+ years		
	Floor - Tile	341A/B Office	218	SF	7	10+ years		
	Lighting - Lay-in	341A/B Office	4	EA	7	6-10 years		
			4	LA	'	o io years		



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Lighting - Pendent/Surface 341A/B Office ΕA 6-10 vears 7 1 Power Distribution ΕA 7 341A/B Office 4 10+ years Walls - Concrete Block 341A/B Office 50 SF 7 10+ years SF 7 Walls - Plaster/Drywall 341A/B Office 540 10+ years SF Ceiling - Plaster/Drywall 341C office/storage inside 118 6 10+ years classroom 341 Doors - Wood Doors inclu hw 341C office/storage inside ΕA 1 7 10+ years classroom 341 Floor - Concrete 341C office/storage inside 118 SF 7 10+ years classroom 341 Lighting - Pendent/Surface 341C office/storage inside 2 ΕA 6 6-10 years classroom 341 341C office/storage inside ΕA 7 Power Distribution 8 10+ years classroom 341 SF Walls - Concrete Block 341C office/storage inside 200 5 Cracking block wall 1-2 years classroom 341 SF Walls - Metal Panel 341C office/storage inside 238 7 10+ years classroom 341 Work SInk 341C office/storage inside ΕA 1 5 6-10 years classroom 341 Ceiling - Lay-in 342 Open Office 1,357 SF 6 10+ years 342 Open Office SF Ceiling - Lay-in 26 4 1-2 years Stained tile Doors - Side-lite 342 Open Office SF 7 30 10+ years SF 7 Doors - Transom Window 342 Open Office 18 10+ years Doors - Wood Doors inclu hw 342 Open Office 2 ΕA 7 10+ years Floor - Tile 342 Open Office 1.383 SF 6 10+ vears Lighting - Lay-in 342 Open Office 24 ΕA 6 6-10 years **Power Distribution** 342 Open Office 46 ΕA 7 10+ years 342 Open Office SF Walls - Concrete Block 450 7 10+ years Walls - Metal Panel 342 Open Office 1,400 SF 7 10+ years 10+ years Work SInk 342 Open Office ΕA 7 1 Ceiling - Plaster/Drvwall 342A Coordinator Office Inside open SF 6 10+ vears 180 office 342(used as storage) Doors - Transom Window 342A Coordinator Office Inside open 16 SF 7 10+ years office 342(used as storage) 342A Coordinator Office Inside open Doors - Wood Doors inclu hw 2 EΑ 7 10+ years office 342(used as storage) Floor - Concrete 342A Coordinator Office Inside open 180 SF 7 10+ years office 342(used as storage) ΕA Lighting - Lay-in 342A Coordinator Office Inside open 3 6 6-10 years office 342(used as storage) 342A Coordinator Office Inside open FΑ Power Distribution 6 7 10+ years office 342(used as storage) Walls - Metal Panel 342A Coordinator Office Inside open 580 SF 6 10+ years



Category : Room		Building : Main-Building A					
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
		office 342(used as storage)					
	Ceiling - Lay-in	342B Office	84	SF	7	10+ years	
	Doors - Side-lite	342B Office	11	SF	7	10+ years	
	Doors - Transom Window	342B Office	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	342B Office	1	EA	7	10+ years	
	Floor - Tile	342B Office	84	SF	7	10+ years	
	Lighting - Lay-in	342B Office	2	EA	7	6-10 years	
	Power Distribution	342B Office	2	EA	7	10+ years	
	Walls - Metal Panel	342B Office	240	SF	7	10+ years	
	Ceiling - Lay-in	344 / 345 Open Office	2,123	SF	7	10+ years	
	Doors - Transom Window	344 / 345 Open Office	18	SF	7	10+ years	
	Doors - Wood Doors inclu hw	344 / 345 Open Office	2	EA	7	10+ years	
	Floor - Tile	344 / 345 Open Office	2,123	SF	7	10+ years	
	Lighting - Lay-in	344 / 345 Open Office	41	EA	7	6-10 years	
	Power Distribution	344 / 345 Open Office	24	EA	7	6-10 years	
	Walls - Concrete Block	344 / 345 Open Office	720	SF	7	10+ years	
	Walls - Metal Panel	344 / 345 Open Office	1,350	SF	7	10+ years	
	Work SInk	344 / 345 Open Office	1	EA	7	10+ years	
	Ceiling - Lay-in	344A Office	81	SF	7	10+ years	
	Doors - Side-lite	344A Office	51	SF	7	10+ years	
	Doors - Transom Window	344A Office	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	344A Office	1	ĒA	7	10+ years	
	Floor - Tile	344A Office	81	SF	7	10+ years	
	Lighting - Lay-in	344A Office	4	ĒΑ	7	6-10 years	
	Walls - Metal Panel	344A Office	180	SF	7	10+ years	
	Ceiling - Lay-in	345A	95	SF	6	10+ years	
	Doors - Wood Doors inclu hw	345A	1	EA	6	10+ years	
	Floor - Tile	345A	95	SF	6	10+ years	
	Lighting - Lay-in	345A	4	ĒA	6	6-10 years	
	Power Distribution	345A	2	EA	7	10+ years	
	Walls - Metal Panel	345A	200	SF	6	10+ years	
	Ceiling - Lay-in	350A science office	134	SF	7	10+ years	
	Ceiling - Lay-in	350A science office	16	SF	5	1-2 years	Missing tile
	Doors - Side-lite	350A science office	14	SF	7	10+ years	ineenig ne
	Doors - Transom Window	350A science office	15	SF	7	10+ years	
	Floor - Tile	350A science office	150	SF	7	10+ years	
	Lighting - Pendent/Surface	350A science office	2	EA	7	6-10 years	
	Power Distribution	350A science office	3	EA	7	10+ years	
	Walls - Plaster/Drywall	350A science office	360	SF	7	10+ years	
	Ceiling - Lay-in	353B- Science Lab Office	108	SF	6	10+ years	
	Doors - Side-lite	353B- Science Lab Office	10	SF	6	10+ years	
	Doors - Transom Window	353B- Science Lab Office	12	SF	6	10+ years	
	Doors - Wood Doors inclu hw	353B- Science Lab Office	1	EA	6	10+ years	
	Floor - Tile	353B- Science Lab Office	108	SF	6	10+ years	
			100	0.	0	io. youro	



Category : Room			Building : Main-Building A				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Lighting - Lay-in	353B- Science Lab Office	2	EA	6	6-10 years	
	Power Distribution	353B- Science Lab Office	4	EA	7	10+ years	
	Walls - Metal Panel	353B- Science Lab Office	397	SF	7	10+ years	
	Ceiling - Lay-in	359 Office	700	SF	6	10+ years	
	Doors - Side-lite	359 Office	66	SF	7	10+ years	
	Doors - Transom Window	359 Office	9	SF	6	10+ years	
	Doors - Wood Doors inclu hw	359 Office	2	EA	6	10+ years	
	Floor - Terrazzo	359 Office	700	SF	6	10+ years	
	Lighting - Lay-in	359 Office	18	EA	6	6-10 years	
	Lighting - Lay-in	359 Office	3	EA	6	1-2 years	Not working
	Power Distribution	359 Office	8	EA	6	10+ years	
	Walls - Concrete Block	359 Office	376	SF	7	10+ years	
	Walls - Metal Panel	359 Office	580	SF	6	10+ years	
	Work SInk	359 Office	2	EA	7	6-10 years	
	Ceiling - Lay-in	382 office	162	SF	7	10+ years	
	Doors - Side-lite	382 office	22	SF	7	10+ years	
	Doors - Transom Window	382 office	26	SF	7	10+ years	
	Doors - Wood Doors inclu hw	382 office	2	EA	7	10+ years	
	Floor - Tile	382 office	162	SF	7	10+ years	
	Lighting - Lay-in	382 office	4	EA	7	6-10 years	
	Power Distribution	382 office	8	EA	7	10+ years	
	Walls - Metal Panel	382 office	230	SF	7	10+ years	
	Walls - Plaster/Drywall	382 office	200	SF	7	10+ years	
	Ceiling - Exposed	B14A Engineer's Shop	352	SF	6	10+ years	
	Doors - Wood Doors inclu hw	B14A Engineer's Shop	4	EA	6	10+ years	
	Floor - Concrete	B14A Engineer's Shop	352	SF	5	10+ years	
	Lighting - Pendent/Surface	B14A Engineer's Shop	7	EA	6	6-10 years	
	Power Distribution	B14A Engineer's Shop	10	EA	7	10+ years	
	Walls - Concrete Block	B14A Engineer's Shop	755	SF	6	10+ years	
	Walls - Plaster/Drywall	B14A Engineer's Shop	61	SF	6	10+ years	
	Ceiling - Plaster/Drywall	B15 Engineer's Office	144	SF	6	10+ years	
	Doors - Wood Doors inclu hw	B15 Engineer's Office	1	EA	6	10+ years	
	Floor - Tile	B15 Engineer's Office	144	SF	6	10+ years	
	Lighting - Lay-in	B15 Engineer's Office	4	EA	7	6-10 years	
	Power Distribution	B15 Engineer's Office	44	EA	7	10+ years	
	Walls - Concrete Block	B15 Engineer's Office	458	SF	7	10+ years	
	Ceiling - Plaster/Drywall	B16 Engineer's Office	134	SF	7	10+ years	
	Doors - Wood Doors inclu hw	B16 Engineer's Office	1	EA	7	10+ years	
	Floor - Tile	B16 Engineer's Office	134	SF	6	10+ years	
	Lighting - Lay-in	B16 Engineer's Office	4	EA	7	6-10 years	
	Power Distribution	B16 Engineer's Office	8	EA	7	10+ years	
	Walls - Concrete Block	B16 Engineer's Office	359	SF	7	10+ years	
	Ceiling - Lay-in	B3 Kitchen Office	135	SF	6	10+ years	
	Doors - Transom Window	B3 Kitchen Office	9	SF	6	10+ years	



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Doors - Wood Doors inclu hw **B3 Kitchen Office** ΕA 10+ vears 7 1 135 SF Floor - Terrazzo **B3 Kitchen Office** 6 10+ vears Lighting - Pendent/Surface **B3** Kitchen Office 2 FΑ 6 6-10 years Power Distribution 6 **B3 Kitchen Office** 4 EΑ 10+ years SF 7 Walls - Structural Glazed Tile **B3 Kitchen Office** 300 10+ years SF 7 Ceiling - Lay-in Science office 348 180 10+ years Doors - Transom Window Science office 348 15 SF 7 10+ years Doors - Wood Doors inclu hw Science office 348 1 EΑ 7 10+ years Floor - Tile Science office 348 180 SF 6 10+ years Lighting - Pendent/Surface Science office 348 2 ΕA 7 6-10 years Power Distribution Science office 348 3 ΕA 7 10+ vears Walls - Metal Panel Science office 348 360 SF 7 10+ years Work SInk Science office 348 ΕA 7 10+ years 1 SF Ceiling - Lay-in Science office 361A 450 6 10+ years Doors - Side-lite SF 7 Science office 361A 14 10+ years Doors - Wood Doors inclu hw 2 FΑ Science office 361A 6 10+ years SF Floor - Tile Science office 361A 450 6 10+ vears Lighting - Lay-in Science office 361A 12 EΑ 6 6-10 years Power Distribution Science office 361A 4 EΑ 7 10+ vears Walls - Concrete Block Science office 361A 950 SF 6 10+ years Walls - Metal Panel Science office 361A 360 SF 6 10+ years 2 ΕA 5 Work SInk Science office 361A 6-10 years Kitchen Ceiling - Lay-in 115 Canteen 185 SF 6 10+ years Doors - Wood Doors inclu hw 115 Canteen 2 ΕA 7 10+ years SF Floor - Terrazzo 115 Canteen 185 6 10+ years Lighting - Pendent/Surface ΕA 7 115 Canteen 4 6-10 years Walls - Structural Glazed Tile 275 SF 7 115 Canteen 10+ years SF Ceiling - Lav-in 116 Serving Area 1.222 6 10+ years SF Doors - Transom Window 116 Serving Area 90 7 10+ years Doors - Wood Doors inclu hw 116 Serving Area 4 ΕA 6 10+ vears Doors - Wood Doors inclu hw 116 Serving Area 4 EΑ 6 10+ years Floor - Terrazzo 116 Serving Area 789 SF 6 10+ years Floor - Tile 116 Serving Area 430 SF 7 10+ years 3 SF Floor - Tile 116 Serving Area 4 1-2 years Missing tile 7 Lighting - Pendent/Surface 116 Serving Area 22 FΑ 6-10 years Serving Line 116 Serving Area 68 LF 7 10+ years SF Walls - Masonry 116 Serving Area 410 7 10+ vears SF Walls - Metal Panel 116 Serving Area 637 10+ years 6 Walls - Structural Glazed Tile SF 7 116 Serving Area 1,040 10+ years SF Ceiling - Lay-in 216/215 Kitchen 1,346 6 10+ years Ceiling - Lay-in 216/215 Kitchen 8 SF 4 1-2 years Water damage Doors - Steel Doors incl hw 7 216/215 Kitchen 9 EΑ 10+ years



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Doors - Wood Doors inclu hw 216/215 Kitchen EΑ 10+ vears 7 1 920 SF Floor - Terrazzo 216/215 Kitchen 6 10+ years Floor - Tile 434 SF 6 10+ years 216/215 Kitchen 28 ΕA 6 Lighting - Lay-in 216/215 Kitchen 6-10 years LF Serving Line 216/215 Kitchen 84 6 6-10 years SF Walls - Metal Panel 500 6 10+ years 216/215 Kitchen Walls - Structural Glazed Tile SF 7 10+ years 216/215 Kitchen 1,420 SF Ceiling - Lay-in 316/315 Serving Lines 1.354 7 10+ years Doors - Wood Doors inclu hw 316/315 Serving Lines 10 EΑ 7 10+ years SF Floor - Terrazzo 316/315 Serving Lines 920 7 10+ years SF Floor - Tile 316/315 Serving Lines 430 6 10+ vears Floor - Tile 316/315 Serving Lines 4 SF 4 1-2 years Missing and damaged tile Lighting - Lay-in 316/315 Serving Lines 28 ΕA 7 6-10 years LF 7 Serving Line 316/315 Serving Lines 84 10+ years Walls - Masonry 316/315 Serving Lines SF 7 340 10+ years Walls - Metal Panel SF 7 316/315 Serving Lines 500 10+ years SF 7 Walls - Structural Glazed Tile 316/315 Serving Lines 1.420 10+ years Ceiling - Lav-in SF Basement 3.047 6 6-10 years Doors - Wood Doors inclu hw Basement 3 ΕA 6 10+ vears Floor - Terrazzo Basement 3.037 SF 6 10+ years Floor - Terrazzo Basement 10 SF 4 1-2 years Damaged area of floor Lighting - Pendent/Surface 59 6 Basement EΑ 6-10 years 825 SF 7 Storage/ Closet **Basement** 10+ years SF Walls - Structural Glazed Tile **Basement** 1.688 7 10+ years Library 2nd Floor LF Casework 138 6 10+ years Ceiling - Lay-in 2nd Floor SF 12,300 6 10+ years Doors - Side-lite 2nd Floor SF 6 20 10+ years SF Doors - Transom Window 2nd Floor 24 6 10+ years Doors - Wood Doors inclu hw 2nd Floor 6 EΑ 6 10+ years SF Floor - Tile 2nd Floor 12.300 7 10+ vears Lighting - Lay-in 2nd Floor 162 EΑ 6 6-10 years Storage/ Closet 2nd Floor 329 SF 5 10+ years Walls - Concrete Block 2nd Floor 414 SF 6 10+ years SF 6 Walls - Metal Panel 2nd Floor 3,750 10+ years Lunch & Multipurpose Room 101/102 Faculty Lunchroom (157 & SF 7 Ceiling - Lay-in 1,443 10+ years 157A on plan) 101/102 Faculty Lunchroom (157 & Doors - Wood Doors inclu hw 2 EΑ 6 10+ years 157A on plan) 101/102 Faculty Lunchroom (157 & Floor - Tile 1.443 SF 5 10+ years 157A on plan)



Category : Room		Building : Main-Building A					
_	-			_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Lighting - Pendent/Surface	101/102 Faculty Lunchroom (157 &	24	EA	6	6-10 years	
		157A on plan)				-	
	Walls - Masonry	101/102 Faculty Lunchroom (157 &	820	SF	7	10+ years	
	-	157A on plan)					
	Walls - Metal Panel	101/102 Faculty Lunchroom (157 &	1,030	SF	6	10+ years	
		157A on plan)					
	Ceiling - Lay-in	118 West Lunchroom	1,675	SF	6	10+ years	
	Floor - Tile	118 West Lunchroom	1,675	SF	7	10+ years	
	Lighting - Pendent/Surface	118 West Lunchroom	1	EA	6	1-2 years	Not working
	Lighting - Pendent/Surface	118 West Lunchroom	27	EA	6	6-10 years	-
	Walls - Masonry	118 West Lunchroom	445	SF	7	10+ years	
	Walls - Metal Panel	118 West Lunchroom	783	SF	6	10+ years	
	Ceiling - Lay-in	119 East Lunchroom	1,770	SF	7	10+ years	
	Floor - Tile	119 East Lunchroom	1,766	SF	7	10+ years	
	Floor - Tile	119 East Lunchroom	4	SF	4	1-2 years	Damaged tile
	Lighting - Pendent/Surface	119 East Lunchroom	29	EA	7	6-10 years	C
	Walls - Masonry	119 East Lunchroom	485	SF	7	10+ years	
	Walls - Metal Panel	119 East Lunchroom	953	SF	7	10+ years	
	Ceiling - Lay-in	218 2nd Floor West	2,128	SF	6	10+ years	
	Floor - Tile	218 2nd Floor West	2,128	SF	6	10+ years	
	Lighting - Lay-in	218 2nd Floor West	33	EA	6	6-10 years	
	Serving Line	218 2nd Floor West	8	LF	7	10+ years	
	Student Lockers - One Tier	218 2nd Floor West	48	EA	7	10+ years	
	Walls - Masonry	218 2nd Floor West	421	SF	7	10+ years	
	Walls - Metal Panel	218 2nd Floor West	1,250	SF	6	10+ years	
	Ceiling - Lay-in	219 2nd Floor East	2,128	SF	6	10+ years	
	Floor - Tile	219 2nd Floor East	2,128	SF	6	10+ years	
	Lighting - Lay-in	219 2nd Floor East	33	EA	6	6-10 years	
	Storage/ Closet	219 2nd Floor East	8	SF	7	10+ years	
	Student Lockers - One Tier	219 2nd Floor East	48	EA	7	10+ years	
	Walls - Masonry	219 2nd Floor East	421	SF	7	10+ years	
	Walls - Metal Panel	219 2nd Floor East	1,250	SF	6	10+ years	
	Ceiling - Lay-in	318 3rd Floor West	2,128	SF	6	10+ years	
	Floor - Tile	318 3rd Floor West	2,128	SF	7	10+ years	
	Lighting - Lay-in	318 3rd Floor West	33	EA	7	6-10 years	
	Serving Line	318 3rd Floor West	8	LF	7	10+ years	
	Student Lockers - One Tier	318 3rd Floor West	20	EA	7	10+ years	
	Walls - Masonry	318 3rd Floor West	421	SF	7	10+ years	
	Walls - Metal Panel	318 3rd Floor West	1,250	SF	7	10+ years	
	Ceiling - Lay-in	319 3rd Floor East	2,128	SF	7	10+ years	
	Floor - Tile	319 3rd Floor East	2,128	SF	7	10+ years	
	Lighting - Lay-in	319 3rd Floor East	33	EA	7	6-10 years	
	Serving Line	319 3rd Floor East	8	LF	7	10+ years	
	Student Lockers - One Tier	319 3rd Floor East	45	EA	7	10+ years	
			•			,	



Catego	ry : Room	В	Building : Main-Building A						
_			Recommend						
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
-	Walls - Masonry	319 3rd Floor East	421	SF	7	10+ years			
	Walls - Metal Panel	319 3rd Floor East	1,250	SF	7	10+ years			
1DF ID	F								
שו_חשו	Doors - Wood Doors inclu hw	237	1	EA	6	10+ years			
	Finishes	237	194	SF	5	10+ years			
	Other Cooling Unit	237	194	EA	7	6-10 years			
		231	I	LA	'	0-10 years			
lechani	cal/ Service Rooms								
	Janitor's Closet	1st Floor	96	SF	5	10+ years			
	Janitor's Closet	1st Floor	96	SF	5	10+ years			
	Mechanical/ Service Rooms	1st Floor	118	SF	7	10+ years			
	Mechanical/ Service Rooms	1st Floor	37	SF	7	10+ years			
	Mechanical/ Service Rooms	1st Floor	75	SF	7	10+ years			
	Storage Room	1st Floor	143	SF	7	10+ years			
	Storage Room	1st Floor	966	SF	7	10+ years			
	Storage Room	1st Floor	86	SF	7	10+ years			
	Storage Room	1st Floor	86	SF	7	10+ years			
	Janitor's Closet	2nd Floor Support Rooms	25	SF	5	10+ years			
	Janitor's Closet	2nd Floor Support Rooms	25	SF	5	10+ years			
	Janitor's Closet	2nd Floor Support Rooms	25	SF	5	10+ years			
	Janitor's Closet	2nd Floor Support Rooms	25	SF	5	10+ years			
	Mechanical/ Service Rooms	2nd Floor Support Rooms	20	SF	5	10+ years			
	Mechanical/ Service Rooms	2nd Floor Support Rooms	20	SF	5	10+ years			
	Mechanical/ Service Rooms	2nd Floor Support Rooms	20	SF	5	10+ years			
	Mechanical/ Service Rooms	2nd Floor Support Rooms	20	SF	5	10+ years			
	Storage Room	2nd Floor Support Rooms	200	SF	5	10+ years			
	Storage Room	2nd Floor Support Rooms	49	SF	5	10+ years			
		3rd Floor	49 25	SF	5	•			
	Janitor's Closet	3rd Floor		SF		10+ years			
	Janitor's Closet	3rd Floor	25 25	SF	5	10+ years			
	Janitor's Closet				5	10+ years			
	Janitor's Closet	3rd Floor	25	SF	5	10+ years			
	Mechanical/ Service Rooms	3rd Floor	65	SF	5	10+ years			
	Mechanical/ Service Rooms	3rd Floor	20	SF	5	10+ years			
	Mechanical/ Service Rooms	3rd Floor	20	SF	5	10+ years			
	Mechanical/ Service Rooms	3rd Floor	20	SF	5	10+ years			
	Mechanical/ Service Rooms	3rd Floor	20	SF	5	10+ years			
	Storage Room	3rd Floor	204	SF	7	10+ years			
	Storage Room	3rd Floor	196	SF	5	10+ years			
	Storage Room	3rd Floor	170	SF	5	10+ years			
	Storage Room	3rd Floor	89	SF	5	10+ years			
	Storage Room	3rd Floor	126	SF	5	10+ years			
	Loading Docks	Basement Loading Dock	504	SF	5	10+ years			
	Janitor's Closet	Basement Service Rooms	21	SF	7	10+ years			



Catego	ry : Room		В	uilding	: Main-B	Building A	4959 S AICHELAVENUE, CHICAGO, IL 60632
J	-			J		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Mechanical/ Service Rooms	Basement Service Rooms	308	SF	7	10+ years	
	Mechanical/ Service Rooms	Basement Service Rooms	164	SF	7	10+ years	
	Mechanical/ Service Rooms	Basement Service Rooms	2,408	SF	7	10+ years	
	Mechanical/ Service Rooms	Basement Service Rooms	40	SF	7	10+ years	
	Mechanical/ Service Rooms	Basement Service Rooms	537	SF	7	10+ years	
	Storage Room	Basement Service Rooms	152	SF	7	10+ years	
	Storage Room	Basement Service Rooms	368	SF	7	10+ years	
	Storage Room	Basement Service Rooms	369	SF	7	10+ years	
	Storage Room	Basement Service Rooms	278	SF	7	10+ years	
	Storage Room	Basement Service Rooms	609	SF	5	10+ years	
Prep Ro	om						
-	Ceiling - Lay-in	151 Dark Room combined into 150	461	SF	6	10+ years	
	Doors - Steel Doors incl hw	151 Dark Room combined into 150	1	EA	7	10+ years	
	Floor - Concrete Epoxy/ Painted	151 Dark Room combined into 150	461	SF	7	6-10 years	
	Lighting - Pendent/Surface	151 Dark Room combined into 150	8	EA	7	10+ years	
	Walls - Concrete Block	151 Dark Room combined into 150	438	SF	7	10+ years	
	Walls - Metal Panel	151 Dark Room combined into 150	514	SF	7	10+ years	
	Work Sink	151 Dark Room combined into 150	2	EA	7	10+ years	
	Casework	340A get from 343	30	LF	6	10+ years	
	Ceiling - Lay-in	340A get from 343	175	SF	6	10+ years	
	Doors - Wood Doors inclu hw	340A get from 343	1	EA	6	10+ years	
	Floor - Tile	340A get from 343	175	SF	6	10+ years	
	Lighting - Lay-in	340A get from 343	3	EA	6	6-10 years	
	Walls - Metal Panel	340A get from 343	380	SF	6	10+ years	
	Walls - Plaster/Drywall	340A get from 343	219	SF	7	10+ years	
	Work Sink	340A get from 343	1	EA	7	10+ years	
	Ceiling - Lay-in	346A/B	406	SF	7	10+ years	
	Doors - Side-lite	346A/B	22	SF	7	10+ years	
	Doors - Transom Window	346A/B	18	SF	7	10+ years	
	Doors - Wood Doors inclu hw	346A/B	2	EA	7	10+ years	
	Floor - Tile	346A/B	406	SF	6	10+ years	
	Lighting - Lay-in	346A/B	5	EA	7	6-10 years	
	Lighting - Lay-in	346A/B	3	EA	6	1-2 years	Not working
	Walls - Concrete Block	346A/B	78	SF	7	10+ years	
	Walls - Metal Panel	346A/B	290	SF	7	10+ years	
	Ceiling - Lay-in	349A/349B	272	SF	6	10+ years	• • • · · ·
	Ceiling - Lay-in	349A/349B	16	SF	4	1-2 years	Missing tile
	Doors - Side-lite	349A/349B	28	SF	7	10+ years	
	Doors - Transom Window	349A/349B	30	SF	7	10+ years	
	Doors - Wood Doors inclu hw	349A/349B	2	EA	6	10+ years	
	Floor - Tile	349A/349B	288	SF	6	10+ years	
	Lighting - Lay-in	349A/349B	11	EA	6	10+ years	
	Lighting - Lay-in	349A/349B	4	EA	6	1-2 years	Not working



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Walls - Metal Panel 349A/349B 675 SF 6 10+ vears Work Sink 349A/349B 2 ΕA 5 6-10 years Casework 350B 12 LF 6 10+ years 350B SF 6 Ceiling - Lay-in 204 10+ years SF Doors - Side-lite 350B 14 6 10+ years SF 7 Doors - Transom Window 350B 15 10+ years Doors - Transom Window 350B 18 SF 7 10+ years Doors - Wood Doors inclu hw 350B 1 ΕA 6 10+ years Floor - Tile 350B 204 SF 6 10+ years Lighting - Lay-in 350B 7 ΕA 6 6-10 years Walls - Metal Panel 350B 477 SF 7 10+ vears Work Sink 350B 1 EΑ 5 6-10 years Ceiling - Lay-in 353A 212 SF 6 10+ years SF 6 Doors - Side-lite 353A 10 10+ years Doors - Transom Window SF 353A 12 6 10+ years Doors - Wood Doors inclu hw FΑ 6 353A 1 10+ years SF Floor - Tile 353A 212 6 10+ years Lighting - Lay-in 353A 1 EΑ 6 1-2 years Not working Lighting - Lav-in 353A 6 ΕA 6 6-10 vears Walls - Metal Panel 353A 530 SF 6 10+ years Work Sink 353A 1 ΕA 5 6-10 years Ceiling - Lay-in SF 6 354B 291 10+ years SF 5 Ceiling - Lay-in 354B 8 1-2 years Missing tile SF 7 Doors - Side-lite 354B 14 10+ years Doors - Transom Window 354B 15 SF 7 10+ years Doors - Wood Doors inclu hw 354B 2 ΕA 6 10+ vears SF Floor - Tile 354B 299 6 10+ years Lighting - Pendent/Surface 354B ΕA 7 6-10 years 11 Walls - Metal Panel SF 354B 675 7 10+ years Work Sink 354B 2 ΕA 7 10+ years Ceiling - Lay-in 363A 135 SF 7 10+ vears SF Doors - Side-lite 363A 14 7 10+ vears SF 7 Doors - Transom Window 363A 15 10+ years Doors - Wood Doors inclu hw 363A EΑ 7 1 10+ years SF 7 Floor - Tile 363A 135 10+ years ΕA Lighting - Lay-in 363A 6 6 6-10 years Walls - Concrete Block SF 363A 42 7 10+ years Walls - Metal Panel 363A SF 369 7 10+ years Work Sink 363A 1 EΑ 7 10+ years SF 382 Laundry Inside Culinary 104 7 Ceiling - Lay-in 10+ years redundant SF 382 Laundry Inside Culinary 16 Ceiling - Lay-in 4 1-2 years Stained tile redundant Doors - Steel Doors incl hw 382 Laundry Inside Culinary 1 EA 7 10+ years



Catego	ry : Room	Building : Main-Building A					
					Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
0.00p		redundant	,				
	Floor - Tile	382 Laundry Inside Culinary	120	SF	7	10+ years	
		redundant		•	-	, e e e e e e e e e e e e e e e e e e e	
	Lighting - Lay-in	382 Laundry Inside Culinary	1	EA	7	6-10 years	
	5 5 5	redundant				,	
	Walls - Plaster/Drywall	382 Laundry Inside Culinary	440	SF	7	10+ years	
	,	redundant				,	
Restroo	n						
	Accessories	109 NW Girls	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	109 NW Girls	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	109 NW Girls	2	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	109 NW Girls	377	SF	6	10+ years	
	Floor Drain	109 NW Girls	1	EA	7	10+ years	
	Hand Dryer	109 NW Girls	1	EA	7	6-10 years	
	Lavatory	109 NW Girls	3	EA	6	10+ years	
	Lighting - Lay-in	109 NW Girls	11	EA	7	6-10 years	
	Partitions	109 NW Girls	7	EA	5	10+ years	
	Walls - Structural Glazed Tile	109 NW Girls	694	SF	6	10+ years	
	Water Closet	109 NW Girls	7	EA	6	10+ years	
	Accessories	112 NE Boys	377	SF	7	2-5 years	
	Ceiling - Plaster/Drywall	112 NE Boys	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	112 NE Boys	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	112 NE Boys	377	SF	6	10+ years	
	Floor Drain	112 NE Boys	1	ĒA	7	10+ years	
	Hand Dryer	112 NE Boys	1	EA	7	6-10 years	
	Lavatory	112 NE Boys	4	EA	6	10+ years	
	Lighting - Lay-in	112 NE Boys	11	EA	7	6-10 years	
	Partitions	112 NE Boys	3	EA	5	10+ years	
	Urinals	112 NE Boys	5	EA	6	10+ years	
	Walls - Structural Glazed Tile	112 NE Boys	694	SF	6	10+ years	
	Water Closet	112 NE Boys	3	ËA	6	10+ years	
	Accessories	159D	80	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	159D	80	SF	7	10+ years	
	Doors - Wood Doors inclu hw	159D	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	159D	80	SF	7	10+ years	
	Floor Drain	159D	1	EA	7	10+ years	
	Hand Dryer	159D	1	EA	7	6-10 years	
	Lavatory	159D	1	EA	7	10+ years	
	Lighting - Lay-in	159D	1	EA	7	6-10 years	
	Walls - Plaster/Drywall	159D	340	SF	6	10+ years	
	Water Closet	159D	1	EA	7	10+ years	
	Accessories	170E Small Unisex in Nurse's Office	17	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	170E Small Unisex in Nurse's Office	17	SF	6	•	
	Centry - Laster/Drywall	THE SHALLOUISEX III NUISES UNCE	17	0	U	10+ years	



Catego	ry : Room		В	uilding	: Main-E	Building A	Building : Main-Building A							
						Recommend								
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments							
	Doors - Wood Doors inclu hw	170E Small Unisex in Nurse's Office	1	EA	6	10+ years								
	Floor - Tile Ceramic/ Porcelain	170E Small Unisex in Nurse's Office	15	SF	6	10+ years								
	Floor - Tile Ceramic/ Porcelain	170E Small Unisex in Nurse's Office	2	SF	4	1-2 years	Damaged tile							
	Lavatory	170E Small Unisex in Nurse's Office	1	EA	6	10+ years								
	Lighting - Wall Mounted	170E Small Unisex in Nurse's Office	1	EA	5	1-2 years	Missing cover							
	Walls - Metal Panel	170E Small Unisex in Nurse's Office	147	SF	6	10+ years								
	Water Closet	170E Small Unisex in Nurse's Office	1	EA	7	10+ years								
	Accessories	170F Unisex in Nurse's Office	43	SF	7	6-10 years								
	Ceiling - Plaster/Drywall	170F Unisex in Nurse's Office	43	SF	6	10+ years								
	Doors - Steel Doors incl hw	170F Unisex in Nurse's Office	1	EA	6	10+ years								
	Floor - Tile Ceramic/ Porcelain	170F Unisex in Nurse's Office	43	SF	6	10+ years								
	Lavatory	170F Unisex in Nurse's Office	1	EA	6	10+ years								
	Lighting - Wall Mounted	170F Unisex in Nurse's Office	1	EA	5	6-10 years								
	Walls - Plaster/Drywall	170F Unisex in Nurse's Office	250	SF	6	10+ years								
	Water Closet	170F Unisex in Nurse's Office	1	EA	6	10+ years								
	Accessories	172A Unisex in Main Office	23	SF	7	6-10 years								
	Ceiling - Plaster/Drywall	172A Unisex in Main Office	23	SF	6	10+ years								
	Doors - Wood Doors inclu hw	172A Unisex in Main Office	1	EA	7	10+ years								
	Floor - Tile Ceramic/ Porcelain	172A Unisex in Main Office	23	SF	6	10+ years								
	Lavatory	172A Unisex in Main Office	1	EA	6	10+ years								
	Lighting - Wall Mounted	172A Unisex in Main Office	1	EA	7	6-10 years								
	Walls - Concrete Block	172A Unisex in Main Office	20	SF	7	10+ years								
	Walls - Metal Panel	172A Unisex in Main Office	150	SF	7	10+ years								
	Water Closet	172A Unisex in Main Office	1	EA	6	10+ years								
	Accessories	182A Unisex in Principal's Office	24	SF	7	6-10 years								
	Ceiling - Plaster/Drywall	182A Unisex in Principal's Office	24	SF	6	10+ years								
	Doors - Wood Doors inclu hw	182A Unisex in Principal's Office	1	EA	7	10+ years								
	Floor - Tile Ceramic/ Porcelain	182A Unisex in Principal's Office	23	SF	6	10+ years								
	Floor - Tile Ceramic/ Porcelain	182A Unisex in Principal's Office	1	SF	4	1-2 years	Missing tile							
	Lavatory	182A Unisex in Principal's Office	1	EA	6	10+ years								
	Lighting - Wall Mounted	182A Unisex in Principal's Office	1	EA	7	6-10 years								
	Walls - Concrete Block	182A Unisex in Principal's Office	48	SF	7	10+ years								
	Walls - Metal Panel	182A Unisex in Principal's Office	128	SF	7	10+ years								
	Water Closet	182A Unisex in Principal's Office	1	EA	6	10+ years								
	Accessories	1st Floor SE Girls	377	SF	7	6-10 years								
	Ceiling - Plaster/Drywall	1st Floor SE Girls	377	SF	6	10+ years								
	Doors - Wood Doors inclu hw	1st Floor SE Girls	2	EA	6	10+ years								
	Floor - Tile Ceramic/ Porcelain	1st Floor SE Girls	377	SF	6	10+ years								
	Floor Drain	1st Floor SE Girls	1	EA	7	10+ years								
	Hand Dryer	1st Floor SE Girls	1	EA	5	6-10 years								
	Lavatory	1st Floor SE Girls	4	EA	5	10+ years								
	Lighting - Lay-in	1st Floor SE Girls	9	EA	6	6-10 years								
	Partitions	1st Floor SE Girls	6	EA	7	10+ years								
	Walls - Structural Glazed Tile	1st Floor SE Girls	694	SF	7	10+ years								



Building : Main-Building A Category : Room Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Water Closet 1st Floor SE Girls 6 ΕA 6 10+ vears 90 SF 7 Accessories 1st Flr NW Mens (in 102 Faculty 6-10 years Lunchroom) SF Ceiling - Plaster/Drywall 1st Flr NW Mens (in 102 Faculty 4 6 1-2 years Paint Lunchroom) SF Ceiling - Plaster/Drywall 1st FIr NW Mens (in 102 Faculty 86 6 10+ years Lunchroom) Doors - Wood Doors inclu hw 1st FIr NW Mens (in 102 Faculty 1 ΕA 7 10+ years Lunchroom) SF Floor - Tile Ceramic/ Porcelain 1st FIr NW Mens (in 102 Faculty 90 7 10+ years Lunchroom) Floor Drain 1st Flr NW Mens (in 102 Faculty 1 ΕA 7 10+ years Lunchroom) Hand Dryer 1st FIr NW Mens (in 102 Faculty 1 ΕA 7 6-10 years Lunchroom) 1st FIr NW Mens (in 102 Faculty FΑ Lavatory 1 6 10+ years Lunchroom) Lighting - Pendent/Surface 1st FIr NW Mens (in 102 Faculty 2 ΕA 7 6-10 years Lunchroom) Lighting - Wall Mounted 1st Flr NW Mens (in 102 Faculty 1 ΕA 7 6-10 years Lunchroom) Partitions 1st Flr NW Mens (in 102 Faculty 1 ΕA 7 10+ years Lunchroom) Urinals 1st FIr NW Mens (in 102 Faculty FΑ 7 1 10+ years Lunchroom) Walls - Structural Glazed Tile 1st Flr NW Mens (in 102 Faculty 512 SF 7 10+ years Lunchroom) Water Closet 1st Flr NW Mens (in 102 Faculty ΕA 1 7 10+ years Lunchroom) Accessories 1st Flr NW Womens (in 102 Faculty 93 SF 7 6-10 years Lunchroom) Ceiling - Plaster/Drvwall 1st Flr NW Womens (in 102 Faculty 93 SF 6 10+ vears Lunchroom) Doors - Wood Doors inclu hw 1st Flr NW Womens (in 102 Faculty FΑ 7 1 10+ years Lunchroom) 1st Flr NW Womens (in 102 Faculty SF Floor - Tile Ceramic/ Porcelain 93 7 10+ years Lunchroom) Floor Drain 1st Flr NW Womens (in 102 Faculty 1 ΕA 7 10+ years Lunchroom) ΕA Hand Dryer 1st Flr NW Womens (in 102 Faculty 1 7 6-10 years Lunchroom) ΕA 1st Flr NW Womens (in 102 Faculty 2 6 Lavatory 10+ years Lunchroom) Lighting - Pendent/Surface 1st Flr NW Womens (in 102 Faculty 1 EA 7 6-10 years



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
		Lunchroom)			_		
	Lighting - Wall Mounted	1st FIr NW Womens (in 102 Faculty	1	EA	6	6-10 years	
		Lunchroom)	0	F A	-	10	
	Partitions	1st FIr NW Womens (in 102 Faculty	2	EA	7	10+ years	
	Walls Structural Clazad Tile	Lunchroom) 1st Flr NW Womens (in 102 Faculty	500	SF	7	10, 10, 10, 10, 10, 10, 10, 10, 10, 10,	
	Walls - Structural Glazed Tile	Lunchroom)	508	эг	7	10+ years	
	Water Closet	1st Fir NW Womens (in 102 Faculty	2	EA	7	10+ years	
	Water bloset	Lunchroom)	2		'	Tor years	
	Accessories	1st Flr SW Boys	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Fir SW Boys	377	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Flr SW Boys	2	ĒA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Fir SW Boys	377	SF	7	10+ years	
	Floor Drain	1st Fir SW Boys	1	EA	7	10+ years	
	Hand Dryer	1st Fir SW Boys	1	EA	7	10+ years	
	Lavatory	1st Fir SW Boys	4	EA	7	10+ years	
	Lighting - Lay-in	1st Fir SW Boys	9	EA	6	6-10 years	
	Partitions	1st Fir SW Boys	4	EA	7	10+ years	
	Urinals	1st Fir SW Boys	5	EA	7	10+ years	
	Walls - Structural Glazed Tile	1st Fir SW Boys	694	SF	7	10+ years	
	Water Closet	1st Fir SW Boys	4	EA	7	10+ years	
	Accessories	5		SF	7	,	
		202 Unisex 202 Unisex	82 82	SF		6-10 years	
	Ceiling - Plaster/Drywall Doors - Wood Doors inclu hw		02 1	EA	6	10+ years	
		202 Unisex	-	SF	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	202 Unisex	82		7	10+ years	
	Floor Drain	202 Unisex	1	EA	7	10+ years	
	Hand Dryer	202 Unisex	1	EA	7	6-10 years	
	Lavatory	202 Unisex	1	EA	7	10+ years	
	Lighting - Lay-in	202 Unisex	1	EA	7	6-10 years	
	Walls - Structural Glazed Tile	202 Unisex	228	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	202 Unisex	114	SF	7	10+ years	
	Water Closet	202 Unisex	1	EA	7	10+ years	
	Accessories	206	83	SF	7	10+ years	
	Ceiling - Plaster/Drywall	206	83	SF	6	10+ years	
	Doors - Transom Window	206	9	SF	6	10+ years	
	Doors - Wood Doors inclu hw	206	1	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	206	83	SF	6	10+ years	
	Lavatory	206	1	EA	6	10+ years	
	Lighting - Lay-in	206	1	EA	6	6-10 years	
	Partitions	206	2	EA	7	10+ years	
	Walls - Structural Glazed Tile	206	267	SF	6	10+ years	
	Water Closet	206	2	EA	6	10+ years	
	Accessories	209 - 2nd FIr SE Girls	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	209 - 2nd FIr SE Girls	377	SF	6	10+ years	



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Doors - Wood Doors inclu hw	209 - 2nd FIr SE Girls	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	209 - 2nd FIr SE Girls	377	SF	6	10+ years	
	Floor Drain	209 - 2nd FIr SE Girls	1	EA	7	10+ years	
	Hand Dryer	209 - 2nd FIr SE Girls	1	EA	7	6-10 years	
	Lavatory	209 - 2nd FIr SE Girls	4	EA	6	10+ years	
	Lighting - Lay-in	209 - 2nd FIr SE Girls	11	EA	7	6-10 years	
	Partitions	209 - 2nd FIr SE Girls	8	EA	5	10+ years	
	Walls - Structural Glazed Tile	209 - 2nd FIr SE Girls	694	SF	7	10+ years	
	Water Closet	209 - 2nd FIr SE Girls	8	EA	6	10+ years	
	Accessories	2nd FIr NE Boys	377	SF	5	6-10 years	
	Ceiling - Plaster/Drywall	2nd FIr NE Boys	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd FIr NE Boys	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd FIr NE Boys	377	SF	6	10+ years	
	Floor Drain	2nd FIr NE Boys	1	EA	7	10+ years	
	Hand Dryer	2nd FIr NE Boys	1	EA	7	6-10 years	
	Lavatory	2nd FIr NE Boys	4	EA	6	10+ years	
	Lighting - Lay-in	2nd FIr NE Boys	11	EA	7	6-10 years	
	Partitions	2nd FIr NE Boys	3	EA	5	10+ years	
	Urinals	2nd FIr NE Boys	5	EA	6	10+ years	
	Walls - Structural Glazed Tile	2nd FIr NE Boys	694	SF	6	10+ years	
	Water Closet	2nd FIr NE Boys	3	EA	6	10+ years	
	Accessories	2nd FIr NW Girls	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	2nd FIr NW Girls	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd FIr NW Girls	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd FIr NW Girls	377	SF	6	10+ years	
	Floor Drain	2nd FIr NW Girls	1	EA	7	10+ years	
	Hand Dryer	2nd FIr NW Girls	1	EA	7	6-10 years	
	Lavatory	2nd FIr NW Girls	4	EA	6	10+ years	
	Lighting - Lay-in	2nd FIr NW Girls	11	EA	7	6-10 years	
	Partitions	2nd FIr NW Girls	7	EA	5	10+ years	
	Walls - Structural Glazed Tile	2nd FIr NW Girls	694	SF	7	10+ years	
	Water Closet	2nd FIr NW Girls	7	EA	6	10+ years	
	Accessories	2nd FIr SW Boys	377	SF	5	6-10 years	
	Ceiling - Plaster/Drywall	2nd Flr SW Boys	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Flr SW Boys	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd Flr SW Boys	377	SF	6	10+ years	
	Floor Drain	2nd Flr SW Boys	1	EA	7	10+ years	
	Hand Dryer	2nd Flr SW Boys	1	EA	7	6-10 years	
	Lavatory	2nd Flr SW Boys	4	EA	6	10+ years	
	Lighting - Lay-in	2nd Flr SW Boys	11	EA	7	6-10 years	
	Partitions	2nd Flr SW Boys	4	EA	5	10+ years	
	Urinals	2nd Flr SW Boys	5	EA	6	10+ years	
	Walls - Structural Glazed Tile	2nd Flr SW Boys	694	SF	7	10+ years	
	Water Closet	2nd Flr SW Boys	4	EA	6	10+ years	



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Accessories	301 SW Boys	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	301 SW Boys	377	SF	6	10+ years	
	Doors - Transom Window	301 SW Boys	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	301 SW Boys	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	301 SW Boys	377	SF	7	10+ years	
	Floor Drain	301 SW Boys	1	EA	7	10+ years	
	Hand Dryer	301 SW Boys	1	EA	7	6-10 years	
	Lavatory	301 SW Boys	4	EA	6	10+ years	
	Lighting - Lay-in	301 SW Boys	11	EA	7	6-10 years	
	Partitions	301 SW Boys	4	EA	5	2-5 years	
	Urinals	301 SW Boys	5	EA	7	10+ years	
	Walls - Structural Glazed Tile	301 SW Boys	694	SF	7	10+ years	
	Water Closet	301 SW Boys	4	EA	6	10+ years	
	Accessories	302 Male staff	82	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	302 Male staff	82	SF	7	10+ years	
	Doors - Wood Doors inclu hw	302 Male staff	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	302 Male staff	82	SF	7	10+ years	
	Lavatory	302 Male staff	1	EA	6	10+ years	
	Lighting - Lay-in	302 Male staff	1	EA	7	6-10 years	
	Partitions	302 Male staff	1	EA	7	10+ years	
	Urinals	302 Male staff	1	EA	7	10+ years	
	Walls - Plaster/Drywall	302 Male staff	283	SF	7	10+ years	
	Water Closet	302 Male staff	1	EA	7	10+ years	
	Accessories	305 SE Girls	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	305 SE Girls	377	SF	6	10+ years	
	Doors - Transom Window	305 SE Girls	9	SF	6	10+ years	
	Doors - Wood Doors inclu hw	305 SE Girls	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	305 SE Girls	377	SF	7	10+ years	
	Floor Drain	305 SE Girls	1	EA	7	10+ years	
	Hand Dryer	305 SE Girls	1	EA	7	6-10 years	
	Lavatory	305 SE Girls	4	EA	6	10+ years	
	Lighting - Lay-in	305 SE Girls	10	EA	7	6-10 years	
	Lighting - Lay-in	305 SE Girls	1	EA	6	1-2 years	Not working
	Partitions	305 SE Girls	8	EA	7	10+ years	3
	Walls - Structural Glazed Tile	305 SE Girls	694	SF	7	10+ years	
	Water Closet	305 SE Girls	8	EA	7	10+ years	
	Accessories	306 Women's Staff Toilet	83	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	306 Women's Staff Toilet	83	SF	7	10+ years	
	Doors - Wood Doors inclu hw	306 Women's Staff Toilet	1	ĒA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	306 Women's Staff Toilet	83	SF	7	10+ years	
	Hand Dryer	306 Women's Staff Toilet	1	EA	7	6-10 years	
	Lavatory	306 Women's Staff Toilet	1	EA	6	10+ years	
	Lighting - Lay-in	306 Women's Staff Toilet	1	EA	7	6-10 years	
	Partitions	306 Women's Staff Toilet	2	EA	7	10+ years	
			2	L/ \	,	ior yourd	



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Structural Glazed Tile	306 Women's Staff Toilet	283	SF	7	10+ years	
	Water Closet	306 Women's Staff Toilet	2	EA	7	10+ years	
	Accessories	309 NW Girls	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	309 NW Girls	377	SF	7	10+ years	
	Doors - Wood Doors inclu hw	309 NW Girls	2	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	309 NW Girls	377	SF	6	10+ years	
	Floor Drain	309 NW Girls	1	EA	7	10+ years	
	Hand Dryer	309 NW Girls	1	EA	7	6-10 years	
	Lavatory	309 NW Girls	4	EA	6	10+ years	
	Lighting - Lay-in	309 NW Girls	. 11	EA	6	6-10 years	
	Partitions	309 NW Girls	7	EA	7	10+ years	
	Walls - Structural Glazed Tile	309 NW Girls	694	SF	7	10+ years	
	Walls - Structural Glazed The Water Closet	309 NW Girls	094 7	EA		-	
					7	10+ years	
	Accessories	3rd NE Boys	377	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	3rd NE Boys	377	SF	6	10+ years	
	Doors - Wood Doors inclu hw	3rd NE Boys	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	3rd NE Boys	377	SF	7	10+ years	
	Floor Drain	3rd NE Boys	1	EA	7	10+ years	
	Hand Dryer	3rd NE Boys	1	EA	7	6-10 years	
	Lavatory	3rd NE Boys	4	EA	6	10+ years	
	Lighting - Lay-in	3rd NE Boys	11	EA	6	6-10 years	
	Partitions	3rd NE Boys	3	EA	7	6-10 years	
	Urinals	3rd NE Boys	5	EA	7	10+ years	
	Walls - Structural Glazed Tile	3rd NE Boys	694	SF	7	10+ years	
	Water Closet	3rd NE Boys	3	EA	7	10+ years	
	Accessories	B15A Engineer's Toilet/Locker	105	SF	7	6-10 years	
	//000000100	Room	100	01	,	o royouro	
	Ceiling - Plaster/Drywall	B15A Engineer's Toilet/Locker	105	SF	6	10+ years	
	Centrig - Flaster/Drywan	Room	105	01	0	TO+ years	
	Doors - Wood Doors inclu hw	B15A Engineer's Toilet/Locker	1	EA	6	10, 10000	
	Doors - wood Doors Inclu nw		I	EA	0	10+ years	
		Room	105	05	~	10	
	Floor - Tile Ceramic/ Porcelain	B15A Engineer's Toilet/Locker	105	SF	6	10+ years	
		Room	-		_		
	Floor Drain	B15A Engineer's Toilet/Locker	2	EA	7	10+ years	
		Room					
	Lavatory	B15A Engineer's Toilet/Locker	1	EA	6	10+ years	
		Room					
	Lighting - Lay-in	B15A Engineer's Toilet/Locker	2	EA	6	6-10 years	
		Room					
	Lighting - Pendent/Surface	B15A Engineer's Toilet/Locker	2	EA	6	6-10 years	
		Room				2	
	Lighting - Wall Mounted	B15A Engineer's Toilet/Locker	1	EA	6	10+ years	
		Room		_/ `	Ũ	.e. youro	
	Partitions	B15A Engineer's Toilet/Locker	1	EA	7	10+ years	
		DTOR Engineer 3 Toller Looker	1	LA	'	ior years	



Catego	ry : Room		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ohannan	Room	4	F A	7	10	
	Showers	B15A Engineer's Toilet/Locker	1	EA	7	10+ years	
	Student Lockers - One Tier	Room B15A Engineer's Toilet/Locker	6	EA	7	10+ years	
	Student Lockers - One her	Room	0	LA	'	TOF years	
	Urinals	B15A Engineer's Toilet/Locker	1	EA	6	10+ years	
		Room			-	,	
	Walls - Structural Glazed Tile	B15A Engineer's Toilet/Locker	459	SF	6	10+ years	
		Room					
	Water Closet	B15A Engineer's Toilet/Locker	1	EA	6	10+ years	
	Accessories	Room B16A Engineeria Tailat/Shower	69	<u>с</u> г	F	6 10 10000	
	Accessories	B16A Engineer's Toilet/Shower Room	68	SF	5	6-10 years	
	Ceiling - Plaster/Drywall	B16A Engineer's Toilet/Shower	68	SF	6	10+ years	
	Coming Place Plywan	Room	00	01	Ū	lot youro	
	Doors - Wood Doors inclu hw	B16A Engineer's Toilet/Shower	1	EA	6	10+ years	
		Room					
	Floor - Tile Ceramic/ Porcelain	B16A Engineer's Toilet/Shower	68	SF	6	10+ years	
		Room			_	10	
	Floor Drain	B16A Engineer's Toilet/Shower	2	EA	7	10+ years	
	Lavatory	Room B16A Engineer's Toilet/Shower	1	EA	6	10+ years	
	Lavalory	Room	I	EA	0	10+ years	
	Lighting - Lay-in	B16A Engineer's Toilet/Shower	1	EA	6	6-10 years	
	3 3 3	Room				- ,	
	Lighting - Wall Mounted	B16A Engineer's Toilet/Shower	1	EA	6	6-10 years	
		Room			_		
	Partitions	B16A Engineer's Toilet/Shower	1	EA	7	10+ years	
	Showers	Room B16A Engineer's Toilet/Shower	1	EA	4	1-2 years	Disassembled
	Showers	Room	I	EA	4	I-2 years	Disassembled
	Walls - Structural Glazed Tile	B16A Engineer's Toilet/Shower	276	SF	7	10+ years	
		Room	2.0	•	•	let yeare	
	Water Closet	B16A Engineer's Toilet/Shower	1	EA	7	10+ years	
		Room				-	
	Accessories	B17 Mens Toilet/Locker Room	535	SF	5	6-10 years	
	Ceiling - Plaster/Drywall	B17 Mens Toilet/Locker Room	535	SF	6	10+ years	
	Doors - Wood Doors inclu hw	B17 Mens Toilet/Locker Room	2	EA	6	10+ years	
	Floor - Tile	B17 Mens Toilet/Locker Room	334	SF	5	10+ years	
	Floor - Tile	B17 Mens Toilet/Locker Room	1	SF	4	1-2 years	Damaged tile
	Floor - Tile Ceramic/ Porcelain	B17 Mens Toilet/Locker Room	200	SF	6	10+ years	
	Floor Drain	B17 Mens Toilet/Locker Room	3	EA	7	10+ years	
	Hand Dryer	B17 Mens Toilet/Locker Room	1	EA	7	6-10 years	
	Lavatory	B17 Mens Toilet/Locker Room	2	EA	5	6-10 years	



Catego	ry : Room		В	uilding	: Main-E	Building A	4959 S AICHELAVENDE, CHICAGO, IL 60652
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Lighting - Lay-in	B17 Mens Toilet/Locker Room	2	EA	6	1-2 years	Not working
	Lighting - Lay-in	B17 Mens Toilet/Locker Room	4	EA	6	6-10 years	
	Lighting - Wall Mounted	B17 Mens Toilet/Locker Room	1	EA	6	6-10 years	
	Partitions	B17 Mens Toilet/Locker Room	2	EA	7	10+ years	
	Showers	B17 Mens Toilet/Locker Room	1	EA	7	10+ years	
	Student Lockers - One Tier	B17 Mens Toilet/Locker Room	39	EA	6	10+ years	
	Urinals	B17 Mens Toilet/Locker Room	2	EA	7	10+ years	
	Walls - Structural Glazed Tile	B17 Mens Toilet/Locker Room	1,524	SF	6	10+ years	
	Water Closet	B17 Mens Toilet/Locker Room	2	EA	6	10+ years	
	Water Closet	B17 Mens Toilet/Locker Room	1	EA	4	1-2 years	Out of service
	Accessories	B18 Womens Toilet/Locker Room	145	SF	5	6-10 years	
	Ceiling - Plaster/Drywall	B18 Womens Toilet/Locker Room	145	SF	6	10+ years	
	Doors - Wood Doors inclu hw	B18 Womens Toilet/Locker Room	2	EA	6	10+ years	
	Floor - Tile	B18 Womens Toilet/Locker Room	119	SF	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	B18 Womens Toilet/Locker Room	26	SF	6	10+ years	
	Lavatory	B18 Womens Toilet/Locker Room	1	EA	6	6-10 years	
	Lighting - Lay-in	B18 Womens Toilet/Locker Room	3	EA	6	6-10 years	
	Lighting - Wall Mounted	B18 Womens Toilet/Locker Room	1	EA	6	6-10 years	
	Student Lockers - One Tier	B18 Womens Toilet/Locker Room	5	EA	6	10+ years	
	Walls - Structural Glazed Tile	B18 Womens Toilet/Locker Room	628	SF	7	10+ years	
	Water Closet	B18 Womens Toilet/Locker Room	1	EA	7	10+ years	
	Accessories	B6 - Men's staff toilet and locker	143	SF	7	6-10 years	
	Osilia a Disstan/Danua II	room	4.40	05	7	10	
	Ceiling - Plaster/Drywall	B6 - Men's staff toilet and locker	143	SF	7	10+ years	
	Deere Meed Deere included	room	4	Γ.	<u>^</u>	10	
	Doors - Wood Doors inclu hw	B6 - Men's staff toilet and locker	1	EA	6	10+ years	
	Floor Tile Coromia/ Doroclain	room DG Man's stoff tailet and lasker	107	SF	c	10, , , , , , , , , , , , , , , , , , ,	
	Floor - Tile Ceramic/ Porcelain	B6 - Men's staff toilet and locker	137	эг	6	10+ years	
	Fleer Tile Coremie/ Dereclein	room	0	SF	4	1.0	Minning tile
	Floor - Tile Ceramic/ Porcelain	B6 - Men's staff toilet and locker	6	55	4	1-2 years	Missing tile
	Floor Drain	room R6 Man's stoff tailet and lasker	1	EA	7	10	
		B6 - Men's staff toilet and locker	1	EA	1	10+ years	
	Hand Driver	room DG Man's stoff tailet and lasker	1	EA	7	6 10 10000	
	Hand Dryer	B6 - Men's staff toilet and locker	1	EA	7	6-10 years	
	Lovoton.	room B6 - Men's staff toilet and locker	2	EA	6	10	
	Lavatory	room	Z	EA	0	10+ years	
	Lighting Low in	B6 - Men's staff toilet and locker	3	EA	7	6 10 years	
	Lighting - Lay-in	room	3	EA	1	6-10 years	
	Lighting - Wall Mounted	B6 - Men's staff toilet and locker	1	EA	6	6-10 years	
	Lighting - Wall Mounted		I	LA	0	0-10 years	
	Partitions	room B6 - Men's staff toilet and locker	1	EA	5	10+ years	
		room	1	EA	5	iut years	
	Student Lockers - One Tier	B6 - Men's staff toilet and locker	9	EA	7	10+ years	
	Student Lockers - One ner		9	LA	1	IUT years	



Catego	ry : Room		В	uilding	: Main-E	Building A		
		Recommend						
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Urinals	room B6 - Men's staff toilet and locker room	1	EA	7	10+ years		
	Walls - Structural Glazed Tile	B6 - Men's staff toilet and locker room	474	SF	7	10+ years		
	Water Closet	B6 - Men's staff toilet and locker room	1	EA	6	10+ years		
	Accessories	B7 Women's Staff Toilet/Locker Room	271	SF	7	6-10 years		
	Ceiling - Plaster/Drywall	B7 Women's Staff Toilet/Locker Room	271	SF	6	10+ years		
	Doors - Wood Doors inclu hw	B7 Women's Staff Toilet/Locker Room	1	EA	6	10+ years		
	Floor - Tile	B7 Women's Staff Toilet/Locker Room	125	SF	6	10+ years		
	Floor - Tile Ceramic/ Porcelain	B7 Women's Staff Toilet/Locker Room	146	SF	6	10+ years		
	Floor Drain	B7 Women's Staff Toilet/Locker Room	1	EA	7	10+ years		
	Hand Dryer	B7 Women's Staff Toilet/Locker Room	1	EA	7	6-10 years		
	Lavatory	B7 Women's Staff Toilet/Locker Room	2	EA	6	6-10 years		
	Lighting - Lay-in	B7 Women's Staff Toilet/Locker Room	5	EA	6	6-10 years		
	Lighting - Wall Mounted	B7 Women's Staff Toilet/Locker Room	1	EA	6	6-10 years		
	Partitions	B7 Women's Staff Toilet/Locker Room	2	EA	7	10+ years		
	Student Lockers - One Tier	B7 Women's Staff Toilet/Locker Room	32	EA	7	10+ years		
	Walls - Structural Glazed Tile	B7 Women's Staff Toilet/Locker Room	699	SF	7	10+ years		
	Water Closet	B7 Women's Staff Toilet/Locker Room	2	EA	6	10+ years		

Category : Classroom	B	Building : Main-Building A				
Group Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
Group Item - Type Classroom #143 Web Design (Computer Lab)	Location	Quantity		Rallk	Replacement	Comments
Ciassicom #145 Web Design (Computer Lab) Ceiling - Lay-in	1st Floor	2,052	SF	6	10+ years	
Doors - Side-lite	1st Floor	36	SF	7	10+ years	
Doors - Transom Window	1st Floor	25	SF	7	10+ years	
Doors - Wood Doors inclu hw	1st Floor	4	EA	7	10+ years	



atego	ry : Classroom		В	Building : Main-Building A					
						Recommend			
iroup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Floor - Tile	1st Floor	2,052	SF	6	10+ years			
	Lighting - Lay-in	1st Floor	70	EA	6	6-10 years			
	Marker Board	1st Floor	20	LF	6	6-10 years			
	Storage/ Closet	1st Floor	181	SF	7	10+ years			
	Walls - Concrete Block	1st Floor	180	SF	7	10+ years			
	Walls - Metal Panel	1st Floor	1,562	SF	7	10+ years			
	Wireless System	1st Floor	1	EA	7	6-10 years			
laceror	om #144 Elect Lab (Regular Classroom)								
1855100	Ceiling - Lay-in	1st Floor	1,225	SF	6	10+ years			
	Doors - Side-lite	1st Floor	36	SF					
					7	10+ years			
	Doors - Transom Window	1st Floor	40	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	5	EA	6	10+ years			
	Floor - Tile	1st Floor	1,225	SF	6	10+ years			
	Lighting - Pendent/Surface	1st Floor	40	EA	6	6-10 years			
	Marker Board	1st Floor	10	LF	6	6-10 years			
	Storage/ Closet	1st Floor	181	SF	7	10+ years			
	Walls - Concrete Block	1st Floor	120	SF	7	10+ years			
	Walls - Metal Panel	1st Floor	856	SF	6	10+ years			
	Walls - Plaster/Drywall	1st Floor	348	SF	6	10+ years			
lassroc	om #145 (Regular Classroom)								
	Ceiling - Lay-in	1st Floor	1,002	SF	6	10+ years			
	Doors - Transom Window	1st Floor	10	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	2	EA	6	10+ years			
	Floor - Carpet	1st Floor	1,002	SF	5	6-10 years			
	Lighting - Pendent/Surface	1st Floor	3	EA	6	1-2 years	Not working		
	Lighting - Pendent/Surface	1st Floor	35	EA	6	6-10 years	Not working		
	Marker Board	1st Floor	16	LF	6	6-10 years			
	Storage/ Closet	1st Floor	90	SF	7				
	Walls - Concrete Block	1st Floor	90 60	SF	7	10+ years			
		1st Floor		SF		10+ years			
	Walls - Metal Panel		904		6	10+ years			
	Walls - Plaster/Drywall	1st Floor	298	SF	7	10+ years			
	Wireless System	1st Floor	1	EA	7	6-10 years			
assroc	om #146 (Regular Classroom)								
	Ceiling - Lay-in	1st Floor	632	SF	6	10+ years			
	Doors - Side-lite	1st Floor	17	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	1	EA	6	10+ years			
	Floor - Tile	1st Floor	632	SF	6	10+ years			
	Lighting - Pendent/Surface	1st Floor	23	ĒA	6	6-10 years			
	Marker Board	1st Floor	18	LF	7	6-10 years			



Category : Classroom			В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Walls - Metal Panel	1st Floor	990	SF	6	10+ years			
lassroo	m #147 (Regular Classroom)	 .							
	Ceiling - Lay-in	1st Floor	793	SF	6	10+ years			
	Chalk Board	1st Floor	5	LF	4	2-5 years			
	Doors - Wood Doors inclu hw	1st Floor	1	EA	6	10+ years			
	Floor - Tile	1st Floor	793	SF	6	10+ years			
	Lighting - Pendent/Surface	1st Floor	28	EA	7	6-10 years			
	Lighting - Pendent/Surface	1st Floor	6	EA	6	1-2 years	Not working		
	Marker Board	1st Floor	10	LF	7	6-10 years			
	Walls - Concrete Block	1st Floor	454	SF	6	10+ years			
	Walls - Metal Panel	1st Floor	493	SF	6	10+ years			
	Walls - Plaster/Drywall	1st Floor	250	SF	6	10+ years			
lassroo	m #148 DigitalDsgn (Computer Lab)	4 / - 1			_	10			
	Ceiling - Lay-in	1st Floor	2,234	SF	7	10+ years			
	Doors - Side-lite	1st Floor	20	SF	7	10+ years			
	Doors - Transom Window	1st Floor	18	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	3	EA	6	10+ years			
	Floor - Tile	1st Floor	2,234	SF	7	10+ years			
	Lighting - Pendent/Surface	1st Floor	87	EA	6	6-10 years			
	Marker Board	1st Floor	16	LF	7	6-10 years			
	Storage/ Closet	1st Floor	538	SF	7	10+ years			
	Walls - Concrete Block	1st Floor	740	SF	7	10+ years			
	Walls - Metal Panel	1st Floor	1,253	SF	7	10+ years			
	Wireless System	1st Floor	1	EA	7	6-10 years			
Jassroo	<u>m #150 Photography (Laboratory/Shop)</u> Ceiling - Lay-in	1st Floor	734	SF	6	10+ years			
	Doors - Side-lite	1st Floor	36	SF	6 7				
						10+ years			
	Doors - Transom Window	1st Floor	15	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	6	EA	6	10+ years			
	Floor - Epoxy/ Painted	1st Floor	734	SF	7	10+ years			
	Lighting - Pendent/Surface	1st Floor	30	EA	6	6-10 years			
	Marker Board	1st Floor	5	LF	6	6-10 years			
	Storage/ Closet	1st Floor	231	SF	7	10+ years			
	Walls - Concrete Block	1st Floor	290	SF	7	10+ years			
	Walls - Metal Panel	1st Floor	900	SF	7	10+ years			
	Work Sink	1st Floor	2	EA	5	6-10 years			
	m #152 Comp/Elec (Computer Lab)								
lassroo									
lassroo	Ceiling - Lay-in	1st Floor	1,451	SF	6	10+ years			



Building : Main-Building A Category : Classroom Recommend **Replacement** Comments Group Item - Type Location Quantity UOM Rank Floor - Tile 1st Floor 1.451 SF 6 10+ vears 1st Floor 22 ΕA 7 6-10 vears Lighting - Lay-in Marker Board 1st Floor 16 LF 6 6-10 years Walls - Concrete Block 120 SF 7 1st Floor 10+ years SF Walls - Metal Panel 1st Floor 1,092 7 10+ years SF Walls - Plaster/Drywall 1st Floor 598 6 10+ years Wireless System ΕA 7 1st Floor 1 6-10 years Classroom #159 (Other Instructional Use) Casework 1st Floor LF 9 7 10+ years Ceiling - Lay-in 1st Floor 1,627 SF 7 10+ years Doors - Side-lite 1st Floor 12 SF 7 10+ years Doors - Transom Window 1st Floor 15 SF 7 10+ years Doors - Wood Doors inclu hw 1st Floor 1 ΕA 6 10+ years Floor - Tile 1.627 SF 7 1st Floor 10+ vears Lighting - Lay-in 1st Floor 30 EΑ 7 6-10 years 8 LF 7 Marker Board 1st Floor 6-10 years SF Walls - Concrete Block 1st Floor 760 7 10+ years SF 7 Walls - Plaster/Drywall 1st Floor 693 10+ years Work Sink 1st Floor ΕA 7 1 10+ years Classroom #160 (Regular Classroom) Ceiling - Lay-in SF 1st Floor 1,434 6 10+ years Doors - Side-lite SF 7 1st Floor 12 10+ years Doors - Wood Doors inclu hw 1st Floor 2 ΕA 6 10+ years Floor - Tile 1st Floor SF 6 10+ years 1,434 Lighting - Lay-in 1st Floor 23 ΕA 7 6-10 years ΕA Lighting - Lay-in 1st Floor 6 1-2 years 1 Not working Marker Board 1st Floor 13 LF 6 6-10 vears SF Walls - Concrete Block 1st Floor 200 7 10+ years Walls - Plaster/Drywall SF 1st Floor 1,292 6 10+ years Classroom #161 (Regular Classroom) Ceiling - Lay-in 1st Floor 1,453 SF 6 10+ years LF Chalk Board 1st Floor 6 4 2-5 years Doors - Wood Doors inclu hw 1st Floor 1 EΑ 6 10+ vears Floor - Tile SF 1st Floor 1,452 6 10+ years Floor - Tile 1st Floor SF 4 1-2 years Missing tile 1 ΕA 6 1-2 years Lighting - Lay-in 1st Floor 1 Not working Lighting - Lay-in 58 ΕA 6 6-10 years 1st Floor Marker Board 5 LF 6 1st Floor 6-10 years Walls - Concrete Block 1st Floor 250 SF 7 10+ years SF Walls - Metal Panel 1st Floor 859 7 10+ years



Catego	ry : Classroom		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Plaster/Drywall	1st Floor	478	SF	6	10+ years	
Clease	m #462 (Computer Leb)						
	om #162 (Computer Lab)		10				
	Casework	1st Floor	12	LF	6	10+ years	
	Ceiling - Lay-in	1st Floor	1,234	SF	6	10+ years	
	Doors - Side-lite	1st Floor	17	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	1	EA	6	10+ years	
	Floor - Tile	1st Floor	1,234	SF	6	10+ years	
	Lighting - Lay-in	1st Floor	48	EA	7	6-10 years	
	Marker Board	1st Floor	10	LF	6	6-10 years	
	Walls - Concrete Block	1st Floor	870	SF	6	10+ years	
	Walls - Metal Panel	1st Floor	474	SF	6	10+ years	
	Work Sink	1st Floor	3	EA	7	10+ years	
Classroo	om #163 Woodworking (Laboratory/Shop)						
	Ceiling - Exposed	1st Floor	2,914	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor	2,011	EA	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	2	EA	6	10+ years	
	Floor - Concrete	1st Floor	2,914	SF	5	1-2 years	Cracking floor
	Lighting - Pendent/Surface	1st Floor	2,014	EA	6	1-2 years	Not working
	Lighting - Pendent/Surface	1st Floor	67	EA	6	6-10 years	Not working
	Storage/ Closet	1st Floor	423	SF	7	10+ years	
	Walls - Concrete Block	1st Floor	2.098	SF	6	10+ years	
	Walls - Concrete Block	1st Floor	2,000	SF	4	1-2 years	Hole in block wall
	Work Sink	1st Floor	2 3	EA	7	10+ years	
	WOR Sink	13(1100)	5	LA	,	TOF years	
Classroo	om #164 Metal (Other Instructional Use)						
	Ceiling - Exposed	1st Floor	2,817	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor	6	EA	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	3	EA	6	10+ years	
	Floor - Concrete Epoxy/ Painted	1st Floor	2,817	SF	7	10+ years	
	Lighting - Pendent/Surface	1st Floor	66	EA	6	6-10 years	
	Lighting - Pendent/Surface	1st Floor	9	EA	6	1-2 years	Not working
	Storage/ Closet	1st Floor	286	SF	7	10+ years	
	Walls - Concrete Block	1st Floor	2,384	SF	7	10+ years	
	Work Sink	1st Floor	3	EA	7	10+ years	
Classroo	om #165 TV Studio (Computer Lab)						
	Ceiling - Lay-in	1st Floor	422	SF	6	10+ years	
	Ceiling - Splined	1st Floor	1,119	SF	6	10+ years	
	Ceiling - Splined	1st Floor	100	SF	5	1-2 years	Missing tile
	Doors - Wood Doors inclu hw	1st Floor	5	EA	6	10+ years	
	Floor - Tile	1st Floor	1,641	SF	6	10+ years	
		13(1100)	1,041	0.	0	ior years	



Category : Classroom			В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Lighting - Lay-in	1st Floor	9	EA	7	6-10 years			
	Lighting - Pendent/Surface	1st Floor	15	EA	6	6-10 years			
	Marker Board	1st Floor	8	LF	7	6-10 years			
	Storage/ Closet	1st Floor	54	SF	7	10+ years			
	Walls - Concrete Block	1st Floor	1,614	SF	7	10+ years			
	Walls - Plaster/Drywall	1st Floor	346	SF	7	10+ years			
Classroo	m #166 Automotive (Autoshop)								
	Casework	1st Floor	19	LF	7	10+ years			
	Ceiling - Plaster/Drywall	1st Floor	3,960	SF	6	10+ years			
	Doors - Steel Doors incl hw	1st Floor	2	EA	6	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	3	EA	6	10+ years			
	Floor - Concrete Epoxy/ Painted	1st Floor	3,960	SF	7	10+ years			
	Lighting - Metal Halide/Sodium Vapor	1st Floor	35	ĒA	7	6-10 years			
	Lighting - Pendent/Surface	1st Floor	3	EA	7	6-10 years			
	Storage/ Closet	1st Floor	977	SF	5	10+ years			
	Student Lockers - One Tier	1st Floor	3	EA	6	10+ years			
	Student Lockers - Two Tiers	1st Floor	98	EA	6	10+ years			
	Walls - Concrete Block	1st Floor	3,602	SF	6	10+ years			
	Work Sink	1st Floor	2	EA	5	6-10 years			
Classroo	m #167 (Other Instructional Use)								
01005100	Ceiling - Lay-in	1st Floor	954	SF	6	10+ years			
	Doors - Steel Doors incl hw	1st Floor		EA	6 7	•			
	Doors - Wood Doors inclu hw	1st Floor	1			10+ years			
			1	EA	6	10+ years			
	Floor - Tile	1st Floor	953	SF SF	6	10+ years	Domogod tilo		
	Floor - Tile	1st Floor 1st Floor	1 35	EA	4	1-2 years	Damaged tile		
	Lighting - Lay-in				6	6-10 years			
	Walls - Concrete Block	1st Floor	510	SF SF	6	10+ years			
	Walls - Metal Panel	1st Floor	560	SF	6	10+ years			
Classroo	m #168 (Other Instructional Use)								
	Ceiling - Lay-in	1st Floor	974	SF	6	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	2	EA	6	10+ years			
	Floor - Tile	1st Floor	971	SF	6	10+ years			
	Floor - Tile	1st Floor	3	SF	4	1-2 years	Damaged tile		
	Lighting - Lay-in	1st Floor	20	EA	6	6-10 years			
	Marker Board	1st Floor	12	LF	7	6-10 years			
	Walls - Concrete Block	1st Floor	190	SF	7	10+ years			
	Walls - Metal Panel	1st Floor	727	SF	6	10+ years			
	Walls - Plaster/Drywall	1st Floor	200	SF	6	10+ years			



Catego	ry : Classroom		Building : Main-Building A						
				Recommend					
iroup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Ceiling - Lay-in	2nd Floor	750	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	10	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	6	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years			
	Floor - Tile	2nd Floor	750	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	14	ĒA	6	6-10 years			
	Marker Board	2nd Floor	12	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	172	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	720	SF	6	10+ years			
lassroc	om #233 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	1,140	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	10	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	6	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6				
			•	EA SF	6 6	10+ years			
	Floor - Tile	2nd Floor	1,140		-	10+ years			
	Lighting - Lay-in	2nd Floor	18	EA	6	6-10 years			
	Marker Board	2nd Floor	16	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	188	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	1,120	SF	6	10+ years			
Classroc	m #235E (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	951	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	20	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	12	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years			
	Floor - Tile	2nd Floor	951	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	17	EA	6	6-10 years			
	Marker Board	2nd Floor	13	LF	6	6-10 years			
	Storage/ Closet	2nd Floor	81	SF	5	10+ years			
	Walls - Metal Panel	2nd Floor	1,060	SF	6	10+ years			
	Wireless System	2nd Floor	1,000	EA	7	6-10 years			
Classroo	m #241 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	1,384	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years			
	Floor - Carpet	2nd Floor	1,384	SF	4	0-1 year	Torn		
	Lighting - Lay-in	2nd Floor	26	EA	6	6-10 years			
	Walls - Concrete Block	2nd Floor	250	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	1,250	SF	6	10+ years			
Classroo	om #243 (Regular Classroom)								



atego	ry : Classroom		В	uilding	: Main-E	Building A	
						Recommend	
roup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
-	Ceiling - Lay-in	2nd Floor	6	SF	5	1-2 years	Water damage
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years	3
	Doors - Steel Doors incl hw	2nd Floor	1	EA	7	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years	
	Marker Board	2nd Floor	16	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	334	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	495	SF	6	10+ years	
		21011001	100	01	Ū	lot youro	
assroo	om #244 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years	
	Doors - Side-lite	2nd Floor	10	SF	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years	
	Floor - Tile	2nd Floor	728	SF	6	10+ years	
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Cracked chipped
	Lighting - Lay-in	2nd Floor	15	ĒA	6	6-10 years	
	Marker Board	2nd Floor	16	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	799	SF	6	10+ years	
						,	
lassroo	om #245 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	722	SF	6	10+ years	
	Ceiling - Lay-in	2nd Floor	16	SF	4	0-1 year	Water damage
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years	
	Marker Board	2nd Floor	15	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	695	SF	6	10+ years	
assroo	om #248 (Regular Classroom)					10	
	Ceiling - Lay-in	2nd Floor	722	SF	6	10+ years	
	Ceiling - Lay-in	2nd Floor	16	SF	4	0-1 year	Water damage
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years	
	Marker Board	2nd Floor	13	LF	6	6-10 years	



Catego	ory : Classroom		В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	570	SF	6	10+ years			
lassro	om #249 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years			
	Marker Board	2nd Floor	15	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	579	SF	6	10+ years			
Classroo	om #250 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	400	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	2	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	400	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	8	EA	6	6-10 years			
	Marker Board	2nd Floor	20	LF	6	6-10 years			
	Walls - Metal Panel	2nd Floor	510	SF	6	10+ years			
Classroo	om #252 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	400	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	400	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	8	EA	6	6-10 years			
	Marker Board	2nd Floor	20	LF	6	6-10 years			
	Walls - Metal Panel	2nd Floor	559	SF	6	10+ years			
lassro	om #253 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years			
	Marker Board	2nd Floor	13	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years			



Categor	ry : Classroom		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Metal Panel	2nd Floor	559	SF	6	10+ years	
Classroo	m #254 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years	
	Marker Board	2nd Floor	16	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	799	SF	6	10+ years	
Classroo	m #255 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	600	SF	6	10+ years	
	Doors - Side-lite	2nd Floor	10	SF	6	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	2	EA	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Floor - Tile	2nd Floor	600	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	12	EA	6	6-10 years	
	Marker Board	2nd Floor	17	LF	7	6-10 years	
	Walls - Metal Panel	2nd Floor	610	SF	6	10+ years	
Classroo	m #257 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years	
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years	
	Marker Board	2nd Floor	13	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	600	SF	6	10+ years	
Classroo	m #258 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	730	SF	6	10+ years	
	Ceiling - Lay-in	2nd Floor	8	SF	4	0-1 year	Water damage
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years	-
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years	
	Marker Board	2nd Floor	12	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years	
	Walls - Metal Panel	2nd Floor	600	SF	6	10+ years	
Classroo	m #259 (Regular Classroom)						



Catego	ry : Classroom		В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Ceiling - Lay-in	2nd Floor	600	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	171	SF	7	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	600	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	12	EA	7	6-10 years			
	Marker Board	2nd Floor	12	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	130	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	465	SF	6	10+ years			
lassroc	om #260 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	ĒA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years			
	Marker Board	2nd Floor	12	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
Classroo	om #261 (Computer Lab)								
	Ceiling - Lay-in	2nd Floor	1,170	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	60	SF	7	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	1,170	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	12	EA	6	6-10 years			
	Marker Board	2nd Floor	13	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	456	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	390	SF	6	10+ years			
	Wireless System	2nd Floor	1	EA	7	6-10 years			
lassroc	om #262 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	722	SF	6	10+ years			
	Ceiling - Lay-in	2nd Floor	16	SF	4	0-1 year	Water damage		
	Doors - Side-lite	2nd Floor	10	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	728	SF	6	10+ years			
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Broken		
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years	Dioken		
	Marker Board	2nd Floor	14	LF	6	6-10 years			
	Marker Dualu	2110 1 1001	13	LF	0	U-TU years			



Catego	ry : Classroom		В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
Classroc	om #263 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years			
	Marker Board	2nd Floor	12	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
Classroc	om #264 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	ĒA	7	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Chipped broken		
	Lighting - Lay-in	2nd Floor	15	ĒA	7	6-10 years			
	Marker Board	2nd Floor	12	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
Classroc	om #265 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Floor - Tile	2nd Floor	12	SF	4	1-2 years	Chipped		
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years	- 1.1		
	Marker Board	2nd Floor	30	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	7	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
			0-0	0,	Ū	io: youro			
Classroc	om #266 (Regular Classroom)		700	05		10			
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years			



Catego	ry : Classroom		В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	14	EA	7	6-10 years			
	Marker Board	2nd Floor	18	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	SF	6	10+ years			
lassroc	m #267 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	3 1	EA	6	10+ years			
	Floor - Tile	2nd Floor	718	SF	6	10+ years			
	Floor - Tile	2nd Floor	20	SF	4	1-2 years	Chipped		
	Lighting - Lay-in	2nd Floor	13	EA	4 6	•	Ompped		
	Marker Board	2nd Floor	13		6	6-10 years			
	Walls - Concrete Block	2nd Floor	12	SF	6 6	6-10 years			
				SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	840	ЪГ	0	10+ years			
lassroo	m #268 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	6	10+ years			
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years			
	Marker Board	2nd Floor	12	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	795	SF	6	10+ years			
Classroo	m #269 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	9	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	11	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years			
	Floor - Tile	2nd Floor	730	SF	6	10+ years			
	Floor - Tile	2nd Floor	8	SF	4	1-2 years	Chipped		
	Lighting - Lay-in	2nd Floor	o 14	EA	4	6-10 years	Оттррец		
		2nd Floor	14 14		7				
	Marker Board				-	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	765	SF	6	10+ years			
lassroc	m #270 (Computer Lab)								
	Ceiling - Lay-in	2nd Floor	1,492	SF	6	10+ years			



Catego	ry : Classroom		Building : Main-Building A					
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Ceiling - Lay-in	2nd Floor	8	SF	4	0-1 year	Water damage	
	Doors - Side-lite	2nd Floor	10	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years		
	Floor - Carpet	2nd Floor	1,500	SF	6	6-10 years		
	Lighting - Lay-in	2nd Floor	27	EA	7	6-10 years		
	Walls - Concrete Block	2nd Floor	488	SF	7	10+ years		
	Walls - Metal Panel	2nd Floor	580	SF	7	10+ years		
	Wireless System	2nd Floor	1	EA	7	6-10 years		
lassroo	om #271 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years		
	Doors - Side-lite	2nd Floor	11	SF	6	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	-	ĒA	6	10+ years		
	Floor - Tile	2nd Floor	738	SF	6	10+ years		
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years		
	Marker Board	2nd Floor	8	LF	6	6-10 years		
	Walls - Concrete Block	2nd Floor	120	SF	6	10+ years		
	Walls - Metal Panel	2nd Floor	980	SF	6	10+ years		
2								
Jassroo	om #272 (Regular Classroom)		222	05	0	10		
	Ceiling - Lay-in	2nd Floor	600	SF	6	10+ years		
	Doors - Side-lite	2nd Floor	251	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	7	10+ years		
	Floor - Tile	2nd Floor	588	SF	6	10+ years		
	Floor - Tile	2nd Floor	12	SF	4	1-2 years	Chipped	
	Lighting - Lay-in	2nd Floor	12	EA	6	6-10 years		
	Marker Board	2nd Floor	15	LF	7	6-10 years		
	Walls - Metal Panel	2nd Floor	610	SF	6	10+ years		
lassroo	om #274 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years		
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years		
	Floor - Tile	2nd Floor	738	SF	6	10+ years		
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years		
	Marker Board	2nd Floor	8	LF	7	6-10 years		
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years		



Catego	ry : Classroom		В	uilding	: Main-E	Building A	
_				-		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Classroo	om #275 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years	
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years	
	Floor - Tile	2nd Floor	738	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years	
	Marker Board	2nd Floor	12	LF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	314	SF	7	10+ years	
	Walls - Metal Panel	2nd Floor	485	SF	7	10+ years	
Classroo	om #277 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	687	SF	6	10+ years	
	Doors - Side-lite	2nd Floor	22	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	18	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	7	10+ years	
	Floor - Tile	2nd Floor	687	SF	7	10+ years	
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Chipped
	Lighting - Metal Halide/Sodium Vapor	2nd Floor	12	EA	6	6-10 years	
	Marker Board	2nd Floor	7	LF	7	6-10 years	
	Walls - Metal Panel	2nd Floor	650	SF	6	10+ years	
Classroo	om #279 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	7	10+ years	
	Doors - Side-lite	2nd Floor	107	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years	
	Floor - Tile	2nd Floor	738	SF	7	10+ years	
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Chipped
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years	
	Marker Board	2nd Floor	20	LF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	120	SF	7	10+ years	
	Walls - Metal Panel	2nd Floor	603	SF	7	10+ years	
Classroo	om #280 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	738	SF	7	10+ years	
	Doors - Side-lite	2nd Floor	171	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years	
	Floor - Tile	2nd Floor	738	SF	7	10+ years	
	Lighting - Lay-in	2nd Floor	15	EA	7	6-10 years	
	Marker Board	2nd Floor	17	LF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	180	SF	7	10+ years	



Category : Classroom			В	Building : Main-Building A				
-						Recommend	0	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Walls - Metal Panel	2nd Floor	600	SF	7	10+ years		
Classroo	m #282 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	687	SF	6	10+ years		
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	7	10+ years		
	Floor - Tile	2nd Floor	675	SF	7	10+ years		
	Floor - Tile	2nd Floor	12	SF	4	1-2 years	Chipped	
	Lighting - Lay-in	2nd Floor	12	EA	7	6-10 years		
	Marker Board	2nd Floor	14	LF	7	6-10 years		
	Walls - Metal Panel	2nd Floor	650	SF	7	10+ years		
Classroo	m #284 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	738	SF	7	10+ years		
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years		
	Floor - Tile	2nd Floor	738	SF	7	10+ years		
	Lighting - Lay-in	2nd Floor	15	ĒA	7	6-10 years		
	Marker Board	2nd Floor	7	LF	7	6-10 years		
	Walls - Concrete Block	2nd Floor	190	SF	7	10+ years		
	Walls - Metal Panel	2nd Floor	663	SF	6	10+ years		
Classroo	m #285 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	738	SF	7	10+ years		
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years		
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years		
	Floor - Tile	2nd Floor	738	SF	7	10+ years		
	Lighting - Lay-in	2nd Floor	15	ĒA	6	6-10 years		
	Marker Board	2nd Floor	13	LF	7	6-10 years		
	Walls - Concrete Block	2nd Floor	150	SF	7	10+ years		
	Walls - Metal Panel	2nd Floor	795	SF	6	10+ years		
Classroo	m #286 (Regular Classroom)							
	Ceiling - Lay-in	2nd Floor	687	SF	6	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years		
	Floor - Tile	2nd Floor	687	SF	7	10+ years		
	Lighting - Lay-in	2nd Floor	15	EA	6	6-10 years		
	Marker Board	2nd Floor	12	LF	6	6-10 years		
			12			o io youio		



Catego	ry : Classroom		В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
Classroo	m #288 (Regular Classroom)								
	Ceiling - Lay-in	2nd Floor	730	SF	6	10+ years			
	Ceiling - Lay-in	2nd Floor	8	SF	4	0-1 year	Water damage		
	Chalk Board	2nd Floor	5	LF	4	2-5 years	-		
	Doors - Side-lite	2nd Floor	14	SF	6	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years			
	Floor - Tile	2nd Floor	738	SF	7	10+ years			
	Lighting - Lay-in	2nd Floor	14	EA	7	6-10 years			
	Marker Board	2nd Floor	8	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	280	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	705	SF	6	10+ years			
Classroo	m #289 (Regular Classroom)								
21000100	Ceiling - Lay-in	2nd Floor	696	SF	6	10+ years			
	Chalk Board	2nd Floor	12	LF	4	2-5 years			
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years			
	Floor - Tile	2nd Floor	696	SF	7	10+ years			
	Lighting - Lay-in	2nd Floor	14	EA	7	6-10 years			
	Marker Board	2nd Floor	12	LF	7	6-10 years			
	Walls - Concrete Block	2nd Floor	180	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	775	SF	6	10+ years			
Classroo	m #290 (Regular Classroom)								
01255100	Ceiling - Lay-in	2nd Floor	738	SF	6	10+ years			
	Doors - Side-lite	2nd Floor	11	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	5 1	EA	7	10+ years			
	Floor - Tile	2nd Floor	733	SF	7	10+ years			
	Floor - Tile	2nd Floor	5	SF	4	1-2 years	Chipped		
	Lighting - Lay-in	2nd Floor	14	EA	7	6-10 years	Chipped		
	Marker Board	2nd Floor	16	LF	6	6-10 years			
	Walls - Concrete Block	2nd Floor	314	SF	6	10+ years			
	Walls - Metal Panel	2nd Floor	485	SF	6	10+ years			
Classree	m #332 (Science Classroom)								
01035100	Ceiling - Lay-in	3rd Floor	1,314	SF	e	6 10 years			
		3rd Floor 3rd Floor		SF	6	6-10 years	Missing stained		
	Ceiling - Lay-in		12	-	4	1-2 years	Missing stained		
	Doors - Side-lite	3rd Floor 3rd Floor	11	SF	7	10+ years			
	Doors - Transom Window	3rd Floor	18 2	SF EA	7 7	10+ years			
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	1	10+ years			



Building : Main-Building A Category : Classroom Recommend Location Group Item - Type Quantity UOM Rank **Replacement** Comments Floor - Tile 3rd Floor 1.326 SF 6 10+ vears 3rd Floor 22 ΕA 7 6-10 years Lighting - Lay-in Walls - Concrete Block 3rd Floor 222 SF 6 10+ years Walls - Metal Panel 895 SF 3rd Floor 6 10+ years 7 Wireless System 3rd Floor 1 EΑ 6-10 years 5 Work Sink 3rd Floor ΕA 7 10+ years Classroom #334/335 (Regular Classroom) 3rd Floor LF Casework 24 6 10+ vears SF Ceiling - Lay-in 3rd Floor 2,716 6 10+ years Doors - Side-lite SF 7 3rd Floor 33 10+ years Doors - Transom Window 3rd Floor 36 SF 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 3 ΕA 7 10+ years Floor - Tile 3rd Floor 2.716 SF 6 10+ years 3rd Floor 7 6-10 years Lighting - Lay-in EΑ 51 Storage/ Closet 3rd Floor 432 SF 5 2-5 years Walls - Concrete Block SF 7 3rd Floor 300 10+ years SF Walls - Metal Panel 3rd Floor 935 6 10+ years Classroom #335A (Regular Classroom) Ceiling - Lay-in 3rd Floor 686 SF 6 10+ years LF Chalk Board 3rd Floor 8 4 2-5 years SF Doors - Side-lite 3rd Floor 11 7 10+ years SF 7 Doors - Transom Window 3rd Floor 13 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 EΑ 7 10+ years 3rd Floor SF 7 Floor - Tile 686 10+ vears Lighting - Lay-in 3rd Floor 16 EΑ 7 6-10 years Marker Board 5 LF 3rd Floor 6 6-10 years Storage/ Closet 3rd Floor 150 SF 7 10+ years Walls - Concrete Block SF 3rd Floor 150 6 10+ years Walls - Metal Panel SF 6 3rd Floor 850 10+ years Work Sink 3rd Floor 1 ΕA 5 6-10 years Classroom #336 (Computer Lab) Ceiling - Lay-in SF 3rd Floor 1.020 6 6-10 years SF Doors - Side-lite 3rd Floor 10 7 10+ vears Doors - Transom Window SF 3rd Floor 6 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 ΕA 7 10+ years Floor - Tile SF 3rd Floor 1,020 6 10+ years 3rd Floor ΕA 6 6-10 years Lighting - Lay-in 21 Marker Board LF 6 3rd Floor 25 6-10 years Walls - Concrete Block 3rd Floor 270 SF 7 10+ years SF Walls - Metal Panel 3rd Floor 950 6 10+ years



Category : Classroom			Building : Main-Building A				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Wireless System	3rd Floor	1	EA	7	6-10 years	
lassroc	om #336A (Computer Lab)		1.501			4.0	
	Ceiling - Lay-in	3rd Floor	1,521	SF	6	10+ years	
	Doors - Side-lite	3rd Floor	49	SF	7	10+ years	
	Doors - Steel Doors incl hw	3rd Floor	3	EA	7	10+ years	
	Doors - Transom Window	3rd Floor	30	SF	7	10+ years	
	Floor - Tile	3rd Floor	1,521	SF	6	10+ years	
	Lighting - Lay-in	3rd Floor	30	EA	7	6-10 years	
	Marker Board	3rd Floor	8	LF	6	6-10 years	
	Walls - Concrete Block	3rd Floor	250	SF	7	10+ years	
	Walls - Metal Panel	3rd Floor	1,175	SF	6	10+ years	
lassror	om #337 (Computer Lab)						
	Ceiling - Lay-in	3rd Floor	960	SF	6	6-10 years	
	Doors - Side-lite	3rd Floor	20	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	12	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	960	SF	6	•	
		3rd Floor		EA		10+ years	
	Lighting - Lay-in		18		7	6-10 years	
	Marker Board	3rd Floor	15	LF	6	6-10 years	
	Walls - Concrete Block	3rd Floor	100	SF	6	10+ years	
	Walls - Metal Panel	3rd Floor	1,106	SF	6	10+ years	
	Wireless System	3rd Floor	1	EA	7	6-10 years	
lassroo	om #338 (Computer Lab)						
	Ceiling - Lay-in	3rd Floor	986	SF	6	6-10 years	
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	986	SF	6	10+ years	
	Lighting - Lay-in	3rd Floor	17	ĒA	7	6-10 years	
	Lighting - Lay-in	3rd Floor	1	EA	6	1-2 years	Not working
	Marker Board	3rd Floor	30	LF	6	6-10 years	
	Walls - Metal Panel	3rd Floor	1,210	SF	6	10+ years	
	Wireless System	3rd Floor	1,210	EA	7	6-10 years	
						-	
Jassioo	om #339 (Computer Lab)	Ord Flace		0-	0	0.40	
	Ceiling - Lay-in	3rd Floor	686	SF	6	6-10 years	
	Doors - Side-lite	3rd Floor	22	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	18	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	686	SF	6	10+ years	



Building : Main-Building A Category : Classroom Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Lighting - Lay-in 3rd Floor 16 ΕA 6-10 years 7 Lighting - Lay-in 3rd Floor 2 ΕA 1-2 vears 6 Not working Marker Board 3rd Floor 12 LF 6 6-10 years Walls - Metal Panel 1,210 SF 6 3rd Floor 10+ years 7 Wireless System 3rd Floor 1 FA 6-10 years Classroom #340 (Science Lab Level 2) LF Casework 3rd Floor 140 6 10+ years SF Ceiling - Lay-in 3rd Floor 1.250 6 6-10 years SF Doors - Side-lite 3rd Floor 20 7 10+ years Doors - Transom Window 12 SF 7 3rd Floor 10+ years Doors - Wood Doors inclu hw 3rd Floor 2 EΑ 7 10+ years Eve Wash Station 3rd Floor ΕA 7 1 10+ years SF Floor - Tile 3rd Floor 1.250 6 10+ years Gas Line 3rd Floor ΕA 7 21 10+ vears Lighting - Lay-in 3rd Floor 19 FΑ 7 6-10 years 2 Lighting - Lay-in 3rd Floor FΑ 6 1-2 vears Not working LF Marker Board 3rd Floor 18 6 6-10 years ΕA Science Lab Fume Hood 3rd Floor 1 7 10+ years Science Lab Shower 3rd Floor ΕA 7 10+ years 1 SF Walls - Plaster/Drvwall 3rd Floor 1.405 6 10+ years Work Sink 3rd Floor 10 ΕA 7 10+ vears Classroom #341 (Computer Lab) Ceiling - Lay-in 3rd Floor 850 SF 6 10+ years Doors - Side-lite 3rd Floor 10 SF 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 ΕA 7 10+ years SF Floor - Tile 3rd Floor 850 6 10+ years Lighting - Lay-in 3rd Floor 17 EΑ 7 6-10 vears LF Marker Board 3rd Floor 17 6 6-10 years Walls - Concrete Block 360 SF 6 3rd Floor 10+ years SF Walls - Metal Panel 3rd Floor 820 7 10+ years Classroom #343 (Computer Lab) Ceiling - Lay-in SF 3rd Floor 1.488 6 10+ years SF Ceiling - Lav-in 3rd Floor 8 5 1-2 vears Stained tile Doors - Side-lite SF 7 3rd Floor 12 10+ years Doors - Transom Window 3rd Floor 9 SF 7 10+ years 2 ΕA 7 Doors - Wood Doors inclu hw 3rd Floor 10+ years Floor - Tile 3rd Floor SF 6 10+ years 1,496 FΑ 6 Lighting - Lay-in 3rd Floor 27 6-10 years Marker Board 3rd Floor 7 LF 6 6-10 years SF Walls - Concrete Block 3rd Floor 380 7 10+ years



Category : Classroom			Building : Main-Building A				
_						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Metal Panel	3rd Floor	1,130	SF	6	10+ years	
lassroo	m #346 (Science Lab Level 2)						
	Casework	3rd Floor	22	LF	6	10+ years	
	Ceiling - Lay-in	3rd Floor	1,110	SF	6	10+ years	
	Doors - Side-lite	3rd Floor	10	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
	Eye Wash Station	3rd Floor	1	EA	7	10+ years	
	Floor - Tile	3rd Floor	1,110	SF	6	10+ years	
	Gas Line	3rd Floor	16	EA	7	10+ years	
	Lighting - Lay-in	3rd Floor	34	EA	7	6-10 years	
	Lighting - Pendent/Surface	3rd Floor	4	EA	6	1-2 years	Not working
	Marker Board	3rd Floor	5	LF	6	6-10 years	
	Science Lab Fume Hood	3rd Floor	1	ĒA	7	10+ years	
	Science Lab Shower	3rd Floor	1	EA	7	6-10 years	
	Walls - Concrete Block	3rd Floor	202	SF	7	10+ years	
	Walls - Metal Panel	3rd Floor	820	SF	6	10+ years	
	Work Sink	3rd Floor	8	EA	7	10+ years	
	Work Sink	3rd Floor	1	EA	4	1-2 years	Not working
Classroo	m #347 (Science Lab Level 2)						
01233100	Casework	3rd Floor	20	LF	6	10+ years	
	Ceiling - Lay-in	3rd Floor	584	SF	6	10+ years	
	Ceiling - Lay-in	3rd Floor	16	SF	5	1-2 years	Stained tile
	Doors - Transom Window	3rd Floor	18	SF	7	10+ years	Stained the
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	600	SF	6	10+ years	
	Lighting - Lay-in	3rd Floor	11	EA	7	6-10 years	
	Marker Board	3rd Floor	10	LF	7	6-10 years	
	Walls - Concrete Block	3rd Floor	120	SF	7	•	
		3rd Floor	680	SF	7	10+ years	
	Walls - Metal Panel Work Sink	3rd Floor	2	EA	7	10+ years	
	WOR SIIK	310 F1001	2	EA	1	10+ years	
lassroc	m #349 (Science Lab Level 1)						
	Casework	3rd Floor	18	LF	6	10+ years	
	Ceiling - Lay-in	3rd Floor	1,234	SF	6	10+ years	
	Doors - Side-lite	3rd Floor	10	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
	Eye Wash Station	3rd Floor	1	EA	7	10+ years	
	Floor - Tile	3rd Floor	1,234	SF	6	10+ years	
	Gas Line	3rd Floor	6	EA	7	10+ years	



Category : Classroom			B	Building : Main-Building A				
				_		Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Lighting - Lay-in	3rd Floor	34	EA	7	6-10 years		
	Marker Board	3rd Floor	10	LF	6	6-10 years		
	Science Lab Fume Hood	3rd Floor	1	EA	6	6-10 years		
	Science Lab Shower	3rd Floor	1	EA	7	6-10 years		
	Walls - Concrete Block	3rd Floor	130	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	825	SF	6	10+ years		
	Work Sink	3rd Floor	8	EA	7	10+ years		
Classroo	m #350 (Science Lab Level 1)							
	Casework	3rd Floor	18	LF	6	10+ years		
	Ceiling - Lay-in	3rd Floor	888	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Eye Wash Station	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	883	SF	6	10+ years		
	Floor - Tile	3rd Floor	5	SF	4	1-2 years	Chipped tile	
	Gas Line	3rd Floor	16	EA	7	10+ years	Chipped life	
	Lighting - Lay-in	3rd Floor	31	EA	7	6-10 years		
	Marker Board	3rd Floor	12	LF	7	6-10 years		
	Science Lab Fume Hood	3rd Floor	12	EA	6	6-10 years		
	Science Lab Fullie Hood	3rd Floor		EA	7			
		3rd Floor	1 120	SF	7	6-10 years		
	Walls - Concrete Block			SF		10+ years		
	Walls - Metal Panel	3rd Floor	815		6	10+ years		
	Work Sink	3rd Floor	8	EA	7	10+ years		
Classroo	m #351 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	625	SF	6	10+ years		
	Chalk Board	3rd Floor	5	LF	4	2-5 years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years		
	Floor - Tile	3rd Floor	625	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	11	EA	7	6-10 years		
	Lighting - Lay-in	3rd Floor	1	EA	6	1-2 years	Not working	
	Marker Board	3rd Floor	10	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	130	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	630	SF	6	10+ years		
Classroo	m #353 (Science Lab Level 1)							
	Casework	3rd Floor	12	LF	6	10+ years		
	Ceiling - Lay-in	3rd Floor	950	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	20	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	20	SF	7	10+ years		
		0.0001	5	0.				



Catego	ry : Classroom		Building : Main-Building A						
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years			
	Eye Wash Station	3rd Floor	1	EA	7	10+ years			
	Floor - Tile	3rd Floor	950	SF	6	10+ years			
	Gas Line	3rd Floor	10	EA	7	10+ years			
	Lighting - Lay-in	3rd Floor	35	EA	7	6-10 years			
	Marker Board	3rd Floor	10	LF	6	6-10 years			
	Science Lab Fume Hood	3rd Floor	1	EA	6	6-10 years			
	Science Lab Shower	3rd Floor	1	EA	7	6-10 years			
	Walls - Concrete Block	3rd Floor	250	SF	7	10+ years			
			876	SF					
	Walls - Metal Panel	3rd Floor			6	10+ years			
	Work Sink	3rd Floor	8	EA	7	10+ years			
lassroc	om #354 (Science Lab Level 1)								
	Casework	3rd Floor	21	LF	6	10+ years			
	Ceiling - Lay-in	3rd Floor	888	SF	6	10+ years			
	Doors - Side-lite	3rd Floor	10	SF	7	10+ years			
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years			
	Eve Wash Station	3rd Floor	1	EA	7	10+ years			
	5		•	SF					
	Floor - Tile	3rd Floor	888		6	10+ years			
	Gas Line	3rd Floor	16	EA	7	10+ years			
	Lighting - Lay-in	3rd Floor	37	EA	7	6-10 years			
	Marker Board	3rd Floor	15	LF	6	6-10 years			
	Science Lab Fume Hood	3rd Floor	1	EA	7	10+ years			
	Science Lab Shower	3rd Floor	1	EA	7	6-10 years			
	Storage/ Closet	3rd Floor	299	SF	7	10+ years			
	Walls - Concrete Block	3rd Floor	120	SF	7	10+ years			
	Walls - Metal Panel	3rd Floor	810	SF	6	10+ years			
	Work Sink	3rd Floor	8	EA	7	10+ years			
Classroo	om #355 (Science Lab Level 3)								
	Casework	3rd Floor	50	LF	6	10+ years			
	Ceiling - Lay-in	3rd Floor	1,850	SF	6	10+ years			
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years			
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years			
	Eye Wash Station	3rd Floor	1	EA	7	6-10 years			
	Floor - Tile	3rd Floor	1,850	SF	6	10+ years			
	Gas Line	3rd Floor	4	EA	7	10+ years			
	Lighting - Lay-in	3rd Floor	19	EA	7	6-10 years			
	Marker Board	3rd Floor	24	LF	6	6-10 years			
						-			
	Science Lab Shower	3rd Floor	1	EA	7	6-10 years			
	Walls - Concrete Block	3rd Floor	309	SF	6	10+ years			
	Walls - Metal Panel	3rd Floor	890	SF	6	10+ years			
	Work Sink	3rd Floor	5	EA	7	10+ years			



Category : Classroom			В	Building : Main-Building A				
				Recommend				
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
lassroo	m #360 (Science Lab Level 1)		00		0	40		
	Casework	3rd Floor	23	LF	6	10+ years		
	Ceiling - Lay-in	3rd Floor	900	SF	6	10+ years		
	Chalk Board	3rd Floor	5	LF	4	2-5 years		
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	12	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Eye Wash Station	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	900	SF	6	10+ years		
	Gas Line	3rd Floor	20	EA	7	10+ years		
	Lighting - Lay-in	3rd Floor	28	EA	7	6-10 years		
	Marker Board	3rd Floor	10	LF	6	6-10 years		
	Science Lab Fume Hood	3rd Floor	1	EA	6	6-10 years		
	Science Lab Shower	3rd Floor	1	EA	7	10+ years		
	Walls - Concrete Block	3rd Floor	156	SF	6	10+ years		
	Walls - Metal Panel	3rd Floor	650	SF	6	10+ years		
	Work Sink	3rd Floor	9	ĒA	7	10+ years		
	Doors - Side-lite Doors - Transom Window Doors - Wood Doors inclu hw Eye Wash Station Floor - Tile Gas Line Lighting - Lay-in Marker Board Science Lab Fume Hood Science Lab Shower	3rd Floor 3rd Floor	14 15 1 900 12 30 10 1 1	SF EA EA EA EA LF EA EA	7 7 7 6 7 7 6 7 7	10+ years 10+ years 10+ years 10+ years 10+ years 6-10 years 6-10 years 6-10 years 6-10 years 6-10 years		
	Walls - Concrete Block	3rd Floor	156	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	725	SF	6	10+ years		
	Work Sink	3rd Floor	12	ËA	7	10+ years		
lassror	m #362 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	500	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	9	EA	7	10+ years		
	Floor - Tile	3rd Floor	500	SF	6	10+ years		
		3rd Floor	28	EA	6	•		
	Lighting - Lay-in	310 11001	20	EA	U	10+ years		



Building : Main-Building A Category : Classroom Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments LF Marker Board 3rd Floor 13 6 10+ vears Walls - Concrete Block 3rd Floor 156 SF 7 10+ years Walls - Metal Panel 3rd Floor 555 SF 7 10+ years 300 SF Walls - Plaster/Drywall 3rd Floor 6 10+ years Work Sink 7 3rd Floor 1 EΑ 6-10 years Classroom #363 (Science Lab Level 2) LF Casework 3rd Floor 43 6 10+ years SF Ceiling - Lay-in 3rd Floor 900 6 10+ years Doors - Side-lite SF 3rd Floor 11 7 10+ years Doors - Transom Window 3rd Floor 9 SF 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 EΑ 7 10+ years Eve Wash Station 3rd Floor 1 ΕA 7 10+ years SF Floor - Tile 3rd Floor 900 6 10+ years Gas Line 3rd Floor ΕA 7 24 10+ vears Lighting - Lay-in 3rd Floor 28 FΑ 7 6-10 years LF Marker Board 3rd Floor 10 7 6-10 years Science Lab Fume Hood 3rd Floor 1 EΑ 7 10+ years 7 Science Lab Shower 3rd Floor 1 EΑ 6-10 years Walls - Concrete Block 3rd Floor 156 SF 7 10+ years SF Walls - Metal Panel 3rd Floor 750 6 10+ years Work Sink 3rd Floor 5 EΑ 7 10+ vears Classroom #364 (Regular Classroom) Casework 3rd Floor 4 LF 6 10+ years Ceiling - Lay-in 3rd Floor 750 SF 10+ years 6 SF Doors - Side-lite 3rd Floor 9 7 10+ years Doors - Steel Doors incl hw 3rd Floor ΕA 7 1 10+ years Doors - Transom Window 3rd Floor 14 SF 7 10+ years SF Floor - Tile 3rd Floor 750 6 10+ years 6 Lighting - Lay-in 3rd Floor 14 EΑ 6-10 years LF Marker Board 3rd Floor 22 6 6-10 years Walls - Concrete Block SF 7 3rd Floor 130 10+ years Walls - Metal Panel 3rd Floor 805 SF 6 10+ years Classroom #365 (Regular Classroom) Ceiling - Lay-in 3rd Floor 725 SF 6 10+ years Chalk Board 3rd Floor 10 LF 4 2-5 years Doors - Side-lite 3rd Floor 9 SF 7 10+ years Doors - Transom Window 3rd Floor 11 SF 7 10+ years Doors - Wood Doors inclu hw FΑ 7 3rd Floor 10+ years 1 Floor - Tile 3rd Floor 725 SF 6 10+ years Lighting - Lay-in 3rd Floor 14 FΑ 7 6-10 years



Category : Classroom			В	Building : Main-Building A				
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Marker Board	3rd Floor	15	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	130	SF	6	10+ years		
	Walls - Metal Panel	3rd Floor	785	SF	6	10+ years		
Classroo	om #366 (Regular Classroom)							
	Casework	3rd Floor	5	LF	6	10+ years		
	Ceiling - Lay-in	3rd Floor	750	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	750	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	14	EA	7	6-10 years		
	Lighting - Lay-in	3rd Floor	1	EA	6	1-2 years	Not working	
	Marker Board	3rd Floor	23	LF	6	6-10 years	iter working	
	Walls - Concrete Block	3rd Floor	130	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	805	SF	6	10+ years		
lasero	om #367 (Regular Classroom)							
01035100		3rd Floor	750	SF	6	10		
	Ceiling - Lay-in	3rd Floor		LF	6	10+ years		
	Chalk Board		10		4	2-5 years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	750	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	15	EA	7	6-10 years		
	Marker Board	3rd Floor	10	LF	7	6-10 years		
	Walls - Concrete Block	3rd Floor	130	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	805	SF	6	10+ years		
Classroo	om #368 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	750	SF	6	10+ years		
	Chalk Board	3rd Floor	10	LF	4	2-5 years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	750	SF	7	10+ years		
	Lighting - Pendent/Surface	3rd Floor	15	EA	7	6-10 years		
	Marker Board	3rd Floor	10	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	130	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	805	SF	6	10+ years		
Classror	om #369 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	960	SF	6	10+ years		



Catego	ry : Classroom		B	Building : Main-Building A				
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	15	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	960	SF	7	10+ years		
	Lighting - Lay-in	3rd Floor	25	EA	7	6-10 years		
	Marker Board	3rd Floor	6	LF	7	6-10 years		
	Walls - Concrete Block	3rd Floor	800	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	240	SF	6	10+ years		
	Wireless System	3rd Floor	1	EA	7	10+ years		
lassroc	m #370 (Special Education)							
	Ceiling - Plaster/Drywall	3rd Floor	350	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Transom Window	3rd Floor	15	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	350	SF	7	10+ years		
	Lighting - Pendent/Surface	3rd Floor	8	EA	7	6-10 years		
	Marker Board	3rd Floor	12	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	458	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	250	SF	6	10+ years		
lassroo	m #371 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	960	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	15	SF	7	10+ years		
	Floor - Tile	3rd Floor	960	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	16	EA	6	6-10 years		
	Marker Board	3rd Floor	12	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	180	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	795	SF	6	10+ years		
lassroc	m #373 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	400	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	15	SF	7	10+ years		
	Floor - Tile	3rd Floor	400	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	8	EA	6	6-10 years		
	Marker Board	3rd Floor	10	LF	6	6-10 years		
	Walls - Metal Panel	3rd Floor	695	SF	6	10+ years		
lacorea	m #374 (Regular Classroom)							



Category : Classroom			B	Building : Main-Building A				
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Ceiling - Lay-in	3rd Floor	696	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	15	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	696	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	15	EA	7	6-10 years		
	Lighting - Lay-in	3rd Floor	4	EA	6	1-2 years	Not working	
	Marker Board	3rd Floor	20	LF	7	6-10 years		
	Walls - Concrete Block	3rd Floor	360	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	550	SF	6	10+ years		
lassroo	om #375 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	722	SF	7	10+ years		
	Doors - Side-lite	3rd Floor	22	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years		
	Floor - Tile	3rd Floor	722	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	13	EA	7	6-10 years		
	Marker Board	3rd Floor	15	LF	7	6-10 years		
	Walls - Metal Panel	3rd Floor	1,050	SF	6	10+ years		
	Wireless System	3rd Floor	1	EA	7	10+ years		
lassroo	om #377 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	696	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	696	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	13	ĒA	7	6-10 years		
	Marker Board	3rd Floor	8	LF	7	6-10 years		
	Walls - Concrete Block	3rd Floor	96	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	799	SF	6	10+ years		
lassroo	om #378 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	725	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	725	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	13	EA	7	6-10 years		
	Marker Board	3rd Floor	12	LF	6	6-10 years		
	Walls - Concrete Block	3rd Floor	170	SF	7	10+ years		



Category : Classroom			В	Building : Main-Building A				
	,			Recommend				
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
Classroo	om #379 (Regular Classroom)							
	Ceiling - Lay-in	3rd Floor	580	SF	6	10+ years		
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	580	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	8	EA	6	6-10 years		
	Marker Board	3rd Floor	6	LF	6	6-10 years		
	Walls - Metal Panel	3rd Floor	705	SF	6	10+ years		
Classroo	om #380 (Computer Lab)							
01255100	Ceiling - Lay-in	3rd Floor	876	SF	6	10+ years		
	Ceiling - Lay-in	3rd Floor	24	SF	4	1-2 years	Stained tile	
	Doors - Side-lite	3rd Floor	14	SF	7	10+ years	Stanled the	
	Doors - Steel Doors incl hw	3rd Floor	14	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	9	SF	7	10+ years		
	Floor - Tile	3rd Floor	900	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	14	EA	6	6-10 years		
	Marker Board	3rd Floor	10		7	6-10 years		
	Walls - Concrete Block	3rd Floor	156	SF	7	10+ years		
	Walls - Metal Panel	3rd Floor	555	SF	6	10+ years		
	Walls - Plaster/Drywall	3rd Floor	300	SF	6	10+ years		
	Wireless System	3rd Floor	1	EA	7	10+ years		
Closeror	om #381 (Culinary)							
CIASSIOC	Ceiling - Lay-in	3rd Floor	2,000	SF	7	10		
	Culinary Exhaust Hood - Type I	3rd Floor	2,000	EA	7	10+ years 10+ years		
	Culinary Kitchen Equipment	3rd Floor	13	EA	7	10+ years		
	Doors - Side-lite	3rd Floor	20	SF	7	10+ years		
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years		
	Doors - Transom Window	3rd Floor	18	SF	7	10+ years		
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years		
	Floor - Tile	3rd Floor	954	SF	6	10+ years		
	Floor - Tile Quarry	3rd Floor	1,046	SF	6	10+ years		
	Lighting - Lay-in	3rd Floor	39	EA	7	6-10 years		
	Marker Board	3rd Floor			7	6-10 years		
	Storage/ Closet	3rd Floor	7	SF	7	10+ years		
	Storage/ Closet	3rd Floor	7	SF	7	10+ years		
	Walls - Concrete Block	3rd Floor	208	SF	7	10+ years		
	Walls - Plaster/Drywall	3rd Floor	610	SF	7	10+ years		
	Walls - Flaster/Drywall Walls - Tile	3rd Floor	470	SF	7	10+ years		
	Work Sink	3rd Floor	470	EA	7	10+ years		
	Work Sink Work Sink	3rd Floor	4	EA	7	10+ years		
			2	LA	'	IUT years		



Category : Classroom			В	Building : Main-Building A					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Work Sink	3rd Floor	1	EA	5	1-2 years	Sensor not working		
Classroc	om #381B (Store Room)								
	Ceiling - Lay-in	3rd Floor	271	SF	7	10+ years			
	Ceiling - Lay-in	3rd Floor	8	SF	4	1-2 years	Stained tile		
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years			
	Floor - Tile	3rd Floor	278	SF	7	10+ years			
	Floor - Tile	3rd Floor	1	SF	4	1-2 years	Chipped tile		
	Lighting - Lay-in	3rd Floor	6	EA	7	6-10 years			
	Storage/ Closet	3rd Floor	8	SF	7	10+ years			
	Walls - Metal Panel	3rd Floor	575	SF	7	10+ years			
		310 1001	575	36	'	TUT years			
Classroc	om #383 (Science Lab Level 3)								
	Casework	3rd Floor	11	LF	6	10+ years			
	Ceiling - Lay-in	3rd Floor	986	SF	6	10+ years			
	Doors - Side-lite	3rd Floor	11	SF	7	10+ years			
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years			
	Doors - Transom Window	3rd Floor	13	SF	7	10+ years			
	Floor - Tile	3rd Floor	986	SF	6	10+ years			
	Gas Line	3rd Floor	2	EA	7	10+ years			
	Lighting - Lay-in	3rd Floor	35	EA	6	6-10 years			
	Marker Board	3rd Floor	12	LF	6	10+ years			
	Walls - Concrete Block	3rd Floor	374	SF	7	10+ years			
	Walls - Metal Panel	3rd Floor	500	SF	6	10+ years			
	Work Sink	3rd Floor	2	EA	7	10+ years			
Catego	ry : Interior		В	uildina	· Main-F	Building A			
oalego	ry . Interior			unung	. Man-L	Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
Corridor	Ceiling - Lay-in	1st East	980	SF	6	10+ years			
			3,784	SF		•			
	Ceiling - Lay-in	1st East			6	10+ years			
	Doors - Steel Doors incl hw	1st East	8	EA	7	10+ years			
	Doors - Transom Window	1st East	48	SF	6	10+ years			
	Drinking Fountains - Single Fountain	1st East	2	EA	7	10+ years			
	Floor - Tile/Sheet	1st East	4,764	SF	5	10+ years			
	Lighting - Lay-in	1st East	58	EA	6	6-10 years			
	Lighting - Wall Mounted	1st East	3	EA	6	6-10 years			
	Walls - Concrete Block	1st East	60	SF	7	10+ years			
				UE .	7	1() L VOORC			
	Walls - Masonry	1st East	2,850	SF		10+ years			
	Walls - Metal Panel	1st East	1,170	SF	6	10+ years			
	•					-			



Catego	ry : Interior		В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Doors - Transom Window	1st North	36	SF	6	10+ years	
	Doors - Wood Doors include hw	1st North	12	EA	6	10+ years	
	Drinking Fountains - Single Water Cooler	1st North	4	EA	7	10+ years	
	Floor - Tile/Sheet	1st North	9,721	SF	7	10+ years	
	Floor - Tile/Sheet	1st North	20	SF	4	1-2 years	Raised tile
	Lighting - Lay-in	1st North	75	EA	6	6-10 years	
	Lighting - Pendent/Surface	1st North	114	EA	6	6-10 years	
	Lighting - Wall Mounted	1st North	1	EA	6	6-10 years	
	Student Lockers - One Tier	1st North	500	EA	6	10+ years	
	Walls - Masonry	1st North	3,610	SF	6	10+ years	
	Walls - Metal Panel	1st North	1,191	SF	6	10+ years	
	Ceiling - Lay-in	1st South	2,615	SF	6	10+ years	
	Doors - Store Front	1st South	8	EA	6	10+ years	
	Drinking Fountains - Single Water Cooler	1st South	4	EA	7	10+ years	
	Floor - Tile/Sheet	1st South	2,615	SF	7	10+ years	
	Lighting - Lay-in	1st South	36	EA	6	6-10 years	
	Student Lockers - One Tier	1st South	82	EA	7	10+ years	
	Walls - Concrete Block	1st South	60	SF	6	10+ years	
	Walls - Masonry	1st South	1,600	SF	6	10+ years	
	Walls - Structural Glazed Tile	1st South	1,420	SF	6	10+ years	
	Ceiling - Lay-in	1st West	2,794	SF	6	10+ years	
	Ceiling - Splined	1st West	595	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st West	8	ĒA	6	10+ years	
	Drinking Fountains - Single Water Cooler	1st West	2	EA	7	10+ years	
	Floor - Tile/Sheet	1st West	3,389	SF	7	10+ years	
	Lighting - Lay-in	1st West	40	EA	6	6-10 years	
	Student Lockers - One Tier	1st West	83	EA	6	10+ years	
	Walls - Concrete Block	1st West	140	SF	6	10+ years	
	Walls - Masonry	1st West	1,636	SF	7	10+ years	
	Walls - Metal Panel	1st West	1,340	SF	6	10+ years	
	Ceiling - Lay-in	1st middle south	1,173	SF	6	10+ years	
	Floor - Tile/Sheet	1st middle south	1,161	SF	7	10+ years	
	Floor - Tile/Sheet	1st middle south	12	SF	4	1-2 years	Chipped tile
	Lighting - Lay-in	1st middle south	30	EA	6	6-10 years	
	Walls - Concrete Block	1st middle south	180	SF	6	10+ years	
	Walls - Metal Panel	1st middle south	1,710	SF	6	10+ years	
	Walls - Plaster/Drywall	1st middle south	650	SF	6	10+ years	
	Ceiling - Lay-in	2nd North	15,400	SF	6	10+ years	
	Doors - Transom Window	2nd North	250	SF	7	10+ years	
	Doors - Wood Doors include hw	2nd North	32	EA	7	10+ years	
	Drinking Fountains - Double Fountain	2nd North	52 1	EA	7	10+ years	
	Drinking Fountains - Double Fountain Drinking Fountains - Single Water Cooler	2nd North	2	EA	7	10+ years	
	Floor - Tile/Sheet	2nd North	15,400	SF	5	10+ years 10+ years	
		2nd North	268	EA	5 6	-	
	Lighting - Lay-in		208	EA	O	6-10 years	



Category : Interior			В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Student Lockers - One Tier	2nd North	746	EA	7	10+ years	
	Walls - Concrete Block	2nd North	250	SF	7	10+ years	
	Walls - Masonry	2nd North	2,800	SF	7	10+ years	
	Walls - Metal Panel	2nd North	12,400	SF	6	10+ years	
	Ceiling - Lay-in	3rd East	2,392	SF	6	10+ years	
	Doors - Store Front	3rd East	16	EA	7	10+ years	
	Drinking Fountains - Single Water Cooler	3rd East	4	EA	7	10+ years	
	Floor - Tile/Sheet	3rd East	2,392	SF	5	10+ years	
	Lighting - Lay-in	3rd East	42	EA	7	6-10 years	
	Student Lockers - One Tier	3rd East	10	EA	7	10+ years	
	Walls - Masonry	3rd East	240	SF	7	10+ years	
	Walls - Metal Panel	3rd East	3,530	SF	6	10+ years	
	Ceiling - Lay-in	3rd Middle South	1,440	SF	6	10+ years	
	Floor - Tile/Sheet	3rd Middle South	1,440	SF	5	10+ years	
	Lighting - Lay-in	3rd Middle South	32	EA	6	6-10 years	
	Walls - Concrete Block	3rd Middle South	200	SF	6	10+ years	
	Walls - Metal Panel	3rd Middle South	3,030	SF	6	10+ years	
	Ceiling - Lay-in	3rd North	4,541	SF	6	10+ years	
	Floor - Tile/Sheet	3rd North	4,531	SF	7	10+ years	
	Floor - Tile/Sheet	3rd North	10	SF	4	1-2 years	Cracked tile
	Lighting - Lay-in	3rd North	136	EA	7	6-10 years	
	Lighting - Lay-in	3rd North	2	EA	6	6-10 years	
	Student Lockers - One Tier	3rd North	720	EA	7	10+ years	
	Walls - Masonry	3rd North	1,115	SF	7	10+ years	
	Walls - Metal Panel	3rd North	1,190	SF	6	10+ years	
	Ceiling - Lay-in	3rd South	3,501	SF	6	10+ years	
	Floor - Tile/Sheet	3rd South	3,501	SF	5	6-10 years	
	Lighting - Lay-in	3rd South	52	EA	6	6-10 years	
	Walls - Masonry	3rd South	750	SF	7	10+ years	
	Walls - Metal Panel	3rd South	3,095	SF	6	10+ years	
	Ceiling - Lay-in	3rd West	2,314	SF	6	10+ years	
	Doors - Store Front	3rd West	2,314	EA	6	10+ years	
	Drinking Fountains - Double Fountain	3rd West	3	EA	7	10+ years	
	Drinking Fountains - Double Fountain	3rd West	3 4	EA	5	6-10 years	
	Floor - Tile/Sheet	3rd West	2,314	SF	5 7	10+ years	
	Lighting - Lay-in	3rd West	2,314	EA	6	6-10 years	
	Student Lockers - One Tier			EA			
		3rd West	15		7	10+ years	
	Walls - Masonry	3rd West 3rd West	240 4,120	SF SF	7	10+ years	
	Walls - Metal Panel			SF	6	10+ years	
	Ceiling - Plaster/Drywall	Basement - N/S Main	1,681		6	10+ years	
	Drinking Fountains - Single Fountain	Basement - N/S Main	1	EA	5	6-10 years	
	Floor - Tile/Sheet	Basement - N/S Main	1,481	SF	5	6-10 years	Missing tile
	Floor - Tile/Sheet	Basement - N/S Main	200	SF	4	0-1 year	Missing tile
	Lighting - Pendent/Surface	Basement - N/S Main	17	EA	6	6-10 years	



Category : Interior			В	uilding	: Main-E	Building A	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Concrete Block	Basement - N/S Main	2,687	SF	6	10+ years	
	Ceiling - Plaster/Drywall	Basement - West	211	SF	6	10+ years	
	Ceiling - Splined	Basement - West	294	SF	6	10+ years	
	Floor - Tile/Sheet	Basement - West	420	SF	5	6-10 years	
	Floor - Tile/Sheet	Basement - West	85	SF	4	1-2 years	Cracked and damaged tile
	Lighting - Pendent/Surface	Basement - West	14	EA	7	6-10 years	
	Walls - Concrete Block	Basement - West	1,165	SF	6	10+ years	
	Ceiling - Lay-in	North Link to Annex	2,809	SF	6	10+ years	
	Doors - Steel Doors incl hw	North Link to Annex	1	EA	6	10+ years	
	Drinking Fountains - Single Fountain	North Link to Annex	2	EA	7	10+ years	
	Floor - Tile/Sheet	North Link to Annex	2,809	SF	5	10+ years	
	Lighting - Lay-in	North Link to Annex	48	ĒA	7	6-10 years	
	Lighting - Wall Mounted	North Link to Annex	2	EA	7	6-10 years	
	Walls - Masonry	North Link to Annex	896	SF	7	10+ years	
	Ceiling - Lay-in	South Link to Annex	2,809	SF	6	10+ years	
	Doors - Steel Doors incl hw	South Link to Annex	2,005	EA	6	10+ years	
	Drinking Fountains - Single Fountain	South Link to Annex	2	EA	7	10+ years	
	Floor - Tile/Sheet	South Link to Annex	2,809	SF	5	10+ years	
	Lighting - Lay-in	South Link to Annex	48	EA	7	6-10 years	
	Lighting - Wall Mounted	South Link to Annex	40	EA	7	,	
	Walls - Masonry		896	SF	7	6-10 years	
	Walls - Masolity	South Link to Annex	090	35	/	10+ years	
Safety							
	Metal Detector	Entire building	3	EA	7	6-10 years	
	Security Cameras	Entire building	45	EA	7	6-10 years	
tairs							
	Ceiling - Plaster/Drywall	East - Basement/1st	169	SF	7	10+ years	
	Floor - Concrete	East - Basement/1st	72	SF	5	10+ years	
	Floor - Tile	East - Basement/1st	20	SF	6	10+ years	
	Handrails	East - Basement/1st	58	LF	5	10+ years	
	Lighting - Lay-in	East - Basement/1st	4	EA	7	6-10 years	
	Stairs - Concrete	East - Basement/1st	92	LF	6	10+ years	
	Walls - Concrete Block	East - Basement/1st	1,168	SF	6	10+ years	
	Ceiling - Lay-in	NE Stair	1,069	SF	7	10+ years	
	Ceiling - Plaster/Drywall	NE Stair	414	SF	7	10+ years	
	Floor - Terrazzo	NE Stair	975	SF	6	10+ years	
	Handrails	NE Stair	72	LF	7	10+ years	
	Lighting - Lay-in	NE Stair	21	EA	6	6-10 years	
	Stairs - Terrazzo	NE Stair	260	LF	6	10+ years	
	Walls - Masonry	NE Stair	2,876	SF	7	10+ years	
	Walls - Plaster/Drywall	NE Stair	2,876	SF	6	-	
	Ceiling - Lay-in	NW Stair A	1,073	SF	6 7	10+ years	
	Ceiling - Plaster/Drywall	NW Stair A	409	SF	6	10+ years	
	Cenny - Flaster/Drywall	INVV SIAILA	409	SF	o	10+ years	



Catego	Category : Interior			uilding	: Main-E	Building A	
					Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Floor - Terrazzo	NW Stair A	975	SF	7	10+ years	
	Handrails	NW Stair A	72	LF	7	10+ years	
	Lighting - Lay-in	NW Stair A	21	EA	6	6-10 years	
	Stairs - Terrazzo	NW Stair A	260	LF	6	10+ years	
	Walls - Masonry	NW Stair A	2,999	SF	7	10+ years	
	Ceiling - Plaster/Drywall	Room 166 mezzanine stairs	90	SF	6	10+ years	
	Floor - Concrete	Room 166 mezzanine stairs	70	SF	5	10+ years	
	Handrails	Room 166 mezzanine stairs	14	LF	7	10+ years	
	Handrails	Room 166 mezzanine stairs	11	LF	7	10+ years	
	Lighting - Pendent/Surface	Room 166 mezzanine stairs	2	EA	7	6-10 years	
	Stairs - Concrete	Room 166 mezzanine stairs	48	LF	7	10+ years	
	Stairs - Concrete	Room 166 mezzanine stairs	51	LF	6	10+ years	
	Walls - Concrete Block	Room 166 mezzanine stairs	520	SF	6	10+ years	
	Ceiling - Lay-in	SE C	1,073	SF	7	10+ years	
	Ceiling - Plaster/Drywall	SE C	409	SF	6	10+ years	
	Floor - Terrazzo	SE C	975	SF	7	10+ years	
	Handrails	SE C	72	LF	7	10+ years	
	Lighting - Lay-in	SE C	21	EA	7	6-10 years	
	Stairs - Terrazzo	SE C	264	LF	6	10+ years	
	Walls - Masonry	SE C	2,999	SF	7	10+ years	
	Ceiling - Lay-in	SW Stair B	1,073	SF	7	10+ years	
	Ceiling - Plaster/Drywall	SW Stair B	409	SF	6	10+ years	
	Floor - Terrazzo	SW Stair B	975	SF	6	10+ years	
	Handrails	SW Stair B	72	LF	7	10+ years	
	Lighting - Lay-in	SW Stair B	21	EA	6	6-10 years	
	Stairs - Terrazzo	SW Stair B	260	LF	6	10+ years	
	Walls - Masonry	SW Stair B	2,999	SF	7	10+ years	
	Ceiling - Exposed	West - Basement/1st	137	SF	6	10+ years	
	Floor - Concrete	West - Basement/1st	77	SF	5	10+ years	
	Handrails	West - Basement/1st	58	LF	7	10+ years	
	Lighting - Pendent/Surface	West - Basement/1st	2	EA	6	6-10 years	
	Lighting - Wall Mounted	West - Basement/1st	2	EA	6		
	Stairs - Concrete	West - Basement/1st	85	LF	6		
	Walls - Concrete Block	West - Basement/1st	729	SF	7	10+ years	
	Walls - Masonry	West - Basement/1st	141	SF	7	10+ years	
						,	
Vertical	Conveyance						
	Elevator - Hydraulic Elevator	1st Floor	1	EA	6	2-5 years	
	Elevator - Hydraulic Elevator	1st Floor	1	EA	6	10+ years	
_Vertical	Walls - Masonry Ceiling - Lay-in Ceiling - Plaster/Drywall Floor - Terrazzo Handrails Lighting - Lay-in Stairs - Terrazzo Walls - Masonry Ceiling - Exposed Floor - Concrete Handrails Lighting - Pendent/Surface Lighting - Pendent/Surface Lighting - Wall Mounted Stairs - Concrete Walls - Concrete Block Walls - Masonry Conveyance Elevator - Hydraulic Elevator	SE C SW Stair B SW Stair B SW Stair B SW Stair B SW Stair B SW Stair B West - Basement/1st West - Basement/1st	2,999 1,073 409 975 72 21 260 2,999 137 77 58 2 2 85 729 141	SF SF SF LA LF SF LF A LF F SF EA EA	7 6 6 7 6 6 7 6 6 7 7 6 6	10+ years 10+ years 10+ years 10+ years 6-10 years 10+ years 10+ years 10+ years 10+ years 6-10 years 6-10 years 10+ years 10+ years 10+ years 10+ years 10+ years 10+ years	



_	Category : Exterior			Building : Addition Recommend					
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
Entrance									
	Exterior Doors - Exterior Steel Door	15 West	1	EA	6	6-10 years			
	Exterior Stairs - Wood	15 West	15	LF	6	6-10 years			
	Ramp Handrail - Wood_Ramp Handrail	15 West	88	LF	6	6-10 years			
	Ramp Handrail - Wood_Ramp Handrail	15 West	2	LF	5	0-1 year	Broken		
	Ramps - Wood Ramp	15 West	45	LF	6	6-10 years			
	Stair Handrail - Wood_Stair Handrail	15 West	14	LF	6	6-10 years			
	Exterior Doors - Exterior Steel Door	16	1	EA	5	1-2 years	Missing door handle		
	Exterior Stairs - Steel or Aluminum	16	9	LF	5	1-2 years	Corrosion		
	Stair Handrail - Steel_Stair Handrail	16	10	LF	6	6-10 years			
	Exterior Doors - Exterior Steel Door	17 East	1	EA	5	0-1 year	Broken door handle		
	Exterior Stairs - Steel or Aluminum	17 East	9	LF	5	1-2 years	Corrosion		
	Stair Handrail - Steel_Stair Handrail	17 East	10	LF	6	6-10 years			
			-		-				
Foundatio		Father Duilding	4.000	05	7	10			
	Superstructure - Steel	Entire Building	1,200	SF	7	10+ years			
Roof Syst	tem								
	Roof - Metal	Entire Building	1,200	SF	6	6-10 years			
	Roof Structure - Steel / Metal Deck/ Concrete Topping	Entire Building	1,200	SF	7	10+ years			
Walls									
vvalis	Canopy - Metal	Entire Building	24	SF	6	6-10 years			
	Canopy - Metal	Entire Building	12	SF	3	1-2 years	Door 17 East it is folded up and		
	ouriopy motor	Entiro Banang	12	01	Ŭ	1 2 youro	laying on the roof.		
	Exterior Walls - Prefabricated Metal Panel Wall	Entire Building	2,600	SF	6	6-10 years	Graffiti, deterioration		
Windows									
	Windows - Casement Steel	Entire Building	2	SF	6	6-10 years			
Categor	y : Electrical		В	uilding	: Additi	on			
301			_			Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
-	cy System		····· ·						
Linergent	Exit Signs - Multipurpose Room	Entire Building	3	EA	4	0.1.voor	Not illuminated		
			3	EA	4	0-1 year			
Power Dig	stribution								
	Lighting and Power Panels - 100 A	Entire Building	1	EA	7	6-10 years			



Catego	ory : Mechanical	В	Building : Addition					
Group	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments	
Air Cond	ditioning							
	Condensing Unit- Ground Mounted - Less than 5 tons	East Façade	1	EA	7	6-10 years	No dataplate or CPS Asset Tag present. Mounted to the east exterior wall.	
_Air Hand	lling Systems							
	Fan Coil Unit- Floor Mounted - Electric	Multipurpose Room	1	EA	7	6-10 years	No CPS Asset Tag present.	
Catego	ory : Classroom		В	uilding	: Additi	on		
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
Classroo	om #Driver's ed (Regular Classroom)							
	AC Units	1st Floor	1	EA	7	10+ years		
	Ceiling - Plaster/Drywall	1st Floor	1,200	SF	7	10+ years		
	Chalk Board	1st Floor	6	LF	4	2-5 years		
	Doors - Steel Doors incl hw	1st Floor	2	EA	7	10+ years		
	Floor - Carpet	1st Floor	1,200	SF	7	10+ years		
	Lighting - Pendent/Surface	1st Floor	8	EA	7	10+ years		
	Storage/ Closet	1st Floor	8	SF	7	10+ years		
	Walls - Plaster/Drywall	1st Floor	1,280	SF	7	10+ years		



Category : Exterior			В	uilding	: Linked	Building : Linked Addition-Athletic Building B					
						Recommend					
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments				
Entrance											
	Entrance Control - Audio and Video	1 - Main north	1	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	1 - Main north	4	EA	6	10+ years					
	Exterior Doors - Side lite	1 - Main north	12	EA	6	10+ years					
	Exterior Doors - Transom Lite	1 - Main north	9	EA	6	10+ years					
	Power Door Operator and Controls	1 - Main north	1	EA	7	6-10 years					
	Exterior Doors - Exterior FRP Door	11/12	8	EA	6	10+ years					
	Exterior Doors - Transom Lite	11/12	8	EA	6	10+ years					
	Exterior Stairs - Concrete	11/12	24	LF	6	10+ years					
	Ramps - Concrete	11/12	10	LF	6	10+ years					
	Exterior Doors - Exterior FRP Door	13	2	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	14	2	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	2	2	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	3	2	EA	6	10+ years					
	Exterior Doors - Transom Lite	3	2	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	4	2	EA	6	10+ years					
	Exterior Doors - Transom Lite	4	2	EA	6	10+ years					
	Exterior Doors - Side lite	5	4	EA	6	10+ years					
	Exterior Doors - Store Front	5	8	EA	6	10+ years					
	Exterior Doors - Exterior FRP Door	Courtyard doors	8	EA	7	10+ years					
	Exterior Doors - Side lite	Courtyard doors	8	EA	7	10+ years					
	Exterior Doors - Transom Lite	Courtyard doors	8	EA	7	10+ years					
	Exterior Stairs - Concrete	Courtyard doors	40	LF	7	10+ years					
	Ramps - Concrete	Courtyard doors	1	LF	6	10+ years					
	Exterior Doors - Exterior Steel Door	Roof	1	EA	6	10+ years					
					·	je na je					
Foundati	on										
	Foundation - Concrete	Entire Building	1,640	LF	7	10+ years					
	Superstructure - Metal Deck/ Concrete	Entire Building	170,493	SF	7	10+ years					
	Topping	-				-					
Lighting											
	Exterior Lighting - Parapet or Roof Mounted	Entire Building	15	EA	7	10+ years					
	Exterior Lighting - Wall Mounted	Entire Building	29	EA	7	10+ years					
	Exterior Lighting - Wall Mounted	Entire Building	2	EA	6	6-10 years					
_Roof Sys	stem										
	Coping - Metal	G	509	LF	7	10+ years					
	Downspouts - Interior Downspouts	G	30	LF	6	10+ years					
	Parapet - 16" - 30" Height	G	509	LF	7	10+ years					
	Roof - Modified Bitumen	G	10,330	SF	6	10+ years					
	Roof Structure - Steel / Metal Deck/	G	10,330	SF	7	10+ years					
		0	10,330	0	I	io+ years					

Category : Exterior



Marie Sklodowska Curie Metropolitan High School

4959 S Archer AVENUE, Chicago, IL 60632 **Category : Exterior** Building : Linked Addition-Athletic Building B Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Concrete Topping Coping - Metal Н LF 7 10+ vears 1.345 Downspouts - Interior Downspouts Н 455 LF 6 10+ years Parapet - Parapet < 16" Height 1,350 LF 7 н 10+ years SF Roof - Modified Bitumen н 56,899 6 10+ years SF Roof Structure - Steel / Metal Deck/ н 56,899 7 10+ years **Concrete Topping** LF Coping - Metal 428 7 10+ years Downspouts - Interior Downspouts 140 LF 6 2-5 vears Parapet - Parapet < 16" Height LF 428 7 10+ years Roof - Modified Bitumen SF 23.408 6 10+ vears Roof Structure - Steel / Metal Deck/ Е 23,408 SF 7 10+ years Concrete Topping Access Ladder - Metal J 1 EΑ 7 10+ years LF 7 Coping - Metal J 60 10+ years LF Downspouts - Interior Downspouts J 10 6 10+ years Parapet - Parapet < 16" Height LF 7 J 60 10+ years SF Roof - Modified Bitumen J 225 6 10+ years ΕA Roof Hatch - Metal J 1 7 10+ vears 225 Roof Structure - Steel / Metal Deck/ .1 SF 7 10+ years Concrete Topping Walls Canopy - Concrete/ Stucco Entire Building 2.240 SF 6 10+ vears Exterior Walls - Brick Entire Building 48.934 SF 6 10+ years Windows LF Lintels - Steel Entire Building 556 6 10+ years Skylite - Glass Double-Pane Entire Building 22 SF 7 10+ years SF Skylite - Glass Double-Pane Entire Building 10 7 10+ years Storefront Windows SF Entire Building 3,990 6 10+ years SF Windows - Decorative Entire Building 431 6 10+ years **Building : Linked Addition-Athletic Building B Category : Electrical** Recommend Item - Type Location Quantity UOM Rank **Replacement** Comments Group Emergency System Security System - CCTV Electrical Room SF 6 6-10 years 170.483 SF Security System - Intrusion Detection Electrical Room 170.493 6 6-10 years Exit Signs - Auditoium Entire Building 14 ΕA 6 6-10 years Quantity and Priority Rep adjusted based on current observations. Rank

based on current observations. Rank adjusted based on current observations as no exit signs need to



Catego	ry : Electrical		В	uilding	: Linked	Addition-Ath	letic Building B
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Exit Signs - Corridors and Stairs	Entire Building	30	EA	6	6-10 years	be added or moved. Priority Rep adjusted based on current observations. Rank adjusted based on current observations as no exit signs need to be added or moved.
	Exit Signs - Gym	Entire Building	8	EA	6	6-10 years	Quantity and Priority Rep adjusted based on current observations.
	Exit Signs - Pool	Entire Building	4	EA	6	6-10 years	Priority Rep adjusted based on current observations. Rank adjusted based on current observations as no exit signs need to be added or moved.
	Emergency A/C Power - Auditoium and Aisle Lighting	Entire Building	8,200	SF	6	6-10 years	Location changed for clarification as the auditorium occupies space on multiple floors.
	Emergency A/C Power - Corridors and Stairs	Entire Building	29,956	SF	6	6-10 years	
	Emergency A/C Power - Gym	Entire Building	22,551	SF	6	6-10 years	
Main Se	rvice						
	PA System	Entire Building	170,493	SF	6	6-10 years	Served by Main. Rank adjusted per review with Building Engineer.
	Main Electrical Service - 1200 A 277/480/3PH	Entire Building	4	EA	6	6-10 years	Priority Rep adjusted based on current observations.
Power D	Distribution						
	Lighting and Power Panels - 100 A	Entire Building	16	EA	7	10+ years	Numerous panels screwed shut for security purposes.
	Lighting and Power Panels - 100 A	Entire Building	2	EA	4	0-1 year	Open fuse receptacles expose live conductors presenting a live front condition.
	Lighting and Power Panels - Above 100 A	Entire Building	30	EA	6	2-5 years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	4	0-1 year	Open breaker slot exposes live conductors presenting a live front condition.
	Main Distribution Panels - 400 - 600 amp	Entire Building	1	EA	6	6-10 years	
	Main Distribution Panels - Greater than 600 amp	Entire Building	1	EA	4	0-1 year	Exterior cover panel is removed which exposes live electrical conductors presenting a live front condition.
	Main Distribution Panels - Less than 400 amp	Entire Building	2	EA	6	6-10 years	
	Transformers - 277/480 - 120/208	Entire Building	4	EA	6	6-10 years	Quantity changed to match current



	SCHOOIS						4959 S Archer AVENUE, Chicago, IL 60632
Catego	ry : Electrical		В	uilding	: Linked		letic Building B
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
							observations.
Catego	ry : Fire Protection		В	uildina	: Linked	d Addition-Ath	letic Building B
Calogo				anang	. בוווונסנ	Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Fire Alar	m						
	Fire Alarm Strobe Lights	Entire Building	170,493	SF	6	6-10 years	
	Fire Alarm_System	Entire Building	170,493	SF	6	6-10 years	
Sprinkle							
	Sprinkler Heads	Basement	4,400	SF	7	6-10 years	
	Sprinkler Piping Wet Sprinkler System	Basement Basement	4,400 4,400	SF SF	6 7	10+ years	Ead from main position of bosoment
	wei Spinkier System	Basement	4,400	Эг	/	10+ years	Fed from main, section of basement.
Catego	ry : Mechanical		В	uilding	: Linked	d Addition-Ath	letic Building B
Ŭ				Ŭ		Recommend	Ū
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Air Conc	litioning						
	Condensing Unit- Roof Mounted - 21-30	Roof	1	EA	6	10+ years	Integral component of the pool air
	tons						handler.
Air Hand	lling Systems						
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating & DX Cooling w/ Remote	Roof	1	EA	7	10+ years	BHVC-4
	Mounted Compressor - 31 - 45 tons						
	Roof Top Unit-Single Zone-Roof Mounted-	Roof	1	EA	7	10+ years	BAC-4; Item Type changed to match
	Gas Heating and DX Cooling Coil - 11 - 20			L / (•	for yourd	current observations.
	tons						
	Roof Top Unit-Single Zone-Roof Mounted-	Roof	1	EA	7	10+ years	BAC-1; Item Type changed to match
	Gas Heating and DX Cooling Coil - 11 - 20						current observations.
	tons Dest Ten Heit Gingle Zene Dest Meurited	Dest	4	F A	7	10	
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - 31 - 45	Roof	1	EA	7	10+ years	BAC-4
	tons						
	Roof Top Unit-Single Zone-Roof Mounted-	Roof	1	EA	7	10+ years	BHVC-5
	Gas Heating and DX Cooling Coil - 31 - 45			L / (•	for yourd	Bitte
	tons						
	Roof Top Unit-Single Zone-Roof Mounted-	Roof	1	EA	7	10+ years	BAC-2; Item Type changed to match
	Gas Heating and DX Cooling Coil - 31 - 45						current observations.
	tons	5 (_	10	
	Roof Top Unit-Single Zone-Roof Mounted-	Roof	1	EA	7	10+ years	BHVC-1
	Gas Heating and DX Cooling Coil - 31 - 45 tons						
	10115						



Catego	ry : Mechanical		В	Building : Linked Addition-Athletic Building B					
ealege	, y i moonamoul			anang		Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - 31 - 45 tons	Roof	1	EA	7	10+ years	BAC-6		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - 31 - 45 tons	Roof	1	EA	7	10+ years	BAC-5		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - 31 - 45 tons	Roof	1	EA	7	10+ years	BHVC-7		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - Greater than 45 tons	Roof	1	EA	7	10+ years	BHVC-3		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - Greater than 45 tons	Roof	1	EA	7	10+ years	BHVC-8; Item Type changed to match current observations.		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - Greater than 45 tons	Roof	1	EA	7	10+ years	BHVC-6		
	Roof Top Unit-Single Zone-Roof Mounted- Gas Heating and DX Cooling Coil - Greater than 45 tons	Roof	1	EA	7	10+ years	BHVC-2; Item Type changed to match current observations.		
Heating	Devices								
	Cabinet Heaters - With Electric Coil Unit Heater - Electric	1st Floor Entire Building	3 1	EA EA	6 6	6-10 years 6-10 years	Quantity changed as total has been divided/aggregated. Location changed for clarification. Rank changed based on current observations.		
	Unit Heater - Electric	Entire Building	1	EA	6	6-10 years			
	Duct Heater - Electric	Entire Building	12	_/ (6	6-10 years			
	Fin Tube - Electric	Entire Building	450	LF	7	10+ years	Quantity changed as total has been divided/aggregated.		
Tempera	ature Control								
-	DDC System	Entire Building	170,493	SF	7	10+ years			
	Electric Thermostat	Entire Building	1	EA	7	6-10 years			
	Electric Thermostat	Entire Building	1	EA	7	6-10 years			
	Electric Thermostat	Entire Building	1	EA	7	6-10 years			
	Thermostats - DDC	Entire Building	18	EA	7	10+ years			
Ventilatio	n								
, or math	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	6	6-10 years			



Catego	ry : Mechanical		В	Building : Linked Addition-Athletic Building B					
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Exhaust Fans- Indoor - Less than 500 CFM	Entire Building	1	EA	5	6-10 years	Rank, Reason and Priority Rep adjusted based on current observations that this is a vintage unit but is well-maintained and fully operational.		
	Exhaust Fans- Roof Mounted - 1501 - 8000 CFM	Entire Building	5	EA	7	10+ years			
	Exhaust Fans- Roof Mounted - 1501 - 8000 CFM	Entire Building	1	EA	5	6-10 years	Unit is fully operational but housing is damaged.		
	Exhaust Fans- Roof Mounted - 500 - 1500 CFM	Entire Building	10	EA	7	10+ years	Quantity changed as total has been divided/aggregated.		
	Exhaust Fans- Roof Mounted - 500 - 1500 CFM	Entire Building	5	EA	6	6-10 years			
	Exhaust Fans- Roof Mounted - Greater than 8000 CFM	Entire Building	1	EA	7	10+ years			
	Exhaust Fans- Roof Mounted - Less than 500 CFM	Entire Building	1	EA	6	6-10 years			
	Roof Mounted Duct Work	Entire Building	20	LF	7	10+ years	Lineal footage confirmed by physical measurement at the time of assessment.		
Catego	ry : Plumbing		В	uilding	: Linked	Addition-Ath	letic Building B		
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
Hot Wate	er								
	Gas Heater - 300001 - 600000 BTU/HR	Mechanical Room	1	EA	6	6-10 years			
	Gas Heater - Greater than 600000 BTU/HR	Mechanical Room	1	EA	6	6-10 years	Rank and Priority Rep adjusted based on current observations.		
	Hot Water Storage Tank_Gas - 201 - 500 Gallons	Mechanical Room	2	EA	6	6-10 years	Quantity changed as total has been divided/aggregated. Rank and Priority Rep adjusted based on current observations.		
	Hot Water Storage Tank_Gas - 201 - 500 Gallons	Mechanical Room	1	EA	2	0-1 year	Tank removed from service and replaced with a119-gallon tank in 2016. Rank, Reason and Priority Rep changed as tank has is obsolete and has been abandoned in place.		
	Hot Water Storage Tank_Gas - Less than 200 Gallons	Mechanical Room	1	EA	6	6-10 years			



Category : Plumbing Building : Linked Addition-Athletic Building B Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments exceeded its anticipated service life. SF Pipes are galvanized material over 50 Domestic Piping-Hot Water Return Risers 4 2-5 years Entire Building 170.493 years old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life. SF Pipes are galvanized material over 50 Entire Building 170,493 4 2-5 years Domestic Piping-Hot Water from Risers to years old. Reason and Priority Rep Fixtures changed to note that the piping has exceeded its anticipated service life. Domestic Piping-Hot/Cold Water Supply 170.493 SF Pipes are galvanized material over 50 Entire Building 4 2-5 years (Horizontal Lines) vears old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life. Domestic Piping-Hot/Cold Water Supply Entire Building 170,493 SF 4 2-5 years Pipes are galvanized material over 50 years old. Reason and Priority Rep (Risers) changed to note that the piping has exceeded its anticipated service life. Domestic Piping-Hot/Cold Water Supply Entire Building 170,493 SF 4 2-5 years Pipes are galvanized material over 50 (from Risers to Fixtures) vears old. Reason and Priority Rep changed to note that the piping has exceeded its anticipated service life. Sanitary Piping Entire Building 170,493 SF 6 6-10 years Priority Rep adjusted to match Reason. Storm Piping SF 6 Priority Rep adjusted to match Entire Building 170,493 6-10 years Reason. Vent Piping Entire Building 170.493 SF 6 6-10 years Priority Rep adjusted to match Reason. Pool Systems LF 7 Pool Drain Piping Mechanical Room 50 6-10 years Pool Filtration System including Pump Mechanical Room 2 ΕA 6 6-10 years Pool Hot Water Heater - Gas Fired Mechanical Room 1 ΕA 6 10+ vears Pool Supply and Return Piping Mechanical Room 300 LF 7 10+ years Pumps ΕA Pumps - Ejector-Duplex Mechanical Room 1 5 6-10 years Rank, Reason and Priority Rep changed based on current observations and per review with Building Engineer. Sump cover plate shows signs of corrosion but is intact. Both pumps are fully operational. Mechanical Room ΕA 5 Location changed for clarification. Pumps - Sump-Simplex 1 6-10 years Elevator pit sump pump, not accessible at the time of assessment.

Chicago Public Schools Category : Plumbing		Marie Sklodowska Curie Metropolitan High School 4959 S Archer AVENUE, Chicago, IL 60632 Building : Linked Addition-Athletic Building B					
Group Item - Type	Location	Recommend Quantity UOM Rank Replacement Comments					
	Location	CPS Asset Tag not available. Condition verified by the Building Engineer.					

Catego	ry : Room	Building : Linked Addition-Athletic Building B					
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Administ	rative Suites/Offices						
	Ceiling - Splined	1st Floor Boys Gym Office North	112	SF	6	6-10 years	
	Ceiling - Splined	1st Floor Boys Gym Office North	8	SF	4	0-1 year	Damaged
	Doors - Side-lite	1st Floor Boys Gym Office North	100	SF	6	10+ years	-
	Doors - Wood Doors inclu hw	1st Floor Boys Gym Office North	3	EA	6	10+ years	
	Floor - Tile	1st Floor Boys Gym Office North	120	SF	6	10+ years	
	Lighting - Lay-in	1st Floor Boys Gym Office North	2	EA	6	6-10 years	
	Power Distribution	1st Floor Boys Gym Office North	4	EA	7	10+ years	
	Walls - Concrete Block	1st Floor Boys Gym Office North	250	SF	6	10+ years	
	Ceiling - Splined	1st Floor Boys Gym Office South	110	SF	6	6-10 years	
	Ceiling - Splined	1st Floor Boys Gym Office South	10	SF	4	0-1 year	Damaged
	Doors - Side-lite	1st Floor Boys Gym Office South	100	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor Boys Gym Office South	3	EA	6	10+ years	
	Floor - Tile	1st Floor Boys Gym Office South	120	SF	6	6-10 years	
	Lighting - Lay-in	1st Floor Boys Gym Office South	2	EA	7	6-10 years	
	Power Distribution	1st Floor Boys Gym Office South	4	EA	6	10+ years	
	Walls - Concrete Block	1st Floor Boys Gym Office South	250	SF	6	10+ years	
	Ceiling - Splined	1st Floor Girls Gym North Office	88	SF	6	10+ years	
	Ceiling - Splined	1st Floor Girls Gym North Office	4	SF	4	0-1 year	Chipped
	Doors - Wood Doors inclu hw	1st Floor Girls Gym North Office	1	EA	6	10+ years	
	Floor - Tile	1st Floor Girls Gym North Office	92	SF	6	10+ years	
	Lighting - Lay-in	1st Floor Girls Gym North Office	2	EA	6	6-10 years	
	Power Distribution	1st Floor Girls Gym North Office	4	EA	7	10+ years	
	Walls - Concrete Block	1st Floor Girls Gym North Office	350	SF	6	10+ years	
	Ceiling - Splined	1st Floor Girls Gym South Office	82	SF	6	10+ years	
	Ceiling - Splined	1st Floor Girls Gym South Office	10	SF	4	0-1 year	Damaged
	Doors - Wood Doors inclu hw	1st Floor Girls Gym South Office	1	EA	6	10+ years	
	Floor - Tile	1st Floor Girls Gym South Office	92	SF	6	10+ years	
	Lighting - Lay-in	1st Floor Girls Gym South Office	2	EA	6	6-10 years	
	Power Distribution	1st Floor Girls Gym South Office	4	EA	6	10+ years	
	Walls - Concrete Block	1st Floor Girls Gym South Office	350	SF	6	10+ years	
	Ceiling - Splined	503E Production Manager Office	70	SF	6	10+ years	
	Doors - Side-lite	503E Production Manager Office	56	SF	6	10+ years	
	Doors - Wood Doors inclu hw	503E Production Manager Office	1	EA	6	10+ years	
	Floor - Wood	503E Production Manager Office	70	SF	6	10+ years	
	Lighting - Lay-in	503E Production Manager Office	1	EA	6	6-10 years	
	Power Distribution	503E Production Manager Office	4	EA	7	10+ years	
		-				-	



Group

Category : Room Building : Linked Addition-Athletic Building B Recommend Item - Type Location Quantity UOM Rank **Replacement** Comments Walls - Concrete Block 503E Production Manager Office 166 SF 6 10+ vears Ceiling - Plaster/Drvwall 220 SF 6 505 (tickets room) 10+ years Doors - Wood Doors inclu hw 505 (tickets room) 2 EΑ 6 10+ years Floor - Tile SF 6 505 (tickets room) 220 6-10 years 505 (tickets room) Lighting - Lay-in 4 EΑ 6 6-10 years Power Distribution 505 (tickets room) 4 EΑ 6 10+ years Walls - Plaster/Drywall 505 (tickets room) SF 6 10+ years 800 SF Ceiling - Plaster/Drywall 506 Theatre Office 210 6 10+ years Doors - Wood Doors inclu hw 506 Theatre Office 1 EΑ 6 10+ years SF Floor - Tile 506 Theatre Office 210 6 10+ vears Lighting - Lav-in 506 Theatre Office 4 ΕA 6 6-10 years Power Distribution 506 Theatre Office 4 EΑ 6 10+ years Walls - Plaster/Drywall 400 SF 6 506 Theatre Office 10+ years SF 6 Ceiling - Plaster/Drywall 507 Theatre Office 210 10+ years Doors - Wood Doors inclu hw 2 ΕA 6 507 Theatre Office 10+ years Floor - Tile SF 6 507 Theatre Office 210 10+ years Lighting - Pendent/Surface ΕA 7 507 Theatre Office 3 6-10 years Power Distribution 507 Theatre Office 4 EΑ 7 10+ years Walls - Plaster/Drvwall SF 507 Theatre Office 400 6 10+ vears Work SInk 507 Theatre Office 1 EΑ 5 6-10 years Ceiling - Splined 508A Tickets (Box Office) inside 30 SF 6 10+ years dance room 508A Tickets (Box Office) inside SF Ceiling - Splined 6 4 0-1 year Missing dance room Doors - Wood Doors inclu hw 508A Tickets (Box Office) inside EΑ 1 6 10+ years dance room 508A Tickets (Box Office) inside Floor - Tile 36 SF 6 10+ years dance room Lighting - Lay-in 508A Tickets (Box Office) inside 1 EΑ 6 6-10 years dance room Power Distribution 508A Tickets (Box Office) inside 2 FΑ 6 10+ years dance room SF Walls - Concrete Block 508A Tickets (Box Office) inside 220 6 10+ years dance room SF Ceiling - Splined 510A - Practice Room 76 4 0-1 year Missing broken 25 SF Doors - Side-lite 510A - Practice Room 6 10+ years Doors - Wood Doors inclu hw 510A - Practice Room 1 EΑ 6 10+ years 76 SF Floor - Tile 510A - Practice Room 6 10+ years Lighting - Lay-in 510A - Practice Room 2 EΑ 6 6-10 years Power Distribution 510A - Practice Room 4 ΕA 6 10+ vears SF Walls - Concrete Block 510A - Practice Room 200 6 10+ years SF 6 Ceiling - Splined 510B - Practice Room 54 6-10 years Doors - Side-lite 510B - Practice Room 25 SF 6 10+ years

Doors - Wood Doors inclu hw

1

EA

6

10+ years

510B - Practice Room



Group

Category : Room Building : Linked Addition-Athletic Building B Recommend Item - Type Location Quantity UOM Rank **Replacement** Comments Floor - Tile 510B - Practice Room 54 SF 6-10 vears 6 Lighting - Lay-in 2 ΕA 7 510B - Practice Room 6-10 years Power Distribution 510B - Practice Room 4 FΑ 7 10+ years SF 7 Walls - Concrete Block 510B - Practice Room 163 10+ years SF Ceiling - Splined 510C - Practice Room 76 4 0-1 year Damaged SF Doors - Side-lite 510C - Practice Room 25 6 10+ years Doors - Wood Doors inclu hw ΕA 6 10+ years 510C - Practice Room 1 SF Floor - Tile 510C - Practice Room 76 6 10+ years Lighting - Lay-in 510C - Practice Room 3 EΑ 6 6-10 years SF Walls - Concrete Block 510C - Practice Room 200 6 10+ vears SF Ceiling - Splined 510D - Practice Room 76 4 1-2 vears Broken Doors - Side-lite 510D - Practice Room 25 SF 6 10+ years Doors - Wood Doors inclu hw ΕA 6 10+ years 510D - Practice Room 1 SF 6 Floor - Tile 510D - Practice Room 76 10+ years Lighting - Lay-in 2 ΕA 510D - Practice Room 6 6-10 years Walls - Concrete Block SF 6 510D - Practice Room 200 10+ years SF Ceiling - Splined 514A - Practice Room 50 6 6-10 years SF Ceiling - Splined 514A - Practice Room 4 4 0-1 year Chipped Doors - Side-lite SF 514A - Practice Room 25 6 10+ vears Doors - Wood Doors inclu hw 514A - Practice Room 1 EΑ 6 10+ years Floor - Tile 514A - Practice Room 54 SF 6 10+ years 2 Lighting - Lay-in 514A - Practice Room EΑ 6 6-10 years 4 7 Power Distribution 514A - Practice Room EA 10+ years SF Walls - Concrete Block 514A - Practice Room 163 7 10+ years Ceiling - Splined 50 SF 6 514B - Practice Room 6-10 years Ceiling - Splined SF 514B - Practice Room 4 4 0-1 vear Damaged Doors - Side-lite 25 SF 6 514B - Practice Room 10+ years Doors - Wood Doors inclu hw ΕA 5 0-1 year 514B - Practice Room 1 Broken glasses SF Floor - Tile 514B - Practice Room 54 6 10+ years Lighting - Lay-in 514B - Practice Room 1 ΕA 6 6-10 years Power Distribution 2 FΑ 6 10+ vears 514B - Practice Room Walls - Concrete Block 514B - Practice Room 163 SF 7 10+ vears SF Ceiling - Splined 86 0-1 year 514C - Practice Room 4 Missing Doors - Side-lite 514C - Practice Room 75 SF 6 10+ years Doors - Wood Doors inclu hw 514C - Practice Room 1 EA 6 10+ years SF 6 Floor - Tile 514C - Practice Room 86 10+ years Lighting - Lay-in 514C - Practice Room 2 EΑ 6 6-10 years Power Distribution 2 514C - Practice Room EA 6 10+ years Walls - Concrete Block 514C - Practice Room 200 SF 6 10+ years SF Ceiling - Splined 518 1st Floor Music Office 410 6 6-10 years SF Ceiling - Splined 518 1st Floor Music Office 30 4 0-1 year Damaged Doors - Side-lite 225 SF 6 518 1st Floor Music Office 10+ vears Doors - Transom Window 518 1st Floor Music Office 6 SF 6 10+ years

Doors - Wood Doors inclu hw

4

EA

6

10+ years

518 1st Floor Music Office



Category : Room Building : Linked Addition-Athletic Building B Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Floor - Tile 518 1st Floor Music Office 440 SF 6 10+ vears Lighting - Lay-in ΕA 6 6-10 vears 518 1st Floor Music Office 10 Power Distribution 518 1st Floor Music Office 16 ΕA 6 10+ years SF 7 Storage/ Closet 518 1st Floor Music Office 280 10+ years SF Walls - Concrete Block 518 1st Floor Music Office 480 6 10+ years SF Ceiling - Splined 520 Green Room 358 6 10+ years Doors - Transom Window 520 Green Room SF 6 10+ years 10 10+ years Doors - Wood Doors inclu hw 520 Green Room 1 ΕA 6 Floor - Carpet 520 Green Room 358 SF 6 6-10 years Lighting - Lay-in 6 ΕA 7 6-10 years 520 Green Room Power Distribution 520 Green Room 6 ΕA 7 10+ vears Walls - Concrete Block 520 Green Room 720 SF 6 10+ years Work SInk ΕA 7 10+ years 520 Green Room 1 SF Ceiling - Splined 522 1st Floor Dressing Room (make 282 7 10+ years (moor au Ceiling - Splined 522 1st Floor Dressing Room (make 2 SF 4 0-1 year Chipped up room) Doors - Transom Window 522 1st Floor Dressing Room (make 20 SF 7 10+ years up room) 522 1st Floor Dressing Room (make Doors - Wood Doors inclu hw 2 ΕA 7 10+ years up room) 522 1st Floor Dressing Room (make Floor - Tile 284 SF 6 10+ years up room) Lighting - Pendent/Surface 522 1st Floor Dressing Room (make 3 FΑ 7 6-10 years up room) Lighting - Wall Mounted 522 1st Floor Dressing Room (make 82 FΑ 7 6-10 years up room) **Power Distribution** 522 1st Floor Dressing Room (make ΕA 16 7 10+ years up room) Walls - Concrete Block 522 1st Floor Dressing Room (make 612 SF 6 10+ years up room) Work SInk 522 1st Floor Dressing Room (make ΕA 7 1 10+ vears up room) Ceiling - Splined 525 Shop Office SF 6 150 10+ years SF Ceiling - Splined 525 Shop Office 20 4 0-1 year Damaged ΕA 6 Doors - Steel Doors incl hw 525 Shop Office 1 10+ years SF Doors - Transom Window 525 Shop Office 6 6 10+ years Doors - Wood Doors inclu hw 525 Shop Office 1 ΕA 6 10+ years SF Floor - Tile 525 Shop Office 170 6 10+ years ΕA Lighting - Lay-in 525 Shop Office 3 4 6-10 vears Not working Power Distribution 525 Shop Office 6 ΕA 7 10+ years SF Walls - Concrete Block 525 Shop Office 300 6 10+ years Ceiling - Plaster/Drywall 542C Pool Office 135 SF 6 10+ years Doors - Steel Doors incl hw 542C Pool Office 1 EA 6 10+ years



Building : Linked Addition-Athletic Building B

Catego	Category : Room			uildina	: Linked		letic Building B
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
-	Doors - Wood Doors inclu hw	542C Pool Office	1	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	542C Pool Office	135	SF	6	10+ years	
	Lighting - Lay-in	542C Pool Office	4	EA	6	6-10 years	
	Power Distribution	542C Pool Office	6	EA	7	10+ years	
	Walls - Concrete Block	542C Pool Office	430	SF	6	10+ years	
	Ceiling - Lay-in	601 Control Room (in Auditorium)	190	SF	4	1-2 years	Missing, different colors throughout
	Doors - Side-lite	601 Control Room (in Auditorium)	80	SF	6	10+ years	
	Doors - Wood Doors inclu hw	601 Control Room (in Auditorium)	1	EA	6	10+ years	
	Floor - Carpet	601 Control Room (in Auditorium)	190	SF	5	6-10 years	
	Lighting - Pendent/Surface	601 Control Room (in Auditorium)	4	EA	6	6-10 years	
	Power Distribution	601 Control Room (in Auditorium)	8	EA	6	10+ years	
	Walls - Concrete Block	601 Control Room (in Auditorium)	410	SF	6	10+ years	
	Ceiling - Splined	602 Spots in Auditorium	68	SF	6	10+ years	
	Doors - Side-lite	602 Spots in Auditorium	40	SF	7	10+ years	
	Doors - Wood Doors inclu hw	602 Spots in Auditorium	1	EA	6	10+ years	
	Floor - Carpet	602 Spots in Auditorium	70	SF	6	6-10 years	
	Lighting - Pendent/Surface	602 Spots in Auditorium	2	EA	4	1-2 years	Not working
	Power Distribution	602 Spots in Auditorium	2	EA	7	10+ years	
	Walls - Concrete Block	602 Spots in Auditorium	208	SF	6	10+ years	
	Ceiling - Splined	603 Spots in Auditorium	70	SF	5	10+ years	
	Doors - Side-lite	603 Spots in Auditorium	40	SF	7	10+ years	
	Doors - Wood Doors inclu hw	603 Spots in Auditorium	1	EA	6	10+ years	
	Floor - Carpet	603 Spots in Auditorium	70	SF	6	6-10 years	
	Lighting - Pendent/Surface	603 Spots in Auditorium	2	EA	5	6-10 years	
	Power Distribution	603 Spots in Auditorium	2	EA	7	10+ years	
	Walls - Concrete Block	603 Spots in Auditorium	208	SF	6	10+ years	
	Ceiling - Lay-in	611 Teacher's Office	327	SF	7	10+ years	
	Doors - Wood Doors inclu hw	611 Teacher's Office	2	EA	7	10+ years	
	Floor - Tile	611 Teacher's Office	327	SF	6	10+ years	
	Lighting - Lay-in	611 Teacher's Office	2	EA	7	6-10 years	
	Power Distribution	611 Teacher's Office	8	EA	7	10+ years	
	Storage/ Closet	611 Teacher's Office	35	SF	5	10+ years	
	Walls - Concrete Block	611 Teacher's Office	736	SF	7	10+ years	
	Ceiling - Splined	616 Music Office	290	SF	6	10+ years	
	Doors - Side-lite	616 Music Office	84	SF	6	10+ years	
	Doors - Transom Window	616 Music Office	6	SF	6	10+ years	
	Doors - Wood Doors inclu hw	616 Music Office	1	EA	6	10+ years	
	Floor - Carpet	616 Music Office	290	SF	7	6-10 years	
	Lighting - Lay-in	616 Music Office	6	EA	7	6-10 years	
	Power Distribution	616 Music Office	6	EA	7	10+ years	
	Walls - Concrete Block	616 Music Office	350	SF	7	10+ years	
	Walls - Masonry	616 Music Office	190	SF	7	10+ years	
	Ceiling - Splined	616B - Practice Room	117	SF	7	10+ years	
	Ceiling - Splined	616B - Practice Room	3	SF	4	0-1 year	Damaged
						-	



Group

Category : Room Building : Linked Addition-Athletic Building B Recommend Item - Type Location Quantity UOM Rank **Replacement** Comments Doors - Side-lite 616B - Practice Room 25 SF 10+ vears 6 ΕA 6 Doors - Wood Doors inclu hw 616B - Practice Room 1 10+ vears Floor - Carpet 616B - Practice Room 120 SF 5 2-5 years ΕA 7 Lighting - Lay-in 616B - Practice Room 1 6-10 years 2 7 Power Distribution 616B - Practice Room EΑ 10+ years SF 7 Walls - Concrete Block 616B - Practice Room 276 10+ years Ceiling - Lay-in SF 7 10+ years 616C/D- Practice Room 63 616C/D- Practice Room SF Ceiling - Lay-in 12 4 0-1 year Water damage Doors - Side-lite 616C/D- Practice Room 25 SF 6 10+ years Doors - Wood Doors inclu hw 616C/D- Practice Room 1 FΑ 7 10+ vears Floor - Carpet 616C/D- Practice Room 75 SF 7 6-10 vears Lighting - Lay-in 616C/D- Practice Room 2 ΕA 7 6-10 years **Power Distribution** 2 ΕA 7 616C/D- Practice Room 10+ years SF 7 Walls - Concrete Block 616C/D- Practice Room 208 10+ years SF Ceiling - Splined 620 Art Office 703 6 10+ years Ceiling - Splined 2 SF 620 Art Office 4 0-1 year Damaged Doors - Side-lite SF 6 620 Art Office 52 10+ vears Doors - Wood Doors inclu hw 620 Art Office 1 EΑ 7 10+ years 620 Art Office SF Floor - Tile 705 6 10+ vears Lighting - Lay-in 620 Art Office 19 EΑ 7 6-10 years Power Distribution 620 Art Office 8 ΕA 6 10+ years Walls - Concrete Block SF 7 620 Art Office 1,010 10+ years 5 Work SInk 620 Art Office EA 10+ years 1 SF Ceiling - Plaster/Drywall 88 6 10+ years 620A Art Office Doors - Transom Window SF 7 620A Art Office 10 10+ years Doors - Wood Doors inclu hw 620A Art Office 1 EΑ 7 10+ vears 88 SF Floor - Tile 620A Art Office 6 10+ years Lighting - Pendent/Surface ΕA 7 6-10 years 620A Art Office 1 Walls - Concrete Block SF 620A Art Office 344 7 10+ years

287

287

2

3

2

540

123

570

565

1

5

8

12

1,017

204

SF

EΑ

SF

FΑ

FΑ

SF

SF

SF

EA

SF

SF

ΕA

FΑ

SF

SF

4

7

6

6

6

6

7

4

7

6

4

7

7

6

7

0-1 year

10+ vears

10+ vears

6-10 years

10+ years

10+ years

10+ years

0-1 year

10+ years

10+ years

1-2 vears

6-10 years

10+ vears

10+ years

10+ years

Dirty damaged

Damaged

Broken

Ceiling - Splined

Power Distribution

Ceiling - Splined

Lighting - Lay-in

Power Distribution

Walls - Concrete Block

Walls - Plaster/Drywall

Walls - Concrete Block

Walls - Plaster/Drywall

Floor - Tile

Floor - Tile

Floor - Tile

Doors - Wood Doors inclu hw

Lighting - Pendent/Surface

Doors - Wood Doors inclu hw

630 Office

631 Office



Catego	ry : Room		B	uilding	: Linked	Addition-Ath	letic Building B
			Recomme			Recommend	-
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	AC Unit	638 - Copy Room	1	EA	7	6-10 years	
	Ceiling - Plaster/Drywall	638 - Copy Room	287	SF	6	10+ years	
	Doors - Wood Doors inclu hw	638 - Copy Room	2	EA	6	10+ years	
	Floor - Tile	638 - Copy Room	287	SF	6	10+ years	
	Lighting - Pendent/Surface	638 - Copy Room	3	EA	6	6-10 years	
	Power Distribution	638 - Copy Room	2	EA	7	10+ years	
	Walls - Concrete Block	638 - Copy Room	440	SF	6	10+ years	
	Walls - Concrete Block	638 - Copy Room	100	SF	5	0-1 year	Cracked
	Walls - Plaster/Drywall	638 - Copy Room	123	SF	6	10+ years	
	Ceiling - Splined	639 Office	570	SF	6	10+ years	
	Doors - Wood Doors inclu hw	639 Office	1	EA	7	10+ years	
	Floor - Tile	639 Office	570	SF	6	10+ years	
	Lighting - Lay-in	639 Office	8	EA	7	6-10 years	
	Power Distribution	639 Office	12	EA	7	10+ years	
	Walls - Concrete Block	639 Office	1,000	SF	6	10+ years	
	Walls - Concrete Block	639 Office	17	SF	5	,	Cracked
		639 Office	204	SF	5	0-1 year	Clackeu
	Walls - Plaster/Drywall	839 Office	204	SF	1	10+ years	
uditoriu	ım & Theater						
	Ceiling - Exposed	1st Floor	3,000	SF	7	10+ years	
	Ceiling - Plaster/Drywall	1st Floor	8,000	SF	7	10+ years	
	Ceiling - Splined	1st Floor	500	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	2	EA	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	4	EA	6	10+ years	
	Floor - Carpet	1st Floor	11,500	SF	5	10+ years	
	Lighting - Lay-in	1st Floor	12	ĒA	6	6-10 years	
	Lighting - Pendent/Surface	1st Floor	96	EA	5	6-10 years	
	Lighting - Wall Mounted	1st Floor	14	EA	6	6-10 years	
	Main Floor Seating	1st Floor	965	EA	7	10+ years	
	Sound System	1st Floor	1	EA	7	6-10 years	
	Stage	1st Floor	3,300	SF	5	10+ years	
	Stage Curtain	1st Floor	5,500	EA	5	6-10 years	
	Stage Lift	1st Floor	5	EA	5	10+ years	
			1	EA	-		
	Stage Lighting System Stage-Stairs - Wood	1st Floor 1st Floor	-	EA LF	5	6-10 years	
			30		6	10+ years	
	Stairs - Tile	1st Floor	302	LF LF	6	10+ years	
	Stairs - Wood	1st Floor	100		7	10+ years	
	Storage/ Closet	1st Floor	640	SF	7	10+ years	
	Walls - Concrete Block	1st Floor	4,100	SF	6	10+ years	
	Walls - Masonry	1st Floor	8,000	SF	7	10+ years	
Symnasi	ia						
-	Bleacher Seating	1st Floor Boys Gym	1,430	EA	6	6-10 years	
	Dicacher Ocaling		.,		•	0 10 30010	



Catego	Category : Room			Building : Linked Addition-Athletic Building B					
5				Ŭ		Recommend	-		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Ceiling - Plaster/Drywall	1st Floor Boys Gym	24	SF	6	10+ years			
	Doors - Transom Window	1st Floor Boys Gym	32	SF	6	10+ years			
	Doors - Wood Doors inclu hw	1st Floor Boys Gym	2	EA	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor Boys Gym	4	EA	6	10+ years			
	Floor - Wood	1st Floor Boys Gym	12,254	SF	6	10+ years			
	Lighting - Metal Halide/ High Pressure	1st Floor Boys Gym	48	EA	6	6-10 years			
	Sodium					-			
	Lighting - Pendent/Surface	1st Floor Boys Gym	6	EA	7	6-10 years			
	Scoreboards	1st Floor Boys Gym	2	EA	7	6-10 years			
	Walls - Concrete Block	1st Floor Boys Gym	11,800	SF	6	10+ years			
	Walls - Metal Panel	1st Floor Boys Gym	2,100	SF	6	10+ years			
	Ceiling - Exposed	1st Floor Girls Gym North 533A	4,560	SF	6	10+ years			
	Ceiling - Plaster/Drywall	1st Floor Girls Gym North 533A	12	SF	7	10+ years			
	Doors - Steel Doors incl hw	1st Floor Girls Gym North 533A	2	EA	6	10+ years			
	Doors - Transom Window	1st Floor Girls Gym North 533A	6	SF	7	10+ years			
	Doors - Transom Window	1st Floor Girls Gym North 533A	20	SF	6	10+ years			
	Doors - Wood Doors inclu hw	1st Floor Girls Gym North 533A	1	EA	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor Girls Gym North 533A	2	EA	6	10+ years			
	Floor - Wood	1st Floor Girls Gym North 533A	4,572	SF	6	10+ years			
	Lighting - Metal Halide/Sodium Vapor	1st Floor Girls Gym North 533A	15	ĒA	6	6-10 years			
	Lighting - Pendent/Surface	1st Floor Girls Gym North 533A	2	EA	7	6-10 years			
	Scoreboards	1st Floor Girls Gym North 533A	1	EA	7	6-10 years			
	Storage/ Closet	1st Floor Girls Gym North 533A	130	SF	5	10+ years			
	Storage/ Closet	1st Floor Girls Gym North 533A	200	SF	5	10+ years			
	Walls - Concrete Block	1st Floor Girls Gym North 533A	4,200	SF	6	10+ years			
	Walls - Metal Panel	1st Floor Girls Gym North 533A	160	SF	7	10+ years			
	Walls - Metal Panel	1st Floor Girls Gym North 533A	1,070	SF	6	10+ years			
	Walls - Metal Panel	1st Floor Girls Gym North 533A	4,230	SF	6	10+ years			
	Ceiling - Exposed	1st Floor Girls Gym South 533B	4,560	SF	6	10+ years			
	Ceiling - Plaster/Drywall	1st Floor Girls Gym South 533B	12	SF	5	10+ years			
	Doors - Steel Doors incl hw	1st Floor Girls Gym South 533B	5	EA	6	10+ years			
	Doors - Transom Window	1st Floor Girls Gym South 533B	26	SF	6	10+ years			
	Doors - Wood Doors inclu hw	1st Floor Girls Gym South 533B	2	EA	6	10+ years			
	Floor - Wood	1st Floor Girls Gym South 533B	4,572	SF	6	10+ years			
	Lighting - Metal Halide/Sodium Vapor	1st Floor Girls Gym South 533B	15	EA	6	6-10 years			
	Lighting - Pendent/Surface	1st Floor Girls Gym South 533B	1	EA	6	6-10 years			
	Scoreboards	1st Floor Girls Gym South 533B	1	EA	7	6-10 years			
	Storage/ Closet	1st Floor Girls Gym South 533B	200	SF	5	10+ years			
	Storage/ Closet	1st Floor Girls Gym South 533B	130	SF	5	10+ years			
	Walls - Concrete Block	1st Floor Girls Gym South 533B	4,170	SF	6	10+ years			
	Walls - Metal Panel	1st Floor Girls Gym South 533B	722	SF	6	10+ years			
	Walls - Metal Panel	1st Floor Girls Gym South 533B	1,862	SF	6	10+ years			
	Ceiling - Plaster/Drywall	540 Wrestling Gym	2,679	SF	6	10+ years			
	Doors - Wood Doors inclu hw	540 Wrestling Gym	2,079	EA	7	10+ years			
			Z		'	io+ years			



Category : Room			Building : Linked Addition-Athletic Building B						
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Floor - Weight/ Fitness Room Floor Matting	540 Wrestling Gym	2,679	SF	6	10+ years			
	Lighting - Lay-in	540 Wrestling Gym	50	EA	6	6-10 years			
	Storage/ Closet	540 Wrestling Gym	117	SF	5	10+ years			
	Walls - Concrete Block	540 Wrestling Gym	2,800	SF	6	10+ years			
Locker/S	Shower Room								
	Accessories	2nd Floor 642	881	SF	5	6-10 years			
	Ceiling - Plaster/Drywall	2nd Floor 642	881	SF	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor 642	2	EA	6	10+ years			
	Floor - Concrete	2nd Floor 642	530	SF	7	10+ years			
	Floor - Tile Ceramic/ Porcelain	2nd Floor 642	351	SF	6	10+ years			
	Floor Drain	2nd Floor 642	3	EA	7	10+ years			
	Lavatory	2nd Floor 642	2	EA	5	10+ years			
	Lighting - Pendent/Surface	2nd Floor 642	2 8	EA	6	6-10 years			
	Partitions	2nd Floor 642	0	EA	7				
		2nd Floor 642	1	EA		10+ years			
	Showers		4		5	10+ years			
	Storage/ Closet	2nd Floor 642	108	SF	7	10+ years			
	Student Lockers - One Tier	2nd Floor 642	71	EA	6	10+ years			
	Urinals	2nd Floor 642	1	EA	5	10+ years			
	Walls - Concrete Block	2nd Floor 642	691	SF	6	10+ years			
	Walls - Structural Glazed Tile	2nd Floor 642	598	SF	6	10+ years			
	Water Closet	2nd Floor 642	1	EA	6	10+ years			
	Ceiling - Plaster/Drywall	2nd Floor 636	248	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor 636	1	EA	6	10+ years			
	Floor - Concrete	2nd Floor 636	248	SF	7	10+ years			
	Lighting - Pendent/Surface	2nd Floor 636	4	EA	6	6-10 years			
	Student Lockers - Two Tier	2nd Floor 636	64	EA	5	10+ years			
	Walls - Concrete Block	2nd Floor 636	476	SF	6	10+ years			
	Accessories	2nd Floor Boys 634	3,781	SF	7	6-10 years			
	Benches, ped mounted	2nd Floor Boys 634	80	LF	6	10+ years			
	Ceiling - Plaster/Drywall	2nd Floor Boys 634	3,781	SF	6	10+ years			
	Doors - Steel Doors incl hw	2nd Floor Boys 634	4	EA	6	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor Boys 634	2	EA	6	10+ years			
	Floor - Concrete Epoxy/ Painted	2nd Floor Boys 634	2,398	SF	7	10+ years			
	Floor - Tile Ceramic/ Porcelain	2nd Floor Boys 634	1,383	SF	6	10+ years			
	Floor Drain	2nd Floor Boys 634	24	EA	7	10+ years			
	Hand Dryer	2nd Floor Boys 634	12	EA	7	6-10 years			
	Lavatory	2nd Floor Boys 634	3	EA	6	10+ years			
	Lighting - Pendent/Surface	2nd Floor Boys 634	51	EA	6	6-10 years			
	Partitions	2nd Floor Boys 634	3	EA	7	•			
						10+ years			
	Showers	2nd Floor Boys 634	26	EA	5	10+ years			
	Storage/ Closet	2nd Floor Boys 634	54	SF	7	10+ years			
	Student Lockers - One Tier	2nd Floor Boys 634	28	EA	6	10+ years			
	Student Lockers - Two Tier	2nd Floor Boys 634	750	EA	6	10+ years			



Catego	ry : Room		В	uilding	: Linked	Addition-Athl	etic Building B	
						Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Urinals	2nd Floor Boys 634	2	EA	7	10+ years		
	Walls - Concrete Block	2nd Floor Boys 634	1,305	SF	6	10+ years		
	Walls - Structural Glazed Tile	2nd Floor Boys 634	1,902	SF	6	10+ years		
	Water Closet	2nd Floor Boys 634	3	EA	6	10+ years		
	Accessories	538A Accessible Locker Room	251	SF	7	6-10 years		
	Benches, ped mounted	538A Accessible Locker Room	4	LF	6	10+ years		
	Ceiling - Plaster/Drywall	538A Accessible Locker Room	251	SF	6	10+ years		
	Doors - Wood Doors inclu hw	538A Accessible Locker Room	2	EA	6	10+ years		
	Floor - Tile Ceramic/ Porcelain	538A Accessible Locker Room	251	SF	6	10+ years		
	Floor Drain	538A Accessible Locker Room	2	EA	7	10+ years		
	Hand Dryer	538A Accessible Locker Room	1	EA	7	6-10 years		
	Lavatory	538A Accessible Locker Room	1	EA	6	10+ years		
	Lighting - Lay-in	538A Accessible Locker Room	4	EA	6	6-10 years		
	Lighting - Pendent/Surface	538A Accessible Locker Room	2	EA	6	6-10 years		
	Showers	538A Accessible Locker Room	1	EA	7	10+ years		
	Student Lockers - One Tier	538A Accessible Locker Room	4	EA	6	10+ years		
	Walls - Structural Glazed Tile	538A Accessible Locker Room	930	SF	6	10+ years		
	Water Closet	538A Accessible Locker Room	1	ĒA	6	10+ years		
	Accessories	539B Accessible Locker Room	251	SF	7	6-10 years		
	Benches, ped mounted	539B Accessible Locker Room	4	LF	7	10+ years		
	Ceiling - Plaster/Drywall	539B Accessible Locker Room	251	SF	7	10+ years		
	Doors - Wood Doors inclu hw	539B Accessible Locker Room	2	EA	6	10+ years		
	Floor - Tile Ceramic/ Porcelain	539B Accessible Locker Room	251	SF	7	10+ years		
	Floor Drain	539B Accessible Locker Room	201	EA	7	10+ years		
	Hand Dryer	539B Accessible Locker Room	1	EA	7	10+ years		
	Lavatory	539B Accessible Locker Room	1	EA	7	10+ years		
	Lighting - Lay-in	539B Accessible Locker Room	4	EA	7	6-10 years		
	Lighting - Pendent/Surface	539B Accessible Locker Room	2	EA	7	6-10 years		
	Showers	539B Accessible Locker Room	1	EA	7	10+ years		
	Student Lockers - One Tier	539B Accessible Locker Room	4	EA	7	10+ years		
	Walls - Structural Glazed Tile	539B Accessible Locker Room	930	SF	7	10+ years		
	Water Closet	539B Accessible Locker Room	1	EA	7	10+ years		
	Ceiling - Plaster/Drywall	634D	170	SF	6	10+ years		
	Doors - Side-lite	634D	9	SF	7	10+ years		
	Doors - Steel Doors incl hw	634D	1	EA	6	10+ years		
	Floor - Tile Ceramic/ Porcelain	634D	170	SF	6	10+ years		
	Lighting - Pendent/Surface	634D	3	EA	6	6-10 years		
	Power Distribution	634D	2	EA	6	10+ years		
	Walls - Concrete Block	634D	525	SF	6	10+ years		
	Work Sink	634D	1	EA	5	6-10 years		
	Accessories	637	240	SF	5	6-10 years		
	Ceiling - Plaster/Drywall	637	240	SF	6	10+ years		
	Doors - Wood Doors inclu hw	637	240	EA	6	10+ years		
	Floor - Concrete	637	240	SF	7	10+ years		
		007	240	0	'	ior years		



Catego	Category : Room			Building : Linked Addition-Athletic Building B					
				. 3		Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Lavatory	637	1	EA	6	10+ years			
	Lighting - Pendent/Surface	637	8	EA	6	6-10 years			
	Partitions	637	1	EA	7	10+ years			
	Showers	637	2	EA	7	10+ years			
	Student Lockers - One Tier	637	55	EA	6	10+ years			
	Urinals	637	1	EA	6	10+ years			
	Walls - Concrete Block	637	475	SF	6	10+ years			
	Water Closet	637	1	ĒA	6	10+ years			
	Ceiling - Plaster/Drywall	642D locker room	175	SF	6	10+ years			
	Doors - Steel Doors incl hw	642D locker room	1	ĒA	6	10+ years			
	Floor - Carpet	642D locker room	25	SF	6	6-10 years			
	Floor - Tile Ceramic/ Porcelain	642D locker room	150	SF	6	10+ years			
	Lighting - Pendent/Surface	642D locker room	3	EA	6	6-10 years			
	Power Distribution	642D locker room	1	EA	6	10+ years			
	Walls - Concrete Block	642D locker room	550	SF	6	10+ years			
	Work Sink	642D locker room	1	EA	7	10+ years			
	Accessories	646 Girls Locker Room	400	SF	7	6-10 years			
	Benches, ped mounted	646 Girls Locker Room	400 80	LF	6				
	Ceiling - Plaster/Drywall			SF	6	10+ years			
		646 Girls Locker Room	3,681	SF	6 4	10+ years	Weter demore		
	Ceiling - Plaster/Drywall	646 Girls Locker Room	100		-	1-2 years	Water damage		
	Doors - Steel Doors incl hw	646 Girls Locker Room	4	EA	6	10+ years			
	Doors - Wood Doors inclu hw	646 Girls Locker Room	2	EA	6	10+ years			
	Floor - Epoxy/ Painted	646 Girls Locker Room	2,398	SF	7	10+ years			
	Floor - Tile Ceramic/ Porcelain	646 Girls Locker Room	1,383	SF	6	10+ years			
	Floor Drain	646 Girls Locker Room	24	EA	7	10+ years			
	Hand Dryer	646 Girls Locker Room	12	EA	7	6-10 years			
	Lavatory	646 Girls Locker Room	4	EA	6	10+ years			
	Lighting - Pendent/Surface	646 Girls Locker Room	51	EA	6	6-10 years			
	Partitions	646 Girls Locker Room	5	EA	7	10+ years			
	Showers	646 Girls Locker Room	26	EA	5	10+ years			
	Storage/ Closet	646 Girls Locker Room	54	SF	7	10+ years			
	Student Lockers - One Tier	646 Girls Locker Room	8	EA	6	10+ years			
	Student Lockers - Two Tier	646 Girls Locker Room	734	EA	6	10+ years			
	Walls - Concrete Block	646 Girls Locker Room	1,305	SF	6	10+ years			
	Walls - Structural Glazed Tile	646 Girls Locker Room	1,902	SF	6	10+ years			
	Water Closet	646 Girls Locker Room	5	EA	6	10+ years			
Mechani	cal/ Service Rooms								
	Janitor's Closet	1st Floor	180	SF	7	10+ years			
	Janitor's Closet	1st Floor	180	SF	5	10+ years			
	Mechanical/ Service Rooms	1st Floor	300	SF	7	10+ years			
	Mechanical/ Service Rooms	1st Floor	244	SF	7	10+ years			
	Mechanical/ Service Rooms	1st Floor	81	SF	5	10+ years			
	Mechanical/ Service Rooms	1st Floor	80	SF	5	10+ years			



Category : Room		Building : Linked Addition-Athletic Building B					
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Mechanical/ Service Rooms	1st Floor	65	SF	5	10+ years	
	Storage Room	1st Floor	358	SF	7	10+ years	
	Storage Room	1st Floor	125	SF	7	10+ years	
	Storage Room	1st Floor	160	SF	7	10+ years	
	Storage Room	1st Floor	232	SF	7	10+ years	
	Storage Room	1st Floor	200	SF	7	10+ years	
	Janitor's Closet	2nd Floor	28	SF	7	10+ years	
	Janitor's Closet	2nd Floor	30	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	300	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	200	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	200	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	110	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	150	SF	7	10+ years	
	Mechanical/ Service Rooms	2nd Floor	90	SF	7	10+ years	
	Storage Room	2nd Floor	620	SF	7	10+ years	
	Storage Room	2nd Floor	406	SF	7	10+ years	
	Storage Room	2nd Floor	154	SF	7	10+ years	
	Storage Room	2nd Floor	134	SF	7	10+ years	
	Storage Room	2nd Floor	56	SF	5	10+ years	
	Mechanical/ Service Rooms	Basement	4,450	SF	5	10+ years	
	Mechanical/ Service Rooms	Penthouse	625	SF	5	10+ years	
Pool & N	latatorium						
	Accessories	1st Floor	7,592	SF	7	6-10 years	
	Bleachers Seating/Plank Seating	1st Floor	136	EA	6	10+ years	
	Ceiling - Lay-in	1st Floor	7,202	SF	6	10+ years	
	Ceiling - Plaster/Drywall	1st Floor	390	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor	4	EA	6	10+ years	
	Floor - Concrete Epoxy/ Painted	1st Floor	7,592	SF	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor	10	SF	4	1-2 years	Damaged
	Lighting - Lay-in	1st Floor	6	EA	7	6-10 years	C C
	Lighting - Metal Halide/Sodium Vapor	1st Floor	19	EA	7	6-10 years	
	Lighting - Wall Mounted	1st Floor	4	EA	7	6-10 years	
	Pool Basin	1st Floor	3,451	SF	6	10+ years	
	Pool Deck	1st Floor	2,873	SF	6	10+ years	
	Pool Deck Drains	1st Floor	24	EA	7	10+ years	
	Storage/ Closet	1st Floor	92	SF	7	10+ years	
	Walls - Masonry	1st Floor	8,605	SF	6	10+ years	
			,			2	
Restroor							
	Accessories	1st Floor NE Boys	355	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor NE Boys	355	SF	6	10+ years	
	Doors - Transom Window	1st Floor NE Boys	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor NE Boys	2	EA	6	10+ years	



Category : Room			Building : Linked Addition-Athletic Building B				
				Ŭ		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Floor - Tile Ceramic/ Porcelain	1st Floor NE Boys	355	SF	6	10+ years	
	Floor Drain	1st Floor NE Boys	1	EA	7	10+ years	
	Hand Dryer	1st Floor NE Boys	2	EA	7	6-10 years	
	Lavatory	1st Floor NE Boys	3	EA	6	10+ years	
	Lighting - Lay-in	1st Floor NE Boys	4	EA	7	6-10 years	
	Partitions	1st Floor NE Boys	3	EA	7	10+ years	
	Urinals	1st Floor NE Boys	4	EA	6	10+ years	
	Walls - Structural Glazed Tile	1st Floor NE Boys	875	SF	7	10+ years	
	Water Closet	1st Floor NE Boys	3	EA	6	10+ years	
	Accessories	1st Floor NW Girls (by link)	385	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor NW Girls (by link)	385	SF	7	10+ years	
	Doors - Transom Window	1st Floor NW Girls (by link)	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor NW Girls (by link)	2	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor NW Girls (by link)	385	SF	6	10+ years	
	Floor Drain	1st Floor NW Girls (by link)	1	EA	7	10+ years	
	Hand Dryer	1st Floor NW Girls (by link)	2	EA	7	6-10 years	
	Lavatory	1st Floor NW Girls (by link)	4	EA	6	10+ years	
	Lighting - Lay-in	1st Floor NW Girls (by link)	5	EA	6	6-10 years	
	Partitions	1st Floor NW Girls (by link)	5	EA	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor NW Girls (by link)	, 950	SF	7	10+ years	
	Water Closet	1st Floor NW Girls (by link)	7	EA	7	10+ years	
	Accessories	1st Floor Pool Boys	, 70	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor Pool Boys	70	SF	6	10+ years	
	Doors - Side-lite	1st Floor Pool Boys	1	SF	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor Pool Boys	60	SF	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor Pool Boys		SF	4		Missing broken
	Floor Drain	1st Floor Pool Boys	10 1	EA	4 7	0-1 year 10+ years	Missing broken
		1st Floor Pool Boys	1	EA	6		
	Lighting - Lay-in Partitions	1st Floor Pool Boys	1	EA	6 5	6-10 years	
			•			10+ years	
	Urinals	1st Floor Pool Boys	1 9	EA SF	6	10+ years	
	Walls - Plaster/Drywall	1st Floor Pool Boys	-	SF	6	10+ years	
	Walls - Structural Glazed Tile	1st Floor Pool Boys	360		6	10+ years	
	Water Closet	1st Floor Pool Boys	1	EA	6	10+ years	
		1st Floor Pool Girls	70	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor Pool Girls	70	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor Pool Girls	1	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor Pool Girls	70	SF	6	10+ years	
	Floor Drain	1st Floor Pool Girls	1	EA	7	10+ years	
	Lighting - Lay-in	1st Floor Pool Girls	1	EA	6	6-10 years	
	Partitions	1st Floor Pool Girls	2	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor Pool Girls	9	SF	6	10+ years	
	Walls - Structural Glazed Tile	1st Floor Pool Girls	360	SF	6	10+ years	
	Water Closet	1st Floor Pool Girls	2	EA	6	10+ years	
	Accessories	1st Floor SE Girls	208	SF	7	6-10 years	



Category : Room			Building : Linked Addition-Athletic Building B					
				anang		Recommend		
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments	
	Ceiling - Plaster/Drywall	1st Floor SE Girls	208	SF	6	10+ years		
	Doors - Wood Doors inclu hw	1st Floor SE Girls	1	EA	4	0-1 year	Don't lock properly	
	Floor - Tile Ceramic/ Porcelain	1st Floor SE Girls	208	SF	7	10+ years		
	Floor Drain	1st Floor SE Girls	1	EA	7	10+ years		
	Hand Dryer	1st Floor SE Girls	1	EA	7	6-10 years		
	Lavatory	1st Floor SE Girls	3	EA	7	10+ years		
	Lighting - Lay-in	1st Floor SE Girls	3	EA	7	6-10 years		
	Partitions	1st Floor SE Girls	3	EA	7	10+ years		
	Walls - Structural Glazed Tile	1st Floor SE Girls	750	SF	6	10+ years		
	Water Closet	1st Floor SE Girls	3	EA	7	10+ years		
	Accessories	1st Floor SW Boys (used as	175	SF	4	1-2 years	Not working	
		Storage)				,	5	
	Ceiling - Plaster/Drywall	1st Floor SW Boys (used as	175	SF	6	10+ years		
	5	Storage)				,		
	Doors - Wood Doors inclu hw	1st Floor SW Boys (used as	1	EA	6	10+ years		
		Storage)				-)		
	Floor - Tile Ceramic/ Porcelain	1st Floor SW Boys (used as	175	SF	6	10+ years		
		Storage)				,		
	Lavatory	1st Floor SW Boys (used as	2	EA	6	10+ years		
		Storage)				-)		
	Lighting - Lay-in	1st Floor SW Boys (used as	3	EA	6	6-10 years		
	5 5 7	Storage)				,		
	Partitions	1st Floor SW Boys (used as	2	EA	7	10+ years		
		Storage)				-)		
	Urinals	1st Floor SW Boys (used as	2	EA	6	10+ years		
		Storage)						
	Walls - Structural Glazed Tile	1st Floor SW Boys (used as	648	SF	7	10+ years		
		Storage)						
	Water Closet	1st Floor SW Boys (used as	2	EA	6	10+ years		
		Storage)						
	Accessories	2nd Floor NE Men 623	190	SF	7	6-10 years		
	Ceiling - Plaster/Drywall	2nd Floor NE Men 623	190	SF	6	10+ years		
	Doors - Transom Window	2nd Floor NE Men 623	20	SF	6	10+ years		
	Doors - Wood Doors inclu hw	2nd Floor NE Men 623	2	EA	6	10+ years		
	Floor - Tile Ceramic/ Porcelain	2nd Floor NE Men 623	190	SF	6	10+ years		
	Floor Drain	2nd Floor NE Men 623	1	EA	7	10+ years		
	Hand Dryer	2nd Floor NE Men 623	1	EA	7	6-10 years		
	Lavatory	2nd Floor NE Men 623	2	EA	6	10+ years		
	Lighting - Lay-in	2nd Floor NE Men 623	3	EA	6	6-10 years		
	Partitions	2nd Floor NE Men 623	2	EA	7	10+ years		
	Urinals	2nd Floor NE Men 623	3	EA	6	10+ years		
	Walls - Structural Glazed Tile	2nd Floor NE Men 623	642	SF	6	10+ years		
	Water Closet	2nd Floor NE Men 623	2	ĒA	6	10+ years		
	Accessories	2nd Floor NE Women 625	230	SF	7	6-10 years		
					-			



Category : Room			Building : Linked Addition-Athletic Building B				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Plaster/Drywall	2nd Floor NE Women 625	230	SF	6	10+ years	
	Doors - Transom Window	2nd Floor NE Women 625	10	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor NE Women 625	1	EA	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd Floor NE Women 625	230	SF	6	10+ years	
	Floor Drain	2nd Floor NE Women 625	1	EA	7	10+ years	
	Lavatory	2nd Floor NE Women 625	2	EA	6	10+ years	
	Lighting - Lay-in	2nd Floor NE Women 625	3	EA	6	6-10 years	
	Partitions	2nd Floor NE Women 625	4	EA	7	10+ years	
	Walls - Structural Glazed Tile	2nd Floor NE Women 625	926	SF	7	10+ years	
	Water Closet	2nd Floor NE Women 625	4	EA	7	10+ years	
	Accessories	2nd Floor NW Mens (614)	190	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	2nd Floor NW Mens (614)	190	SF	7	10+ years	
	Doors - Transom Window	2nd Floor NW Mens (614)	10	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor NW Mens (614)	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd Floor NW Mens (614)	190	SF	6	10+ years	
	Floor Drain	2nd Floor NW Mens (614)	1	EA	7	10+ years	
	Hand Dryer	2nd Floor NW Mens (614)	1	EA	7	6-10 years	
	Lavatory	2nd Floor NW Mens (614)	3	EA	6	10+ years	
	Lighting - Lay-in	2nd Floor NW Mens (614)	3	EA	6	6-10 years	
	Partitions	2nd Floor NW Mens (614)	1	EA	7	10+ years	
	Urinals	2nd Floor NW Mens (614)	3	EA	6	10+ years	
	Walls - Structural Glazed Tile	2nd Floor NW Mens (614)	750	SF	7	10+ years	
	Water Closet	2nd Floor NW Mens (614)	1	EA	7	10+ years	
	Accessories	2nd Floor NW Womens (615)	190	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	2nd Floor NW Womens (615)	190	SF	7	10+ years	
	Doors - Transom Window	2nd Floor NW Womens (615)	10	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor NW Womens (615)	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	2nd Floor NW Womens (615)	190	SF	6	10+ years	
	Floor Drain	2nd Floor NW Womens (615)	1	EA	7	10+ years	
	Hand Dryer	2nd Floor NW Womens (615)	1	EA	7	6-10 years	
	Lavatory	2nd Floor NW Womens (615)	3	EA	6	10+ years	
	Lighting - Lay-in	2nd Floor NW Womens (615)	2	EA	7	6-10 years	
	Partitions	2nd Floor NW Womens (615)	2	EA	7	10+ years	
	Walls - Structural Glazed Tile	2nd Floor NW Womens (615)	700	SF	7	10+ years	
	Water Closet	2nd Floor NW Womens (615)	2	EA	7	10+ years	
	Accessories	521 1st Floor Womens Dressing	350	SF	7	6-10 years	
		Room	000	0.	•	e re jeure	
	Ceiling - Plaster/Drywall	521 1st Floor Womens Dressing	136	SF	7	10+ years	
	· ·	Room				2	
	Ceiling - Splined	521 1st Floor Womens Dressing	174	SF	6	6-10 years	
		Room		0-		<u> </u>	• • · · ·
	Ceiling - Splined	521 1st Floor Womens Dressing Room	40	SF	4	0-1 year	Missing damaged
	Doors - Transom Window	521 1st Floor Womens Dressing	10	SF	7	10+ years	



Category : Room			Building : Linked Addition-Athletic Building B				
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
		Room					
	Doors - Wood Doors inclu hw	521 1st Floor Womens Dressing	1	EA	7	10+ years	
		Room				- ,	
	Floor - Tile	521 1st Floor Womens Dressing	214	SF	6	10+ years	
		Room				- ,	
	Floor - Tile Ceramic/ Porcelain	521 1st Floor Womens Dressing	136	SF	7	10+ years	
		Room				,	
	Floor Drain	521 1st Floor Womens Dressing	1	EA	7	10+ years	
		Room				,	
	Lavatory	521 1st Floor Womens Dressing	1	EA	6	10+ years	
	,, ,	Room			-	- ,	
	Lighting - Lay-in	521 1st Floor Womens Dressing	5	EA	7	6-10 years	
	0 0 9	Room				,	
	Partitions	521 1st Floor Womens Dressing	1	EA	7	10+ years	
		Room				- ,	
	Showers	521 1st Floor Womens Dressing	2	EA	7	10+ years	
		Room				- ,	
	Student Lockers - One Tier	521 1st Floor Womens Dressing	6	EA	7	10+ years	
		Room	-			, , , , , , , , , , , , , , , , , , ,	
	Walls - Concrete Block	521 1st Floor Womens Dressing	640	SF	6	10+ years	
		Room		-	-	- ,	
	Walls - Structural Glazed Tile	521 1st Floor Womens Dressing	520	SF	7	10+ years	
		Room		•		, , , , , , , , , , , , , , , , , , ,	
	Water Closet	521 1st Floor Womens Dressing	1	EA	7	10+ years	
		Room				- ,	
	Accessories	523 1st Floor Mens Dressing Room	360	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	523 1st Floor Mens Dressing Room	116	SF	6	10+ years	
	Ceiling - Splined	523 1st Floor Mens Dressing Room	224	SF	6	6-10 years	
	Ceiling - Splined	523 1st Floor Mens Dressing Room	20	SF	4	0-1 year	Damaged
	Doors - Transom Window	523 1st Floor Mens Dressing Room	10	SF	6	10+ years	5
	Doors - Wood Doors inclu hw	523 1st Floor Mens Dressing Room	1	EA	6	10+ years	
	Floor - Tile	523 1st Floor Mens Dressing Room	244	SF	6	10+ years	
	Floor - Tile Ceramic/ Porcelain	523 1st Floor Mens Dressing Room	116	SF	6	10+ years	
	Floor Drain	523 1st Floor Mens Dressing Room	1	EA	7	10+ years	
	Lavatory	523 1st Floor Mens Dressing Room	1	EA	6	10+ years	
	Lighting - Lay-in	523 1st Floor Mens Dressing Room	5	EA	6	6-10 years	
	Partitions	523 1st Floor Mens Dressing Room	1	EA	7	10+ years	
	Showers	523 1st Floor Mens Dressing Room	2	EA	7	10+ years	
	Student Lockers - One Tier	523 1st Floor Mens Dressing Room	6	EA	7	10+ years	
	Walls - Concrete Block	523 1st Floor Mens Dressing Room	640	SF	6	10+ years	
	Walls - Structural Glazed Tile	523 1st Floor Mens Dressing Room	520	SF	6	10+ years	
	Water Closet	523 1st Floor Mens Dressing Room	1	EA	6	10+ years	
		° °					



Building : Linked Addition-Athletic Building B Category : Classroom Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Classroom #508 Quin Hall (Dance Room) Ceiling - Exposed 2,520 SF 6 1st Floor 10+ years Ceiling - Splined 1st Floor 90 SF 6 10+ years Doors - Transom Window 20 SF 6 10+ years 1st Floor Doors - Wood Doors inclu hw 8 ΕA 7 10+ years 1st Floor 90 SF Floor - Tile 1st Floor 6 10+ years Floor - Wood 1st Floor 2.520 SF 6 10+ years Lighting - Lay-in 1st Floor 2 FΑ 7 6-10 years Lighting - Pendent/Surface 1st Floor 40 EΑ 6 6-10 years Lighting - Wall Mounted 1st Floor 1 EA 7 6-10 years Storage/ Closet 300 SF 7 1st Floor 10+ years Wall Mirrors 1st Floor 320 SF 7 10+ years Walls - Concrete Block 1st Floor 940 SF 7 10+ years SF Walls - Concrete Block 1st Floor 5.290 6 10+ years Classroom #510 (Band Room) Ceiling - Splined 1st Floor SF 2,010 6 10+ years Ceiling - Splined SF 0-1 year 1st Floor 10 4 Missing damaged Doors - Side-lite SF 1st Floor 290 6 10+ years Doors - Wood Doors inclu hw 1st Floor ΕA 6 10+ years 4 SF Floor - Tile 1st Floor 2,020 6 10+ years LF 7 Instrument Storage Casework 1st Floor 90 10+ years Lighting - Metal Halide/Sodium Vapor 1st Floor 39 EΑ 6 6-10 years Risers 138 LF 1st Floor 6 10+ years Sound Panels 1st Floor 74 EΑ 7 6-10 years Storage/ Closet 1st Floor SF 7 10+ vears 160 SF Walls - Plaster/Drywall 1st Floor 1.000 6 10+ years Work Sink 1st Floor EΑ 5 6-10 years 1 Classroom #514 (Band Room) Ceiling - Splined 1st Floor SF 6 2,030 10+ years Doors - Side-lite SF 1st Floor 290 6 10+ years Doors - Transom Window 1st Floor 6 SF 6 10+ years Doors - Wood Doors inclu hw 1st Floor 4 EΑ 6 10+ years SF Floor - Tile 1st Floor 2.030 6 10+ years Lighting - Metal Halide/Sodium Vapor 1st Floor 31 EΑ 7 6-10 years Risers LF 1st Floor 138 6 10+ years Sound Panels 1st Floor 158 ΕA 7 6-10 years SF 7 Storage/ Closet 1st Floor 380 10+ years Student Lockers - One Tier ΕA 6 10+ years 1st Floor 11 Student Lockers - Three Tiers FΑ 1st Floor 51 6 10+ years Student Lockers - Two Tiers 1st Floor 22 FΑ 6 10+ years SF Walls - Plaster/Drywall 1st Floor 1.000 6 10+ years



Catego	ry : Classroom		В	uilding	: Linked	d Addition-Ath	letic Building B
_				_		Recommend	-
iroup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
assroo	m #525 (Laboratory/Shop)						
	Casework	1st Floor	112	LF	6	10+ years	
	Ceiling - Plaster/Drywall	1st Floor	1,970	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor	1	EA	6	10+ years	
	Doors - Transom Window	1st Floor	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	5	EA	6	10+ years	
	Floor - Concrete	1st Floor	1,970	SF	5	10+ years	
	Lighting - Pendent/Surface	1st Floor	23	EA	7	6-10 years	
	Lighting - Pendent/Surface	1st Floor	12	EA	6	1-2 years	Relamp
	Storage/ Closet	1st Floor	370	SF	5	10+ years	
	Storage/ Closet	1st Floor	145	SF	5	10+ years	
	Student Lockers - Two Tiers	1st Floor	48	ĒA	5	10+ years	
	Walls - Concrete Block	1st Floor	3,300	SF	6	10+ years	
	Work Sink	1st Floor	2	EA	5	6-10 years	
	Work Sink	13(1100)	2	LA	5	0-10 years	
lassroo	m #544 (Weight)						
	Ceiling - Plaster/Drywall	1st Floor	2,876	SF	6	10+ years	
	Doors - Steel Doors incl hw	1st Floor	2,010	EA	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	1	EA	6	10+ years	
	Floor - Weight/ Fitness Room Floor Matting	1st Floor	2,876	SF	6	6-10 years	
	Lighting - Lay-in	1st Floor	2,070	EA	7	6-10 years	
	Lighting - Lay-in	1st Floor	5	EA	6	1-2 years	Relamp
	Wall Mirrors	1st Floor	400	SF	7	10+ years	Relation
	Walls - Concrete Block	1st Floor	2,894	SF	7	•	
		151 F1001	2,094	35	/	10+ years	
lassroo	m #612 (Music Room)						
	Ceiling - Splined	2nd Floor	820	SF	6	6-10 years	
	Doors - Transom Window	2nd Floor	10	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years	
	Floor - Tile	2nd Floor	810	SF	6	6-10 years	
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Chipped
	Lighting - Lay-in	2nd Floor	27	EA	7	6-10 years	
	Marker Board	2nd Floor	16	LF	6	6-10 years	
	Walls - Plaster/Drywall	2nd Floor	1,040	SF	6	10+ years	
			.,010	0.	Ŭ	youro	
lassroo	m #613 (Music Room)						
	Ceiling - Splined	2nd Floor	683	SF	6	10+ years	
	Doors - Transom Window	2nd Floor	10	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years	
	Floor - Tile	2nd Floor	683	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	20	EA	7	6-10 years	
	Marker Board	2nd Floor	22	LF	6	6-10 years	



Catego	ry : Classroom		В	uilding	: Linked	Addition-Ath	etic Building B
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Sound System	2nd Floor	1	EA	7	6-10 years	
	Walls - Plaster/Drywall	2nd Floor	890	SF	6	10+ years	
Classroo	om #616 (Music Room)						
	Ceiling - Splined	2nd Floor	1,640	SF	6	10+ years	
	Doors - Transom Window	2nd Floor	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	3	EA	6	10+ years	
	Floor - Wood	2nd Floor	1,640	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	27	EA	7	6-10 years	
	Lighting - Lay-in	2nd Floor	7	EA	6	6-10 years	
	Marker Board	2nd Floor	16	LF	7	6-10 years	
	Sound Panels	2nd Floor	83	EA	7	6-10 years	
	Sound System	2nd Floor	1	EA	7	6-10 years	
	Storage/ Closet	2nd Floor	125	SF	7	10+ years	
	Walls - Plaster/Drywall	2nd Floor	950	SF	7	10+ years	
Classroo	om #619 (Art Room)						
	Ceiling - Lay-in	2nd Floor	775	SF	6	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	350	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	20	EA	6	10+ years	
	Floor - Tile	2nd Floor	1,125	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	18	EA	7	6-10 years	
	Marker Board	2nd Floor	6	LF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	224	SF	6	10+ years	
	Walls - Concrete Block Walls - Masonry	2nd Floor	270	SF	7		
	Walls - Masonry Walls - Plaster/Drywall	2nd Floor	620	SF	6	10+ years 10+ years	
	Work Sink	2nd Floor	020	EA	7		
	Work Sink Work Sink	2nd Floor	1	EA	5	10+ years	
	WORK SINK	2nd Floor	1	EA	Э	2-5 years	
Classroo	om #621 (Art Room)						
	Ceiling - Lay-in	2nd Floor	600	SF	6	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	228	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years	
	Floor - Tile	2nd Floor	828	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	14	EA	7	6-10 years	
	Marker Board	2nd Floor	12	LF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	308	SF	6	10+ years	
	Walls - Masonry	2nd Floor	230	SF	7	10+ years	
	Walls - Plaster/Drywall	2nd Floor	380	SF	6	10+ years	
	Work Sink	2nd Floor	2	EA	5	6-10 years	



Catego	ry : Classroom		В	uilding	: Linked		etic Building B
Ŭ				Ŭ		Recommend	5
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Casework	2nd Floor	40	LF	6	10+ years	
	Ceiling - Lay-in	2nd Floor	2,282	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	40	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years	
	Floor - Tile	2nd Floor	2,282	SF	6	10+ years	
	Kiln	2nd Floor	1	EA	7	10+ years	
	Lighting - Lay-in	2nd Floor	58	EA	7	6-10 years	
	Lighting - Lay-in	2nd Floor	2	EA	6	6-10 years	
	Marker Board	2nd Floor	12	LF	6	6-10 years	
	Storage/ Closet	2nd Floor	154	SF	5	10+ years	
	Walls - Concrete Block	2nd Floor	2,300	SF	6	10+ years	
	Work Sink	2nd Floor	_,3	ĒA	5	6-10 years	
			C C	_/ \	Ū		
Classroo	om #629 (Art Room)						
	Ceiling - Lay-in	2nd Floor	775	SF	6	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	350	SF	7	10+ years	
	Doors - Transom Window	2nd Floor	20	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years	
	Floor - Tile	2nd Floor	1,125	SF	6	10+ years	
	Lighting - Lay-in	2nd Floor	18	EA	7	6-10 years	
	Marker Board	2nd Floor	12	LF	6	6-10 years	
	Walls - Concrete Block	2nd Floor	660	SF	6	10+ years	
	Walls - Masonry	2nd Floor	265	SF	7	10+ years	
	Walls - Plaster/Drywall	2nd Floor	190	SF	6	10+ years	
	Work Sink	2nd Floor	2	EA	5	6-10 years	
Classes	om #639 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	750	SF	6	10+ years	
		2nd Floor	30	SF	6		Not fit in
	Ceiling - Lay-in Chalk Board				4	0-1 year	Not fit in
		2nd Floor	10 1	LF	4	2-5 years	
	Doors - Wood Doors inclu hw	2nd Floor 2nd Floor	-	EA SF	6	10+ years	
	Floor - Tile		780		6	10+ years	
	Lighting - Lay-in	2nd Floor	14	EA	6	6-10 years	
	Marker Board	2nd Floor	8	LF SF	7	6-10 years	
	Walls - Concrete Block	2nd Floor	879		6	10+ years	
	Walls - Plaster/Drywall	2nd Floor	105	SF	6	10+ years	
Classroo	om #643 (Regular Classroom)						
	Ceiling - Lay-in	2nd Floor	763	SF	6	6-10 years	
	Ceiling - Lay-in	2nd Floor	10	SF	4	0-1 year	Water damage
	Chalk Board	2nd Floor	12	LF	4	2-5 years	
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	6	10+ years	
	Floor - Tile	2nd Floor	773	SF	6	10+ years	
		2.1.4 1 1001	110	0.	v	101 900.0	



Catego	ry : Classroom		B	uilding	: Linked	Addition-Athl	etic Building B
						Recommend	
Group	ltem - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Lighting - Lay-in	2nd Floor	20	EA	6	6-10 years	
	Walls - Concrete Block	2nd Floor	879	SF	6	10+ years	
	Walls - Plaster/Drywall	2nd Floor	105	SF	6	10+ years	

Category : Interior

Building : Linked Addition-Athletic Building B

GroupItem - TypeLocationQuantityUOMRankReplacementCommentsCorling- Lay-in1st Floor16,500SF710- yearsDamagedCelling- Lay-in1st Floor20SF41-2 yearsDamagedCelling- Lay-in1st Floor120SF610+ yearsDamagedDoors- Side-Hite1st Floor1EA710+ yearsDamagedDoors- Side-Hite1st Floor2EA610+ yearsDamagedDoors- Store Front1st Floor20SF610+ yearsDamagedDoors- Store Front1st Floor20SF610+ yearsDamagedDoors- Transom Window1st Floor20SF610+ yearsDamagedDoors- Transom Window1st Floor20SF610+ yearsDamagedDoors- Wood Doors include hw1st Floor2EA610+ yearsDamagedDoors- Wood Doors include hw1st Floor7EA610+ yearsDamagedDoors- Wood Doors include hw1st Floor7EA610+ yearsReaDoors- Wood Doors include hw1st Floor7EA710+ years16Doors- Wood Doors include hw1st Floor7EA710+ years16Dorinking Fountain- St Floor1EA							Recommend	
Celling - Lay-in1st Floor16.500SF710+ yearsCelling - Lay-in1st Floor120SF41.2 yearsDamagedDoras - Sidel-Ibors incl hw1st Floor120SF610+ yearsDoras - Sidel-Doors incl hw1st Floor1EA710+ yearsDoras - Sidel-Doors incl hw1st Floor2EA610+ yearsDoras - Siteel Doors incl hw1st Floor20SF610+ yearsDoors - Transom Window1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDorns - Wood Doors include hw1st Floor1EA710+ yearsDorns - Single Fountain1st Floor1EA710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsHighting - Vaul Mounted1st Floor16EA710+ yearsLighting - Lay-in1	Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Ceiling - Lay-in1st Floor20SF41-2 yearsDamagedCeiling - Plaster/Drywall1st Floor22SF610+ yearsDoors - Steel Doors incl hw1st Floor22EA610+ yearsDoors - Steel Doors incl hw1st Floor20EA610+ yearsDoors - Steel Doors incl hw1st Floor20EA610+ yearsDoors - Transom Window1st Floor20EA610+ yearsDoors - Transom Window1st Floor20EA610+ yearsDoors - Transom Window1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDoors - Tinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Tile/Sheet1st Floor40SF710+ yearsFloor - Tile/Sheet1st Floor40SF710+ yearsLighting - Lay-in1st Floor40SF710+ yearsKall Songe Explored1st Floor80SF710+ yearsFloor - Tile/Sheet <t< th=""><th>Corridor</th><th></th><th></th><th></th><th></th><th></th><th></th><th></th></t<>	Corridor							
Celling - Plaster/Drywall1st Floor120SF610-yearsDoorsSitel Doors incl hw1st Floor1EA710+ yearsDoorsSteel Doors incl hw1st Floor2EA610+ yearsDoorsSteel Doors incl hw1st Floor20EA610+ yearsDoorsSteel Doors incl hw1st Floor200SF610+ yearsDoorsTransom Window1st Floor200SF610+ yearsDoorsTransom Window1st Floor2EA710+ yearsDoorsWood Doors include hw1st Floor2EA610+ yearsDoorsWood Doors include hw1st Floor2EA610+ yearsDoorsWood Doors include hw1st Floor7EA610+ yearsDoorsWood Doors include hw1st Floor7EA710+ yearsDoorsWood Doors include hw1st Floor1EA710+ yearsDoorsWood Doors include hw1st Floor1EA710+ yearsDorrTile/Sheet1st Floor1EA710+ yearsFloorTile/Sheet1st Floor20SF41-2 yearsFloorTile/Sheet1st Floor40SF710+ yearsKaitsConcrete Book1st Floor80SF710+ yearsKaitsConcrete Book1st Floor8		Ceiling - Lay-in	1st Floor	16,500		7	10+ years	
DoorsSide-lite1st Floor82SF610+ yearsDoorsSteel Doors incl hw1st Floor2EA610+ yearsDoorsStore Front1st Floor20EA610+ yearsDoorsTransom Window1st Floor20SF610+ yearsDoorsTransom Window1st Floor20SF610+ yearsDoorsTransom Window1st Floor2EA710+ yearsDoorsWood Doors include hw1st Floor2EA710+ yearsDoorsWood Doors include hw1st Floor2EA610+ yearsDoorsWood Doors include hw1st Floor2EA610+ yearsDoorsWood Doors include hw1st Floor7EA610+ yearsDoorsWood Doors include hw1st Floor7EA710+ yearsDoorsWood Doors include hw1st Floor7EA710+ yearsDoorsWood Doors include hw1st Floor1EA710+ yearsDoorsWood Doors include hw1st Floor12,594SF710+ yearsDoorsFloor1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor10LF710+ yearsLighting - Lay-in1st Floor890SF <t< td=""><td></td><td>Ceiling - Lay-in</td><td></td><td></td><td></td><td>4</td><td>1-2 years</td><td>Damaged</td></t<>		Ceiling - Lay-in				4	1-2 years	Damaged
Doors - Steel Doors ind hw1st Floor1EA710+ yearsDoors - Steel Doors ind hw1st Floor2EA610+ yearsDoors - Streen Front1st Floor200SF610+ yearsDoors - Transom Window1st Floor200SF610+ yearsDoors - Transom Wordow1st Floor20EA610+ yearsDoors - Wood Doors include hw1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDrinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Tile/Sheet1st Floor25.594SF710+ yearsFloor - Tile/Sheet1st Floor27.42476-10 yearsLighting - Lay-in1st Floor10LF710+ yearsWalls - Concrete Block1st Floor16, 170SF710+ yearsWalls - Concrete Block1st Floor16, 170SF710+ yearsWalls - Masony1st Flo		Ceiling - Plaster/Drywall	1st Floor			6	10+ years	
Doors - Steel Doors incl hw1st Floor2EA610-yearsDoors - Transom Window1st Floor200SF610+ yearsDoors - Transom Window1st Floor200SF610+ yearsDoors - Transom Window1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA710+ yearsDoors - Concrete Epoxyl Painted1st Floor3,685SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor10SF710+ yearsValls - Concrete Block1st Floor16,170890SF710+ yearsValls - Concrete Block1st Floor16,170SF710+ yearsValls - Manned1st Floor16,170SF710+ yearsValls - Concrete Block1st Floor16,170SF710+ yearsValls - Masony <t< td=""><td></td><td></td><td></td><td>82</td><td></td><td>6</td><td>10+ years</td><td></td></t<>				82		6	10+ years	
Doors - Store Front1st Floor20EA610+ yearsDoors - Transom Window1st Floor200SF610+ yearsDoors - Transom Window1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA710+ yearsDoors - Wood Doors include hw1st Floor7EA710+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDorr - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsFloor - Tile/Sheet1st Floor6EA76-10 yearsLighting - Lay-in1st Floor890SF710+ yearsStars - Concrete Block1st Floor16,170SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsStars - Concrete Block1st Floor16,170SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Splined2nd Floor20S		Doors - Steel Doors incl hw		1	EA	7	10+ years	
Doors - Transom Window1st Floor200SF610+ yearsDoors - Wood Doors include hw1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA710+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDorr - Concrete Epoxy Painted1st Floor1, EA710+ yearsFloor - Tile/Sheet1st Floor1, EA710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor10LF710+ yearsValls - Concrete Block1st Floor16, 170SF710+ yearsWalls - Masonry1st Floor10LF710+ yearsValls - Masonry1st Floor16, 170SF710+ yearsWalls - Masonry1st Floor10LF710+ yearsCeiling - Splined2nd Floor660SF <td></td> <td>Doors - Steel Doors incl hw</td> <td>1st Floor</td> <td>2</td> <td>EA</td> <td>6</td> <td>10+ years</td> <td></td>		Doors - Steel Doors incl hw	1st Floor	2	EA	6	10+ years	
Doors - Transom Window1st Floor80SF610 - yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDoors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDors - Wood Doors include hw1st Floor7EA710+ yearsDrinking Fountains - Single Fountain1st Floor3,585SF710+ yearsFloor - Concrete Epoxyl Painted1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor6EA76-10 yearsStairs - Concrete Block1st Floor10LF710+ yearsWalls - Masonry1st Floor6EA76-10 yearsWalls - Masonry1st Floor16,170SF710+ yearsWalls - Masonry1st Floor10SF41-2 yearsCeiling - Splined2nd Floor10SF710+ yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Steel Doors incl hw2nd Floor2EA610+ years <tr< tr="">Doors - Transom Window2</tr<>		Doors - Store Front	1st Floor	20		6	10+ years	
Doors - Wood Doors include hw1st Floor2EA710+ yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor1EA710+ yearsDrinking Fountains - Single Fountain1st Floor1EA710+ yearsDrinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor27EA76-10 yearsLighting - Lay-in1st Floor27EA710+ yearsKairs - Concrete Biock1st Floor6EA76-10 yearsWalls - Concrete Biock1st Floor85SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor16SF66-10 yearsCeiling - Splined2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2<		Doors - Transom Window	1st Floor			6	10+ years	
DoorsWood Doors include hw1st Floor1EA610+ yearsDoorsWood Doors include hw1st Floor2EA610+ yearsDoorsWood Doors include hw1st Floor7EA610+ yearsDoorsWood Doors include hw1st Floor7EA610+ yearsDoorsWood Doors include hw1st Floor7EA710+ yearsDrinking Fountains1st Floor7EA710+ yearsFloorConcrete Epoxy/ Painted1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor6EA76-10 yearsStairsConcrete Stairs1st Floor890SF710+ yearsWallsConcrete Block1st Floor42,00SF710+ yearsWallsMasnry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor42,00SF41-2 yearsCeiling - Splined2nd Floor2nd Floor2EA610+ yearsDoorsSteel Doors incl hw2nd Floor2EA610+ yearsDoorsSteel Doors incl hw2nd Floor2EA610+ yearsDoorsSteel Doors incl hw2nd Floor2EA <t< td=""><td></td><td>Doors - Transom Window</td><td>1st Floor</td><td>80</td><td>SF</td><td>6</td><td>10+ years</td><td></td></t<>		Doors - Transom Window	1st Floor	80	SF	6	10+ years	
Doors - Wood Doors include hw1st Floor2EA610+ yearsDoors - Wood Doors include hw1st Floor7EA610+ yearsDors - Wood Doors include hw1st Floor1EA610+ yearsDrinking Fountains - Single Fountain1st Floor7EA710+ yearsDrinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Concrete Epoxy/ Painted1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor6EA76-10 yearsLighting - Lay-in1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor10LF710+ yearsStairs - Concrete Block1st Floor10LF710+ yearsWalls - Concrete Block1st Floor10LF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA		Doors - Wood Doors include hw	1st Floor	2	EA	7	10+ years	
Doors - Wood Doors include hw1st Floor7EA610+ yearsDoors - Wood Doors include hw1st Floor1EA610+ yearsDrinking Fountains - Single Fountain1st Floor7EA710+ yearsDrinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Concrete Epoxyl Painted1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor40SF41-2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 years6Lighting - Lay-in1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor10LF710+ yearsWalls - Concrete Block1st Floor16,170SF710+ yearsWalls - Concrete Block1st Floor16,170SF710+ yearsWalls - Concrete Block1st Floor42,30SF710+ yearsCeiling - Lay-in2nd Floor10SF66-10 yearsCeiling - Splined2nd Floor2nd Floor2EA610+ yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ years		Doors - Wood Doors include hw		1	EA	6	10+ years	
Doors - Wood Doors include hw1st Floor1EA610+ yearsDrinking Fountains - Single Fountain1st Floor7EA710+ yearsDrinking Fountains - Single Fountain1st Floor3,585SF710+ yearsFloor - Concrete Epoxyl Painted1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor274EA76-10 yearsLighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor110LF710+ yearsStairs - Concrete Block1st Floor800SF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor4SF610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors		Doors - Wood Doors include hw	1st Floor	2	EA	6	10+ years	
Drinking FountainsSingle Fountain1st Floor7EA710+ ýearsDrinking Fountains- Single Fountain1st Floor1EA710+ yearsFloor - Cincrete Epoxy/ Painted1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor40SF41.2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor10LF710+ yearsWalls - Concrete Block1st Floor16,170SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor10SF41.2 yearsCeiling - Splined2nd Floor10SF41.2 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors		Doors - Wood Doors include hw	1st Floor	7	EA	6	10+ years	
Drinking Fountains - Single Fountain1st Floor1EA710+ yearsFloor - Concrete Epoxy/ Painted1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor40SF41-2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 years6Stairs - Concrete Stairs1st Floor6EA76-10 yearsWalls - Concrete Stairs1st Floor10LF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor16,170SF710+ yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDamagedDoors - Transom Window2nd Floor26SF710+ yearsDamagedDoors - Transom Window2nd Floor2EA610+ yearsDamagedDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor		Doors - Wood Doors include hw	1st Floor	1	EA	6	10+ years	
Floor - Concrete Epoxy/ Painted1st Floor1st Floor3,585SF710+ yearsFloor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor40SF41-2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Masonry1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor10SF41-2 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor26SF710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ years <tr<tr>Doors - Wood Doors in</tr<tr>		Drinking Fountains - Single Fountain	1st Floor	7	EA	7	10+ years	
Floor - Tile/Sheet1st Floor12,594SF710+ yearsFloor - Tile/Sheet1st Floor40SF41-2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor16,170SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw<		Drinking Fountains - Single Fountain	1st Floor	1	EA	7	10+ years	
Floor - Tile/Sheet1st Floor40SF41-2 yearsChipped damagedLighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years <tr <tr="">Doors - Wood Doors include hw</tr>		Floor - Concrete Epoxy/ Painted	1st Floor	3,585		7	10+ years	
Lighting - Lay-in1st Floor274EA76-10 yearsLighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor <td< td=""><td></td><td>Floor - Tile/Sheet</td><td>1st Floor</td><td>12,594</td><td></td><td>7</td><td>10+ years</td><td></td></td<>		Floor - Tile/Sheet	1st Floor	12,594		7	10+ years	
Lighting - Wall Mounted1st Floor6EA76-10 yearsStairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Wood Doors include hw2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor		Floor - Tile/Sheet		40		4		Chipped damaged
Stairs - Concrete Stairs1st Floor110LF710+ yearsWalls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw </td <td></td> <td>Lighting - Lay-in</td> <td>1st Floor</td> <td>274</td> <td>EA</td> <td>7</td> <td>6-10 years</td> <td></td>		Lighting - Lay-in	1st Floor	274	EA	7	6-10 years	
Walls - Concrete Block1st Floor890SF710+ yearsWalls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Lighting - Wall Mounted		6		7	6-10 years	
Walls - Masonry1st Floor16,170SF710+ yearsCeiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Stairs - Concrete Stairs	1st Floor	110	LF	7	10+ years	
Ceiling - Lay-in2nd Floor4,230SF710+ yearsCeiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Store Front2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Walls - Concrete Block	1st Floor		SF	7	10+ years	
Ceiling - Splined2nd Floor660SF66-10 yearsCeiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Store Front2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Walls - Masonry	1st Floor	16,170		7	10+ years	
Ceiling - Splined2nd Floor10SF41-2 yearsDamagedDoors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Transom Window2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Ceiling - Lay-in	2nd Floor	4,230		7	10+ years	
Doors - Steel Doors incl hw2nd Floor2EA610+ yearsDoors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Ceiling - Splined	2nd Floor	660		6	6-10 years	
Doors - Store Front2nd Floor2EA610+ yearsDoors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Ceiling - Splined	2nd Floor	10		4	1-2 years	Damaged
Doors - Transom Window2nd Floor26SF710+ yearsDoors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years			2nd Floor	2		6	10+ years	
Doors - Transom Window2nd Floor44SF610+ yearsDoors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years		Doors - Store Front	2nd Floor			6	10+ years	
Doors - Wood Doors include hw2nd Floor11EA710+ yearsDoors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years						-		
Doors - Wood Doors include hw2nd Floor2EA610+ yearsDoors - Wood Doors include hw2nd Floor4EA610+ years				44		-	10+ years	
Doors - Wood Doors include hw2nd Floor4EA610+ years		Doors - Wood Doors include hw	2nd Floor	11	EA	7	10+ years	
· · · · · · · · · · · · · · · · · · ·		Doors - Wood Doors include hw	2nd Floor	2	EA	6	10+ years	
Design Maria Design for the Construction of th		Doors - Wood Doors include hw	2nd Floor	4	EA	6	10+ years	
		Doors - Wood Doors include hw	2nd Floor	1	EA	6	10+ years	
Drinking Fountains - Single Fountain 2nd Floor 3 EA 7 10+ years		Drinking Fountains - Single Fountain	2nd Floor	3	EA	7	10+ years	



Group Item - Type Location Quantity UOM Rank Replacement Comments Floor - Tile/Sheet 2nd Floor 3,889 SF 5 10+ years Cracked chipped Lighting - Lay-in 2nd Floor 75 EA 7 6-10 years Cracked chipped Walls - Masonry 2nd Floor 6.814 SF 7 10+ years Cracked chipped Walls - Masonry 2nd Floor 6.814 SF 7 10+ years Statis Stataty 2nd Floor 1.81 SF 7 10+ years Statis Camera Vewing Station 1st Floor 1 EA 7 6-10 years Statis Caling - Splined East Locker Stairs 34 SF 6 10+ years Caling - Splined East Locker Stairs 135 SF 6 10+ years Caling - Splined East Locker Stairs 135 SF 6 10+ years Caling - Splined East Locker Stairs 135 SF	Catego	ry : Interior		В	uilding	: Linked	Addition-Athl	letic Building B
Floor - Tile/Sheet2nd Floor3.89SF510+ yearsFloor - Tile/Sheet2nd Floor7.5EA76-10 yearsWalls - Masonry2nd Floor7.5EA76-10 yearsWalls - Masonry2nd Floor6.814SF710+ yearsWalls - Masonry2nd Floor6.814SF710+ yearsWalls - Masonry2nd Floor6.814SF710+ yearsWalls - Masonry2nd Floor6.814SF710+ yearsStatin1st Floor1EA76-10 yearsMetal Detector1st Floor3EA76-10 yearsStatin1st Floor3SF610+ yearsCeiling - SplinedEast Locker Stairs157SF610+ yearsCeiling - SplinedEast Locker Stairs135SF610+ yearsCeiling - SplinedEast Locker Stairs135SF610+ yearsCeiling - SplinedEast Locker Stairs135SF610+ yearsCamp - SplinedEast Locker Stairs135SF610+ yearsFloor - TerrazzoEast Locker Stairs135SF710+ yearsLighting - Lay-inEast Locker Stairs135SF610+ yearsLighting - Lay-inEast Locker Stairs128F710+ yearsStairs - TerrazzoEast Locker Stairs128F710+ yearsStair	_						Recommend	
Floor - Tile/Sheet2nd Floor1011SF40-1 year 6-10 yearsCracked chippedUighting - Lay-in Walls - Nasonry2nd Floor2.286SF610+ yearsWalls - Nasonry Walls - Plaster/Drywall2nd Floor2.286SF710+ yearsSafety	Group		Location	Quantity		Rank		Comments
Lighting - Lay-in 2nd Floor 75 EA 7 6-10 years Walls - Masonry 2nd Floor 6.814 SF 7 10- years Walls - Masonry 2nd Floor 6.814 SF 7 10- years Walls - Plaster/Drywall 2nd Floor 1.271 SF 7 10- years Carnera Viewing Station 1st Floor 1 EA 7 6-10 years Metal Detector 1st Floor 20 EA 5 6-10 years Security Cameras 1st Floor 20 EA 5 6-10 years Security Cameras 1st Floor 20 EA 5 6-10 years Ceiling - Splined East Locker Stairs 34 SF 6 10- years Ceiling - Splined East Locker Stairs 157 SF 6 10- years Ceiling - Splined East Locker Stairs 157 SF 6 10- years Ceiling - Splined East Locker Stairs 157 SF 6 10- years Ceiling - Splined East Locker Stairs 157 SF 6 10- years Ceiling - Splined East Locker Stairs 157 SF 6 10- years Ceiling - Splined East Locker Stairs 158 SF 6 10- years Ceiling - Splined East Locker Stairs 158 SF 6 10- years Floor - Terrazzo East Locker Stairs 70 LF 5 10- years Valls - Masonry East Locker Stairs 70 LF 5 10- years Stairs - Torrazzo East Locker Stairs 70 LF 5 10- years Stairs - Torrazzo East Locker Stairs 70 SF 7 10- years Stairs - Torrazzo East Locker Stairs 70 SF 7 10- years Stairs - Torrazzo East Locker Stairs 70 SF 7 10- years Stairs - Torrazzo East Locker Stairs 70 SF 7 10- years Stairs - Torrazzo East Locker Stairs 70 SF 5 10- years Stairs - Torrazzo East Locker Stairs 1.33 SF 7 10- years Stairs - Torrazzo East Locker Stairs 1.34 SF 7 10- years Stairs - Concrete East Pool Stairs 70 SF 5 10- years Stairs - Concrete East Pool Stairs 70 SF 5 10- years Stairs - Concrete East Pool Stairs 70 SF 5 10- years Stairs - Torrazzo Notheast Fire Stair 116 LF 6 10- years Stairs - Torrazo Notheast Fire Stair 128 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 128 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 128 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 128 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 22 SF 6 10- years Stairs - Torrazo Notheast Fire Stair 124 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 124 SF 7 10- years Stairs - Torrazo Notheast Fire Stair 24 SF 7 10- years St			2nd Floor	3,889		5	10+ years	
Walls - Concrete Block2nd Floor2.266SF61 0+ yearsWalls - Masonry2nd Floor1.271SF710+ yearsSafety			2nd Floor	1,011	SF	4		Cracked chipped
Walls - Masonry Walls - Plaster/Drywall2nd Floor6.814 2.71SF710+ yearsSafetyCamera Viewing Station Metal Detector1 st Floor1EA76-10 yearsSecurity Cameras1 st Floor20EA76-10 yearsStatis1 st Floor20EA56-10 yearsStatis20EA56-10 yearsStatisColling - SplinedEast Locker Stairs34SF610+ yearsColling - SplinedEast Locker Stairs13SF610+ yearsColling - SplinedEast Locker Stairs13SF610+ yearsFloor - Tite Coramic/ PorcelainEast Locker Stairs71SF610+ yearsFloor - Tite Coramic/ PorcelainEast Locker Stairs70LF510+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Lay-inEast Locker Stairs12EA76-10 yearsStairs - TerrazzoEast Locker Stairs1234SF710+ yearsWalls - MasonryEast Locker Stairs128FF710+ yearsGeiling - Lay-inEast Pool Stairs22SF610+ yearsGeiling - Lay-inEast Locker Stairs1334SF710+ yearsGeiling - Lay-inEast Locker Stairs128FF710+ yearsGeil			2nd Floor	75		7	6-10 years	
Walls - Plaster/DrywallZnd Floor1,271SF710+ ýearsSafetyCamera Viewing StationMetal Detector1st Floor1EA76-10 yearsSecurity Cameras1st Floor20EA76-10 yearsStationCeiling - SplinedEast Locker Stairs20EA56-10 yearsCeiling - SplinedEast Locker Stairs13SF610+ yearsCeiling - SplinedEast Locker Stairs13SF50-1 yearDamaged, missingFloor - TierazzoEast Locker Stairs13SF710+ yearsFloor - TierazzoEast Locker Stairs13SF710+ yearsFloor - TierazzoEast Locker Stairs71SF710+ yearsLighting - Lay-inEast Locker Stairs112F710+ yearsStairs - TerrazzoEast Locker Stairs112F710+ yearsGeiling - Lay-inEast Locker Stairs128LF710+ y			2nd Floor				10+ years	
Safety Image: Control of the set of the se		Walls - Masonry	2nd Floor	6,814		7	10+ years	
Camera Viewing Station Metal Detector Security Cameras1 st Floor 1st Floor1 EA 3 EA 5 6-10 yearsStairs1 st Floor20 EA 20 EA5 6-10 yearsStairs		Walls - Plaster/Drywall	2nd Floor	1,271	SF	7	10+ years	
Metal Detector1st Floor3EA76-10 yearsSecurity Cameras1st Floor20EA56-10 yearsStairsCeiling - SplinedEast Locker Stairs34SF610+ yearsCeiling - SplinedEast Locker Stairs13SF50-1 yearsCeiling - SplinedEast Locker Stairs135SF610+ yearsGeling - SplinedEast Locker Stairs135SF610+ yearsFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsHandrailsEast Locker Stairs71SF710+ yearsLighting - Pendent/SurfaceEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalts - MasonryEast Locker Stairs134SF510+ yearsCeiling - Lay-inEast Pool Stairs22SF710+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - Tile <td>Safety</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>	Safety							
Metal Detector1st Floor3EA76-10 yearsSecurity Cameras1st Floor20EA56-10 yearsStairsCeiling - SplinedEast Locker Stairs34SF610+ yearsCeiling - SplinedEast Locker Stairs157SF610+ yearsCeiling - SplinedEast Locker Stairs135SF610+ yearsFloor - TierzazoEast Locker Stairs135SF610+ yearsFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsLighting - Pendent/SurfaceEast Locker Stairs71F710+ yearsLighting - Pandent/SurfaceEast Locker Stairs128LF76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonyEast Locker Stairs128LF710+ yearsCeiling - Lay-inEast Pool Stairs22SF610+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsStairs - TileEast Pool Stairs72LF710+ yearsHandrailsEast Pool Stairs17LF710+ yearsStairs - ConcreteEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs116LF610+ yearsStairs - TileEas		Camera Viewing Station	1st Floor	1	EA	7	6-10 years	
Security Cameras1st Floor20EA56-10 yearsStairsCeiling - SplinedEast Locker Stairs34SF610+ yearsCeiling - SplinedEast Locker Stairs13SF50-1 yearDamaged, missingFloor - TrazzoEast Locker Stairs13SF50-1 yearDamaged, missingFloor - Tile Ceramic/ PorcelainEast Locker Stairs13SF610+ yearsDamaged, missingLighting - Lay-inEast Locker Stairs70LF510+ yearsDamaged, missingStairs - TerrazzoEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsGeling - Lay-inEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs134SF710+ yearsCelling - Lay-inEast Pool Stairs22SF610+ yearsFloor - ConcreteEast Pool Stairs22SF510+ yearsFloor - ConcreteEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - Tile <td></td> <td></td> <td></td> <td>3</td> <td></td> <td></td> <td>6-10 years</td> <td></td>				3			6-10 years	
Ceiling - SplinedEast Locker Stairs34SF610+ yearsCeiling - SplinedEast Locker Stairs157SF610+ yearsDamaged, missingFloor - TerrazzoEast Locker Stairs13SF50-1 yearDamaged, missingFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Pendent/SurfaceEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs1.28LF710+ yearsWalls - MasonryEast Locker Stairs1.334SF710+ yearsValls - MasonryEast Locker Stairs1.334SF710+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsLighting - Vall MountedEast Pool Stairs72LF510+ yearsLighting - Vall MountedEast Pool Stairs72LF510+ yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - ChireEast Pool Stairs117LF710+ yearsStairs - ChireEast Pool Stairs116LF610+ yearsStairs - ChireEast Pool Stairs117LF710+ yearsStairs - ChireEast Pool Stairs1135SF </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
Ceiling - SplinedEast Locker Stairs34SF610+ yearsCeiling - SplinedEast Locker Stairs13SF610+ yearsDamaged, missingFloor - TerrazzoEast Locker Stairs13SF610+ yearsDamaged, missingFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Pendent/SurfaceEast Locker Stairs2EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsValls - MasonryEast Locker Stairs1,334SF710+ yearsFloor - CorcreteEast Pool Stairs22SF610+ yearsFloor - Rubber FloorEast Pool Stairs72LF510+ yearsLighting - Vall MountedEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72LF710+ yearsStairs - CorcreteEast Pool Stairs17LF710+ yearsStairs - CarceteEast Pool Stairs17LF710+ yearsGeiling - Lay-inNortheast Fire Stair28SF610+ yearsCeiling - Lay-inNortheast Fire Stair135SF710+ yearsGeiling - Lay-inNortheast Fire Stair2	.							
Ceiling - SplinedEast Locker Stairs157SF610+ yearsCeiling - SplinedEast Locker Stairs13SF50-1 yearDamaged, missingFloor - TierrazzoEast Locker Stairs13SF610+ yearsFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Lay-inEast Locker Stairs2EA76-10 yearsStairs - TerrazoEast Locker Stairs1EA76-10 yearsStairs - TerrazoEast Locker Stairs1.8LF710+ yearsWalls - MasonryEast Locker Stairs1.34SF710+ yearsCeiling - Lay-inEast Pool Stairs22SF610+ yearsFloor - ConcreteEast Pool Stairs72LF510+ yearsFloor - ConcreteEast Pool Stairs72LF510+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs116LF610+ yearsCeiling - Lay-inNortheast Fire Stair173SF710+ yearsCeiling - Lay-inNortheast Fire Stair173SF710+ yearsCeili	Stairs	Ceiling - Splined	East Locker Stairs	34	SF	6	10+ years	
CeilingSplinedEast Locker Stairs13SF50-1 yearDamaged, missingFloor - Tire Ceramic/ PorcelainEast Locker Stairs135SF610+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Lay-inEast Locker Stairs2EA76-10 yearsStairs - TerrazzoEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs1.28LF710+ yearsWalls - MasonnyEast Locker Stairs1.34SF710+ yearsCeiling - Lay-inEast Locker Stairs1.34SF710+ yearsFloor - ConcreteEast Pool Stairs2.24SF710+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72LF610+ yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - ChrietEast Pool Stairs117LF710+ yearsStairs - ChrietEast Pool Stairs117LF610+ yearsStairs - ChrietEast Pool Stairs116LF610+ yearsStairs - ChrietEast Pool Stairs117LF710+ yearsCeiling - Lay-inNortheast Fire Stair248SF56-10 years <td></td> <td>Ceiling - Splined</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>		Ceiling - Splined						
Floor - TerrazzoEast Locker Stairs135SF610+ ýearsFloor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsLighting - Lay-inEast Locker Stairs70LF510+ yearsLighting - Pendent/SurfaceEast Locker Stairs2EA76-10 yearsStairs - TerrazzoEast Locker Stairs1EA7710+ yearsWalls - MasonryEast Locker Stairs1.28LF710+ yearsCeiling - Lay-inEast Locker Stairs1.334SF710+ yearsFloor - ConcreteEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs72LF510+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72LF710+ yearsStairs - TileEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs116LF710+ yearsStairs - TileEast Pool Stairs117LF710+ yearsWalls - MasonryEast Pool Stairs117SF610+ yearsCeiling - Plaxer/DrywallNortheast Fire Stair128SF710+ yearsGiling - Plaxer/DrywallNortheast Fire Stair124SF710+ yearsCeiling - Plaxer/DrywallNortheast Fire Stair124SF710+ yea							•	Damaged missing
Floor - Tile Ceramic/ PorcelainEast Locker Stairs71SF710+ yearsHandrailsEast Locker Stairs70LF510+ yearsLighting - Lay-inEast Locker Stairs2EA76-10 yearsLighting - Pendent/SurfaceEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs70SF510+ yearsFloor - Rubber FloorEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72LF510+ yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs17LF610+ yearsCeiling - Lay-inNortheast Fire Stair28SF610+ yearsCeiling - Lay-inNortheast Fire Stair342SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF710+ yearsFloor - Tile/SheetNortheast Fire Stair162LF710+ years <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>Damagoa, moonig</td></t<>								Damagoa, moonig
HandrailsEast Locker Stairs70LF510- yearsLighting - Lay-inEast Locker Stairs2EA76-10 yearsStairs - TerrazzoEast Locker Stairs1EA76-10 yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Pool Stairs2,424SF710+ yearsFloor - ConcreteEast Pool Stairs2,22SF610+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72LF610+ yearsStairs - TileEast Pool Stairs16LF610+ yearsStairs - TileEast Pool Stairs17LF610+ yearsWalls - MasonryEast Pool Stairs116LF610+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsWalls - MasonryEast Pool Stairs1,70SF610+ yearsCeiling - Lay-inNortheast Fire Stair248SF710+ yearsFloor - TerrazzoNortheast Fire Stair170SF610+ yearsFloor - Tile/SheetNortheast Fire Stair342SF710+ yearsFloor - TerrazzoNortheast Fir						-		
Lighting - Lay-inEast Locker Stairs2EA76-10 yearsLighting - Pendent/SurfaceEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Locker Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs22SF610+ yearsLighting - Wall MountedEast Pool Stairs72LF510+ yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs116LF710+ yearsStairs - TileEast Pool Stairs117LF710+ yearsWalls - MasonryEast Pool Stairs117LF710+ yearsCeiling - Lay-inNortheast Fire Stair28SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair24SF710+ yearsLighting - Lay-inNortheast Fire Stair24SF710+ yearsFloor								
Lighting - Pendent/SurfaceEast Locker Stairs1EA76-10 yearsStairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs72EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - ConcreteEast Pool Stairs17LF710+ yearsStairs - TileEast Pool Stairs1,15SF710+ yearsWalls - MasonryEast Pool Stairs1,15SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Lay-inNortheast Fire Stair342SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF710+ yearsLighting - Lay-inNortheast Fire Stair6EA6-10 yearsStairs - TerrazzoNortheast Fire Stair6EA6-10 yearsWalls - MasonryNortheast Fire Stair162SF710+ yearsGeiling - Lay-inNo				-				
Stairs - TerrazzoEast Locker Stairs128LF710+ yearsWalls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs22SF610+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs22SF610+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - ConcreteEast Pool Stairs116LF710+ yearsStairs - TileEast Pool Stairs1,135SF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair246SF610+ yearsFloor - Tile/SheetNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair68LF510+ yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair102LF710+ yearsWalls - MasonryN		Lighting Dondont/Surface						
Walls - MasonryEast Locker Stairs1,334SF710+ yearsCeiling - Lay-inEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs70SF510+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs17LF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsFloor - Tile/SheetNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsLighting - Lay-inNortheast Fire Stair342SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsLighting - Lay-inNortheast Fire Stair102LF710+ yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsLighting - Lay-inNortheast Fire Stair102LF710+ yearsKairs								
Ceiling - Lay-inEast Pool Stairs242SF710+ yearsFloor - ConcreteEast Pool Stairs70SF510+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF610+ yearsCeiling - Lay-inNortheast Fire Stair246SF610+ yearsFloor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair68LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsUighting - Lay-inNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1621SF710+ yearsWalls - Masonry <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>•</td> <td></td>							•	
Floor - ConcreteEast Pool Stairs70SF510+ yearsFloor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs22SF610+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs116LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair24SF610+ yearsFloor - TrirazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsLighting - Lay-inNortheast Fire Stair68LF510+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsKairs - TerrazzoNortheast Fire Stair102LF710+ yearsKairs -								
Floor - Rubber FloorEast Pool Stairs22SF610+ yearsHandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair24SF56-10 yearsLighting - Lay-inNortheast Fire Stair342SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsLighting - Lay-inNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair68LF510+ yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsLighting - Lay-inNortheast Fire Stair102LF710+ yearsGeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsGeiling - Lay-inNortheast Stair - Central Stairs40SF7								
HandrailsEast Pool Stairs72LF510+ yearsLighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair24SF710+ yearsFloor - TerrazzoNortheast Fire Stair24SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsFloor - TerrazzoNortheast Fire Stair342SF510+ yearsFloor - TerrazzoNortheast Fire Stair6EA66-10 yearsLighting - Lay-inNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs69LF710+ yearsHandrailsNortheast Stair - Central Stairs69L								
Lighting - Wall MountedEast Pool Stairs2EA76-10 yearsStairs - ConcreteEast Pool Stairs116LF610+ yearsStairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair24SF710+ yearsFloor - TerrazzoNortheast Fire Stair342SF56-10 yearsFloor - Tile/SheetNortheast Fire Stair342SF510+ yearsLighting - Lay-inNortheast Fire Stair68LF510+ yearsFloor - Tile/SheetNortheast Fire Stair68LF510+ yearsKing - Lay-inNortheast Fire Stair68LF510+ yearsValls - MasonryNortheast Fire Stair1,621SF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsGeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years								
StairsConcreteEast Pool Stairs116LF610+ yearsStairsTileEast Pool Stairs17LF710+ yearsWallsMasonryEast Pool Stairs1,135SF710+ yearsCeilingLay-inNortheast Fire Stair286SF610+ yearsCeilingPlaster/DrywallNortheast Fire Stair286SF610+ yearsFloorTerrazzoNortheast Fire Stair24SF710+ yearsFloor - TerrazzoNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLightingLay-inNortheast Fire Stair6EA66-10 yearsStairsTerrazzoNortheast Fire Stair102LF710+ yearsWallsMasonryNortheast Fire Stair102LF710+ yearsUightingLay-inNortheast Fire Stair102LF710+ yearsVallsMasonryNortheast Stair - Central Stairs187SF710+ yearsFloorTerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years								
Stairs - TileEast Pool Stairs17LF710+ yearsWalls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair170SF610+ yearsFloor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years							-	
Walls - MasonryEast Pool Stairs1,135SF710+ yearsCeiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair170SF610+ yearsFloor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair102LF710+ yearsFloor - TerrazzoNortheast Fire Stair1,621SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years								
Ceiling - Lay-inNortheast Fire Stair286SF610+ yearsCeiling - Plaster/DrywallNortheast Fire Stair170SF610+ yearsFloor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs187SF710+ yearsHandrailsNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years								
Ceiling - Plaster/DrywallNortheast Fire Stair170SF610+ yearsFloor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs187SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years							-	
Floor - TerrazzoNortheast Fire Stair24SF710+ yearsFloor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years							10+ years	
Floor - Tile/SheetNortheast Fire Stair342SF56-10 yearsHandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years			Northeast Fire Stair				10+ years	
HandrailsNortheast Fire Stair68LF510+ yearsLighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years		Floor - Terrazzo	Northeast Fire Stair	24		7	10+ years	
Lighting - Lay-inNortheast Fire Stair6EA66-10 yearsStairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years		Floor - Tile/Sheet	Northeast Fire Stair	342			6-10 years	
StairsTerrazzoNortheast Fire Stair102LF710+ yearsWallsMasonryNortheast Fire Stair1,621SF710+ yearsCeilingLay-inNortheast StairCentral Stairs187SF710+ yearsFloorTerrazzoNortheast StairCentral Stairs40SF710+ yearsHandrailsNortheast StairCentral Stairs69LF710+ years			Northeast Fire Stair	68	LF	5		
Stairs - TerrazzoNortheast Fire Stair102LF710+ yearsWalls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years		Lighting - Lay-in	Northeast Fire Stair	6	EA	6	6-10 years	
Walls - MasonryNortheast Fire Stair1,621SF710+ yearsCeiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years			Northeast Fire Stair	102		7	•	
Ceiling - Lay-inNortheast Stair - Central Stairs187SF710+ yearsFloor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years		Walls - Masonry	Northeast Fire Stair		SF			
Floor - TerrazzoNortheast Stair - Central Stairs40SF710+ yearsHandrailsNortheast Stair - Central Stairs69LF710+ years			Northeast Stair - Central Stairs		SF	7	-	
Handrails Northeast Stair - Central Stairs 69 LF 7 10+ years								
							•	
		Handrails	Northeast Stair - Central Stairs	28	LF	5	2-5 years	
Lighting - Lay-in Northeast Stair - Central Stairs 4 EA 7 6-10 years							•	
				7		,	o io youis	



Category : Interior Building : Linked Addition-Athletic Building B Recommend Group Item - Type Location Quantity UOM Rank **Replacement** Comments Stairs - Terrazzo Northeast Stair - Central Stairs 160 LF 10+ vears 7 994 SF 7 Walls - Masonry Northeast Stair - Central Stairs 10+ years Ceiling - Lay-in Northwest Fire Stair 286 SF 6 10+ years Floor - Terrazzo 24 SF 7 Northwest Fire Stair 10+ years SF 5 Floor - Tile/Sheet Northwest Fire Stair 342 6-10 years LF 5 Handrails Northwest Fire Stair 68 10+ years Lighting - Lay-in Northwest Fire Stair ΕA 7 6-10 years 6 LF Stairs - Terrazzo Northwest Fire Stair 102 7 10+ years Walls - Masonry SF Northwest Fire Stair 1,621 7 10+ vears SF Walls - Plaster/Drywall 7 10+ vears Northwest Fire Stair 104 SF Ceiling - Lav-in Northwest Stair - Central Stairs 187 7 2-5 vears Floor - Terrazzo Northwest Stair - Central Stairs 52 SF 5 10+ years Handrails Northwest Stair - Central Stairs 69 LF 7 10+ years LF 5 Handrails Northwest Stair - Central Stairs 38 2-5 years ΕA 7 6-10 years Lighting - Lay-in Northwest Stair - Central Stairs 4 Stairs - Terrazzo 160 LF 7 Northwest Stair - Central Stairs 10+ years SF 7 Walls - Masonry Northwest Stair - Central Stairs 994 10+ years SF Ceiling - Splined Southeast Core Stairs 187 4 1-2 years Dirty and damaged Floor - Terrazzo SF Southeast Core Stairs 40 6 10+ vears LF Handrails Southeast Core Stairs 69 7 10+ years Handrails Southeast Core Stairs 38 LF 5 10+ years 3 ΕA 7 Lighting - Lay-in Southeast Core Stairs 6-10 years Stairs - Terrazzo LF 7 Southeast Core Stairs 160 10+ years SF 7 Walls - Masonry Southeast Core Stairs 994 10+ years Ceiling - Splined SF 5 2-5 years Southwest Stairs - Core Stairs 187 Dirtv Floor - Terrazzo SF Southwest Stairs - Core Stairs 40 5 2-5 vears LF 7 Handrails Southwest Stairs - Core Stairs 69 10+ years LF Handrails Southwest Stairs - Core Stairs 38 5 2-5 years ΕA 7 Lighting - Lay-in Southwest Stairs - Core Stairs 3 6-10 years Stairs - Terrazzo Southwest Stairs - Core Stairs 160 LF 7 10+ years SF Walls - Masonry Southwest Stairs - Core Stairs 994 7 10+ vears SF Ceiling - Plaster/Drvwall West Locker Stairs 6 6 10+ vears Ceiling - Splined SF West Locker Stairs 6 2-5 vears 182 Ceiling - Splined SF 5 0-1 year Chipped West Locker Stairs 17 Floor - Terrazzo SF 7 West Locker Stairs 121 10+ years Floor - Tile Ceramic/ Porcelain SF 7 West Locker Stairs 151 10+ years LF Handrails West Locker Stairs 70 5 10+ years 2 ΕA 7 6-10 years Lighting - Lay-in West Locker Stairs Lighting - Pendent/Surface West Locker Stairs 1 EΑ 7 6-10 years Stairs - Terrazzo LF West Locker Stairs 128 7 10+ vears SF Walls - Masonry West Locker Stairs 1.334 7 10+ years SF 7 Ceiling - Lay-in West Pool Stairs 242 10+ vears Floor - Concrete West Pool Stairs 70 SF 5 10+ years Floor - Rubber Floor SF West Pool Stairs 22 6 10+ years



Catego	ry : Interior		В	uilding	: Linked	Addition-Athl	etic Building B
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Handrails	West Pool Stairs	72	LF	5	10+ years	
	Lighting - Wall Mounted	West Pool Stairs	2	EA	7	6-10 years	
	Stairs - Concrete	West Pool Stairs	116	LF	6	10+ years	
	Stairs - Tile	West Pool Stairs	17	LF	7	10+ years	
	Walls - Masonry	West Pool Stairs	1,135	SF	7	10+ years	
Vertical	Conveyance						
	Elevator - Hydraulic Elevator	1st Floor	1	EA	6	10+ years	



Catego	ry : Site		В	uilding	: Site		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Athletic							
	Surface - Asphalt	East	29,484	SF	4	0-1 year	Nets missing, courts need to be resealed and striped.
	Lighting	Northeast	8	EA	6	6-10 years	
	Metal Bleachers	Northeast	1	LF	6	2-5 years	
	Surface - Natural	Northeast	57,150	SF	6	10+ years	
	Surface - Concrete	Northeast	7,300	SF	6	10+ years	
	Surface - Natural	Northeast	63,852	SF	6	10+ years	
_Civil/Dra	inage						
	Civil/ Drainage - Catch Basin	Entire Site	2	EA	6	6-10 years	Repaired
	Civil/ Drainage - Catch Basin	Entire Site	19	EA	6	10+ years	
	Civil/ Drainage - Site Drain	Entire Site	5	EA	6	10+ years	
	Civil/ Drainage - Site Manhole	Entire Site	18	EA	6	10+ years	
	Fencing - Chain Link	Entire Site	1,794	LF	6	10+ years	
	Fencing - Chain Link	Entire Site	3,639	LF	4	0-1 year	Loose chain link and falling over
	Fencing - Guard Rail	Entire Site	209	LF	6	10+ years	
	Fencing - New Standard Ornamental	Entire Site	1,389	LF	6	10+ years	
Landsca	pe						
	Benches	Entire Site	4	EA	6	6-10 years	
	Landscape - Grass	Entire Site	205,413	SF	7	10+ years	
	Landscape - Hardscape- Concrete	Entire Site	38,753	SF	6	10+ years	
	Landscape - Hardscape- Concrete	Entire Site	3,215	SF	4	0-1 year	Cracking, holes, and minor sloping
	Landscape - Hardscape- Pavers	Entire Site	190	SF	7	10+ years	
	Parkway trees	Entire Site	29	EA	7	10+ years	
	Parkway trees	Entire Site	3	EA	4	1-2 years	Cut off, stumps left
	Planting Beds/ Area	Entire Site	4,896	SF	7	10+ years	
	Retaining Wall - Concrete	Entire Site	1,055	SF	7	10+ years	
	Retaining Wall - Concrete	Entire Site	60	SF	5	0-1 year	Broken, displaced
	Trash Receptacles	Entire Site	9	EA	6	10+ years	
Parking I	ot						
2	Concrete Curbs	Parking Lot- North	2,777	LF	6	10+ years	
	Interior Plantings	Parking Lot- North	8	LF	6	6-10 years	
	Lighting - Pole Mounted	Parking Lot- North	1	EA	6	6-10 years	
	Surface - Asphalt	Parking Lot- North	103,641	SF	6	6-10 years	
	Surface - Asphalt	Parking Lot- North	40,000	SF	4	0-1 year	Potholes, cracks
	Surface - Concrete	Parking Lot- North	1,000	SF	4	0-1 year	Potholes, cracks
	Concrete Curbs	Parking Lot- South	250	LF	6	10+ years	



Catego	ry : Site		В	uilding	: Site		· · · · · · · · · · · · · · · · · · ·
_				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Interior Plantings	Parking Lot- South	20	LF	7	10+ years	
	Lighting - Pole Mounted	Parking Lot- South	2	EA	6	6-10 years	
	Surface - Asphalt	Parking Lot- South	38,920	SF	7	10+ years	New parking lot
	Trash Compactor	Parking Lot- South	1	EA	6	10+ years	
Service	Garage						
	Service Garage - Free-Standing	East Service Garage	1	SF	7	10+ years	
Sidewall	(S						
	Sidewalks - Internal Walks	Entire Site	400	LF	6	10+ years	
	Sidewalks - Perimeter Sidewalks	Entire Site	24,502	SF	6	10+ years	
	Sidewalks - Perimeter Sidewalks	Entire Site	500	SF	4	0-1 year	Cracking
Signage							
0 0	Flag Pole - Flag Pole	Entire Site	1	EA	6	10+ years	
	Marquee - Free Standing Back lighted w/	Entire Site	1	EA	5	6-10 years	
	Monument - Building Mounted Cut Letter Sign	Entire Site	3	EA	6	10+ years	

¹ It is very rare for assessors to find a feature in this condition. If assessors do, they are required to report it to CPS right away, and CPS facilities will address it immediately. As a result, no features should be ranked "1" in this report; by the time the report is compiled, they will have been resolved.

Definitions

- Quantity means, for each item, the total number (or amount) of that item that exists and was evaluated
- Unit means the generally accepted standard unit of measure for each item. Some items, like doors, are measured individually and use the unit of measurement "EA" for "each." Other items, like chimneys, are measured in terms of linear feet ("LF"). Still other items, like flooring, are generally measured in square feet ("SF").



			Room	Floor Plan Room	Area	Glazed Window	Operable Window	Window	Smart-
Current Usage Building : Main-Building A	Intended Usage	Room Location	Number	Number	(SF)	Area	Area	Stop	Board
Autoshop	Laboratory/Shop	1st Floor	166	166	3,960	195	0	N	Y
			Automotive	100	0,000	100	°,		
Computer Lab	Computer Lab	1st Floor	148	148	2,234	0	0	N	Y
	•		DigitalDsgn		,				
Computer Lab	Computer Lab	3rd Floor	336	336	1,020	0	0	N	Y
Computer Lab	Computer Lab	3rd Floor	336A	336A	1,521	0	0	Ν	Ν
Computer Lab	Computer Lab	3rd Floor	337	337	960	0	0	N	Ν
Computer Lab	Computer Lab	3rd Floor	338	338	986	0	0	N	N
Computer Lab	Computer Lab	3rd Floor	339	339	686	0	0	N	N
Computer Lab	Computer Lab	3rd Floor	341	341	850	0	0	N	Y
Computer Lab	Computer Lab	3rd Floor	343	343	1,496	0	0	N	Y
Computer Lab	Laboratory/Shop	1st Floor	143 Web	143	2,052	0	0	N	Y
			Design						
Computer Lab	Other Instructional Use	1st Floor	152	152/153	1,451	0	0	N	N
			Comp/Elec						
Computer Lab	Other Instructional Use	1st Floor	162	162	1,234	104	0	Ν	N
Computer Lab	Other Instructional Use	1st Floor	165 TV	165	1,641	0	0	N	N
			Studio						
Computer Lab	Other Instructional Use	2nd Floor	270	270	1,500	312	0	N	Y
Computer Lab	Regular Classroom	2nd Floor	261	261	1,170	264	0	N	N
Computer Lab	Regular Classroom	3rd Floor	380	380	900	144	0	N	Y
Culinary	Regular Classroom	3rd Floor	381	381	2,000	165	0	N	N
Laboratory/Shop	Laboratory/Shop	1st Floor	150	150	734	0	0	N	Y
			Photograph						
			у						
Laboratory/Shop	Laboratory/Shop	1st Floor	163	163	2,914	117	0	N	Y
			Woodworki						
			ng						
Other Instructional Use	Laboratory/Shop	1st Floor	164 Metal	164	2,817	104	0	N	N
Other Instructional Use	Other Instructional Use	1st Floor	167	167	954	130	0	N	Y
Other Instructional Use	Other Instructional Use	1st Floor	168	168	974	130	0	N	Y
Other Instructional Use	Special Program	1st Floor	159	159	1,627	166	0	N	Y
Regular Classroom	Computer Lab	2nd Floor	235E	235E	951	0	0	N	N
Regular Classroom	Computer Lab	3rd Floor	375	375	722	0	0	N	Y
Regular Classroom	Laboratory/Shop	1st Floor	144 Elect	144 (partial)	1,225	0	0	N	Y
			Lab						
Regular Classroom	Other Instructional Use	1st Floor	145	146	1,002	0	0	N	N
Regular Classroom	Other Instructional Use	1st Floor	160	160	1,434	156	0	N	Y
Regular Classroom	Other Instructional Use	1st Floor	161	161	1,453	156	0	N	Y



Current lineare		Deem Leastien	Room	Floor Plan Room Number	Area	Glazed Window	Operable Window	Window	Smart-
Current Usage Regular Classroom	Intended Usage Other Instructional Use	Room Location 3rd Floor	Number 335A	335A	(SF) 686	Area 0	Area	Stop N	Board
Regular Classroom Regular Classroom		1st Floor	<u> </u>	335A 147	632	•	0		Y N
	Regular Classroom			147		0	0	N	N
Regular Classroom	Regular Classroom	1st Floor	147		793	•	0	N	N Y
Regular Classroom	Regular Classroom	2nd Floor	232	232	750	168	0	N	•
Regular Classroom	Regular Classroom	2nd Floor	233	233	1,140	147	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	241	241	1,384	0	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	243	243	738	216	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	244	244	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	245	245	738	120	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	248	248	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	249	249	738	120	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	250	250	400	0	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	252	252	400	0	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	253	253	738	120	0	N	Ν
Regular Classroom	Regular Classroom	2nd Floor	254	254	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	255	255	600	0	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	257	257	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	258	258	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	259	259	600	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	260	260	738	120	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	262	262	738	120	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	263	263	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	264	264	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	265	265	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	266	266	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	267	267	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	268	268	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	269	269	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	271	271	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	272	272	600	300	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	274	274	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	275	275	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	277	277	687	320	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	279	279	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	280	280	738	120	0	N	Y
Regular Classroom	Regular Classroom	2nd Floor	282	282	687	0	0	N	Ý
Regular Classroom	Regular Classroom	2nd Floor	284	284	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	285	285	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	286	286	687	87	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	288	288	738	120	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	289	289	696	120	0	N	N
Negulai Classi UUIII		2110 1 1001	209	203	090	120	U		



Current Usage	Intended Usage	Room Location	Room Number	Floor Plan Room Number	Area (SF)	Glazed Window Area	Operable Window Area	Window Stop	Smart- Board
Regular Classroom	Regular Classroom	2nd Floor	290	290	738	216	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	334/335	334	2,716	0	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	362	362	500	96	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	364	364	750	120	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	365	365	725	120	0	N	Y
Regular Classroom	Regular Classroom	3rd Floor	366	366	750	120	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	367	367	750	120	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	368	368	750	120	0	N	Y
Regular Classroom	Regular Classroom	3rd Floor	369	369	960	240	0	N	Y
Regular Classroom	Regular Classroom	3rd Floor	371	371	960	103	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	374	374	696	120	0	N	N
Regular Classroom	Regular Classroom	3rd Floor	377	377	696	120	0	N	Y
Regular Classroom	Regular Classroom	3rd Floor	378	378	725	120	0	N	Y
Regular Classroom	Regular Classroom	3rd Floor	379	379	580	0	0	N	N
Regular Classroom	Science Lab Level 2	3rd Floor	351	351	625	120	0	N	Y
Regular Classroom	Store Room	3rd Floor	373	373	400	0	0	N	Y
Science Classroom	Computer Lab	3rd Floor	332	332	1,326	168	0	N	Y
Science Lab Level 1	Regular Classroom	3rd Floor	360	360	900	144	0	N	Y
Science Lab Level 1	Science Lab Level 2	3rd Floor	349	349	1,234	120	0	N	Y
Science Lab Level 1	Science Lab Level 2	3rd Floor	350	350	888	120	0	N	N
Science Lab Level 1	Science Lab Level 2	3rd Floor	353	353	950	120	0	N	Y
Science Lab Level 1	Science Lab Level 2	3rd Floor	354	354	888	126	0	N	Y
Science Lab Level 2	Science Lab Level 2	3rd Floor	340	340	1,250	0	0	N	Y
Science Lab Level 2	Science Lab Level 2	3rd Floor	346	346	1,110	168	0	N	N
Science Lab Level 2	Science Lab Level 2	3rd Floor	347	357	600	210	0	N	Y
Science Lab Level 2	Science Lab Level 2	3rd Floor	361	361	900	144	0	N	Y
Science Lab Level 2	Science Lab Level 2	3rd Floor	363	363	900	144	0	N	Y
Science Lab Level 3	Regular Classroom	3rd Floor	383	383	986	240	0	N	Y
Science Lab Level 3	Science Lab Level 3	3rd Floor	355	355	1,850	120	0	N	Y
Special Education	Special Education	3rd Floor	370	370	350	72	0	N	N
Store Room	Other Instructional Use	3rd Floor	381B	NA	279	72	0	N	N

Building : Linked Add	lition-Athletic Building B								
Art Room	Art Room	2nd Floor	619	619	1,125	400	0	N	N
Art Room	Art Room	2nd Floor	621	621	828	276	0	N	Y
Art Room	Art Room	2nd Floor	627	627	2,282	252	0	N	Y
Art Room	Art Room	2nd Floor	629	629	1,125	400	0	N	Y
Band Room	Band Room	1st Floor	510	510	2,020	0	0	N	N
Band Room	Band Room	1st Floor	514	514	2,030	0	0	N	N
Dance Room	Dance Room	1st Floor	508 Quin	508	2,610	0	0	N	N
			Hall						



			Room	Floor Plan Room	Area	Glazed Window	Operable Window	Window	Smart-
Current Usage	Intended Usage	Room Location	Number	Number	(SF)	Area	Area	Stop	Board
Laboratory/Shop	Laboratory/Shop	1st Floor	525	525	1,970	0	0	N	N
Music Room	Music Room	2nd Floor	612	612	820	100	0	N	Y
Music Room	Music Room	2nd Floor	613	613	683	150	0	N	N
Music Room	Music Room	2nd Floor	616	616	1,640	25	0	N	N
Regular Classroom	Health	2nd Floor	643	643	773	0	0	N	N
Regular Classroom	Regular Classroom	2nd Floor	639	639	780	0	0	N	N
Weight	Weight	1st Floor	544	544	2,876	0	0	N	N
Duilding - Addition									
Building : Addition Regular Classroom	Adult Education	1st Floor	Driver's ed		1,200	0	0		