



#### **Facility Assessment Report**

This report contains the detailed findings of the facility condition assessment completed on the date noted in the document footer. Assessors rate each facility item by visual observation only; they do not test the operation of equipment or perform destructive testing of walls, ceilings, or floors. Each facility item is ranked on a 7-point scale: a rank 7 means the item is new or in like-new condition and no work is required while rank 1 means the item has failed and has led to an immediate life safety condition. The remaining ranks generally mean that the item requires regular maintenance (rank 5 or 6) or full replacement (rank 2, 3 or 4). To enhance reporting and capital planning analysis, each assessed item must also be assigned a recommended replacement range (used to specify the time span, in years, before replacement is recommended). Definitions for Quantity and Unit of Measure (UOM) can be found at the end of this report.

For additional detail and definition on rank values as they relate to each assessed item or the recommended replacement range, please visit the "CPS Guide to Biennial Facility Assessments" found on the Facilities Standards webpage under CPS Policies and Guidelines at <a href="http://www.cps.edu/facilityassessment">http://www.cps.edu/facilityassessment</a>.

| Campus Summary |                  |                  |                       |
|----------------|------------------|------------------|-----------------------|
| BuildingName   | Year Constructed | Number of Floors | Building Area (Sq Ft) |
| Main           | 1949             | 3                | 76,304                |
| Annex          | 1973             | 2                | 27,600                |
| Campus Total   |                  |                  | 103,904               |

| Catego   | ory : Exterior                        |                      | В        | uilding | : Main |                          |          |
|----------|---------------------------------------|----------------------|----------|---------|--------|--------------------------|----------|
| Group    | Item - Type                           | Location             | Quantity | UOM     | Rank   | Recommend<br>Replacement | Comments |
| Cell Equ | iipment                               |                      |          |         |        |                          |          |
| •        | Cell Equipment - Antenna              | Main Roof            | 3        | EA      | 7      | 10+ years                |          |
|          | Cell Equipment - Cabinets             | Main Roof            | 6        | EA      | 7      | 6-10 years               |          |
|          | Cell Equipment - Generator            | Main Roof            | 1        | EA      | 7      | 6-10 years               |          |
| Entrance | 9                                     |                      |          |         |        |                          |          |
|          | Exterior Doors - Exterior FRP Door    | #1- SW               | 2        | EA      | 6      | 10+ years                |          |
|          | Exterior Doors - Transom Lite         | #1- SW               | 1        | EA      | 6      | 10+ years                |          |
|          | Exterior Stairs - Concrete            | #1- SW               | 60       | LF      | 6      | 10+ years                |          |
|          | Entrance Control - Audio and Video    | #2- S- Main Entrance | 1        | EΑ      | 6      | 6-10 years               |          |
|          | Exterior Doors - Exterior FRP Door    | #2- S- Main Entrance | 2        | EA      | 6      | 10+ years                |          |
|          | Exterior Doors - Transom Lite         | #2- S- Main Entrance | 1        | EA      | 6      | 10+ years                |          |
|          | Exterior Stairs - Concrete            | #2- S- Main Entrance | 168      | LF      | 6      | 10+ years                |          |
|          | Exterior Stairs - Stone               | #2- S- Main Entrance | 10       | LF      | 6      | 10+ years                |          |
|          | Stair Handrail - Steel_Stair Handrail | #2- S- Main Entrance | 42       | LF      | 6      | 10+ years                |          |
|          | Entrance Control - Audio and Video    | #3- SE               | 1        | EA      | 6      | 6-10 years               |          |
|          | Exterior Doors - Exterior FRP Door    | #3- SE               | 2        | EΑ      | 6      | 10+ years                |          |
|          | Exterior Doors - Transom Lite         | #3- SE               | 1        | EΑ      | 6      | 10+ years                |          |
|          | Exterior Stairs - Concrete            | #3- SE               | 80       | LF      | 5      | 2-5 years                |          |
|          | Exterior Stairs - Stone               | #3- SE               | 10       | LF      | 6      | 10+ years                |          |
|          | Power Door Operator and Controls      | #3- SE               | 2        | EA      | 7      | 10+ years                |          |
|          | Ramp Handrail - Steel_Ramp Handrail   | #3- SE               | 80       | LF      | 6      | 10+ years                |          |
|          | Ramps - Concrete                      | #3- SE               | 160      | LF      | 7      | 10+ years                |          |
|          | Stair Handrail - Steel_Stair Handrail | #3- SE               | 25       | LF      | 6      | 10+ years                |          |



| Categor     | ry : Exterior                                      |                        | В        | uilding | : Main |             | _                                |
|-------------|--|------------------------|----------|---------|--------|-------------|----------------------------------|
|             |  |                        |          | _       |        | Recommend   |                                  |
| Group       | Item - Type  | Location               | Quantity | UOM     | Rank   | Replacement | Comments                         |
|             | Exterior Doors - Exterior FRP Door                 | #4- NE                 | 2        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Transom Lite                      | #4- NE                 | 1        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Stairs - Stone                            | #4- NE                 | 16       | LF      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Exterior Steel Door               | #4.5- NE- Yard Storage | 2        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Exterior FRP Door                 | #5- NE                 | 2        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Transom Lite                      | #5- NE                 | 1        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Stairs - Stone                            | #5- NE                 | 64       | LF      | 5      | 2-5 years   |                                  |
|             | Exterior Doors - Exterior Steel Door               | #5.5- N- Boiler Room   | 1        | EA      | 6      | 6-10 years  |                                  |
|             | Exterior Stairs - Concrete                         | #5.5- N- Boiler Room   | 28       | LF      | 6      | 10+ years   |                                  |
|             | Stair Handrail - Steel_Stair Handrail              | #5.5- N- Boiler Room   | 15       | LF      | 6      | 10+ years   |                                  |
|             | Entrance Control - Audio and Video                 | #6- NW                 | 1        | EA      | 6      | 6-10 years  |                                  |
|             | Exterior Doors - Exterior FRP Door                 | #6- NW                 | 2        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Transom Lite                      | #6- NW                 | 1        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Stairs - Concrete                         | #6- NW                 | 64       | LF      | 5      | 2-5 years   |                                  |
|             | Ramp Handrail - Steel_Ramp Handrail                | #6- NW                 | 160      | LF      | 6      | 10+ years   |                                  |
|             | Ramps - Concrete                                   | #6- NW                 | 80       | LF      | 5      | 2-5 years   |                                  |
|             | Stair Handrail - Steel_Stair Handrail              | #6- NW                 | 20       | LF      | 5      | 2-5 years   |                                  |
|             | Exterior Doors - Exterior FRP Door                 | #7- NW                 | 2        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Doors - Transom Lite                      | #7- NW                 | 1        | EA      | 6      | 10+ years   |                                  |
|             | Exterior Stairs - Stone                            | #7- NW                 | 6        | LF      | 6      | 10+ years   |                                  |
|             |  |                        |          |         |        |             |                                  |
| _Foundation | on<br>Foundation - Concrete                        | Fating Duilding        | 005      | 1.5     | 7      | 10          |                                  |
|             |  | Entire Building        | 925      | LF      | 7      | 10+ years   |                                  |
|             | Foundation - Concrete                              | Entire Building        | 10       | LF      | 6      | 10+ years   |                                  |
|             | Superstructure - Concrete                          | Entire Building        | 76,279   | SF      | 7      | 10+ years   |                                  |
|             | Superstructure - Concrete                          | Entire Building        | 15       | SF      | 5      | 10+ years   |                                  |
|             | Superstructure - Concrete                          | Entire Building        | 10       | SF      | 5      | 10+ years   |                                  |
| Lighting    |  |                        |          |         |        |             |                                  |
| Lighting    | Exterior Lighting - Parapet or Roof Mounted        | Entire Building        | 10       | EA      | 6      | 6-10 years  |                                  |
|             | Exterior Lighting - Parapet or Roof Mounted        | Entire Building        | 4        | ΕA      | 5      | 2-5 years   |                                  |
|             | Exterior Lighting - Wall Mounted                   | Entire Building        | 4        | EA      | 6      | 6-10 years  |                                  |
|             | Exterior Lighting - Wall Mounted                   | Entire Building        | 2        | EA      | 5      | 2-5 years   |                                  |
|             | 0 0  | G                      |          |         |        | ·           |                                  |
| Roof Sys    |  |                        |          |         |        |             |                                  |
|             | Access Ladder - Metal                              | Main Roof              | 3        | EA      | 7      | 10+ years   |                                  |
|             | Access Ladder - Metal                              | Main Roof              | 1        | EA      | 7      | 6-10 years  |                                  |
|             | Access Ladder - Metal                              | Main Roof              | 6        | EA      | 5      | 2-5 years   |                                  |
|             | Access Ladder - Wood                               | Main Roof              | 1        | EA      | 5      | 6-10 years  | RUL based on observed conditions |
|             | Chimney - Brick Chimney- Concrete/ Mortar Liner    | Main Roof              | 30       | LF      | 6      | 10+ years   |                                  |
|             | Chimney - Brick Chimney- Concrete/ Mortar<br>Liner | Main Roof              | 66       | LF      | 5      | 10+ years   |                                  |



| Catego           | ry : Exterior                              |                 | В        | uilding | : Main |                          |                         |
|------------------|--|-----------------|----------|---------|--------|--------------------------|-------------------------|
| Jaiogo           | Ty . Exterior                              |                 |          | anamg   | · Wani | Recommend                |                         |
| Group            | Item - Type                                | Location        | Quantity | UOM     | Rank   | Replacement              | Comments                |
|                  | Coping - Metal                             | Main Roof       | 25       | LF      | 6      | 10+ years                |                         |
|                  | Coping - Stone                             | Main Roof       | 794      | LF      | 6      | 2-5 years                |                         |
|                  | Coping - Stone                             | Main Roof       | 381      | LF      | 6      | 2-5 years                |                         |
|                  | Downspouts - Exterior Downspouts           | Main Roof       | 12       | LF      | 7      | 6-10 years               |                         |
|                  | Downspouts - Interior Downspouts           | Main Roof       | 408      | LF      | 6      | 10+ years                |                         |
|                  | Parapet - 16" - 30" Height                 | Main Roof       | 900      | LF      | 7      | 10+ years                |                         |
|                  | Parapet - Parapet > 30"                    | Main Roof       | 275      | LF      | 5      | 10+ years                |                         |
|                  | Roof - Modified Bitumen                    | Main Roof       | 15       | SF      | 7      | 6-10 years               | Per POC, "NA"           |
|                  | Roof - Modified Bitumen                    | Main Roof       | 24,182   | SF      | 6      | 6-10 years               | 1 01 1 0 0, 1 11 1      |
|                  | Roof Hatch - Metal                         | Main Roof       | 5        | EA      | 7      | 6-10 years               |                         |
|                  | Roof Hatch - Wood                          | Main Roof       | 6        | EA      | 5      | 2-5 years                |                         |
|                  | Roof Structure - Concrete                  | Main Roof       | 5,115    | SF      | 7      | 10+ years                |                         |
|                  | Roof Structure - Steel / Metal Deck/       | Main Roof       | 156      | SF      | 7      | ,                        |                         |
|                  | Concrete Topping                           | Maill NOOI      | 130      | 3F      | ,      | 10+ years                |                         |
|                  | Roof Structure - Steel with Clay Tile Arch | Main Roof       | 18,926   | SF      | 7      | 10+ years                |                         |
|                  | Roof Structure - Steel with Clay Tile Arch | IVIAIII ROOI    | 10,920   | SF      | ,      | 10+ years                |                         |
| Valls            |  |                 |          |         |        |                          |                         |
|                  | Cheek-Wall - Concrete                      | Entire Building | 70       | SF      | 6      | 10+ years                |                         |
|                  | Cheek-Wall - Concrete                      | Entire Building | 90       | SF      | 6      | 10+ years                |                         |
|                  | Cheek-Wall - Stone                         | Entire Building | 70       | SF      | 6      | 10+ years                |                         |
|                  | Cheek-Wall - Stone                         | Entire Building | 15       | SF      | 6      | 10+ years                |                         |
|                  | Exterior Walls - Brick                     | Entire Building | 40,344   | SF      | 6      | 10+ years                |                         |
|                  | Exterior Walls - Stone-Cast                | Entire Building | 1,870    | SF      | 6      | 10+ years                |                         |
|                  | Exterior Walls - Stone-Cast                | Entire Building | 50       | SF      | 5      | 10+ years                |                         |
|                  | Exterior Walls - Stone-Cut                 | Entire Building | 302      | SF      | 5      | 10+ years                |                         |
| Windows          |  |                 |          |         |        |                          |                         |
| VINGOWS          | Guard - Guards perforated                  | Entire Building | 2,170    | SF      | 6      | 10+ years                |                         |
|                  | Lintels - Steel                            | Entire Building | 616      | LF      | 6      | 10+ years                |                         |
|                  | Lintels - Stone                            | Entire Building | 441      | LF      | 6      | 10+ years                |                         |
|                  | Windows - Sash Aluminum Double-pane        | Entire Building | 7,967    | SF      | 6      | 10+ years                |                         |
|                  | William Bausia palia                       | Zitai 5 Bananig | .,001    | 0.      | Ü      | io. youro                |                         |
| Catego           | ry : Electrical                            |                 | В        | uilding | : Main | _                        |                         |
| Group            | Itom - Typo                                | Location        | Quantity | UOM     | Rank   | Recommend<br>Replacement | Comments                |
| Group<br>⊑morgor | Item - Type<br>ncy System                  | Location        | Quantity | UUIVI   | Rdlik  | Replacement              | Confinents              |
| -merger          | Automatic Transfer Switch                  | Electrical Room | 1        | Ε^      | 6      | 6.10 40000               | Proviously not assessed |
|                  |  |                 |          | EΑ      | 6      | 6-10 years               | Previously not assessed |
|                  | Exit Signs - Auditoium                     | Entire Building | 6        | EΑ      | 6      | 6-10 years               | Functional              |
|                  | Exit Signs - Corridors and Stairs          | Entire Building | 22       | EΑ      | 6      | 6-10 years               | Functional              |
|                  | Exit Signs - Gym                           | Entire Building | 2        | EΑ      | 6      | 6-10 years               | Functional              |
|                  | Exit Signs - Lunchroom                     | Entire Building | 3        | EA      | 6      | 6-10 years               | Functional              |
|                  | Emergency Battery Packs - Auditoium and    | Entire Building | 2        | EA      | 6      | 6-10 years               |                         |
|                  | Aisle Lighting                             |                 |          |         |        |                          |                         |



| Catego    | ry : Electrical  |                 | В        | uilding | : Main |                          |   |
|-----------|--|-----------------|----------|---------|--------|--------------------------|---|
| _         |  |                 |          | _       |        | Recommend                |   |
| Group     | Item - Type  | Location        | Quantity | UOM     | Rank   | Replacement              | Comments                                      |
| •         | Emergency Battery Packs - Corridors and Stairs                             | Entire Building | 14       | EA      | 6      | 6-10 years               |   |
|           | Emergency Battery Packs - Gym  | Entire Building | 2        | EA      | 6      | 6-10 years               | Previously not assessed                       |
|           | Emergency Battery Packs - Lunchrooms                                       | Entire Building | 2        | ĒΑ      | 6      | 6-10 years               | 1 Toviously flot assessed                     |
|           | Emergency A/C Power - Auditoium and  | Entire Building | 2,557    | SF      | 6      | 6-10 years               |   |
|           | Aisle Lighting   | 3               | ,        |         |        | •                        |   |
|           | Emergency A/C Power - Corridors and Stairs                                 | Entire Building | 13,579   | SF      | 6      | 6-10 years               |   |
|           | Emergency A/C Power - Gym  | Entire Building | 2,400    | SF      | 6      | 6-10 years               |   |
|           | Emergency A/C Power - Lunchrooms   | Entire Building | 2,108    | SF      | 6      | 6-10 years               |   |
|           | Security System - CCTV   | Entire Building | 76,304   | SF      | 5      | 6-10 years               |   |
|           | Security System - Intrusion Detection                                      | Entire Building | 76,304   | SF      | 5      | 6-10 years               |   |
| Main Se   | rvice  |                 |          |         |        |                          |   |
|           | Independent Electrical Service for<br>emergency power                      | Basement        | 1        | EA      | 6      | 6-10 years               | Serves main building, previously not assessed |
|           | Main Electrical Service - 1200 A<br>120/208/3PH                            | Electrical Room | 1        | EA      | 6      | 6-10 years               | Serves main, serviced, functional             |
|           | PA System  | Entire Building | 76,304   | SF      | 5      | 6-10 years               | Also serves annex, functional                 |
| Power D   | istribution  |                 |          |         |        |                          |   |
|           | Lighting and Power Panels - 100 A  | Entire Building | 1        | EA      | 7      | 10+ years                | Functional panels rated 7                     |
|           | Lighting and Power Panels - 100 A  | Entire Building | 1        | EA      | 7      | 10+ years                | Functional panels rated 7                     |
|           | Lighting and Power Panels - Above 100 A                                    | Entire Building | 7        | EΑ      | 7      | 10+ years                | Functional panels rated 7                     |
|           | Lighting and Power Panels - Above 100 A                                    | Entire Building | 4        | EA      | 7      | 10+ years                | Functional panels rated 7                     |
|           | 0 0  | Entire Building | 3        | EA      | 7      | ,                        | Functional panels rated 7                     |
|           | Main Distribution Panels - 400 - 600 amp                                   | Entire Building | 3        | EA      | ,      | 10+ years                | Functional panels rated 7                     |
| Catego    | ry : Fire Protection   |                 | В        | uilding | : Main | Dagammand                |   |
| Group     | Item - Type  | Location        | Quantity | UOM     | Rank   | Recommend<br>Replacement | Comments                                      |
| Fire Alar | m  |                 |          |         |        |                          |   |
|           | Fire Alarm Panel   | Entire Building | 1        | EA      | 6      | 6-10 years               | Functional, inspected by fire marshal         |
|           | Fire Alarm Strobe Lights   | Entire Building | 76,304   | SF      | 6      | 10+ years                | Good condition                                |
|           | Fire Alarm_System  | Entire Building | 76,304   | SF      | 6      | 6-10 years               | Periodically serviced, recently               |
|           | The Alam_System  | Entire building | 70,304   | OI .    | U      | 0-10 years               | inspected by fire marshal                     |
| Catego    | ry : Mechanical  |                 | В        | uilding | : Main |                          |   |
|           |  |                 |          |         |        | Recommend                |   |
| Group     | Item - Type  | Location        | Quantity | UOM     | Rank   | Replacement              | Comments                                      |
| Air Hand  | ling Systems   |                 |          |         |        |                          |   |
|           | Air Handling Unit- Built Up-Multi Zone-<br>Steam Coils - 15001 - 25000 cfm | Mechanical Room | 1        | EA      | 5      | 6-10 years               | Serves auditorium and gym, functional         |
|           | Air Intake   | Mechanical Room | 1        | EA      | 5      | 6-10 years               | Recently adjusted                             |

Campus Name: Pulaski Page : 4 of 41 Assessment Date: 07/19/2021



| Catego    | ry : Mechanical  |                 | В        | uilding | : Main |             |  |
|-----------|--|-----------------|----------|---------|--------|-------------|--|
|           |  |                 |          | _       |        | Recommend   |  |
| Group     | Item - Type  | Location        | Quantity | UOM     | Rank   | Replacement | Comments   |
|           | Auxiliaries - 15001 - 25000 cfm  | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Recently adjusted and cleaned  |
|           | Return Duct Work - Indoor- Vertical Shaft and Ducts  | Mechanical Room | 100      | LF      | 6      | 6-10 years  | Common return, recently serviced   |
|           | Zone Dampers   | Mechanical Room | 5        | EA      | 5      | 6-10 years  | Functional, manually adjusted, no ABS, recently adjusted                   |
|           | Air Handling Unit- Built Up- Single Zone w/<br>Air Tunnel- Steam Coils - 15001 - 25000 cfm | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Recently serviced  |
|           | Air Intake   | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Auxiliaries - 15001 - 25000 cfm  | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Reheat Boxes - Reheat Boxes with Steam Coil  | Mechanical Room | 6        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Return Duct Work - Sheet Metal- Exterior<br>Vertical Shaft and Ducts                       | Mechanical Room | 100      | LF      | 5      | 6-10 years  | Previously not assessed, common return                                     |
|           | Zone Dampers   | Mechanical Room | 21       | EA      | 5      | 6-10 years  | Functional, manually operated, functional, no ABS, recently adjusted       |
|           | Air Handling Unit- Built Up- Single Zone w/<br>Air Tunnel- Steam Coils - 15001 - 25000 cfm | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Motor replaced a few years ago   |
|           | Air Intake   | Mechanical Room | 1        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Auxiliaries - 15001 - 25000 cfm  | Mechanical Room | 1        | EΑ      | 5      | 6-10 years  | Regularly serviced   |
|           | Reheat Boxes - Reheat Boxes with Steam Coil  | Mechanical Room | 5        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Return Duct Work - Indoor- Vertical Shaft and Ducts  | Mechanical Room | 100      | LF      | 6      | 6-10 years  | Common return, previously not assessed                                     |
|           | Zone Dampers   | Mechanical Room | 18       | EA      | 5      | 6-10 years  | Some dampers disconnected, manually functioning, no ABS, recently adjusted |
| Boiler Sy |  |                 |          |         |        |             |  |
|           | Boiler Auxiliary- Scotch Marine- Steam Low Pressure Boiler - 201 - 300 HP                  | Entire Building | 2        | EA      | 5      | 6-10 years  | Recently adjusted  |
|           | Chemical Feed System   | Entire Building | 1        | EA      | 6      | 6-10 years  |  |
|           | Combustion Dampers   | Entire Building | 2        | EA      | 5      | 6-10 years  | Functional, need cleaning, recently adjusted                               |
|           | Condensate Pump  | Entire Building | 6        | EA      | 5      | 6-10 years  | Direct feed to feed tank, gravity, previously not assessed                 |
|           | Feed Water Pumps and Tank  | Entire Building | 1        | EA      | 5      | 6-10 years  | Recently serviced  |
|           | Non Condensing- Fire Tube- Scotch Marine-<br>Steam- Low Pressure Boiler - 201 - 300 HP     | Entire Building | 2        | EA      | 5      | 6-10 years  | Serves main building, tubes recently descaled                              |
|           | Piping - Condensate Pipe- Steel  | Entire Building | 300      | LF      | 6      | 10+ years   | Functional, there are a few pipe clamps                                    |
|           | Piping - Steam Pipe- Steel   | Entire Building | 300      | LF      | 6      | 10+ years   | There are a few pipe clamps  |
|           | Steam Traps  | Entire Building | 50       | ĒA      | 5      | 6-10 years  | Many have internal leaks, periodically serviced                            |

Campus Name: Pulaski Page : 5 of 41 Assessment Date: 07/19/2021



| Catego    | ry : Mechanical                                |                 | В        | uilding | Building : Main |                          |  |  |  |
|-----------|--|-----------------|----------|---------|-----------------|--------------------------|--|--|--|
| Group     | Item - Type                                    | Location        | Quantity | UOM     | Rank            | Recommend<br>Replacement | Comments   |  |  |
| Heating   | Devices  |                 |          |         |                 |                          |  |  |  |
|           | Unit Heater - Steam                            | Entire Building | 1        | EA      | 6               | 6-10 years               | Functional, recently cleaned                       |  |  |
|           | Unit Heater - Steam                            | Entire Building | 1        | EA      | 5               | 6-10 years               | Functional, recently cleaned                       |  |  |
|           | Wall Heater - Electric                         | Entire Building | 6        | EA      | 6               | 6-10 years               |  |  |  |
|           | Radiators - Steam                              | Entire Building | 20       | EA      | 5               | 6-10 years               | Some recently painted                              |  |  |
|           | Fin Tube - Steam                               | Entire Building | 34       | LF      | 5               | 6-10 years               | Behind grill, recently serviced, functional        |  |  |
| [empera   | ature Control                                  |                 |          |         |                 |                          |  |  |  |
|           | Electric Thermostat                            | Entire Building | 4        | EA      | 5               | 6-10 years               | Some do not work well, previously rassessed        |  |  |
|           | Pneumatic System                               | Entire Building | 76,304   | SF      | 4               | 2-5 years                | Manually operated, leaks, old, beyond service life |  |  |
|           | Thermostats - Pneumatic                        | Entire Building | 44       | EA      | 4               | 2-5 years                | Manually controlled, many leak                     |  |  |
| entilatio | on   |                 |          |         |                 |                          |  |  |  |
|           | Exhaust Fans- Indoor - 500 - 1500 CFM          | Entire Building | 4        | EA      | 5               | 6-10 years               | Periodically serviced                              |  |  |
|           | Exhaust Fans- Indoor - 500 - 1500 CFM          | Entire Building | 1        | EA      | 5               | 6-10 years               | Periodically serviced                              |  |  |
|           | Exhaust Fans- Indoor - Less than 500 CFM       | Entire Building | 1        | EA      | 5               | 6-10 years               | Periodically serviced                              |  |  |
|           | Exhaust Fans- Indoor - Less than 500 CFM       | Entire Building | 1        | EA      | 5               | 6-10 years               | Previously not assessed                            |  |  |
|           | Exhaust Fans- Roof Mounted - 500 - 1500<br>CFM | Entire Building | 1        | EA      | 6               | 6-10 years               | Periodically serviced                              |  |  |
|           | Exhaust Fans- Roof Mounted - 500 - 1500<br>CFM | Entire Building | 6        | EA      | 5               | 6-10 years               | Restroom exhausts                                  |  |  |

Category : Plumbing

**Building: Main** 

| Group    | Item - Type   | Location                   | Quantity | UOM      | Rank   | Recommend<br>Replacement | Comments   |
|----------|---|----------------------------|----------|----------|--------|--------------------------|--|
| Hot Wate | er  |                            |          |          |        |                          |  |
|          | Gas Heater - Less than 150000 BTU/HR<br>Hot Water Storage Tank_Gas - 501 - 1000 | Boiler Room<br>Boiler Room | 1<br>1   | EA<br>EA | 6<br>5 | 6-10 years<br>6-10 years | 2017 installation, functional, no leaks Previously not assesssed |
|          | Gallons   |                            |          |          |        | ·                        | ·  |
| Piping   |   |                            |          |          |        |                          |  |
|          | Domestic Piping-Hot Water Return Lines  | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | Functional, no leaks   |
|          | Domestic Piping-Hot Water Return Risers   | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | Functional, no leaks   |
|          | Domestic Piping-Hot Water from Risers to Fixtures                               | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | Functional, no leaks   |
|          | Domestic Piping-Hot/Cold Water Supply (Horizontal Lines)                        | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | There are a few pipe clamps, no leaks                            |
|          | Domestic Piping-Hot/Cold Water Supply (Risers)                                  | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | Functional, no leaks   |
|          | Domestic Piping-Hot/Cold Water Supply   | Entire Building            | 76,304   | SF       | 6      | 6-10 years               | Functional, no leaks   |
|          |   |                            |          |          |        |                          |  |

Campus Name: Pulaski Page : 6 of 41 Assessment Date: 07/19/2021



| Catego | ry : Plumbing                         |                 | В        | uilding | : Main |                       |   |
|--------|---------------------------------------|-----------------|----------|---------|--------|-----------------------|---|
| Group  | Item - Type                           | Location        | Quantity | UOM     | Rank   | Recommend Replacement | Comments                                |
|        | (from Risers to Fixtures)             |                 |          |         |        |                       |   |
|        | Sanitary Piping                       | Entire Building | 76,304   | SF      | 6      | 10+ years             | Functional, no leaks                    |
|        | Storm Piping                          | Entire Building | 76,304   | SF      | 6      | 10+ years             | Functional, no leaks                    |
|        | Vent Piping                           | Entire Building | 76,304   | SF      | 6      | 10+ years             | Functional                              |
| Pumps  |                                       |                 |          |         |        |                       |   |
| ·      | Pumps - Domestic Booster Pump-Simplex | Entire Building | 3        | EA      | 5      | 6-10 years            | Serves main building, recently repaired |
|        | Pumps - Sump-Simplex                  | Entire Building | 2        | EA      | 6      | 10+ years             | Recently serviced                       |
|        | Pumps - Sump-Simplex                  | Entire Building | 1        | EA      | 6      | 10+ years             | Recently serviced                       |
|        | Pumps - Sump-Simplex                  | Entire Building | 1        | EA      | 6      | 10+ years             | Under elevator, previously not assessed |

Category: Room Building: Main

| Calego   | ry . Room                   |                         | D        | unung | . IVIAIII |             |          |
|----------|-----------------------------|-------------------------|----------|-------|-----------|-------------|----------|
| 0        | Mana Tana                   | Lagation                | 0        | LIOM  | Danis     | Recommend   | 0        |
| Group    | Item - Type                 | Location                | Quantity | UOM   | Rank      | Replacement | Comments |
| Administ | rative Suites/Offices       |                         |          |       |           |             |          |
|          | AC Unit                     | 1st - 100 Main Office   | 1        | EA    | 7         | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st - 100 Main Office   | 273      | SF    | 6         | 6-10 years  |          |
|          | Doors - Transom Window      | 1st - 100 Main Office   | 8        | SF    | 6         | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 1st - 100 Main Office   | 1        | EΑ    | 6         | 6-10 years  |          |
|          | Floor - Carpet              | 1st - 100 Main Office   | 152      | SF    | 6         | 2-5 years   |          |
|          | Floor - Tile                | 1st - 100 Main Office   | 121      | SF    | 6         | 6-10 years  |          |
|          | Lighting - Lay-in           | 1st - 100 Main Office   | 6        | EA    | 7         | 6-10 years  |          |
|          | Power Distribution          | 1st - 100 Main Office   | 8        | EΑ    | 6         | 6-10 years  |          |
|          | Storage/ Closet             | 1st - 100 Main Office   | 299      | SF    | 5         | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 1st - 100 Main Office   | 716      | SF    | 6         | 6-10 years  |          |
|          | AC Unit                     | 1st - 103 Office        | 1        | EA    | 7         | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st - 103 Office        | 262      | SF    | 6         | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st - 103 Office        | 24       | SF    | 5         | 1-2 years   | Damaged  |
|          | Doors - Wood Doors inclu hw | 1st - 103 Office        | 1        | EA    | 6         | 6-10 years  |          |
|          | Floor - Tile                | 1st - 103 Office        | 296      | SF    | 6         | 6-10 years  |          |
|          | Lighting - Lay-in           | 1st - 103 Office        | 6        | EΑ    | 7         | 6-10 years  |          |
|          | Power Distribution          | 1st - 103 Office        | 2        | EΑ    | 6         | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 1st - 103 Office        | 736      | SF    | 6         | 6-10 years  |          |
|          | Ceiling - Plaster/Drywall   | 1st - 106 Social Worker | 69       | SF    | 6         | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 1st - 106 Social Worker | 1        | EA    | 6         | 6-10 years  |          |
|          | Floor - Tile                | 1st - 106 Social Worker | 69       | SF    | 6         | 6-10 years  |          |
|          | Lighting - Pendent/Surface  | 1st - 106 Social Worker | 1        | EA    | 7         | 6-10 years  |          |
|          | Power Distribution          | 1st - 106 Social Worker | 2        | EA    | 6         | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 1st - 106 Social Worker | 411      | SF    | 6         | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st - 107               | 515      | SF    | 6         | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st - 107               | 10       | SF    | 4         | 1-2 years   | Damaged  |
|          | Doors - Transom Window      | 1st - 107               | 8        | SF    | 6         | 6-10 years  |          |
|          |                             |                         |          |       |           |             |          |

Campus Name: Pulaski Page : 7 of 41 Assessment Date: 07/19/2021



| Catego     | ry : Room                           |                            | В        | uilding | : Main |             |          |
|------------|-------------------------------------|----------------------------|----------|---------|--------|-------------|----------|
|            |                                     |                            |          | _       |        | Recommend   |          |
| Group      | Item - Type                         | Location                   | Quantity | UOM     | Rank   | Replacement | Comments |
|            | Doors - Wood Doors inclu hw         | 1st - 107                  | 1        | EA      | 6      | 6-10 years  |          |
|            | Floor - Tile                        | 1st - 107                  | 535      | SF      | 6      | 6-10 years  |          |
|            | Lighting - Lay-in                   | 1st - 107                  | 9        | EA      | 7      | 6-10 years  |          |
|            | Power Distribution                  | 1st - 107                  | 4        | EA      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | 1st - 107                  | 945      | SF      | 6      | 6-10 years  |          |
|            | Ceiling - Lay-in                    | 1st - 124 Gym Office       | 89       | SF      | 6      | 6-10 years  |          |
|            | Doors - Wood Doors inclu hw         | 1st - 124 Gym Office       | 1        | EA      | 6      | 6-10 years  |          |
|            | Floor - Tile                        | 1st - 124 Gym Office       | 89       | SF      | 6      | 6-10 years  |          |
|            | Lighting - Lay-in                   | 1st - 124 Gym Office       | 1        | EA      | 7      | 6-10 years  |          |
|            | Power Distribution                  | 1st - 124 Gym Office       | 2        | EA      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | 1st - 124 Gym Office       | 387      | SF      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | 1st - 124 Gym Office       | 10       | SF      | 5      | 1-2 years   |          |
|            | AC Unit                             | 1st - Principal inside 100 | 1        | EΑ      | 7      | 6-10 years  |          |
|            | Ceiling - Lay-in                    | 1st - Principal inside 100 | 92       | SF      | 6      | 6-10 years  |          |
|            | Doors - Wood Doors inclu hw         | 1st - Principal inside 100 | 1        | EΑ      | 6      | 6-10 years  |          |
|            | Floor - Carpet                      | 1st - Principal inside 100 | 92       | SF      | 6      | 6-10 years  |          |
|            | Lighting - Lay-in                   | 1st - Principal inside 100 | 6        | EΑ      | 7      | 6-10 years  |          |
|            | Power Distribution                  | 1st - Principal inside 100 | 4        | EA      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | 1st - Principal inside 100 | 300      | SF      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | 1st - Principal inside 100 | 96       | SF      | 5      | 1-2 years   |          |
|            | Ceiling - Plaster/Drywall           | Basement Engineer's Office | 100      | SF      | 6      | 6-10 years  |          |
|            | Doors - Wood Doors inclu hw         | Basement Engineer's Office | 1        | EA      | 6      | 6-10 years  |          |
|            | Floor - Tile                        | Basement Engineer's Office | 100      | SF      | 6      | 6-10 years  |          |
|            | Lighting - Pendent/Surface          | Basement Engineer's Office | 1        | EA      | 7      | 6-10 years  |          |
|            | Power Distribution                  | Basement Engineer's Office | 6        | EA      | 6      | 6-10 years  |          |
|            | Storage/ Closet                     | Basement Engineer's Office | 10       | SF      | 7      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | Basement Engineer's Office | 375      | SF      | 6      | 6-10 years  |          |
|            | Ceiling - Plaster/Drywall           | School counselor           | 400      | SF      | 6      | 6-10 years  |          |
|            | Doors - Wood Doors inclu hw         | School counselor           | 1        | EA      | 6      | 6-10 years  |          |
|            | Floor - Tile                        | School counselor           | 400      | SF      | 6      | 10+ years   |          |
|            | Lighting - Pendent/Surface          | School counselor           | 2        | EA      | 6      | 6-10 years  |          |
|            | Walls - Plaster/Drywall             | School counselor           | 600      | SF      | 6      | 6-10 years  |          |
|            | ŕ                                   |                            |          |         |        | •           |          |
| _Auditoriu | ım & Theater                        |                            |          |         |        |             |          |
|            | Ceiling - Plaster/Drywall           | 1st - 121 Assembly Hall    | 2,375    | SF      | 6      | 6-10 years  |          |
|            | Ceiling - Plaster/Drywall           | 1st - 121 Assembly Hall    | 200      | SF      | 5      | 1-2 years   | Damaged  |
|            | Doors - Wood Doors inclu hw         | 1st - 121 Assembly Hall    | 4        | EA      | 6      | 6-10 years  |          |
|            | Floor - Carpet                      | 1st - 121 Assembly Hall    | 644      | SF      | 6      | 6-10 years  |          |
|            | Floor - Tile                        | 1st - 121 Assembly Hall    | 1,913    | SF      | 6      | 6-10 years  |          |
|            | Lighting - Chandelier, Incandescent | 1st - 121 Assembly Hall    | 6        | EA      | 6      | 6-10 years  |          |
|            | Main Floor Seating                  | 1st - 121 Assembly Hall    | 272      | EA      | 7      | 6-10 years  |          |
|            | Sound System                        | 1st - 121 Assembly Hall    | 1        | EA      | 7      | 6-10 years  |          |
|            | Stage                               | 1st - 121 Assembly Hall    | 385      | SF      | 6      | 6-10 years  |          |
|            | Stage Curtain                       | 1st - 121 Assembly Hall    | 4        | EA      | 7      | 6-10 years  |          |
|            | -                                   | •                          |          |         |        | -           |          |



|         | ry : Room                                     |                         | В        | uilding | : Main |             |          |
|---------|---|-------------------------|----------|---------|--------|-------------|----------|
|         |   |                         |          |         |        | Recommend   |          |
| Group   | Item - Type                                   | Location                | Quantity | UOM     | Rank   | Replacement | Comments |
|         | Stage Lift                                    | 1st - 121 Assembly Hall | 1        | EA      | 7      | 6-10 years  |          |
|         | Stage Lighting System                         | 1st - 121 Assembly Hall | 1        | EA      | 7      | 6-10 years  |          |
|         | Stage-Stairs - Wood                           | 1st - 121 Assembly Hall | 10       | LF      | 6      | 6-10 years  |          |
|         | Walls - Plaster/Drywall                       | 1st - 121 Assembly Hall | 3,810    | SF      | 6      | 2-5 years   |          |
|         | Walls - Tile Ceramic/ Porcelain               | 1st - 121 Assembly Hall | 616      | SF      | 6      | 6-10 years  |          |
| Clinic  |   |                         |          |         |        |             |          |
| Jiiiic  | Ceiling - Plaster/Drywall                     | 1st - 126 Clinic        | 165      | SF      | 6      | 6-10 years  |          |
|         | Doors - Transom Window                        | 1st - 126 Clinic        | 8        | SF      | 6      | 6-10 years  |          |
|         | Doors - Wood Doors inclu hw                   | 1st - 126 Clinic        | 1        | EA      | 6      | 6-10 years  |          |
|         |   |                         | 165      | SF      |        | •           |          |
|         | Floor - Tile/Sheet                            | 1st - 126 Clinic        |          |         | 7      | 6-10 years  |          |
|         | Lighting - Pendent/Surface                    | 1st - 126 Clinic        | 2        | EA      | 7      | 6-10 years  |          |
|         | Walls - Plaster/Drywall                       | 1st - 126 Clinic        | 747      | SF      | 6      | 6-10 years  |          |
| Gymnasi |   |                         |          |         |        |             |          |
|         | Ceiling - Plaster/Drywall                     | 1.5 - 120 Gym           | 2,400    | SF      | 6      | 6-10 years  |          |
|         | Doors - Wood Doors inclu hw                   | 1.5 - 120 Gym           | 4        | EA      | 6      | 6-10 years  |          |
|         | Floor - Wood                                  | 1.5 - 120 Gym           | 2,400    | SF      | 6      | 6-10 years  |          |
|         | Lighting - Metal Halide/ High Pressure Sodium | 1.5 - 120 Gym           | 12       | EA      | 7      | 6-10 years  |          |
|         | Sound System                                  | 1.5 - 120 Gym           | 1        | EA      | 7      | 6-10 years  |          |
|         | Walls - Metal Panel                           | 1.5 - 120 Gym           | 320      | SF      | 6      | 6-10 years  |          |
|         | Walls - Structural Glazed Tile                | 1.5 - 120 Gym           | 3,403    | SF      | 6      | 6-10 years  |          |
|         | Walls - Structural Glazed Tile                | 1.5 - 120 Gym           | 40       | SF      | 5      | 6-10 years  |          |
| ibrary  |   |                         |          |         |        |             |          |
| шату    | AC Unit                                       | 2nd Floor               | 6        | EA      | 7      | 6-10 years  |          |
|         | Ceiling - Lay-in                              | 2nd Floor               | 2,154    | SF      | 6      | 6-10 years  |          |
|         | Doors - Transom Window                        | 2nd Floor               | 18       | SF      | 6      | 6-10 years  |          |
|         | Doors - Wood Doors inclu hw                   | 2nd Floor               | 3        | EA      | 6      | 6-10 years  |          |
|         |   |                         |          | SF      |        |             |          |
|         | Floor - Carpet                                | 2nd Floor               | 2,154    |         | 6      | 6-10 years  |          |
|         | Lighting - Lay-in                             | 2nd Floor               | 33       | EA      | 7      | 6-10 years  |          |
|         | Walls - Plaster/Drywall                       | 2nd Floor               | 2,875    | SF      | 6      | 6-10 years  |          |
| unch &  | Multipurpose Room                             |                         |          |         |        |             |          |
|         | Ceiling - Lay-in                              | 1st - 111 Lunchroom     | 2,108    | SF      | 6      | 6-10 years  |          |
|         | Doors - Transom Window                        | 1st - 111 Lunchroom     | 18       | SF      | 6      | 6-10 years  |          |
|         | Doors - Wood Doors inclu hw                   | 1st - 111 Lunchroom     | 3        | EA      | 6      | 6-10 years  |          |
|         | Floor - Tile                                  | 1st - 111 Lunchroom     | 2,024    | SF      | 6      | 6-10 years  |          |
|         | Floor - Tile                                  | 1st - 111 Lunchroom     | 42       | SF      | 5      | 2-5 years   |          |
|         | Lighting - Lay-in                             | 1st - 111 Lunchroom     | 33       | ĒΑ      | 7      | 6-10 years  |          |
|         | Serving Line                                  | 1st - 111 Lunchroom     | 11       | LF      | 6      | 6-10 years  |          |
|         | - · · · · · · · · · · · · · · · · · · ·       |                         | 2,360    | SF      | 6      | 6-10 years  |          |

Campus Name: Pulaski Page : 9 of 41 Assessment Date: 07/19/2021



| Catego         | ry : Room                       |  | В        | uilding  | : Main |             |                        |
|----------------|---------------------------------|--|----------|----------|--------|-------------|------------------------|
|                |                                 |  |          |          |        | Recommend   |                        |
| Group          | Item - Type                     | Location   | Quantity | UOM      | Rank   | Replacement | Comments               |
|                | _                               |  |          |          |        |             |                        |
| <u> IDF_ID</u> |                                 | Ord Floor  | 1        | ΕΛ       |        | 0.40        |                        |
|                | Doors - Steel Doors incl hw     | 3rd Floor<br>3rd Floor                                 | 784      | EA<br>SF | 6      | 6-10 years  |                        |
|                | Finishes                        |  |          |          | 5      | 6-10 years  |                        |
|                | Window AC Unit                  | 3rd Floor  | 1        | EA       | 7      | 6-10 years  |                        |
| Mechani        | cal/ Service Rooms              |  |          |          |        |             |                        |
|                | Janitor's Closet                | 1st Floor  | 19       | SF       | 5      | 6-10 years  |                        |
|                | Janitor's Closet                | 1st Floor  | 15       | SF       | 5      | 6-10 years  |                        |
|                | Storage Room                    | 1st Floor  | 319      | SF       | 5      | 10+ years   |                        |
|                | Vaults                          | 1st Floor  | 400      | SF       | 5      | 10+ years   |                        |
|                | Janitor's Closet                | 2nd Floor  | 30       | SF       | 5      | 10+ years   |                        |
|                | Janitor's Closet                | 2nd Floor  | 30       | SF       | 5      | 6-10 years  |                        |
|                | Janitor's Closet                | 3rd Floor  | 15       | SF       | 5      | 6-10 years  |                        |
|                | Janitor's Closet                | 3rd Floor  | 15       | SF       | 5      | 6-10 years  |                        |
|                | Storage Room                    | 3rd Floor  | 19       | SF       | 5      | 6-10 years  |                        |
|                | Janitor's Closet                | 3rd Floor  | 25       | SF       | 5      | 2-5 years   | Drywall needs repair   |
|                | Boiler Room                     | Basement   | 1,937    | SF       | 5      | 10+ years   | Dry Wall Floods Topall |
|                | Mechanical/ Service Rooms       | Basement   | 4,143    | SF       | 5      | 10+ years   |                        |
|                | Storage Room                    | Basement   | 226      | SF       | 5      | 10+ years   |                        |
|                | Storage Room                    | Basement   | 448      | SF       | 5      | 10+ years   |                        |
|                | Storage Room                    | Dasement   | 440      | OI.      | 3      | 10+ years   |                        |
| Restroor       | n                               |  |          |          |        |             |                        |
|                | Accessories                     | 1st - 115 Staff Toilet Rm                              | 170      | SF       | 7      | 6-10 years  |                        |
|                | Ceiling - Plaster/Drywall       | 1st - 115 Staff Toilet Rm                              | 170      | SF       | 6      | 6-10 years  |                        |
|                | Doors - Transom Window          | 1st - 115 Staff Toilet Rm                              | 8        | SF       | 6      | 6-10 years  |                        |
|                | Doors - Wood Doors inclu hw     | 1st - 115 Staff Toilet Rm                              | 1        | EA       | 6      | 6-10 years  |                        |
|                | Floor - Tile                    | 1st - 115 Staff Toilet Rm                              | 155      | SF       | 6      | 6-10 years  |                        |
|                | Floor - Tile Ceramic/ Porcelain | 1st - 115 Staff Toilet Rm                              | 15       | SF       | 6      | 6-10 years  |                        |
|                | Lavatory                        | 1st - 115 Staff Toilet Rm                              | 1        | EA       | 6      | 6-10 years  |                        |
|                | Lighting - Pendent/Surface      | 1st - 115 Staff Toilet Rm                              | 4        | EA       | 6      | 6-10 years  |                        |
|                | Partitions                      | 1st - 115 Staff Toilet Rm                              | 1        | EA       | 7      | 6-10 years  |                        |
|                | Walls - Plaster/Drywall         | 1st - 115 Staff Toilet Rm                              | 608      | SF       | 6      | 6-10 years  |                        |
|                | Water Closet                    | 1st - 115 Staff Toilet Rm                              | 1        | EA       | 6      | 6-10 years  |                        |
|                | Accessories                     | 1st - 113 Stall Follet Kill<br>1st - 128 Teachers Bath | 42       | SF       | 7      | 6-10 years  |                        |
|                | Ceiling - Plaster/Drywall       | 1st - 126 Teachers Bath                                | 42       | SF       | 6      | 6-10 years  |                        |
|                | Doors - Wood Doors inclu hw     | 1st - 128 Teachers Bath                                | 1        | EA       | 6      | 6-10 years  |                        |
|                | Floor - Tile                    | 1st - 128 Teachers Bath                                | 42       | SF       | 6      | 6-10 years  |                        |
|                |                                 | 1st - 128 Teachers Bath                                | 42       | EA       | 7      | ,           |                        |
|                | Lavatory                        |  |          |          |        | 6-10 years  |                        |
|                | Lighting - Pendent/Surface      | 1st - 128 Teachers Bath                                | 1        | EA       | 7      | 6-10 years  |                        |
|                | Walls - Concrete Block          | 1st - 128 Teachers Bath                                | 82       | SF       | 6      | 10+ years   |                        |
|                | Walls - Plaster/Drywall         | 1st - 128 Teachers Bath                                | 51       | SF       | 6      | 6-10 years  |                        |
|                | Walls - Structural Glazed Tile  | 1st - 128 Teachers Bath                                | 132      | SF       | 6      | 6-10 years  |                        |

Campus Name: Pulaski Page : 10 of 41 Assessment Date: 07/19/2021



| Catego | ory : Room                        |                                      | В        | uilding  | : Main |                          |                            |
|--------|-----------------------------------|--------------------------------------|----------|----------|--------|--------------------------|----------------------------|
|        |                                   |                                      |          |          |        | Recommend                |                            |
| Group  | Item - Type                       | Location                             | Quantity | UOM      | Rank   | Replacement              | Comments                   |
|        | Water Closet                      | 1st - 128 Teachers Bath              | 1        | EΑ       | 6      | 6-10 years               |                            |
|        | Accessories                       | 1st - Boys by elevator               | 268      | SF       | 7      | 6-10 years               |                            |
|        | Ceiling - Plaster/Drywall         | 1st - Boys by elevator               | 268      | SF       | 6      | 6-10 years               |                            |
|        | Doors - Wood Doors inclu hw       | 1st - Boys by elevator               | 1        | EA       | 6      | 6-10 years               |                            |
|        | Floor - Tile Ceramic/ Porcelain   | 1st - Boys by elevator               | 268      | SF       | 6      | 6-10 years               |                            |
|        | Floor Drain                       | 1st - Boys by elevator               | 1        | EA       | 7      | 6-10 years               |                            |
|        | Hand Dryer                        | 1st - Boys by elevator               | 1        | EA       | 7      | 6-10 years               |                            |
|        | Lavatory                          | 1st - Boys by elevator               | 2        | EA       | 6      | 6-10 years               |                            |
|        | Lighting - Pendent/Surface        | 1st - Boys by elevator               | 5        | EA       | 6      | 6-10 years               |                            |
|        | Partitions                        | 1st - Boys by elevator               | 1        | EΑ       | 7      | 6-10 years               |                            |
|        | Urinals                           | 1st - Boys by elevator               | 4        | EA       | 6      | 6-10 years               |                            |
|        | Walls - Concrete Block            | 1st - Boys by elevator               | 10       | SF       | 6      | 6-10 years               |                            |
|        | Walls - Structural Glazed Tile    | 1st - Boys by elevator               | 658      | SF       | 6      | 6-10 years               |                            |
|        | Walls - Vinyl Coated Gypsum Panel | 1st - Boys by elevator               | 10       | SF       | 6      | 6-10 years               |                            |
|        | Water Closet                      | 1st - Boys by elevator               | 2        | EΑ       | 6      | 6-10 years               |                            |
|        | Accessories                       | 1st - Girls                          | 366      | SF       | 7      | 6-10 years               |                            |
|        | Ceiling - Plaster/Drywall         | 1st - Girls                          | 636      | SF       | 6      | 6-10 years               |                            |
|        | Doors - Transom Window            | 1st - Girls                          | 32       | SF       | 6      | 6-10 years               |                            |
|        | Floor - Tile Ceramic/ Porcelain   | 1st - Girls                          | 366      | SF       | 6      | 6-10 years               |                            |
|        | Floor Drain                       | 1st - Girls                          | 1        | EA       | 7      | 6-10 years               |                            |
|        | Hand Dryer                        | 1st - Girls                          | 1        | EA       | 7      | 6-10 years               |                            |
|        | Lavatory                          | 1st - Girls                          | 2        | EA       | 6      | 6-10 years               |                            |
|        | Lighting - Pendent/Surface        | 1st - Girls                          | 9        | EA       | 6      | 6-10 years               |                            |
|        | Partitions                        | 1st - Girls                          | 8        | EA       | 7      | 6-10 years               |                            |
|        | Walls - Structural Glazed Tile    | 1st - Girls<br>1st - Girls           | 796      | SF       | 6      | 6-10 years               |                            |
|        | Water Closet                      | 1st - Girls                          | 9        | EA       | 6      | <u>-</u>                 |                            |
|        | Accessories                       | 1st - Gills<br>1st - inside 105      | 35       | SF       | 7      | 6-10 years<br>6-10 years |                            |
|        | Ceiling - Plaster/Drywall         | 1st - inside 105                     | 35       | SF       | 6      |                          |                            |
|        | Doors - Wood Doors inclu hw       | 1st - inside 105                     | 1        | EA       |        | 6-10 years               |                            |
|        | Floor - Tile                      |                                      | 35       | SF       | 6      | 6-10 years               |                            |
|        |                                   | 1st - inside 105<br>1st - inside 105 | 35<br>1  | Sr<br>EA | 6<br>7 | 6-10 years               |                            |
|        | Lighting - Pendent/Surface        |                                      | 234      | SF       |        | 6-10 years               |                            |
|        | Walls - Plaster/Drywall           | 1st - inside 105                     |          | EA       | 6      | 6-10 years               |                            |
|        | Water Closet                      | 1st - inside 105                     | 1        |          | 6      | 6-10 years               |                            |
|        | Accessories                       | 1st - inside 108                     | 25       | SF       | 7      | 6-10 years               |                            |
|        | Ceiling - Plaster/Drywall         | 1st - inside 108                     | 25       | SF       | 6      | 6-10 years               |                            |
|        | Doors - Wood Doors inclu hw       | 1st - inside 108                     | 1        | EA       | 6      | 6-10 years               |                            |
|        | Floor - Tile Ceramic/ Porcelain   | 1st - inside 108                     | 25       | SF       | 6      | 6-10 years               |                            |
|        | Lighting - Pendent/Surface        | 1st - inside 108                     | 1        | EA       | 7      | 6-10 years               |                            |
|        | Walls - Plaster/Drywall           | 1st - inside 108                     | 206      | SF       | 6      | 6-10 years               |                            |
|        | Water Closet                      | 1st - inside 108                     | 1        | EA       | 6      | 6-10 years               |                            |
|        | Accessories                       | 1st - inside 110                     | 35       | SF       | 7      | 6-10 years               |                            |
|        | Ceiling - Lay-in                  | 1st - inside 110                     | 35       | SF       | 6      | 6-10 years               |                            |
|        | Doors - Wood Doors inclu hw       | 1st - inside 110                     | 1        | EA       | 6      | 6-10 years               | _                          |
|        | Floor - Tile Ceramic/ Porcelain   | 1st - inside 110                     | 35       | SF       | 6      | 6-10 years               | Room converted to storage. |
|        |                                   |                                      |          |          |        |                          |                            |

Campus Name: Pulaski Page : 11 of 41 Assessment Date: 07/19/2021



| Category : Room |                                 |                               | Building : Main |     |      |             |                            |  |  |  |
|-----------------|---------------------------------|-------------------------------|-----------------|-----|------|-------------|----------------------------|--|--|--|
|                 |                                 |                               |                 | _   |      | Recommend   |                            |  |  |  |
| Group           | Item - Type                     | Location                      | Quantity        | UOM | Rank | Replacement | Comments                   |  |  |  |
|                 |                                 |                               |                 |     |      |             | Bathroom no longer in use. |  |  |  |
|                 | Lighting - Lay-in               | 1st - inside 110              | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Walls - Plaster/Drywall         | 1st - inside 110              | 214             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Walls - Tile Ceramic/ Porcelain | 1st - inside 110              | 28              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Water Closet                    | 1st - inside 110              | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Accessories                     | 1st - inside Principle Office | 23              | SF  | 7    | 6-10 years  |                            |  |  |  |
|                 | Ceiling - Plaster/Drywall       | 1st - inside Principle Office | 23              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Doors - Wood Doors inclu hw     | 1st - inside Principle Office | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Floor - Tile Ceramic/ Porcelain | 1st - inside Principle Office | 23              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lavatory                        | 1st - inside Principle Office | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lighting - Pendent/Surface      | 1st - inside Principle Office | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Walls - Plaster/Drywall         | 1st - inside Principle Office | 187             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Walls - Plaster/Drywall         | 1st - inside Principle Office | 10              | SF  | 5    | 1-2 years   | Damaged                    |  |  |  |
|                 | Water Closet                    | 1st - inside Principle Office | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Accessories                     | 2nd Floor                     | 415             | SF  | 7    | 6-10 years  |                            |  |  |  |
|                 | Ceiling - Plaster/Drywall       | 2nd Floor                     | 415             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Doors - Wood Doors inclu hw     | 2nd Floor                     | 2               | EA  | 6    | 10+ years   |                            |  |  |  |
|                 | Floor - Tile Ceramic/ Porcelain | 2nd Floor                     | 415             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Floor Drain                     | 2nd Floor                     | 2               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Hand Dryer                      | 2nd Floor                     | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Lavatory                        | 2nd Floor                     | 2               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lighting - Pendent/Surface      | 2nd Floor                     | 9               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Partitions                      | 2nd Floor                     | 9               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Walls - Structural Glazed Tile  | 2nd Floor                     | 876             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Water Closet                    | 2nd Floor                     | 9               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Accessories                     | 2nd Floor                     | 45              | SF  | 7    | 6-10 years  |                            |  |  |  |
|                 | Ceiling - Plaster/Drywall       | 2nd Floor                     | 45              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Doors - Wood Doors inclu hw     | 2nd Floor                     | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Floor - Tile                    | 2nd Floor                     | 45              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lavatory                        | 2nd Floor                     | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lighting - Pendent/Surface      | 2nd Floor                     | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Walls - Concrete Block          | 2nd Floor                     | 63              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Walls - Structural Glazed Tile  | 2nd Floor                     | 75              | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Water Closet                    | 2nd Floor                     | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Accessories                     | 2nd Floor                     | 248             | SF  | 7    | 6-10 years  |                            |  |  |  |
|                 | Ceiling - Plaster/Drywall       | 2nd Floor                     | 248             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Doors - Wood Doors inclu hw     | 2nd Floor                     | 1               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 | Floor - Tile Ceramic/ Porcelain | 2nd Floor                     | 248             | SF  | 6    | 6-10 years  |                            |  |  |  |
|                 | Floor Drain                     | 2nd Floor                     | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Hand Dryer                      | 2nd Floor                     | 1               | EA  | 7    | 2-5 years   |                            |  |  |  |
|                 | Lavatory                        | 2nd Floor                     | 2               | EΑ  | 6    | 6-10 years  |                            |  |  |  |
|                 | Lighting - Lay-in               | 2nd Floor                     | 1               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Partitions                      | 2nd Floor                     | 2               | EA  | 7    | 6-10 years  |                            |  |  |  |
|                 | Urinals                         | 2nd Floor                     | 4               | EA  | 6    | 6-10 years  |                            |  |  |  |
|                 |                                 |                               |                 |     |      |             |                            |  |  |  |

Campus Name: Pulaski Page : 12 of 41 Assessment Date: 07/19/2021



| Category : Room |                                   |                            | Building : Main |     |      |             |                           |  |  |  |
|-----------------|-----------------------------------|----------------------------|-----------------|-----|------|-------------|---------------------------|--|--|--|
| _               |                                   |                            |                 | _   |      | Recommend   |                           |  |  |  |
| Group           | Item - Type                       | Location                   | Quantity        | UOM | Rank | Replacement | Comments                  |  |  |  |
|                 | Walls - Concrete Block            | 2nd Floor                  | 46              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Walls - Vinyl Coated Gypsum Panel | 2nd Floor                  | 66              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Water Closet                      | 2nd Floor                  | 2               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Accessories                       | 300                        | 100             | SF  | 7    | 6-10 years  |                           |  |  |  |
|                 | Ceiling - Plaster/Drywall         | 300                        | 250             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Doors - Wood Doors inclu hw       | 300                        | 4               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor - Tile Ceramic/ Porcelain   | 300                        | 250             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor Drain                       | 300                        | 1               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Hand Dryer                        | 300                        | 1               | EΑ  | 7    | 6-10 years  |                           |  |  |  |
|                 | Lavatory                          | 300                        | 2               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Lighting - Pendent/Surface        | 300                        | 5               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Partitions                        | 300                        | 2               | EΑ  | 7    | 6-10 years  |                           |  |  |  |
|                 | Urinals                           | 300                        | 4               | EA  | 7    | 10+ years   |                           |  |  |  |
|                 | Walls - Concrete Block            | 300                        | 46              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Walls - Structural Glazed Tile    | 300                        | 503             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Walls - Vinyl Coated Gypsum Panel | 300                        | 66              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Water Closet                      | 300                        | 2               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Accessories                       | 3rd Floor                  | 415             | SF  | 7    | 6-10 years  |                           |  |  |  |
|                 | Ceiling - Plaster/Drywall         | 3rd Floor                  | 415             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Doors - Wood Doors inclu hw       | 3rd Floor                  | 2               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor - Tile Ceramic/ Porcelain   | 3rd Floor                  | 415             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor Drain                       | 3rd Floor                  | 2               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Hand Dryer                        | 3rd Floor                  | 1               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Lavatory                          | 3rd Floor                  | 2               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Lighting - Pendent/Surface        | 3rd Floor                  | 9               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Partitions                        | 3rd Floor                  | 2               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Partitions                        | 3rd Floor                  | 7               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Walls - Structural Glazed Tile    | 3rd Floor                  | 876             | SF  | 6    | 6-10 years  | Bathroom under renovation |  |  |  |
|                 | Water Closet                      | 3rd Floor                  | 9               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Accessories                       | 3rd Floor Teacher's Lounge | 45              | SF  | 7    | 6-10 years  |                           |  |  |  |
|                 | Ceiling - Plaster/Drywall         | 3rd Floor Teacher's Lounge | 45              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Doors - Wood Doors inclu hw       | 3rd Floor Teacher's Lounge | 1               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor - Tile                      | 3rd Floor Teacher's Lounge | 45              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Lavatory                          | 3rd Floor Teacher's Lounge | 1               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Lighting - Pendent/Surface        | 3rd Floor Teacher's Lounge | 1               | EA  | 7    | 6-10 years  |                           |  |  |  |
|                 | Walls - Concrete Block            | 3rd Floor Teacher's Lounge | 63              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Walls - Plaster/Drywall           | 3rd Floor Teacher's Lounge | 42              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Walls - Structural Glazed Tile    | 3rd Floor Teacher's Lounge | 75              | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Water Closet                      | 3rd Floor Teacher's Lounge | 1               | EA  | 6    | 6-10 years  |                           |  |  |  |
|                 | Accessories                       | Basement - Helps toilet    | 318             | SF  | 7    | 6-10 years  |                           |  |  |  |
|                 | Ceiling - Exposed                 | Basement - Helps toilet    | 318             | SF  | 6    | 6-10 years  |                           |  |  |  |
|                 | Doors - Wood Doors inclu hw       | Basement - Helps toilet    | 1               | ĒΑ  | 6    | 6-10 years  |                           |  |  |  |
|                 | Floor - Concrete Epoxy/ Painted   | Basement - Helps toilet    | 318             | SF  | 5    | 6-10 years  |                           |  |  |  |
|                 | Lavatory                          | Basement - Helps toilet    | 1               | ĒΑ  | 6    | 6-10 years  |                           |  |  |  |
|                 | ,                                 | · r                        |                 |     | -    | <b>,</b>    |                           |  |  |  |

Campus Name: Pulaski Page : 13 of 41 Assessment Date: 07/19/2021



| Catego    | ry : Room                                  |                            | Building : Main |          |        |                          |            |  |  |
|-----------|--|----------------------------|-----------------|----------|--------|--------------------------|------------|--|--|
|           |  |                            |                 |          |        | Recommend                |            |  |  |
| Group     | Item - Type                                | Location                   | Quantity        | UOM      | Rank   | Replacement              | Comments   |  |  |
|           | Lighting - Pendent/Surface                 | Basement - Helps toilet    | 2               | EA       | 7      | 6-10 years               |            |  |  |
|           | Partitions                                 | Basement - Helps toilet    | 1               | EA       | 7      | 6-10 years               |            |  |  |
|           | Walls - Concrete Block                     | Basement - Helps toilet    | 447             | SF       | 6      | 6-10 years               |            |  |  |
|           | Water Closet                               | Basement - Helps toilet    | 1               | EA       | 6      | 6-10 years               |            |  |  |
|           | Accessories                                | Basement Engineer's Office | 26              | SF       | 7      | 6-10 years               |            |  |  |
|           | Ceiling - Plaster/Drywall                  | Basement Engineer's Office | 26              | SF       | 6      | 6-10 years               |            |  |  |
|           | Doors - Wood Doors inclu hw                | Basement Engineer's Office | 1               | EA       | 6      | 6-10 years               |            |  |  |
|           | Floor - Tile                               | Basement Engineer's Office | 26              | SF       | 6      | 6-10 years               |            |  |  |
|           | Lavatory                                   | Basement Engineer's Office | 1               | EA       | 6      | 6-10 years               |            |  |  |
|           | Lighting - Pendent/Surface                 | Basement Engineer's Office | 1               | EA       | 7      | 6-10 years               |            |  |  |
|           | Walls - Plaster/Drywall                    | Basement Engineer's Office | 181             | SF       | 6      | 10+ years                |            |  |  |
|           | Walls - Plaster/Drywall                    | Basement Engineer's Office | 5               | SF       | 4      | 0-1 year                 | Damaged    |  |  |
|           | Water Closet                               | Basement Engineer's Office | 1               | EA       | 6      | 6-10 years               | 3          |  |  |
| Catego    | ry : Classroom                             |                            | R               | uilding  | · Main |                          |            |  |  |
| Jaiogo    |  |                            |                 | ananig   | . man  | Recommend                |            |  |  |
| Group     | Item - Type                                | Location                   | Quantity        | UOM      | Rank   | Replacement              | Comments   |  |  |
|           | m #105 (Kindergarten)                      | Location                   | Quantity        | COM      | IXAIIX | Replacement              | Comments   |  |  |
| _Cla55100 | AC Units                                   | 1st Floor                  | 2               | ГΛ       | 7      | 6-10 years               |            |  |  |
|           | Casework                                   | 1st Floor                  | 10              | EA<br>LF | 7<br>6 |                          |            |  |  |
|           |  | 1st Floor                  | 898             | SF       | 7      | 6-10 years<br>6-10 years |            |  |  |
|           | Ceiling - Lay-in<br>Doors - Transom Window | 1st Floor                  |                 | SF<br>SF | 7      | 6-10 years               |            |  |  |
|           | Doors - Wood Doors inclu hw                |                            | 16<br>2         | SF<br>EA | 6      |                          |            |  |  |
|           | Floor - Tile                               | 1st Floor                  | 898             | SF       | -      | 6-10 years               |            |  |  |
|           |  | 1st Floor                  |                 |          | 6      | 6-10 years               |            |  |  |
|           | Lighting - Lay-in                          | 1st Floor                  | 12              | EA       | 6      | 6-10 years               |            |  |  |
|           | Marker Board                               | 1st Floor                  | 28              | LF       | 7      | 6-10 years               |            |  |  |
|           | Storage/ Closet                            | 1st Floor                  | 103             | SF<br>SF | 7      | 6-10 years               |            |  |  |
|           | Walls - Plaster/Drywall                    | 1st Floor                  | 915             |          | 6      | 6-10 years               | One obie o |  |  |
|           | Walls - Plaster/Drywall                    | 1st Floor                  | 85              | SF       | 5      | 1-2 years                | Cracking   |  |  |
|           | Work Sink                                  | 1st Floor                  | 1               | EA       | 7      | 6-10 years               |            |  |  |
| Classroo  | m #108 (Kindergarten)                      |                            |                 |          |        |                          |            |  |  |
|           | AC Units                                   | 1st Floor                  | 2               | EA       | 7      | 6-10 years               |            |  |  |
|           | Casework                                   | 1st Floor                  | 9               | LF       | 6      | 6-10 years               |            |  |  |
|           | Ceiling - Lay-in                           | 1st Floor                  | 809             | SF       | 6      | 6-10 years               |            |  |  |
|           | Chalk Board                                | 1st Floor                  | 75              | LF       | 4      | 2-5 years                |            |  |  |
|           | Doors - Transom Window                     | 1st Floor                  | 8               | SF       | 6      | 6-10 years               |            |  |  |
|           | Doors - Wood Doors inclu hw                | 1st Floor                  | 1               | EA       | 6      | 6-10 years               |            |  |  |
|           | Floor - Tile                               | 1st Floor                  | 809             | SF       | 6      | 6-10 years               |            |  |  |
|           | Lighting - Lay-in                          | 1st Floor                  | 12              | EA       | 7      | 6-10 years               |            |  |  |
|           | Storage/ Closet                            | 1st Floor                  | 115             | SF       | 7      | 6-10 years               |            |  |  |
|           | Walls - Plaster/Drywall                    | 1st Floor                  | 858             | SF       | 6      | 6-10 years               |            |  |  |
|           | Walls - Plaster/Drywall                    | 1st Floor                  | 150             | SF       | 4      | 0-1 year                 |            |  |  |
|           | Work Sink                                  | 1st Floor                  | 1               | ĒΑ       | 7      | 6-10 years               |            |  |  |
|           |  |                            |                 |          |        |                          |            |  |  |

Campus Name: Pulaski Page : 14 of 41 Assessment Date: 07/19/2021



| Catego   | ry : Classroom              |           | В        | uilding | : Main |             |          |
|----------|-----------------------------|-----------|----------|---------|--------|-------------|----------|
|          |                             |           |          |         |        | Recommend   |          |
| Group    | Item - Type                 | Location  | Quantity | UOM     | Rank   | Replacement | Comments |
|          |                             |           |          |         |        |             |          |
| Classroc | m #110 (Regular Classroom)  |           |          |         |        |             |          |
|          | AC Units                    | 1st Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 1st Floor | 8        | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st Floor | 898      | SF      | 6      | 6-10 years  |          |
|          | Doors - Transom Window      | 1st Floor | 16       | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 1st Floor | 2        | EA      | 6      | 6-10 years  |          |
|          | Floor - Tile                | 1st Floor | 898      | SF      | 6      | 6-10 years  |          |
|          | Lighting - Lay-in           | 1st Floor | 15       | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 1st Floor | 13       | LF      | 7      | 6-10 years  |          |
|          | Storage/ Closet             | 1st Floor | 103      | SF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 1st Floor | 1,059    | SF      | 7      | 6-10 years  |          |
|          | Work Sink                   | 1st Floor | 2        | ĒΑ      | 7      | 6-10 years  |          |
|          |                             |           | _        |         | •      | 0 .0 ,00.0  |          |
| lassroc  | om #114 (Music Room)        |           |          |         |        |             |          |
|          | AC Units                    | 1st Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 1st Floor | 3        | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 1st Floor | 1,042    | SF      | 6      | 6-10 years  |          |
|          | Doors - Transom Window      | 1st Floor | 8        | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 1st Floor | 1        | ĒΑ      | 6      | 6-10 years  |          |
|          | Floor - Tile                | 1st Floor | 1,042    | SF      | 6      | 6-10 years  |          |
|          | Lighting - Lay-in           | 1st Floor | 18       | ĒΑ      | 7      | 6-10 years  |          |
|          | Marker Board                | 1st Floor | 16       | LF      | 7      | 6-10 years  |          |
|          | Storage/ Closet             | 1st Floor | 11       | SF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 1st Floor | 1,168    | SF      | 7      | 6-10 years  |          |
|          | vvalio i lastel/Diywali     | 13(1100)  | 1,100    | O1      | •      | o ro years  |          |
| lassroc  | m #200 (Regular Classroom)  |           |          |         |        |             |          |
|          | AC Units                    | 2nd Floor | 1        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 2nd Floor | 10       | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor | 690      | SF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor | 20       | SF      | 4      | 1-2 years   | Damaged  |
|          | Doors - Transom Window      | 2nd Floor | 8        | SF      | 7      | 6-10 years  | •        |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA      | 7      | 6-10 years  |          |
|          | Floor - Wood                | 2nd Floor | 5        | SF      | 5      | 1-2 years   | Damaged  |
|          | Floor - Wood                | 2nd Floor | 695      | SF      | 5      | 6-10 years  | ŭ        |
|          | Lighting - Lay-in           | 2nd Floor | 12       | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 2nd Floor | 20       | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 958      | SF      | 6      | 6-10 years  |          |
| Naa      | #202 (Decules Ol)           |           |          |         |        |             |          |
| Jassroc  | m #203 (Regular Classroom)  | 2nd Flore | ^        | Г^      | 7      | 6.10        |          |
|          | AC Units                    | 2nd Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 2nd Floor | 10       | LF      | 7      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor | 700      | SF      | 6      | 6-10 years  |          |



| Catego   | ry : Classroom              |                        | В         | uilding | : Main |             |          |
|----------|-----------------------------|------------------------|-----------|---------|--------|-------------|----------|
|          |                             |                        |           |         |        | Recommend   |          |
| Group    | Item - Type                 | Location               | Quantity  | UOM     | Rank   | Replacement | Comments |
|          | Doors - Transom Window      | 2nd Floor              | 8         | SF      | 7      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor              | 1         | EA      | 7      | 6-10 years  |          |
|          | Floor - Wood                | 2nd Floor              | 700       | SF      | 6      | 6-10 years  |          |
|          | Lighting - Pendent/Surface  | 2nd Floor              | 12        | EΑ      | 7      | 6-10 years  |          |
|          | Marker Board                | 2nd Floor              | 20        | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 2nd Floor              | 967       | SF      | 6      | 6-10 years  |          |
| Classroo | m #204 (Regular Classroom)  |                        |           |         |        |             |          |
|          | AC Units                    | 2nd Floor              | 2         | EA      | 7      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor              | 650       | SF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor              | 50        | SF      | 5      | 1-2 years   | Damaged  |
|          | Chalk Board                 | 2nd Floor              | 100       | LF      | 4      | 2-5 years   | 2 aage a |
|          | Doors - Transom Window      | 2nd Floor              | 8         | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor              | 1         | EA      | 6      | 6-10 years  |          |
|          | Floor - Wood                | 2nd Floor              | 700       | SF      | 5      | 1-2 years   | Worn     |
|          | Lighting - Lay-in           | 2nd Floor              | 12        | EA      | 7      | 6-10 years  | WOIII    |
|          | Marker Board                | 2nd Floor              | 20        | LF      | 6      |             |          |
|          | Walls - Plaster/Drywall     |                        | 20<br>958 | SF      | 6      | 6-10 years  |          |
|          | walls - Flastel/Drywall     | 2nd Floor              | 930       | SF      | O      | 6-10 years  |          |
| Classroo | m #205 (Computer Lab)       |                        |           |         |        |             |          |
|          | AC Units                    | 2nd Floor              | 4         | EA      | 7      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor              | 676       | SF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor              | 24        | SF      | 4      | 0-1 year    | Damaged  |
|          | Doors - Transom Window      | 2nd Floor              | 8         | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor              | 1         | EA      | 6      | 6-10 years  |          |
|          | Floor - Wood                | 2nd Floor              | 700       | SF      | 6      | 6-10 years  |          |
|          | Lighting - Lay-in           | 2nd Floor              | 12        | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 2nd Floor              | 45        | LF      | 6      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 2nd Floor              | 958       | SF      | 6      | 6-10 years  |          |
|          | Wireless System             | 2nd Floor              | 1         | EA      | 7      | 6-10 years  |          |
| Classroo | m #206 (Special Education)  |                        |           |         |        |             |          |
|          | AC Units                    | 2nd Floor              | 2         | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 2nd Floor              | 10        | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 2nd Floor              | 700       | SF      | 6      | 6-10 years  |          |
|          | Doors - Transom Window      | 2nd Floor              | 8         | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor              | 1         | EA      | 6      | 6-10 years  |          |
|          | Floor - Wood                | 2nd Floor              | 700       | SF      | 5      | 2-5 years   |          |
|          | Lighting - Pendent/Surface  | 2nd Floor              | 12        | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 2nd Floor              | 20        | LF      | 6      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 2nd Floor<br>2nd Floor | 967       | SF      | 6      | •           |          |
|          | vvalis - Flastei/DryWall    | 211U F1001             | 907       | SF      | O      | 6-10 years  |          |
| laaaraa  | m #207 (Art Room)           |                        |           |         |        |             |          |

Campus Name: Pulaski Page : 16 of 41 Assessment Date: 07/19/2021



| Catego   | Category : Classroom        |           | В        | uilding  | : Main |             |               |
|----------|-----------------------------|-----------|----------|----------|--------|-------------|---------------|
|          |                             |           |          |          |        | Recommend   |               |
| Group    | Item - Type                 | Location  | Quantity | UOM      | Rank   | Replacement | Comments      |
|          | AC Units                    | 2nd Floor | 2        | EA       | 7      | 6-10 years  |               |
|          | Casework                    | 2nd Floor | 28       | LF       | 6      | 6-10 years  |               |
|          | Ceiling - Lay-in            | 2nd Floor | 700      | SF       | 6      | 6-10 years  |               |
|          | Chalk Board                 | 2nd Floor | 25       | LF       | 4      | 2-5 years   | Painted black |
|          | Doors - Transom Window      | 2nd Floor | 8        | SF       | 7      | 6-10 years  |               |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6      | 6-10 years  |               |
|          | Floor - Wood                | 2nd Floor | 700      | SF       | 6      | 6-10 years  |               |
|          | Lighting - Lay-in           | 2nd Floor | 12       | EΑ       | 7      | 6-10 years  |               |
|          | Marker Board                | 2nd Floor | 6        | LF       | 6      | 6-10 years  |               |
|          | Walls - Plaster/Drywall     | 2nd Floor | 958      | SF       | 6      | 6-10 years  |               |
|          | Work Sink                   | 2nd Floor | 1        | EA       | 7      | 6-10 years  |               |
| Classroo | om #208 (Regular Classroom) |           |          |          |        |             |               |
|          | AC Units                    | 2nd Floor | 2        | EA       | 7      | 6-10 years  |               |
|          | Casework                    | 2nd Floor | 10       | LF       | 6      | 2-5 years   |               |
|          | Ceiling - Lay-in            | 2nd Floor | 690      | SF       | 6      | 6-10 years  |               |
|          | Ceiling - Lay-in            | 2nd Floor | 10       | SF       | 5      | 1-2 years   | Damaged       |
|          | Chalk Board                 | 2nd Floor | 25       | LF       | 4      | 2-5 years   | Damageu       |
|          | Doors - Transom Window      | 2nd Floor | 8        | SF       | 6      |             |               |
|          |                             |           | -        | Sr<br>EA | _      | 6-10 years  |               |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        |          | 6      | 6-10 years  | Halaa         |
|          | Floor - Wood                | 2nd Floor | 100      | SF       | 5      | 1-2 years   | Holes         |
|          | Lighting - Lay-in           | 2nd Floor | 12       | EA       | 7      | 6-10 years  |               |
|          | Marker Board                | 2nd Floor | 20       | LF       | 6      | 6-10 years  |               |
|          | Walls - Plaster/Drywall     | 2nd Floor | 883      | SF       | 6      | 6-10 years  |               |
|          | Walls - Plaster/Drywall     | 2nd Floor | 75       | SF       | 6      | 6-10 years  |               |
| Classroo | om #209 (Regular Classroom) |           |          |          |        |             |               |
|          | AC Units                    | 2nd Floor | 2        | EA       | 7      | 6-10 years  |               |
|          | Casework                    | 2nd Floor | 10       | LF       | 6      | 6-10 years  |               |
|          | Ceiling - Lay-in            | 2nd Floor | 692      | SF       | 6      | 6-10 years  |               |
|          | Ceiling - Lay-in            | 2nd Floor | 8        | SF       | 5      | 1-2 years   | Damaged       |
|          | Chalk Board                 | 2nd Floor | 25       | LF       | 4      | 2-5 years   |               |
|          | Doors - Transom Window      | 2nd Floor | 8        | SF       | 6      | 6-10 years  |               |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6      | 6-10 years  |               |
|          | Floor - Wood                | 2nd Floor | 700      | SF       | 6      | 6-10 years  |               |
|          | Lighting - Lay-in           | 2nd Floor | 12       | EA       | 7      | 6-10 years  |               |
|          | Marker Board                | 2nd Floor | 20       | LF       | 7      | 6-10 years  |               |
|          | Walls - Plaster/Drywall     | 2nd Floor | 958      | SF       | 6      | 6-10 years  |               |
| Classroo | om #211 (Regular Classroom) |           |          |          |        |             |               |
|          | AC Units                    | 2nd Floor | 2        | EA       | 7      | 6-10 years  |               |
|          | Casework                    | 2nd Floor | 20       | LF       | 6      | 6-10 years  |               |
|          | Ceiling - Lay-in            | 2nd Floor | 676      | SF       | 6      | 6-10 years  |               |
|          |                             |           | 010      | ٥.       | ·      | 5 .5 jours  |               |

Campus Name: Pulaski Page : 17 of 41 Assessment Date: 07/19/2021



| Category : Classroom |                             | В         | uilding  | : Main   |      |             |          |
|----------------------|-----------------------------|-----------|----------|----------|------|-------------|----------|
| _                    |                             |           |          | _        |      | Recommend   |          |
| Group                | Item - Type                 | Location  | Quantity | UOM      | Rank | Replacement | Comments |
|                      | Ceiling - Lay-in            | 2nd Floor | 24       | SF       | 5    | 1-2 years   | Damaged  |
|                      | Chalk Board                 | 2nd Floor | 25       | LF       | 4    | 2-5 years   | -        |
|                      | Doors - Transom Window      | 2nd Floor | 8        | SF       | 6    | 6-10 years  |          |
|                      | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6    | 6-10 years  |          |
|                      | Floor - Wood                | 2nd Floor | 675      | SF       | 6    | 6-10 years  |          |
|                      | Floor - Wood                | 2nd Floor | 25       | SF       | 6    | 6-10 years  |          |
|                      | Lighting - Lay-in           | 2nd Floor | 12       | ĒΑ       | 7    | 6-10 years  |          |
|                      | Marker Board                | 2nd Floor | 20       | LF       | 7    | 6-10 years  |          |
|                      | Walls - Plaster/Drywall     | 2nd Floor | 958      | SF       | 6    | 6-10 years  |          |
| Classroc             | om #213 (Regular Classroom) |           |          |          |      |             |          |
|                      | AC Units                    | 2nd Floor | 2        | EA       | 7    | 6-10 years  |          |
|                      | Casework                    | 2nd Floor | 10       | LF       | 6    | 6-10 years  |          |
|                      | Ceiling - Lay-in            | 2nd Floor | 700      | SF       | 6    | 6-10 years  |          |
|                      | Ceiling - Lay-in            | 2nd Floor | 36       | SF       | 4    | 1-2 years   | Damaged  |
|                      | Doors - Transom Window      | 2nd Floor | 8        | SF       | 6    | 6-10 years  | zaagea   |
|                      | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6    | 6-10 years  |          |
|                      | Floor - Wood                | 2nd Floor | 700      | SF       | 6    | 6-10 years  |          |
|                      | Lighting - Lay-in           | 2nd Floor | 12       | EA       | 7    | 6-10 years  |          |
|                      | Marker Board                | 2nd Floor | 20       | LF       | 7    | 6-10 years  |          |
|                      | Walls - Plaster/Drywall     | 2nd Floor | 868      | SF       | 6    | 6-10 years  |          |
|                      | Walls - Plaster/Drywall     | 2nd Floor | 100      | SF       | 6    | 6-10 years  |          |
| Classroo             | om #300 (Regular Classroom) |           |          |          |      |             |          |
|                      | AC Units                    | 3rd Floor | 2        | EA       | 7    | 6-10 years  |          |
|                      | Casework                    | 3rd Floor | 10       | LF       | 6    | 6-10 years  |          |
|                      | Ceiling - Lay-in            | 3rd Floor | 680      | SF       | 6    | 6-10 years  |          |
|                      | Ceiling - Lay-in            | 3rd Floor | 20       | SF       | 4    | 1-2 years   | Damaged  |
|                      | Chalk Board                 | 3rd Floor | 40       | LF       | 4    | 2-5 years   | Damagoa  |
|                      | Doors - Transom Window      | 3rd Floor | 8        | SF       | 6    | 6-10 years  |          |
|                      | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA       | 6    | 6-10 years  |          |
|                      | Floor - Wood                | 3rd Floor | 700      | SF       | 6    | 6-10 years  |          |
|                      | Lighting - Lay-in           | 3rd Floor | 12       | EA       | 7    | 6-10 years  |          |
|                      | Marker Board                | 3rd Floor | 20       | LF       | 7    | 6-10 years  |          |
|                      | Walls - Plaster/Drywall     | 3rd Floor | 971      | SF       | 6    | 6-10 years  |          |
| :lassror             | om #301 (Regular Classroom) |           |          |          |      |             |          |
|                      | AC Units                    | 3rd Floor | 2        | EA       | 7    | 6-10 years  |          |
|                      | Casework                    | 3rd Floor | 10       | LF       | 6    | 6-10 years  |          |
|                      | Casework Ceiling - Lay-in   | 3rd Floor | 700      | SF       | 6    | •           |          |
|                      | Doors - Transom Window      | 3rd Floor | 700<br>8 | SF<br>SF | 6    | 6-10 years  |          |
|                      | Doors - Wood Doors inclu hw | 3rd Floor |          |          |      | 6-10 years  |          |
|                      |                             |           | 1        | EA       | 6    | 6-10 years  |          |
|                      | Floor - Wood                | 3rd Floor | 700      | SF       | 6    | 2-5 years   |          |

Campus Name: Pulaski Page : 18 of 41 Assessment Date: 07/19/2021



| Catego   | ry : Classroom              |           | В        | uilding | : Main |             |          |
|----------|-----------------------------|-----------|----------|---------|--------|-------------|----------|
|          |                             |           |          |         |        | Recommend   |          |
| Group    | Item - Type                 | Location  | Quantity | UOM     | Rank   | Replacement | Comments |
|          | Lighting - Lay-in           | 3rd Floor | 12       | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 953      | SF      | 6      | 6-10 years  |          |
| Classroo | om #302 (Regular Classroom) |           |          |         |        |             |          |
|          | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 3rd Floor | 10       | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 3rd Floor | 700      | SF      | 6      | 6-10 years  |          |
|          | Chalk Board                 | 3rd Floor | 30       | LF      | 4      | 2-5 years   |          |
|          | Doors - Transom Window      | 3rd Floor | 8        | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA      | 6      | 6-10 years  |          |
|          | Floor - Wood                | 3rd Floor | 700      | SF      | 6      | 6-10 years  |          |
|          | Lighting - Lay-in           | 3rd Floor | 12       | ĒΑ      | 7      | 6-10 years  |          |
|          | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 20       | SF      | 6      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 933      | SF      | 6      | 6-10 years  |          |
| Classroo | om #303 (Science)           |           |          |         |        |             |          |
|          | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 3rd Floor | 10       | LF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 3rd Floor | 686      | SF      | 6      | 6-10 years  |          |
|          | Ceiling - Lay-in            | 3rd Floor | 24       | SF      | 5      | 1-2 years   |          |
|          | Chalk Board                 | 3rd Floor | 30       | ĹF      | 4      | 2-5 years   |          |
|          | Doors - Transom Window      | 3rd Floor | 8        | SF      | 7      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA      | 7      | 6-10 years  |          |
|          | Floor - Wood                | 3rd Floor | 710      | SF      | 6      | 6-10 years  |          |
|          | Lighting - Lay-in           | 3rd Floor | 12       | EA      | 7      | 6-10 years  |          |
|          | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 10       | SF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 957      | SF      | 6      | 6-10 years  |          |
| Classroo | om #304 (Regular Classroom) |           |          |         |        |             |          |
|          | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |          |
|          | Casework                    | 3rd Floor | 10       | LF      | 6      | 2-5 years   |          |
|          | Ceiling - Lay-in            | 3rd Floor | 700      | SF      | 6      | 6-10 years  |          |
|          | Chalk Board                 | 3rd Floor | 30       | ĹF      | 4      | 2-5 years   |          |
|          | Doors - Transom Window      | 3rd Floor | 4        | SF      | 6      | 6-10 years  |          |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | ĒΑ      | 6      | 6-10 years  |          |
|          | Floor - Wood                | 3rd Floor | 700      | SF      | 5      | 1-2 years   | Worn     |
|          | Lighting - Lay-in           | 3rd Floor | 12       | ĒΑ      | 6      | 6-10 years  |          |
|          | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |          |
|          | Walls - Plaster/Drywall     | 3rd Floor | 972      | SF      | 6      | 6-10 years  |          |

Campus Name: Pulaski Page : 19 of 41 Assessment Date: 07/19/2021



| Catego    | ry : Classroom              |           | В        | uilding | : Main |             | William Avenue, Gilleago, le 60047 |
|-----------|-----------------------------|-----------|----------|---------|--------|-------------|------------------------------------|
|           |                             |           |          |         |        | Recommend   |                                    |
| Group     | Item - Type                 | Location  | Quantity | UOM     | Rank   | Replacement | Comments                           |
| Classroo  | om #305 (Regular Classroom) |           |          |         |        |             |                                    |
|           | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |                                    |
|           | Casework                    | 3rd Floor | 10       | LF      | 6      | 6-10 years  |                                    |
|           | Ceiling - Lay-in            | 3rd Floor | 20       | SF      | 7      | 6-10 years  |                                    |
|           | Ceiling - Lay-in            | 3rd Floor | 660      | SF      | 6      | 6-10 years  |                                    |
|           | Doors - Transom Window      | 3rd Floor | 8        | SF      | 6      | 6-10 years  |                                    |
|           | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA      | 6      | 6-10 years  |                                    |
|           | Floor - Wood                | 3rd Floor | 700      | SF      | 6      | 6-10 years  |                                    |
|           | Lighting - Lay-in           | 3rd Floor | 12       | EA      | 7      | 6-10 years  |                                    |
|           | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |                                    |
|           | Walls - Plaster/Drywall     | 3rd Floor | 689      | SF      | 6      | 6-10 years  |                                    |
| _Classroo | om #306 (Regular Classroom) |           |          |         |        |             |                                    |
|           | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |                                    |
|           | Ceiling - Lay-in            | 3rd Floor | 700      | SF      | 7      | 6-10 years  |                                    |
|           | Chalk Board                 | 3rd Floor | 60       | LF      | 4      | 2-5 years   |                                    |
|           | Doors - Transom Window      | 3rd Floor | 6        | SF      | 6      | 6-10 years  |                                    |
|           | Floor - Wood                | 3rd Floor | 700      | SF      | 5      | 6-10 years  |                                    |
|           | Lighting - Lay-in           | 3rd Floor | 9        | ĒΑ      | 7      | 6-10 years  |                                    |
|           | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |                                    |
|           | Walls - Plaster/Drywall     | 3rd Floor | 972      | SF      | 7      | 6-10 years  |                                    |
| _Classroo | om #307 (Science)           |           |          |         |        |             |                                    |
|           | AC Units                    | 3rd Floor | 2        | EA      | 7      | 6-10 years  |                                    |
|           | Casework                    | 3rd Floor | 16       | LF      | 6      | 6-10 years  |                                    |
|           | Ceiling - Lay-in            | 3rd Floor | 700      | SF      | 6      | 6-10 years  |                                    |
|           | Chalk Board                 | 3rd Floor | 20       | LF      | 4      | 2-5 years   |                                    |
|           | Doors - Transom Window      | 3rd Floor | 8        | SF      | 6      | 6-10 years  |                                    |
|           | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA      | 6      | 6-10 years  |                                    |
|           | Eye Wash Station            | 3rd Floor | 1        | EA      | 6      | 6-10 years  |                                    |
|           | Floor - Wood                | 3rd Floor | 700      | SF      | 6      | 6-10 years  |                                    |
|           | Lighting - Lay-in           | 3rd Floor | 12       | EA      | 7      | 6-10 years  |                                    |
|           | Marker Board                | 3rd Floor | 20       | LF      | 7      | 6-10 years  |                                    |
|           | Walls - Plaster/Drywall     | 3rd Floor | 690      | SF      | 6      | 6-10 years  |                                    |
|           | Walls - Plaster/Drywall     | 3rd Floor | 10       | SF      | 6      | 6-10 years  |                                    |
|           | Work Sink                   | 3rd Floor | 1        | EA      | 7      | 6-10 years  |                                    |
| Classroo  | om #308 (Special Education) |           |          |         |        |             |                                    |
|           | AC Units                    | 3rd Floor | 1        | EA      | 7      | 6-10 years  |                                    |
|           | Casework                    | 3rd Floor | 8        | LF      | 6      | 6-10 years  |                                    |
|           | Ceiling - Lay-in            | 3rd Floor | 390      | SF      | 5      | 6-10 years  |                                    |
|           | Doors - Transom Window      | 3rd Floor | 8        | SF      | 5      | 1-2 years   |                                    |
|           | Doors - Wood Doors inclu hw | 3rd Floor | 1        | ĒΑ      | 6      | 6-10 years  |                                    |
|           |                             |           |          |         |        |             |                                    |



| Catego   | ry : Classroom              |           | В        | uilding   | : Main | <del></del> | 30 W Molecul Avende, officago, ie 00047 |
|----------|-----------------------------|-----------|----------|-----------|--------|-------------|---|
|          |                             |           |          |           |        | Recommend   |   |
| Group    | Item - Type                 | Location  | Quantity | UOM       | Rank   | Replacement | Comments                                |
|          | Floor - Wood                | 3rd Floor | 390      | SF        | 5      | 2-5 years   |   |
|          | Lighting - Lay-in           | 3rd Floor | 4        | EA        | 7      | 6-10 years  |   |
|          | Marker Board                | 3rd Floor | 16       | LF        | 7      | 6-10 years  |   |
|          | Walls - Plaster/Drywall     | 3rd Floor | 746      | SF        | 6      | 6-10 years  |   |
| Classroo | om #309 (Regular Classroom) |           |          |           |        |             |   |
|          | AC Units                    | 3rd Floor | 2        | EA        | 7      | 6-10 years  |   |
|          | Casework                    | 3rd Floor | 10       | LF        | 6      | 6-10 years  |   |
|          | Ceiling - Lay-in            | 3rd Floor | 686      | SF        | 6      | 6-10 years  |   |
|          | Ceiling - Lay-in            | 3rd Floor | 24       | SF        | 4      | 1-2 years   | Damaged                                 |
|          | Doors - Transom Window      | 3rd Floor | 8        | SF        | 6      | 6-10 years  | ŭ                                       |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA        | 6      | 6-10 years  |   |
|          | Floor - Wood                | 3rd Floor | 710      | SF        | 6      | 6-10 years  |   |
|          | Lighting - Lay-in           | 3rd Floor | 12       | EA        | 7      | 6-10 years  |   |
|          | Marker Board                | 3rd Floor | 20       | LF        | 7      | 6-10 years  |   |
|          | Walls - Plaster/Drywall     | 3rd Floor | 967      | SF        | 6      | 6-10 years  |   |
| Classroo | om #310 (Regular Classroom) |           |          |           |        |             |   |
|          | AC Units                    | 3rd Floor | 2        | EA        | 7      | 6-10 years  |   |
|          | Casework                    | 3rd Floor | 10       | LF        | 6      | 6-10 years  |   |
|          | Ceiling - Lay-in            | 3rd Floor | 710      | SF        | 5      | 1-2 years   |   |
|          | Chalk Board                 | 3rd Floor | 40       | ĹF        | 4      | 2-5 years   |   |
|          | Doors - Transom Window      | 3rd Floor | 8        | SF        | 6      | 6-10 years  |   |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EA        | 6      | 6-10 years  |   |
|          | Floor - Wood                | 3rd Floor | 710      | SF        | 5      | 2-5 years   |   |
|          | Lighting - Lay-in           | 3rd Floor | 12       | EA        | 7      | 6-10 vears  |   |
|          | Marker Board                | 3rd Floor | 16       | LF        | 7      | 6-10 years  |   |
|          | Walls - Plaster/Drywall     | 3rd Floor | 964      | SF        | 6      | 6-10 years  |   |
| Classroo | om #311 (Regular Classroom) |           |          |           |        |             |   |
|          | AC Units                    | 3rd Floor | 2        | EA        | 7      | 6-10 years  |   |
|          | Casework                    | 3rd Floor | 16       | LF        | 6      | 6-10 years  |   |
|          | Ceiling - Lay-in            | 3rd Floor | 679      | SF        | 6      | 6-10 years  |   |
|          | Ceiling - Lay-in            | 3rd Floor | 21       | SF        | 4      | 1-2 years   | Damaged                                 |
|          | Doors - Transom Window      | 3rd Floor | 8        | SF        | 7      | 6-10 years  | J                                       |
|          | Doors - Wood Doors inclu hw | 3rd Floor | 1        | EΑ        | 7      | 6-10 years  |   |
|          | Floor - Wood                | 3rd Floor | 700      | SF        | 6      | 6-10 years  |   |
|          | Lighting - Lay-in           | 3rd Floor | 12       | ĒΑ        | 7      | 6-10 years  |   |
|          | Marker Board                | 3rd Floor | 20       | LF        | 7      | 6-10 years  |   |
|          | Walls - Plaster/Drywall     | 3rd Floor | 967      | SF        | 6      | 6-10 years  |   |
| Classroo | om #312 (Regular Classroom) |           |          |           |        |             |   |
|          | AC Units                    | 3rd Floor | 2        | EA        | 7      | 6-10 years  |   |
|          | - 2                         | 2.230.    | _        | <i></i> , | •      | 2 12 , 24.3 |   |



| atego    | ry : Classroom                |            | R        | uilding   | : Main |                          |                  |
|----------|-------------------------------|------------|----------|-----------|--------|--------------------------|------------------|
| go       | . ,                           |            |          | a.i.diiig |        | Recommend                |                  |
| roup     | Item - Type                   | Location   | Quantity | UOM       | Rank   | Replacement              | Comments         |
| . о с. р | Casework                      | 3rd Floor  | 10       | LF        | 6      | 6-10 years               |                  |
|          | Ceiling - Lay-in              | 3rd Floor  | 710      | SF        | 7      | 6-10 years               |                  |
|          | Chalk Board                   | 3rd Floor  | 40       | LF        | 4      | 2-5 years                |                  |
|          | Doors - Transom Window        | 3rd Floor  | 8        | SF        | 6      | 6-10 years               |                  |
|          | Doors - Wood Doors inclu hw   | 3rd Floor  | 1        | EA        | 7      | 6-10 years               |                  |
|          | Floor - Wood                  | 3rd Floor  | 100      | SF        | 5      | 1-2 years                | damaged          |
|          | Floor - Wood                  | 3rd Floor  | 610      | SF        | 5      | 2-5 years                | damaged          |
|          | Lighting - Lay-in             | 3rd Floor  | 12       | EA        | 7      | 6-10 years               |                  |
|          | Walls - Plaster/Drywall       | 3rd Floor  | 956      | SF        | 6      | 6-10 years               |                  |
|          | vvalis - Flastei/Drywali      | 31d F1001  | 930      | SF        | U      | 0-10 years               |                  |
| assroc   | om #313 (Regular Classroom)   |            |          |           |        |                          |                  |
|          | AC Units                      | 3rd Floor  | 2        | EA        | 7      | 6-10 years               |                  |
|          | Casework                      | 3rd Floor  | 10       | LF        | 6      | 6-10 years               |                  |
|          | Ceiling - Lay-in              | 3rd Floor  | 700      | SF        | 6      | 6-10 years               |                  |
|          | Chalk Board                   | 3rd Floor  | 30       | LF        | 4      | 2-5 years                |                  |
|          | Doors - Transom Window        | 3rd Floor  | 8        | SF        | 6      | 6-10 years               |                  |
|          | Doors - Wood Doors inclu hw   | 3rd Floor  | 1        | ĒΑ        | 6      | 6-10 years               |                  |
|          | Floor - Wood                  | 3rd Floor  | 700      | SF        | 6      | 6-10 years               |                  |
|          | Lighting - Lay-in             | 3rd Floor  | 12       | EΑ        | 7      | 6-10 years               |                  |
|          | Marker Board                  | 3rd Floor  | 6        | LF        | 6      | 6-10 years               |                  |
|          | Walls - Plaster/Drywall       | 3rd Floor  | 60       | SF        | 6      | 6-10 years               |                  |
|          |                               |            |          |           |        | - · · · <b>,</b> · · · · |                  |
| lassroc  | om #314 (Regular Classroom)   |            |          |           |        |                          |                  |
|          | AC Units                      | 3rd Floor  | 2        | EA        | 7      | 6-10 years               |                  |
|          | Casework                      | 3rd Floor  | 10       | LF        | 6      | 6-10 years               |                  |
|          | Ceiling - Lay-in              | 3rd Floor  | 700      | SF        | 6      | 6-10 years               | Replace one tile |
|          | Chalk Board                   | 3rd Floor  | 20       | LF        | 4      | 2-5 years                |                  |
|          | Doors - Transom Window        | 3rd Floor  | 8        | SF        | 6      | 6-10 years               |                  |
|          | Doors - Wood Doors inclu hw   | 3rd Floor  | 1        | EA        | 6      | 6-10 years               |                  |
|          | Floor - Wood                  | 3rd Floor  | 710      | SF        | 5      | 1-2 years                | Damaged          |
|          | Lighting - Lay-in             | 3rd Floor  | 12       | EA        | 7      | 6-10 years               | •                |
|          | Walls - Plaster/Drywall       | 3rd Floor  | 956      | SF        | 6      | 6-10 years               |                  |
| atego    | ry : Interior                 |            | В        | uilding   | : Main |                          |                  |
| _        |                               |            |          |           |        | Recommend                |                  |
| roup     | Item - Type                   | Location   | Quantity | UOM       | Rank   | Replacement              | Comments         |
| orridor  |                               | 1 ot Floor | 0.700    |           |        | 6.40                     |                  |
|          | Ceiling - Lay-in              | 1st Floor  | 3,708    | SF        | 6      | 6-10 years               | Damagad          |
|          | Ceiling - Lay-in              | 1st Floor  | 36       | SF        | 4      | 1-2 years                | Damaged          |
|          | Ceiling - Plaster/Drywall     | 1st Floor  | 979      | SF        | 6      | 6-10 years               |                  |
|          | Doors - Steel Doors incl hw   | 1st Floor  | 1        | EA        | 6      | 6-10 years               |                  |
|          | Doors - Transom Window        | 1st Floor  | 86       | SF        | 6      | 6-10 years               |                  |
|          | Doors - Wood Doors include hw | 1st Floor  | 10       | EA        | 6      | 6-10 years               |                  |

Campus Name: Pulaski Page : 22 of 41 Assessment Date: 07/19/2021



| Catego | ry : Interior   |                        | Building : Main |          |        |                          |              |  |  |
|--------|---|------------------------|-----------------|----------|--------|--------------------------|--------------|--|--|
| _      |   |                        |                 | _        |        | Recommend                |              |  |  |
| Group  | Item - Type   | Location               | Quantity        | UOM      | Rank   | Replacement              | Comments     |  |  |
|        | Drinking Fountains - Single Fountain                  | 1st Floor              | 4               | EA       | 7      | 6-10 years               |              |  |  |
|        | Floor - Terrazzo                                      | 1st Floor              | 747             | SF       | 6      | 6-10 years               |              |  |  |
|        | Floor - Tile Ceramic/ Porcelain                       | 1st Floor              | 655             | SF       | 6      | 6-10 years               |              |  |  |
|        | Floor - Tile/Sheet                                    | 1st Floor              | 3,708           | SF       | 5      | 6-10 years               |              |  |  |
|        | Lighting - Lay-in                                     | 1st Floor              | 46              | EA       | 6      | 6-10 years               |              |  |  |
|        | Lighting - Pendent/Surface                            | 1st Floor              | 18              | EA       | 6      | 6-10 years               |              |  |  |
|        | Stairs - Terrazzo                                     | 1st Floor              | 20              | LF       | 6      | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier                            | 1st Floor              | 179             | EA       | 6      | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier                            | 1st Floor              | 18              | EA       | 5      | 1-2 years                | Broken latch |  |  |
|        | Walls - Concrete Block                                | 1st Floor              | 388             | SF       | 6      | 6-10 years               |              |  |  |
|        | Walls - Plaster/Drywall                               | 1st Floor              | 10              | SF       | 6      | 6-10 years               |              |  |  |
|        | Walls - Plaster/Drywall                               | 1st Floor              | 5,367           | SF       | 6      | 6-10 years               |              |  |  |
|        | Walls - Structural Glazed Tile                        | 1st Floor              | 5,367           | SF       | 6      | 6-10 years               |              |  |  |
|        | Ceiling - Lay-in                                      | 2nd Floor              | 3,497           | SF       | 6      | 6-10 years               |              |  |  |
|        | Ceiling - Plaster/Drywall                             | 2nd Floor              | 357             | SF       | 6      | 6-10 years               |              |  |  |
|        | Doors - Transom Window                                | 2nd Floor              | 110             | SF       | 6      | 6-10 years               |              |  |  |
|        | Doors - Wood Doors include hw                         | 2nd Floor              | 12              | EA       | 6      | 6-10 years               |              |  |  |
|        | Drinking Fountains - Single Fountain                  | 2nd Floor              | 5               | EA       | 7      | 6-10 years               |              |  |  |
|        | Floor - Terrazzo                                      | 2nd Floor              | 357             | SF       | 6      | 6-10 years               |              |  |  |
|        | Floor - Tile Ceramic/ Porcelain                       | 2nd Floor              | 58              | SF       | 6      | 6-10 years               |              |  |  |
|        | Floor - Tile/Sheet                                    | 2nd Floor              | 3,333           | SF       | 5      | 6-10 years               |              |  |  |
|        | Lighting - Lay-in                                     | 2nd Floor              | 39              | EA       | 6      | 6-10 years               |              |  |  |
|        | Lighting - Pendent/Surface                            | 2nd Floor              | 10              | EA       | 6      | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier                            | 2nd Floor              | 150             | EA       | 6      | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier                            | 2nd Floor              | 23              | EA       | 5      | 1-2 years                |              |  |  |
|        | Student Lockers - One Tier                            | 2nd Floor              | 11              | EA       | 4      | 1-2 years                |              |  |  |
|        | Walls - Concrete Block                                | 2nd Floor              | 303             | SF       | 6      | 6-10 years               |              |  |  |
|        | Walls - Plaster/Drywall                               | 2nd Floor              | 3,529           | SF       | 6      | 6-10 years               |              |  |  |
|        | Walls - Structural Glazed Tile                        | 2nd Floor              | 3,529           | SF       | 6      | 6-10 years               |              |  |  |
|        | Ceiling - Lay-in                                      | 3rd Floor              | 3,461           | SF       | 6      | 6-10 years               |              |  |  |
|        | Ceiling - Lay-in                                      | 3rd Floor              | 36              | SF<br>SF | 4      | 1-2 years                |              |  |  |
|        | Ceiling - Plaster/Drywall                             | 3rd Floor              | 350             |          | 6      | 6-10 years               |              |  |  |
|        | Doors - Side-lite                                     | 3rd Floor              | 114             | SF       | 6      | 6-10 years               |              |  |  |
|        | Doors - Transom Window                                | 3rd Floor              | 72              | SF       | 6      | 6-10 years               |              |  |  |
|        | Doors - Wood Doors include hw                         | 3rd Floor              | 8<br>5          | EA<br>EA | 6<br>7 | 6-10 years               |              |  |  |
|        | Drinking Fountains - Single Fountain Floor - Terrazzo | 3rd Floor              | 5<br>456        | SF       | 6      | 6-10 years               |              |  |  |
|        | Floor - Terrazzo Floor - Tile Ceramic/ Porcelain      | 3rd Floor<br>3rd Floor | 456<br>58       | SF<br>SF |        | 6-10 years               |              |  |  |
|        | Floor - Tile Ceramic/ Porcelain Floor - Tile/Sheet    | 3rd Floor<br>3rd Floor | 3,333           | SF<br>SF | 6<br>5 | 6-10 years               |              |  |  |
|        | Lighting - Lay-in                                     | 3rd Floor              | ა,ააა<br>43     | EA       | 5<br>6 | 6-10 years<br>6-10 years |              |  |  |
|        | Lighting - Lay-in<br>Lighting - Pendent/Surface       | 3rd Floor              | 43<br>7         | EA       | 6      |                          |              |  |  |
|        | Student Lockers - One Tier                            | 3rd Floor              | 189             | EA       | 6      | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier Student Lockers - One Tier | 3rd Floor<br>3rd Floor | 33              | EA<br>EA |        | 6-10 years               |              |  |  |
|        | Student Lockers - One Tier Student Lockers - One Tier | 3rd Floor              | 33<br>8         | EA       | 5<br>4 | 1-2 years                |              |  |  |
|        | Gludelit Lockers - Olle Tiel                          | 510 1 1001             | 0               | ĽA       | 4      | 1-2 years                |              |  |  |
|        |   |                        |                 |          |        |                          |              |  |  |

Campus Name: Pulaski Page : 23 of 41 Assessment Date: 07/19/2021



| Catego | ry : Interior  |                          | В         | uilding  | : Main |                          |                             |
|--------|--|--------------------------|-----------|----------|--------|--------------------------|-----------------------------|
|        |  |                          |           |          |        | Recommend                |                             |
| Group  | Item - Type  | Location                 | Quantity  | UOM      | Rank   | Replacement              | Comments                    |
|        | Walls - Concrete Block                                 | 3rd Floor                | 303       | SF       | 6      | 6-10 years               |                             |
|        | Walls - Plaster/Drywall                                | 3rd Floor                | 3,529     | SF       | 6      | 6-10 years               |                             |
|        | Walls - Structural Glazed Tile                         | 3rd Floor                | 3,529     | SF       | 6      | 6-10 years               |                             |
| Safety |  |                          |           |          |        |                          |                             |
|        | Camera Viewing Station                                 | Entire Building          | 3         | EA       | 7      | 10+ years                |                             |
|        | Security Cameras                                       | Entire Building          | 8         | EA       | 7      | 6-10 years               |                             |
|        | Security Cameras                                       | Entire Building          | 2         | EA       | 7      | 10+ years                |                             |
|        | Security Cameras                                       | Entire Building          | 6         | EA       | 7      | 6-10 years               |                             |
| O4 :   |  |                          |           |          |        |                          |                             |
| Stairs | Ceiling - Lay-in                                       | North East               | 190       | SF       | 6      | 6-10 years               |                             |
|        | Ceiling - Lay-in                                       | North East               | 24        | SF       | 4      | 1-2 years                |                             |
|        | Ceiling - Lay-iii Ceiling - Plaster/Drywall            | North East               | 100       | SF       | 6      | 6-10 years               |                             |
|        | Floor - Terrazzo                                       | North East               | 194       | SF       | 6      | 6-10 years               |                             |
|        | Handrails  | North East               | 94        | LF       | 7      | 6-10 years               |                             |
|        | Lighting - Pendent/Surface                             | North East               | 4         | EA       | 6      | ,                        |                             |
|        |  | North East               | 43        | LF       | 6      | 6-10 years               | Motal congrating from atoms |
|        | Stairs - Terrazzo<br>Walls - Plaster/Drywall           | North East               | 472       | SF       | 6      | 6-10 years               | Metal separating from steps |
|        | Walls - Plaster/Drywall Walls - Structural Glazed Tile | North East               | 163       | SF       | 7      | 2-5 years<br>6-10 years  |                             |
|        |  |                          |           | SF       | ,<br>5 | •                        |                             |
|        | Walls - Structural Glazed Tile                         | North East<br>North West | 80<br>214 | SF<br>SF |        | 2-5 years                |                             |
|        | Ceiling - Lay-in<br>Ceiling - Plaster/Drywall          | North West               | 100       | SF<br>SF | 6<br>6 | 6-10 years               |                             |
|        | Floor - Terrazzo                                       | North West               | 194       | SF       | 6      | 6-10 years<br>6-10 years |                             |
|        | Handrails  | North West               | 94        | LF       | 7      | 6-10 years               |                             |
|        |  | North West               | 4         | EA       | 6      |                          |                             |
|        | Lighting - Pendent/Surface<br>Stairs - Terrazzo        | North West               | 43        | LF       | 6      | 6-10 years<br>6-10 years |                             |
|        | Walls - Plaster/Drywall                                | North West               | 442       | SF       | 6      | 6-10 years               |                             |
|        | Walls - Plaster/Drywall                                | North West               | 30        | SF       | 6      | •                        | Damagad                     |
|        | Walls - Plaster/Drywall Walls - Structural Glazed Tile |                          | 243       | SF<br>SF | 6      | 1-2 years                | Damaged                     |
|        | Ceiling - Lay-in                                       | North West<br>South East | 263       | SF<br>SF | 6      | 6-10 years<br>6-10 years |                             |
|        | Ceiling - Lay-in                                       | South East               | 16        | SF       | 4      | 1-2 years                | Damagad                     |
|        | Ceiling - Lay-in<br>Ceiling - Plaster/Drywall          | South East               |           | SF<br>SF |        | •                        | Damaged                     |
|        | •  |                          | 131       | SF<br>SF | 6      | 6-10 years               |                             |
|        | Floor - Terrazzo<br>Floor - Terrazzo                   | South East<br>South East | 223<br>20 | SF<br>SF | 6      | 6-10 years               | Damagad                     |
|        | Handrails  | South East               | 113       | LF       | 5<br>7 | 1-2 years                | Damaged                     |
|        |  | South East South East    | 6         | EA       | 7<br>7 | 6-10 years               |                             |
|        | Lighting - Pendent/Surface                             |                          |           | LF       |        | 6-10 years               |                             |
|        | Stairs - Terrazzo<br>Walls - Plaster/Drywall           | South East               | 43<br>998 | LF<br>SF | 6      | 6-10 years               |                             |
|        |  | South East               |           | SF<br>SF | 6      | 6-10 years               |                             |
|        | Walls - Structural Glazed Tile                         | South East               | 492       | SF<br>SF | 6      | 6-10 years               |                             |
|        | Ceiling - Lay-in                                       | South West               | 199       |          | 6      | 6-10 years               |                             |
|        | Ceiling - Lay-in                                       | South West               | 80        | SF       | 4      | 1-2 years                |                             |
|        | Ceiling - Plaster/Drywall                              | South West               | 131       | SF       | 6      | 6-10 years               |                             |
|        | Floor - Terrazzo                                       | South West               | 213       | SF       | 6      | 6-10 years               |                             |

Page : 24 of 41 Campus Name: Pulaski Assessment Date: 07/19/2021



| Catego   | ry : Interior                                    |            | В        | Building : Main |      |             |             |  |
|----------|--|------------|----------|-----------------|------|-------------|-------------|--|
|          |  |            |          |                 |      | Recommend   |             |  |
| Group    | Item - Type                                      | Location   | Quantity | UOM             | Rank | Replacement | Comments    |  |
|          | Floor - Terrazzo                                 | South West | 30       | SF              | 4    | 6-10 years  |             |  |
|          | Handrails  | South West | 113      | LF              | 7    | 6-10 years  |             |  |
|          | Lighting - Pendent/Surface                       | South West | 6        | EA              | 6    | 6-10 years  |             |  |
|          | Stairs - Terrazzo                                | South West | 43       | LF              | 6    | 6-10 years  |             |  |
|          | Walls - Plaster/Drywall                          | South West | 10       | SF              | 6    | 6-10 years  |             |  |
|          | Walls - Plaster/Drywall                          | South West | 978      | SF              | 6    | 6-10 years  |             |  |
|          | Walls - Structural Glazed Tile                   | South West | 452      | SF              | 6    | 6-10 years  |             |  |
|          | Walls - Structural Glazed Tile                   | South West | 40       | SF              | 5    | 2-5 years   |             |  |
| Vertical | Conveyance                                       |            |          |                 |      |             |             |  |
|          | Elevator - Elevator- Roped Holeless<br>Hydraulic | 1st Floor  | 1        | EA              | 6    | 10+ years   | Redo finish |  |

Campus Name: Pulaski Page : 25 of 41 Assessment Date: 07/19/2021



| J         |   |                         | Building : Annex |     |           |             |                               |  |
|-----------|---|-------------------------|------------------|-----|-----------|-------------|-------------------------------|--|
|           |   |                         | _                |     | Recommend |             |                               |  |
| 3roup     | Item - Type                                 | Location                | Quantity         | UOM | Rank      | Replacement | Comments                      |  |
| ntrance   |   |                         |                  |     |           |             |                               |  |
|           | Exterior Doors - Store Front                | #1- SE                  | 3                | EA  | 6         | 10+ years   |                               |  |
|           | Exterior Stairs - Concrete                  | #1- SE                  | 20               | LF  | 5         | 2-5 years   |                               |  |
|           | Entrance Control - Audio and Video          | #2- N                   | 1                | EA  | 6         | 6-10 years  |                               |  |
|           | Exterior Doors - Side lite                  | #2- N                   | 2                | EA  | 6         | 10+ years   |                               |  |
|           | Exterior Doors - Store Front                | #2- N                   | 3                | EA  | 6         | 10+ years   |                               |  |
|           | Exterior Stairs - Concrete                  | #2- N                   | 20               | LF  | 5         | 2-5 years   |                               |  |
|           | Power Door Operator and Controls            | #2- N                   | 1                | EA  | 7         | 6-10 years  |                               |  |
|           | Exterior Doors - Exterior FRP Door          | #2.5- NW- Yard Storage  | 1                | ΕA  | 6         | 10+ years   |                               |  |
|           | Exterior Stairs - Concrete                  | #2.5- NW- Yard Storage  | 6                | LF  | 5         | 2-5 years   |                               |  |
|           | Entrance Control - Audio and Video          | #3- SW- Main Accessible | 1                | EA  | 6         | 6-10 years  |                               |  |
|           | Exterior Doors - Store Front                | #3- SW- Main Accessible | 2                | EA  | 6         | 10+ years   |                               |  |
|           | Power Door Operator and Controls            | #3- SW- Main Accessible | 2                | EA  | 7         | 6-10 years  |                               |  |
|           | Exterior Doors - Exterior FRP Door          | #4- SW                  | 1                | EA  | 6         | 10+ years   |                               |  |
|           | Exterior Doors - Exterior FRP Door          | #5- SW                  | 1                | EA  | 6         | 10+ years   |                               |  |
|           | Exterior Stairs - Concrete                  | #5- SW                  | 9                | LF  | 6         | 10+ years   |                               |  |
|           | Exterior Stairs - Concrete                  | #3- 3VV                 | 9                | LF  | O         | 10+ years   |                               |  |
| oundatio  | on  |                         |                  |     |           |             |                               |  |
|           | Foundation - Concrete                       | Entire Building         | 620              | LF  | 7         | 10+ years   |                               |  |
|           | Superstructure - Concrete                   | Entire Building         | 27,611           | SF  | 7         | 10+ years   |                               |  |
|           |   |                         |                  |     |           |             |                               |  |
| _ighting_ |   |                         |                  |     |           |             |                               |  |
|           | Exterior Lighting - Parapet or Roof Mounted | Entire Building         | 7                | EA  | 7         | 6-10 years  |                               |  |
|           | Exterior Lighting - Wall Mounted            | Entire Building         | 16               | EA  | 7         | 6-10 years  |                               |  |
| Roof Sys  | stem.                                       |                         |                  |     |           |             |                               |  |
|           | Access Ladder - Metal                       | Main Roof               | 1                | EA  | 7         | 2-5 years   |                               |  |
|           | Access Ladder - Metal                       | Main Roof               | 1                | EA  | 7         | 10+ years   |                               |  |
|           | Access Ladder - Metal                       | Main Roof               | 1                | EA  | 7         | 6-10 years  |                               |  |
|           | Coping - Metal                              | Main Roof               | 697              | LF  | 6         | 10+ years   |                               |  |
|           | Downspouts - Interior Downspouts            | Main Roof               | 142              | LF  | 6         | 6-10 years  | Replace basket drain cover as |  |
|           | Downspouts - Interior Downspouts            | Wall Roof               | 172              | LI  | U         | 0-10 years  | required                      |  |
|           | Roof - Modified Bitumen                     | Main Roof               | 16,597           | SF  | 6         | 10+ years   | roquireu                      |  |
|           | Roof Hatch - Metal                          | Main Roof               | 10,597           | EA  | 7         | 6-10 years  |                               |  |
|           | Roof Hatch - Metal                          | Main Roof               | 1                | EA  | 5         | 6-10 years  |                               |  |
|           | Roof Structure - Steel / Metal Deck/        | Main Roof               | 16 507           | SF  | 5<br>7    |             |                               |  |
|           | Concrete Topping                            | Main Rooi               | 16,597           | SF  | /         | 10+ years   |                               |  |
|           | -   |                         |                  |     |           |             |                               |  |
| Valls     |   |                         |                  |     |           |             |                               |  |
|           | Exterior Walls - Precast Panel Wall         | Entire Building         | 888              | SF  | 6         | 10+ years   |                               |  |
|           | Exterior Walls - Prefabricated Metal Panel  | Entire Building         | 12,142           | SF  | 7         | 10+ years   |                               |  |



| Catego  | ry : Exterior                                      |                 | E               | Building | : Annex |             |   |
|---------|--|-----------------|-----------------|----------|---------|-------------|---|
|         | <u>-</u>   |                 |                 |          |         | Recommend   |   |
| roup    | Item - Type  | Location        | Quantity        | UOM      | Rank    | Replacement | Comments                                  |
| indow   | e.   |                 |                 |          |         |             |   |
| HIGOVV. | Curtain wall - Louver                              | Entire Building | 216             | SF       | 6       | 10+ years   |   |
|         | Guard - Guards perforated                          | Entire Building | 968             | SF       | 6       | 10+ years   |   |
|         | Windows - Sash Aluminum Double-pane                | Entire Building | 1,034           |          | 6       | 10+ years   |   |
|         | Windows - Sash Aluminum Double-pane                | Entire building | 1,034           | SF       | 0       | 10+ years   |   |
| atego   | ry : Electrical                                    |                 | E               | Building | : Annex | <u> </u>    |   |
|         |  |                 |                 |          |         | Recommend   |   |
| roup    | Item - Type  | Location        | Quantity        | UOM      | Rank    | Replacement | Comments                                  |
| nergei  | ncy System   |                 |                 |          |         |             |   |
|         | Automatic Transfer Switch                          | 1st Floor       | 1               | EA       | 6       | 6-10 years  | Serves annex                              |
|         | Exit Signs - Corridors and Stairs                  | Entire Building | 9               | EA       | 6       | 6-10 years  |   |
|         | Exit Signs - Lunchroom                             | Entire Building | 2               | EA       | 5       | 6-10 years  | Previously not assessed                   |
|         | Exit Signs - Multipurpose Room                     | Entire Building | 3               | EA       | 6       | 6-10 years  | Revised ranking                           |
|         | Emergency Battery Packs - Corridors and            | Entire Building | 6               | EA       | 6       | 6-10 years  | 3   |
|         | Stairs   |                 | 9               |          | •       | , oa. o     |   |
|         | Emergency Battery Packs - Students Toilets         | Entire Building | 2               | EA       | 6       | 6-10 years  | Revised ranking                           |
|         | Emergency Battery Packs - Students Toilets         | Entire Building | 2               | EA       | 6       | 6-10 years  | Revised fallking                          |
|         |  |                 |                 | SF       |         |             | Device due plane                          |
|         | Security System - CCTV                             | Entire Building | 27,600          |          | 5       | 6-10 years  | Revised ranking                           |
|         | Security System - Intrusion Detection              | Entire Building | 27,600          | SF       | 5       | 6-10 years  | Revised ranking                           |
|         | Emergency A/C Power - Corridors and Stairs         | Entire Building | 7,600           | SF       | 6       | 10+ years   | New assessed item, previously n assessed  |
|         | Emergency A/C Power - Lunchrooms                   | Entire Building | 2,500           | SF       | 6       | 10+ years   | New assed item, previously not assessed   |
|         | Emergency A/C Power - Students Toilets             | Entire Building | 5,000           | SF       | 6       | 10+ years   | New assessed item, previously neassessed  |
| ain Se  | rvice  |                 |                 |          |         |             |   |
|         | Main Electrical Service - 2000 A<br>120/208/3PH    | Electrical Room | 1               | EA       | 6       | 10+ years   | Serves annex, no label                    |
|         | Independent Electrical Service for emergency power | Electrical Room | 1               | EA       | 6       | 6-10 years  | Serves annex, revised ranking             |
|         | PA System  | Entire Building | 27,600          | SF       | 5       | 6-10 years  | Connected to main building                |
| ower D  | Distribution                                       |                 |                 |          |         |             |   |
|         | Lighting and Power Panels - 100 A                  | Entire Building | 1               | EA       | 7       | 10+ years   | Revised ranking, functional is a 7 rating |
|         | Lighting and Power Panels - 100 A                  | Entire Building | 1               | EA       | 7       | 10+ years   | Functional                                |
|         | Lighting and Power Panels - Above 100 A            | Entire Building | 1               | EA       | 7       | 10+ years   | Functional                                |
|         | Lighting and Power Panels - Above 100 A            | Entire Building | 1               | EA       | 7       | 10+ years   | Functional                                |
|         | Lighting and Power Panels - Above 100 A            | Entire Building | 1               | EA       | 7       | 10+ years   | Functional                                |
|         | Lighting and Power Panels - Above 100 A            | Entire Building | 1               | EΑ       | 7       | 10+ years   | Functional                                |
|         | Main Distribution Panels - 400 - 600 amp           | Entire Building | 3               | EA       | 7       | 10+ years   | Functional                                |
|         |  | - <b>J</b>      | _               |          |         | ,           |   |
|         | Name: Pulaski                                      |                 | Page : 27 of 41 |          |         |             | Assessment Date: 07/19                    |

Assessment Date: 07/19/2021 Campus Name: Pulaski Page : 27 of 41



| XXII S     | chools                                      |                  |          |         |         | 22          | 30 W McLean AVENUE, Chicago, IL 60647    |
|------------|---|------------------|----------|---------|---------|-------------|--|
| Catego     | ry : Electrical                             |                  | В        | uilding | : Annex |             |  |
|            |   |                  |          |         |         | Recommend   |  |
| Group      | Item - Type                                 | Location         | Quantity | UOM     | Rank    | Replacement | Comments                                 |
|            | Main Distribution Panels - 400 - 600 amp    | Entire Building  | 2        | EA      | 7       | 10+ years   | Functional                               |
|            | Main Distribution Panels - Greater than 600 | Entire Building  | 3        | EA      | 7       | 10+ years   | Functional                               |
|            | amp   |                  |          |         |         |             |  |
|            |   |                  |          |         |         |             |  |
| Catego     | y : Fire Protection                         |                  | В        | uilding | : Annex |             |  |
|            |   |                  |          |         |         | Recommend   |  |
| Group      | Item - Type                                 | Location         | Quantity | UOM     | Rank    | Replacement | Comments                                 |
| Fire Aları | n   |                  |          |         |         |             |  |
|            | Fire Alarm Panel                            | Entire Building  | 1        | EA      | 6       | 6-10 years  | Serves annex                             |
|            | Fire Alarm Strobe Lights                    | Entire Building  | 27,600   | SF      | 6       | 6-10 years  |  |
|            | Fire Alarm_System                           | Entire Building  | 27,600   | SF      | 6       | 6-10 years  | Serves annex, inspected by fire          |
|            | _ ,   | 3                | •        |         |         | ,           | marshal                                  |
|            |   |                  |          |         |         |             |  |
| Catego     | ry : Mechanical                             |                  | В        | uilding | : Annex |             |  |
|            |   |                  |          |         |         | Recommend   |  |
| Group      | Item - Type                                 | Location         | Quantity | UOM     | Rank    | Replacement | Comments                                 |
| Air Cond   |   |                  |          |         |         | _           |  |
|            | Condensing Unit- Roof Mounted - 5-10        | Entire Building  | 2        | EA      | 5       | 6-10 years  | Recently serviced, coils cleaned         |
|            | tons  | Zimio Danamg     | _        | _, 、    | Ū       | o io youio  | recoming convicta, controlariou          |
|            | Condensing Unit- Roof Mounted - Less        | Entire Building  | 1        | EA      | 6       | 6-10 years  | Recently serviced, coils cleaned         |
|            | than 5 tons                                 | 3                |          |         |         | ,           | ,  |
|            |   |                  |          |         |         |             |  |
| Air Hand   | ling Systems                                |                  |          |         |         |             |  |
|            | Roof Top Unit-Single Zone-Roof Mounted-     | Entire Building  | 4        | EA      | 5       | 2-5 years   | Needs frequent repairs, recently         |
|            | Electric and DX Cooling with Self Contained | g                | •        |         | •       | _ 0 ,00.0   | serviced, operational, coils cleaned     |
|            | Compressor - Less than 5 tons               |                  |          |         |         |             | oornood, operational, colle oleanea      |
|            | F   |                  |          |         |         |             |  |
| _Heating I | Devices                                     |                  |          |         |         |             |  |
|            | PTAC - Electric Heating and Self Contained  | 1st Floor        | 1        | EA      | 6       | 6-10 years  | Teacher's lounge, previously not         |
|            | Cooling                                     | 13(1100)         |          | L/\     | O       | o io years  | assessed                                 |
|            | Cabinet Heaters - With Electric Coil        | 2nd Floor        | 4        | EA      | 5       | 6-10 years  | Ceiling mounted, previously not          |
|            | Cabillot Floators With Eloctile Coll        | 2110 1 1001      | •        | _/\     | Ü       | o io youro  | assessed                                 |
|            | Wall Heater - Electric                      | Entire Building  | 10       | EA      | 6       | 10+ years   | Recently serviced                        |
|            | Wall Heater - Electric                      | Entire Building  | 7        | EA      | 5       | 6-10 years  | Recently serviced                        |
|            |   | 3                |          |         |         | ,           | ,  |
| _Tempera   | ture Control                                |                  |          |         |         |             |  |
|            | Electric Thermostat                         | Entire Building  | 24       | EA      | 6       | 6-10 years  | Individual controls, recently calibrated |
|            |   | Januariy         | 21       | _, .    | Ü       | 3 10 ,0010  | aaa oona olo, rooonay balloratoa         |
| Unit Ven   | ilation                                     |                  |          |         |         |             |  |
| Omit vell  | Unit Ventilators- Floor Mounted- Electric   | Entire Building  | 20       | EA      | 5       | 6-10 years  | Many being repaired, per engineer,       |
|            | Heating & DX Cooling Coil W/ Self           | Little Bulluling | 20       | EA      | 3       | 0-10 years  | 1996 installation, repaired              |
|            | Contained Compressor                        |                  |          |         |         |             | 1990 mstaliation, repaired               |
|            | Contained Compressor                        |                  |          |         |         |             |  |
|            |   |                  |          |         |         |             |  |

Campus Name: Pulaski Page : 28 of 41 Assessment Date: 07/19/2021



| Catego    | ry : Mechanical   |                   | В        | uilding | : Annex |                          |   |
|-----------|---|-------------------|----------|---------|---------|--------------------------|---|
|           |   |                   |          |         |         | Recommend                |   |
| roup      | Item - Type   | Location          | Quantity | UOM     | Rank    | Replacement              | Comments  |
| entilatio | an .  |                   |          |         |         |                          |   |
| emmand    | Exhaust Fans- Indoor - 500 - 1500 CFM                           | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               | Serves warming kitchen, previously not assessed |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 2        | EA      | 6       | 10+ years                | Additional fan found                            |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 1        | EA      | 6       | 6-10 years               |   |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               |   |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               |   |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               | Repaired recently                               |
|           | Exhaust Fans- Roof Mounted - 500 - 1500 CFM                     | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               |   |
|           | Type II Exhaust Hood- Warming Kitchen                           | Roofs and Kitchen | 1        | EA      | 5       | 6-10 years               | Previously not assessed                         |
| atego     | ry : Plumbing   |                   | В        | uilding | : Annex |                          |   |
| roup      | Item - Type   | Location          | Quantity | UOM     | Rank    | Recommend<br>Replacement | Comments  |
| ot Wate   |   | Location          | Quantity | 00111   | IXAIIX  | Replacement              | Comments  |
| OL WAII   | Electric Heater - 20 - 50 KW                                    | 1st Floor         | 1        | EA      | 6       | 6-10 years               | Controls recently replaced                      |
| iping     |   |                   |          |         |         |                          |   |
|           | Domestic Piping-Hot Water Return Lines                          | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional, no leaks                            |
|           | Domestic Piping-Hot Water Return Risers                         | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional                                      |
|           | Domestic Piping-Hot Water from Risers to Fixtures               | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional                                      |
|           | Domestic Piping-Hot/Cold Water Supply (Horizontal Lines)        | Entire Building   | 27,600   | SF      | 6       | 10+ years                | There are a few pipe clamps, functional         |
|           | Domestic Piping-Hot/Cold Water Supply (Risers)                  | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional                                      |
|           | Domestic Piping-Hot/Cold Water Supply (from Risers to Fixtures) | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional, no leaks                            |
|           | Sanitary Piping   | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional                                      |
|           | Storm Piping  | Entire Building   | 27,600   | SF      | 6       | 6-10 years               | Functional                                      |
|           | Vent Piping   | Entire Building   | 27,600   | SF      | 6       | 10+ years                | Functional                                      |
|           | ry : Room   |                   | В        | uildina | : Annex |                          |   |
| atego     |   |                   |          |         |         |                          |   |
| atego     |   |                   |          |         |         | Recommend                |   |

Campus Name: Pulaski Page : 29 of 41 Assessment Date: 07/19/2021



| Catego | ry : Room                   |                                  | Building : Annex |     |      |             |          |  |  |  |
|--------|-----------------------------|----------------------------------|------------------|-----|------|-------------|----------|--|--|--|
|        |                             |                                  |                  |     |      | Recommend   |          |  |  |  |
| Group  | Item - Type                 | Location                         | Quantity         | UOM | Rank | Replacement | Comments |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Conference Room       | 227              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Conference Room       | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Conference Room       | 20               | SF  | 4    | 1-2 years   | Damaged  |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Conference Room       | 207              | SF  | 4    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 1st Floor, Conference Room       | 2                | EΑ  | 6    | 6-10 years  |          |  |  |  |
|        | Power Distribution          | 1st Floor, Conference Room       | 8                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Conference Room       | 542              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Kitchen Office        | 135              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Kitchen Office        | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Kitchen Office        | 125              | SF  | 5    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Kitchen Office        | 10               | SF  | 4    | 1-2 years   | Damaged  |  |  |  |
|        | Lighting - Lay-in           | 1st Floor, Kitchen Office        | 2                | EΑ  | 7    | 6-10 years  |          |  |  |  |
|        | Power Distribution          | 1st Floor, Kitchen Office        | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Kitchen Office        | 418              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Main Office           | 144              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Main Office           | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Main Office           | 144              | SF  | 5    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 1st Floor, Main Office           | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Power Distribution          | 1st Floor, Main Office           | 6                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Main Office           | 432              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Principal's Office    | 246              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Principal's Office    | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Principal's Office    | 245              | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 1st Floor, Principal's Office    | 1                | SF  | 4    | 1-2 years   | Damaged  |  |  |  |
|        | Lighting - Lay-in           | 1st Floor, Principal's Office    | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Power Distribution          | 1st Floor, Principal's Office    | 8                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Principal's Office    | 565              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 2nd Floor, Room 015              | 422              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 2nd Floor, Room 015              | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile/Sheet          | 2nd Floor, Room 015              | 422              | SF  | 5    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 2nd Floor, Room 015              | 5                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Power Distribution          | 2nd Floor, Room 015              | 6                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 2nd Floor, Room 015              | 740              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 2nd Floor, Teacher Collaboration | 730              | SF  | 6    | 6-10 years  |          |  |  |  |
|        |                             | and Resource Room 006            |                  |     |      | •           |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 2nd Floor, Teacher Collaboration | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        |                             | and Resource Room 006            |                  |     |      | •           |          |  |  |  |
|        | Floor - Tile                | 2nd Floor, Teacher Collaboration | 730              | SF  | 6    | 6-10 years  |          |  |  |  |
|        |                             | and Resource Room 006            |                  |     |      | •           |          |  |  |  |
|        | Lighting - Lay-in           | 2nd Floor, Teacher Collaboration | 10               | EA  | 7    | 6-10 years  |          |  |  |  |
|        |                             | and Resource Room 006            |                  |     |      | •           |          |  |  |  |
|        | Power Distribution          | 2nd Floor, Teacher Collaboration | 6                | EA  | 6    | 6-10 years  |          |  |  |  |
|        |                             | and Resource Room 006            |                  |     |      | ,           |          |  |  |  |
|        | Storage/ Closet             | 2nd Floor, Teacher Collaboration | 100              | SF  | 5    | 6-10 years  |          |  |  |  |
|        | -                           |                                  |                  |     |      | •           |          |  |  |  |

Campus Name: Pulaski Page : 30 of 41 Assessment Date: 07/19/2021



| Catego    | ory : Room                                   |                                  | В          | uilding  | : Annex |             | 30 W McLean Avenue, Gilleago, le 60047 |
|-----------|--|----------------------------------|------------|----------|---------|-------------|--|
| _         |  |                                  |            | _        |         | Recommend   |  |
| Group     | Item - Type                                  | Location                         | Quantity   | UOM      | Rank    | Replacement | Comments                               |
|           |  | and Resource Room 006            |            |          |         |             |  |
|           | Walls - Plaster/Drywall                      | 2nd Floor, Teacher Collaboration | 972        | SF       | 6       | 6-10 years  |  |
|           |  | and Resource Room 006            |            |          |         |             |  |
| l/italaaa |  |                                  |            |          |         |             |  |
| _Kitchen  | Coiling Lawin                                | 1st Floor                        | 1.051      | SF       | 6       | 6.10.40.000 |  |
|           | Ceiling - Lay-in Doors - Steel Doors incl hw |                                  | 1,251<br>1 | Sr<br>EA | 6       | 6-10 years  |  |
|           | Doors - Wood Doors inclu hw                  | 1st Floor<br>1st Floor           |            | EA       | 6<br>6  | 6-10 years  |  |
|           | Floor - Tile                                 | 1st Floor                        | 3          | SF       | 6       | 6-10 years  |  |
|           | Floor - Tile<br>Floor - Tile                 |                                  | 370        | SF<br>SF |         | 6-10 years  | Domogod                                |
|           |  | 1st Floor                        | 15         | SF<br>SF | 4       | 1-2 years   | Damaged                                |
|           | Floor - Tile Ceramic/ Porcelain              | 1st Floor                        | 866        |          | 6       | 6-10 years  |  |
|           | Lighting - Lay-in                            | 1st Floor                        | 15         | EA       | 7       | 6-10 years  |  |
|           | Serving Line                                 | 1st Floor                        | 24         | LF       | 6       | 6-10 years  |  |
|           | Storage/ Closet                              | 1st Floor                        | 393        | SF       | 5       | 6-10 years  |  |
|           | Walls - Metal Panel                          | 1st Floor                        | 1,273      | SF       | 6       | 6-10 years  |  |
| Lunch &   | Multipurpose Room                            |                                  |            |          |         |             |  |
|           | Ceiling - Lay-in                             | 1st Floor                        | 3,186      | SF       | 6       | 6-10 years  |  |
|           | Doors - Steel Doors incl hw                  | 1st Floor                        | 2          | ĒΑ       | 6       | 6-10 years  |  |
|           | Floor - Tile                                 | 1st Floor                        | 3,186      | SF       | 6       | 6-10 years  |  |
|           | Lighting - Lay-in                            | 1st Floor                        | 48         | EA       | 7       | 6-10 years  |  |
|           | Storage/ Closet                              | 1st Floor                        | 100        | SF       | 7       | 6-10 years  |  |
|           | Walls - Plaster/Drywall                      | 1st Floor                        | 2,032      | SF       | 6       | 6-10 years  |  |
| _MDF_ID   | nE   |                                  |            |          |         |             |  |
|           | Doors - Steel Doors incl hw                  | 2nd Floor                        | 1          | EA       | 6       | 6-10 years  |  |
|           | Other Cooling Unit                           | 2nd Floor                        | 1          | EA       | 5       | 2-5 years   | Fan coil                               |
|           | Other Cooling Onit                           | 2110 11001                       | ı          | EA       | 5       | 2-5 years   | ran con                                |
| _Mechan   | ical/ Service Rooms                          |                                  |            |          |         |             |  |
|           | Mechanical/ Service Rooms                    | 1st Floor                        | 73         | SF       | 5       | 10+ years   |  |
|           | Storage Room                                 | 1st Floor                        | 232        | SF       | 5       | 10+ years   |  |
|           | Janitor's Closet                             | 2nd Floor                        | 40         | SF       | 5       | 2-5 years   | Chipped tiles on floor. Need Ceiling   |
|           |  |                                  |            |          |         |             | tile replace                           |
| Restroo   | m  |                                  |            |          |         |             |  |
|           | Accessories                                  | 1st Floor                        | 260        | SF       | 7       | 6-10 years  |  |
|           | Ceiling - Lay-in                             | 1st Floor                        | 260        | SF       | 6       | 6-10 years  |  |
|           | Floor - Tile                                 | 1st Floor                        | 260        | SF       | 6       | 6-10 years  |  |
|           | Floor Drain                                  | 1st Floor                        | 1          | EA       | 7       | 6-10 years  |  |
|           | Lavatory                                     | 1st Floor                        | 2          | EA       | 6       | 6-10 years  |  |
|           | Lighting - Lay-in                            | 1st Floor                        | 2          | EA       | 7       | 6-10 years  |  |
|           | Partitions                                   | 1st Floor                        | 5          | EA       | 7       | 6-10 years  |  |
|           | Walls - Tile                                 | 1st Floor                        | 580        | SF       | 7       | 6-10 years  |  |
|           | vvaii9 - 1116                                | 151 1 1001                       | 500        | SI.      | ,       | 0-10 years  |  |
|           |  |                                  |            |          |         |             |  |

Campus Name: Pulaski Page : 31 of 41 Assessment Date: 07/19/2021



| Catego | ry : Room                   |                             | Building : Annex |     |      |             |          |  |  |  |
|--------|-----------------------------|-----------------------------|------------------|-----|------|-------------|----------|--|--|--|
| _      |                             |                             |                  | _   |      | Recommend   |          |  |  |  |
| Group  | Item - Type                 | Location                    | Quantity         | UOM | Rank | Replacement | Comments |  |  |  |
|        | Water Closet                | 1st Floor                   | 5                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Accessories                 | 1st Floor                   | 280              | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor                   | 280              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile                | 1st Floor                   | 280              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor Drain                 | 1st Floor                   | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Lavatory                    | 1st Floor                   | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 1st Floor                   | 2                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Partitions                  | 1st Floor                   | 2                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Urinals                     | 1st Floor                   | 3                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Tile                | 1st Floor                   | 580              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Water Closet                | 1st Floor                   | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Accessories                 | 1st Floor, Kitchen Restroom | 35               | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Kitchen Restroom | 35               | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Kitchen Restroom | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile                | 1st Floor, Kitchen Restroom | 35               | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Lavatory                    | 1st Floor, Kitchen Restroom | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Lighting - Pendent/Surface  | 1st Floor, Kitchen Restroom | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Kitchen Restroom | 212              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Water Closet                | 1st Floor, Kitchen Restroom | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Accessories                 | 1st Floor, Office Restroom  | 60               | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 1st Floor, Office Restroom  | 60               | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Doors - Wood Doors inclu hw | 1st Floor, Office Restroom  | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile                | 1st Floor, Office Restroom  | 60               | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor Drain                 | 1st Floor, Office Restroom  | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Lavatory                    | 1st Floor, Office Restroom  | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 1st Floor, Office Restroom  | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Walls - Plaster/Drywall     | 1st Floor, Office Restroom  | 140              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Walls - Tile                | 1st Floor, Office Restroom  | 140              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Water Closet                | 1st Floor, Office Restroom  | 1                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Accessories                 | 2nd Floor                   | 260              | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 2nd Floor                   | 260              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile                | 2nd Floor                   | 260              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor Drain                 | 2nd Floor                   | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Lavatory                    | 2nd Floor                   | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 2nd Floor                   | 2                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Partitions                  | 2nd Floor                   | 5                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Walls - Tile                | 2nd Floor                   | 580              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Water Closet                | 2nd Floor                   | 5                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Accessories                 | 2nd Floor                   | 280              | SF  | 7    | 6-10 years  |          |  |  |  |
|        | Ceiling - Lay-in            | 2nd Floor                   | 280              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor - Tile                | 2nd Floor                   | 280              | SF  | 6    | 6-10 years  |          |  |  |  |
|        | Floor Drain                 | 2nd Floor                   | 1                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | Lavatory                    | 2nd Floor                   | 2                | EA  | 6    | 6-10 years  |          |  |  |  |
|        | Lighting - Lay-in           | 2nd Floor                   | 2                | EA  | 7    | 6-10 years  |          |  |  |  |
|        | -                           |                             |                  |     |      | -           |          |  |  |  |

Campus Name: Pulaski Page : 32 of 41 Assessment Date: 07/19/2021



| Item - Type Partitions Urinals Walls - Tile Water Closet | <b>Location</b> 2nd Floor 2nd Floor  | Quantity    | uilding     |             | Recommend   |             |
|--|--|-------------|-------------|-------------|-------------|-------------|
| Partitions<br>Urinals<br>Walls - Tile                    | 2nd Floor  | -           | HOM         | I           |             |             |
| Urinals<br>Walls - Tile                                  |  | 2           | OCIVI       | Rank        | Replacement | Comments    |
| Walls - Tile   | 2nd Floor  | 2           | EA          | 7           | 6-10 years  |             |
|  | 2110 [100]   | 3           | EA          | 6           | 6-10 years  |             |
| Water Closet   | 2nd Floor  | 580         | SF          | 6           | 6-10 years  |             |
| Water Closet   | 2nd Floor  | 2           | EA          | 6           | 6-10 years  |             |
| Accessories  | 2nd Floor  | 55          | SF          | 7           | 6-10 years  |             |
| Ceiling - Lay-in   | 2nd Floor  | 55          | SF          | 6           | 6-10 years  |             |
| Doors - Steel Doors incl hw                              | 2nd Floor  | 1           | EΑ          | 6           | 6-10 years  |             |
| Floor - Tile   | 2nd Floor  | 55          | SF          | 6           |             |             |
| Floor Drain  | 2nd Floor  | 1           |             |             |             |             |
|  |  | 1           |             |             |             |             |
|  |  | 1           |             |             |             |             |
| Walls - Tile   |  | 266         |             |             |             |             |
|  |  | 1           |             | _           |             |             |
|  |  | ·           |             |             | ·           |             |
| : Classroom  |  | В           | uilding     | : Annex     |             |             |
| Itom Type  | Location   | Quantity    | ПОМ         | Donk        |             | Comments    |
|  | Location   | Quantity    | UOW         | Rank        | Replacement | Comments    |
| ` ,  | 4 . =  |             |             |             | 0.40        |             |
|  |  |             |             |             | •           |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             | •           |             |
| Walls - Plaster/Drywall                                  | 1st Floor  | 1,390       | SF          | 6           | 6-10 years  |             |
| n #002 (Kindergarten)                                    |  |             |             |             |             |             |
| ` <i>y</i>   | 1st Floor  | 1.490       | SF          | 6           | 6-10 years  |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
|  |  |             |             | _           |             |             |
|  |  |             |             | _           |             | Damaged     |
|  |  |             |             |             |             | Damagod     |
| Storage/ Closet  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
|  |  |             |             |             |             |             |
| Work Clink   | 1001   | ·           | _/\         | Ü           | 2 0 youro   |             |
| n #003 (Kindergarten)                                    |  |             |             |             |             |             |
| Casework   |  |             |             |             |             |             |
|  |  |             |             | 6           |             |             |
|  | 1st Floor  | 20          |             | 4           | 2-5 years   |             |
| Doors - Steel Doors incl hw                              | 1st Floor  | 2           | EA          | 6           | 6-10 years  |             |
| Floor - Tile   | 1st Floor  | 1,240       | SF          | 6           | 6-10 years  |             |
|  | Floor Drain Lavatory Lighting - Lay-in Walls - Tile Water Closet  7: Classroom  Item - Type L#001 (Kindergarten) Casework Ceiling - Lay-in Chalk Board Doors - Steel Doors incl hw Floor - Tile Lighting - Lay-in Walls - Plaster/Drywall  L#002 (Kindergarten) Ceiling - Lay-in Chalk Board Doors - Steel Doors incl hw Floor - Tile Lighting - Lay-in Chalk Board Doors - Steel Doors incl hw Floor - Tile Lighting - Lay-in Storage/ Closet Walls - Plaster/Drywall Work Sink  L#003 (Kindergarten) Casework Ceiling - Lay-in Chalk Board Doors - Steel Doors incl hw | Floor Drain |

Campus Name: Pulaski Page : 33 of 41 Assessment Date: 07/19/2021



| Outogo   | ry : Classroom                             |                        | В                                     | uilding  | : Annex | •           |                            |
|----------|--|------------------------|---------------------------------------|----------|---------|-------------|----------------------------|
| _        |  |                        |                                       | _        |         | Recommend   |                            |
| Group    | Item - Type                                | Location               | Quantity                              | UOM      | Rank    | Replacement | Comments                   |
|          | Floor - Tile                               | 1st Floor              | 250                                   | SF       | 5       | 1-2 years   | Separating                 |
|          | Lighting - Lay-in                          | 1st Floor              | 20                                    | EA       | 6       | 6-10 years  |                            |
|          | Walls - Plaster/Drywall                    | 1st Floor              | 1,390                                 | SF       | 6       | 6-10 years  |                            |
| Classroo | om #004 (Regular Classroom)                |                        |                                       |          |         |             |                            |
|          | Ceiling - Lay-in                           | 1st Floor              | 730                                   | SF       | 6       | 6-10 years  |                            |
|          | Ceiling - Lay-in                           | 1st Floor              | 10                                    | SF       | 5       | 1-2 years   | Damaged                    |
|          | Doors - Steel Doors incl hw                | 1st Floor              | 1                                     | EA       | 6       | 6-10 years  | Damagoa                    |
|          | Floor - Tile                               | 1st Floor              | 740                                   | SF       | 6       | 6-10 years  |                            |
|          | Lighting - Lay-in                          | 1st Floor              | 10                                    | EA       | 7       | 6-10 years  |                            |
|          | Walls - Plaster/Drywall                    | 1st Floor              | 980                                   | SF       | 6       | 6-10 years  |                            |
| Classroo | nm #005 (Regular Classroom)                |                        |                                       |          |         |             |                            |
| 2.000,00 | Casework                                   | 1st Floor              | 12                                    | LF       | 6       | 6-10 years  |                            |
|          | Casework<br>Ceiling - Lay-in               | 1st Floor              | 740                                   | SF       | 6       | 6-10 years  |                            |
|          | Chalk Board                                | 1st Floor              | 10                                    | LF       | 4       | 2-5 years   |                            |
|          | Doors - Steel Doors incl hw                | 1st Floor              | 10                                    | EA       | 6       | 6-10 years  |                            |
|          |  | 1st Floor              | · · · · · · · · · · · · · · · · · · · | SF       | _       | •           |                            |
|          | Floor - Tile                               |                        | 740                                   | SF<br>EA | 6       | 6-10 years  |                            |
|          | Lighting - Lay-in                          | 1st Floor              | 10                                    |          | 7       | 6-10 years  |                            |
|          | Marker Board                               | 1st Floor              | 10                                    | LF       | 7       | 6-10 years  |                            |
|          | Storage/ Closet<br>Walls - Plaster/Drywall | 1st Floor<br>1st Floor | 85<br>980                             | SF<br>SF | 7<br>6  | 6-10 years  |                            |
|          | walls - Plaster/Drywall                    | 1St Floor              | 980                                   | SF       | ь       | 6-10 years  |                            |
| Classroo | om #006 (Store Room)                       |                        |                                       |          |         |             |                            |
|          | Ceiling - Lay-in                           | 1st Floor              | 740                                   | SF       | 7       | 10+ years   |                            |
|          | Chalk Board                                | 1st Floor              | 8                                     | LF       | 4       | 2-5 years   | Chalk board behind. Screen |
|          | Doors - Wood Doors inclu hw                | 1st Floor              | 1                                     | EA       | 6       | 10+ years   |                            |
|          | Floor - Tile/Sheet                         | 1st Floor              | 740                                   | SF       | 7       | 10+ years   |                            |
|          | Lighting - Lay-in                          | 1st Floor              | 10                                    | EA       | 7       | 10+ years   |                            |
|          | Walls - Plaster/Drywall                    | 1st Floor              | 980                                   | SF       | 7       | 10+ years   |                            |
| Classroo | om #007 (Regular Classroom)                |                        |                                       |          |         |             |                            |
|          | Casework                                   | 2nd Floor              | 30                                    | LF       | 6       | 6-10 years  |                            |
|          | Ceiling - Lay-in                           | 2nd Floor              | 730                                   | SF       | 6       | 6-10 years  |                            |
|          | Chalk Board                                | 2nd Floor              | 20                                    | LF       | 4       | 2-5 years   |                            |
|          | Doors - Wood Doors inclu hw                | 2nd Floor              | 1                                     | EA       | 6       | 6-10 years  |                            |
|          | Floor - Tile                               | 2nd Floor              | 730                                   | SF       | 6       | 6-10 years  |                            |
|          | Lighting - Lay-in                          | 2nd Floor              | 10                                    | ĒΑ       | 6       | 6-10 years  |                            |
|          | Walls - Plaster/Drywall                    | 2nd Floor              | 972                                   | SF       | 6       | 6-10 years  |                            |
|          | Work Sink                                  | 2nd Floor              | 1                                     | ĒΑ       | 7       | 6-10 years  |                            |
| Classroo | m #008 (Regular Classroom)                 |                        |                                       |          |         |             |                            |
|          | Ceiling - Lay-in                           | 2nd Floor              | 730                                   | SF       | 6       | 6-10 years  |                            |

Campus Name: Pulaski Page : 34 of 41 Assessment Date: 07/19/2021



| Catego   | ry : Classroom              |           | В        | uilding  | : Annex |                          |          |
|----------|-----------------------------|-----------|----------|----------|---------|--------------------------|----------|
| _        |                             |           |          | _        |         | Recommend                |          |
| Group    | Item - Type                 | Location  | Quantity | UOM      | Rank    | Replacement              | Comments |
|          | Chalk Board                 | 2nd Floor | 10       | LF       | 4       | 2-5 years                |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6       | 6-10 years               |          |
|          | Floor - Tile                | 2nd Floor | 730      | SF       | 6       | 6-10 years               |          |
|          | Lighting - Lay-in           | 2nd Floor | 10       | EA       | 7       | 6-10 years               |          |
|          | Marker Board                | 2nd Floor | 10       | LF       | 7       | 6-10 years               |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 972      | SF       | 6       | 6-10 years               |          |
| Classroo | om #009 (Regular Classroom) |           |          |          |         |                          |          |
|          | Casework                    | 2nd Floor | 21       | LF       | 6       | 6-10 years               |          |
|          | Ceiling - Lay-in            | 2nd Floor | 742      | SF       | 6       | 6-10 years               |          |
|          | Chalk Board                 | 2nd Floor | 20       | LF       | 4       | 2-5 years                |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6       | 6-10 years               |          |
|          | Floor - Tile                | 2nd Floor | 12       | SF       | 6       | 2-5 years                |          |
|          | Floor - Tile                | 2nd Floor | 718      | SF       | 6       | 6-10 years               |          |
|          | Lighting - Lay-in           | 2nd Floor | 10       | EA       | 7       | •                        |          |
|          |                             |           |          | SF       |         | 6-10 years               |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 960      | SF<br>SF | 6<br>6  | 6-10 years               |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 20       | SF       | ь       | 2-5 years                |          |
| Classroo | om #010 (Regular Classroom) |           |          |          |         |                          |          |
|          | Casework                    | 2nd Floor | 25       | LF       | 6       | 6-10 years               |          |
|          | Ceiling - Lay-in            | 2nd Floor | 708      | SF       | 6       | 6-10 years               |          |
|          | Chalk Board                 | 2nd Floor | 20       | LF       | 4       | 2-5 years                |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 7       | 6-10 years               |          |
|          | Floor - Tile                | 2nd Floor | 708      | SF       | 5       | 2-5 years                |          |
|          | Lighting - Lay-in           | 2nd Floor | 10       | EA       | 7       | 6-10 years               |          |
|          | Storage/ Closet             | 2nd Floor | 120      | SF       | 7       | 6-10 years               |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 958      | SF       | 6       | 6-10 years               |          |
|          | Work Sink                   | 2nd Floor | 1        | EA       | 5       | 6-10 years               |          |
| Classroo | om #011 (Regular Classroom) |           |          |          |         |                          |          |
|          | Casework                    | 2nd Floor | 21       | LF       | 6       | 6-10 years               |          |
|          | Ceiling - Lay-in            | 2nd Floor | 744      | SF       | 6       | 6-10 years               |          |
|          | Doors - Wood Doors inclu hw | 2nd Floor | 1        | EA       | 6       | 6-10 years               |          |
|          | Floor - Tile                | 2nd Floor | 724      | SF       | 6       | 6-10 years               |          |
|          | Floor - Tile                | 2nd Floor | 10       | SF       | 6       | 6-10 years               |          |
|          | Lighting - Lay-in           | 2nd Floor | 10       | EA       | 7       | 6-10 years               |          |
|          | Marker Board                | 2nd Floor | 6        | LF       | 7       |                          |          |
|          | Walls - Plaster/Drywall     | 2nd Floor | 982      | SF       | 6       | 6-10 years<br>6-10 years |          |
| OI-      | - 1040 (Damilar O           |           |          |          |         | -                        |          |
| Classro  | om #012 (Regular Classroom) |           |          |          |         |                          |          |
|          | Casework                    | 2nd Floor | 15       | LF       | 6       | 6-10 years               |          |
|          | Ceiling - Lay-in            | 2nd Floor | 730      | SF       | 6       | 6-10 years               |          |
|          | Chalk Board                 | 2nd Floor | 10       | LF       | 4       | 2-5 years                |          |
|          |                             |           |          |          |         |                          |          |

Campus Name: Pulaski Page : 35 of 41 Assessment Date: 07/19/2021



Category: Classroom

# Pulaski International School of Chicago 2230 W McLean AVENUE, Chicago, IL 60647

| Group     | Item - Type                          | Location    | Quantity | UOM     | Rank     | Replacement | Comments |
|-----------|--------------------------------------|-------------|----------|---------|----------|-------------|----------|
|           | Doors - Wood Doors inclu hw          | 2nd Floor   | 1        | EΑ      | 6        | 6-10 years  |          |
|           | Floor - Tile                         | 2nd Floor   | 730      | SF      | 5        | 2-5 years   |          |
|           | Lighting - Lay-in                    | 2nd Floor   | 10       | EA      | 7        | 6-10 years  |          |
|           | Marker Board                         | 2nd Floor   | 10       | LF      | 7        | 6-10 years  |          |
|           | Walls - Plaster/Drywall              | 2nd Floor   | 972      | SF      | 6        | 6-10 years  |          |
|           | •                                    |             |          |         |          | •           |          |
| Classroo  | om #013 (Regular Classroom)          |             |          |         |          |             |          |
|           | Casework                             | 2nd Floor   | 18       | LF      | 6        | 6-10 years  |          |
|           | Ceiling - Lay-in                     | 2nd Floor   | 708      | SF      | 6        | 6-10 years  |          |
|           | Doors - Wood Doors inclu hw          | 2nd Floor   | 1        | EA      | 6        | 6-10 years  |          |
|           | Floor - Tile                         | 2nd Floor   | 708      | SF      | 6        | 6-10 years  |          |
|           | Lighting - Lay-in                    | 2nd Floor   | 10       | EA      | 7        | 6-10 years  |          |
|           | Marker Board                         | 2nd Floor   | 10       | LF      | 7        | 6-10 years  |          |
|           | Walls - Plaster/Drywall              | 2nd Floor   | 958      | SF      | 6        | 6-10 years  |          |
|           | •                                    |             |          |         |          | •           |          |
| Classroo  | om #014 (Regular Classroom)          |             |          |         |          |             |          |
|           | Casework                             | 2nd Floor   | 18       | LF      | 6        | 6-10 years  |          |
|           | Ceiling - Lay-in                     | 2nd Floor   | 665      | SF      | 6        | 6-10 years  |          |
|           | Doors - Wood Doors inclu hw          | 2nd Floor   | 1        | EΑ      | 6        | 6-10 years  |          |
|           | Floor - Tile                         | 2nd Floor   | 640      | SF      | 6        | 6-10 years  |          |
|           | Floor - Tile                         | 2nd Floor   | 25       | SF      | 5        | 1-2 years   | Damaged  |
|           | Lighting - Lay-in                    | 2nd Floor   | 10       | EA      | 7        | 6-10 years  |          |
|           | Marker Board                         | 2nd Floor   | 6        | LF      | 7        | 6-10 years  |          |
|           | Walls - Plaster/Drywall              | 2nd Floor   | 930      | SF      | 6        | 6-10 years  |          |
| Catego    | ry : Interior                        |             | R        | uildina | : Annex  | •           |          |
| Catego    | iy . Interior                        |             |          | ununig  | . Alliex | Recommend   |          |
| Group     | Item - Type                          | Location    | Quantity | UOM     | Rank     | Replacement | Comments |
| -         |                                      | Location    | Quantity | OCIVI   | Ivalik   | Replacement | Comments |
| _Corridor | Ceiling - Lay-in                     | 1st Floor   | 1,871    | SF      | 6        | 6-10 years  |          |
|           | Drinking Fountains - Triple Fountain | 1st Floor   | 1,071    | EA      | 7        | 6-10 years  |          |
|           | Floor - Tile/Sheet                   | 1st Floor   | 1,831    | SF      | 5        | 6-10 years  |          |
|           | Floor - Tile/Sheet                   | 1st Floor   | 40       | SF      | 4        | 1-2 years   | Damaged  |
|           | Lighting - Lay-in                    | 1st Floor   | 15       | EA      | 6        | 6-10 years  | Damagea  |
|           | Walls - Plaster/Drywall              | 1st Floor   | 1,557    | SF      | 6        | 6-10 years  |          |
|           | Ceiling - Lay-in                     | 2nd Floor   | 1,667    | SF      | 6        | 6-10 years  |          |
|           | Ceiling - Lay-in                     | 2nd Floor   | 48       | SF      | 4        | 1-2 years   |          |
|           | Drinking Fountains - Double Fountain | 2nd Floor   | 1        | EA      | 7        | 6-10 years  |          |
|           | Floor - Tile/Sheet                   | 2nd Floor   | 1,703    | SF      | 5        | 6-10 years  |          |
|           | Floor - Tile/Sheet                   | 2nd Floor   | 12       | SF      | 4        | 1-2 years   | Cracks   |
|           | Lighting - Lay-in                    | 2nd Floor   | 12       | EA      | 6        | 6-10 years  |          |
|           | Walls - Plaster/Drywall              | 2nd Floor   | 1,490    | SF      | 6        | 6-10 years  |          |
|           | vvano i lacion/Drywan                | 2110 1 1001 | 1,-30    | O.      | J        | o io yours  |          |

**Building: Annex** 

Recommend



| Catego  | ry : Interior           |                 | В        | uilding | : Annex |             |               |
|---------|-------------------------|-----------------|----------|---------|---------|-------------|---------------|
|         |                         |                 |          |         |         | Recommend   |               |
| Group   | Item - Type             | Location        | Quantity | UOM     | Rank    | Replacement | Comments      |
| Safety  |                         |                 |          |         |         |             |               |
| ,       | Security Cameras        | Entire Building | 4        | EA      | 7       | 6-10 years  |               |
|         | Security Cameras        | Entire Building | 2        | EA      | 7       | 6-10 years  |               |
| _Stairs |                         |                 |          |         |         |             |               |
|         | Ceiling - Lay-in        | Stair 1         | 209      | SF      | 6       | 6-10 years  |               |
|         | Floor - Terrazzo        | Stair 1         | 241      | SF      | 6       | 6-10 years  |               |
|         | Floor - Tile            | Stair 1         | 5        | SF      | 5       | 0-1 year    | Missing tiles |
|         | Handrails               | Stair 1         | 40       | LF      | 7       | 6-10 years  | •             |
|         | Lighting - Lay-in       | Stair 1         | 4        | EA      | 6       | 6-10 years  |               |
|         | Lighting - Wall Mounted | Stair 1         | 1        | EA      | 6       | 6-10 years  |               |
|         | Stairs - Tile           | Stair 1         | 19       | LF      | 6       | 6-10 years  |               |
|         | Walls - Plaster/Drywall | Stair 1         | 725      | SF      | 6       | 6-10 years  |               |
|         | Ceiling - Lay-in        | Stair 2         | 209      | SF      | 6       | 6-10 years  |               |
|         | Floor - Tile            | Stair 2         | 246      | SF      | 6       | 6-10 years  |               |
|         | Handrails               | Stair 2         | 40       | LF      | 5       | 2-5 years   |               |
|         | Lighting - Lay-in       | Stair 2         | 5        | EA      | 6       | 6-10 years  |               |
|         | Stairs - Terrazzo       | Stair 2         | 19       | LF      | 6       | 6-10 years  |               |
|         | Walls - Plaster/Drywall | Stair 2         | 705      | SF      | 6       | 6-10 years  |               |
|         | Walls - Plaster/Drywall | Stair 2         | 20       | SF      | 6       | 6-10 years  |               |



| Category : Site | Building : Site |
|-----------------|-----------------|
|                 |                 |

| thlefic Surf Goa Surf ivil/Drainage Civil Civil Civil Civil encing Fencing Fencing andscape Ben Land Land Land Ligh Park   | rface - Synthetic alpost rface - Synthetic alpost rface - Synthetic  ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  ncing - Chain Link ncing - New Standard Ornamental   | East West West West  Entire Site | 2 1 1 1 1 8  | SF<br>EA<br>SF                   | 7 7 7 5 5 6 6 6            | Recommend<br>Replacement  10+ years 10+ years 10+ years 2-5 years 2-5 years 10+ years 10+ years | Comments |
|--|--|--|--|----------------------------------|----------------------------|---|----------|
| Athletic Surf Goa Surf Civil/Drainage Civil Civil Civil Civil Civil Fencing Fencing Ben Land Land Land Ligh Park   | rface - Synthetic alpost rface - Synthetic | East West West  Entire Site Entire Site Entire Site Entire Site Entire Site Entire Site                  | 3,050<br>2<br>14,200<br>2<br>1<br>1<br>1<br>1<br>8 | SF<br>EA<br>SF                   | 7<br>7<br>7<br>7<br>5<br>5 | 10+ years<br>10+ years<br>10+ years<br>2-5 years<br>2-5 years<br>10+ years                      | Comments |
| Surf<br>Goa<br>Surf<br>Civil/Drainage<br>Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Fencing<br>Fencing<br>Fencing   | alpost rface - Synthetic  e ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  | West West  Entire Site Entire Site Entire Site Entire Site Entire Site Entire Site                       | 2<br>14,200<br>2<br>1<br>1<br>1<br>1<br>8          | EA<br>SF<br>EA<br>EA<br>EA<br>EA | 7<br>7<br>7<br>5<br>5<br>6 | 10+ years<br>10+ years<br>10+ years<br>2-5 years<br>2-5 years<br>10+ years                      |          |
| Goa<br>Surf<br>Civil/Drainage<br>Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Fancing<br>Landscape<br>Landscape<br>Landscape<br>Landscape   | alpost rface - Synthetic  e ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  | West West  Entire Site Entire Site Entire Site Entire Site Entire Site Entire Site                       | 2<br>14,200<br>2<br>1<br>1<br>1<br>1<br>8          | EA<br>SF<br>EA<br>EA<br>EA<br>EA | 7<br>7<br>7<br>5<br>5<br>6 | 10+ years<br>10+ years<br>10+ years<br>2-5 years<br>2-5 years<br>10+ years                      |          |
| Surf Civil/Drainage Civil Civil Civil Civil Civil Fencing Fencing Fencing Landscape Landscape Landscape Landscape Landscape Landscape Landscape  | rface - Synthetic  e  ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  | Entire Site Entire Site Entire Site Entire Site Entire Site Entire Site                                  | 14,200<br>2<br>1<br>1<br>1<br>8                    | EA<br>EA<br>EA<br>EA             | 7<br>7<br>5<br>5<br>6      | 10+ years 10+ years 2-5 years 2-5 years 10+ years   |          |
| Civil/Drainage. Civil Civil Civil Civil Civil Fencing Fencing Fencing Landscape Landscape Landscape Landscape  | ril/ Drainage - Catch Basin<br>ril/ Drainage - Catch Basin<br>ril/ Drainage - Catch Basin<br>ril/ Drainage - Site Drain<br>ril/ Drainage - Site Manhole  | Entire Site Entire Site Entire Site Entire Site Entire Site  | 2<br>1<br>1<br>1<br>8                              | EA<br>EA<br>EA                   | 7<br>5<br>5<br>6           | 10+ years<br>2-5 years<br>2-5 years<br>10+ years  |          |
| Civil<br>Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Landscape<br>Landscape<br>Landscape<br>Landscape<br>Landscape<br>Landscape  | vil/ Drainage - Catch Basin vil/ Drainage - Catch Basin vil/ Drainage - Catch Basin vil/ Drainage - Site Drain vil/ Drainage - Site Manhole ncing - Chain Link   | Entire Site Entire Site Entire Site Entire Site  | 1<br>1<br>1<br>8                                   | EA<br>EA<br>EA                   | 5<br>5<br>6                | 2-5 years<br>2-5 years<br>10+ years   |          |
| Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Landscape<br>Bencing<br>Landscape<br>Landscape   | ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole ncing - Chain Link   | Entire Site Entire Site Entire Site Entire Site  | 1<br>1<br>1<br>8                                   | EA<br>EA<br>EA                   | 5<br>5<br>6                | 2-5 years<br>2-5 years<br>10+ years   |          |
| Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Landscape<br>Bencing<br>Landscape<br>Landscape   | ril/ Drainage - Catch Basin ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole ncing - Chain Link   | Entire Site Entire Site Entire Site  Entire Site   |  | EA<br>EA                         | 5<br>6                     | 2-5 years<br>2-5 years<br>10+ years   |          |
| Civil<br>Civil<br>Civil<br>Fencing<br>Fencing<br>Fencing<br>Landscape<br>Bencing<br>Landscape<br>Landscape<br>Landscape  | ril/ Drainage - Catch Basin ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  | Entire Site Entire Site Entire Site  |  | EA                               | 5<br>6                     | 2-5 years<br>10+ years  |          |
| Civil<br>Civil<br>Fencing<br>Fencing<br>Landscape<br>Bencing<br>Landscape<br>Landscape<br>Bencing<br>Landscape   | ril/ Drainage - Site Drain ril/ Drainage - Site Manhole  | Entire Site Entire Site Entire Site  |  | EA                               | 6                          | 10+ years   |          |
| Civil Fencing Fencing Landscape Bencing Landscape Landscape Landscape  | ril/ Drainage - Site Manhole   | Entire Site  Entire Site   |  |                                  |                            |   |          |
| Fencing Fencing Landscape Bencing Landscape Landscape Landscape  | ncing - Chain Link   |  | 28   |                                  |                            | , , , , , ,   |          |
| Fen<br>Fen<br>Landscape<br>Ben<br>Land<br>Land<br>Ligh<br>Park   |  |  | 28   |                                  |                            |   |          |
| Fendandscape Ben Landscape |  |  | 28   |                                  |                            |   |          |
| Landscape<br>Ben<br>Land<br>Land<br>Land<br>Ligh<br>Park   | ncing - New Standard Ornamental  | Entiro Sito  |  | LF                               | 6                          | 10+ years   |          |
| Ben<br>Land<br>Land<br>Land<br>Ligh<br>Park  |  | Entire Site  | 2,013  | LF                               | 6                          | 10+ years   |          |
| Ben<br>Land<br>Land<br>Land<br>Ligh<br>Park  |  |  |  |                                  |                            |   |          |
| Land<br>Land<br>Land<br>Ligh<br>Park   | nches  | Entire Site  | 11   | EA                               | 7                          | 6-10 years  |          |
| Land<br>Land<br>Ligh<br>Park   | ndscape - Grass  | Entire Site  | 5,519  | SF                               | 6                          | 6-10 years  |          |
| Land<br>Ligh<br>Park   | ndscape - Hardscape- Concrete  | Entire Site  | 2,550  | SF                               | 7                          | 10+ years   |          |
| Ligh<br>Park   | ndscape - Mulch  | Entire Site  | 3,400  | SF                               | 5                          | 2-5 years   |          |
| Park   | hting - Pole Mounted   | Entire Site  | 3  | EA                               | 6                          | 6-10 years  |          |
|  | rkway trees  | Entire Site  | 48   | EΑ                               | 6                          | 10+ years   |          |
| i iai  | anting Beds/ Area  | Entire Site  | 8,798  | SF                               | 6                          | 2-5 years   |          |
| Dlav   | ny Area - Hardscape- Asphalt   | Entire Site  | 3,932  | SF                               | 6                          | 10+ years   |          |
|  | y Area - Hardscape- Asphalt  | Entire Site  | 10   | SF                               | 5                          | 2-5 years   |          |
|  |  |  | 50   | SF                               | 6                          |   |          |
|  | taining Wall - Concrete  | Entire Site  |  |                                  | _                          | 10+ years   |          |
|  | taining Wall - Concrete  | Entire Site  | 148  | SF                               | 5                          | 10+ years   |          |
|  | taining Wall - Masonry   | Entire Site  | 130  | SF                               | 6                          | 10+ years   |          |
|  | taining Wall - Masonry   | Entire Site  | 60   | SF                               | 5                          | 10+ years   |          |
| Iras   | ash Receptacles  | Entire Site  | 3  | EA                               | 6                          | 6-10 years  |          |
| Parking Lot  |  |  |  |                                  |                            |   |          |
|  | ncrete Curbs   | NW site  | 953  | LF                               | 6                          | 10+ years   |          |
|  | erior Plantings  | NW site  | 45   | LF                               | 6                          | 6-10 years  |          |
|  | hting - Pole Mounted   | NW site  | 4  | ĒΑ                               | 6                          | 6-10 years  |          |
|  |  | NW site  | 17,587   | SF                               | 5                          | 2-5 years   |          |
|  | rtace - Asphait  | NW site  | 861  | SF                               | 6                          | 6-10 years  |          |
| Veh  | rface - Asphalt<br>ash Enclosure - Chain Links   | NW site  | 177  | LF                               | 6                          | 6-10 years  |          |

Campus Name: Pulaski Page : 38 of 41 Assessment Date: 07/19/2021



#### **Pulaski International School of Chicago**

2230 W McLean AVENUE, Chicago, IL 60647


| Catego    | ry : Site                                   |                   | В        | uilding | : Site |             |          |
|-----------|---|-------------------|----------|---------|--------|-------------|----------|
|           |   |                   |          |         |        | Recommend   |          |
| Group     | Item - Type                                 | Location          | Quantity | UOM     | Rank   | Replacement | Comments |
|           | Equipment - Combo 3-12                      | Central Courtyard | 1        | EA      | 6      | 6-10 years  |          |
|           | Surface - Poured Surface                    | Central Courtyard | 2,441    | SF      | 6      | 6-10 years  |          |
|           | Equipment - Pre K 3-5                       | East              | 1        | EA      | 6      | 6-10 years  |          |
|           | Surface - Poured Surface                    | East              | 1,665    | SF      | 6      | 10+ years   |          |
| _Sidewalk | s   |                   |          |         |        |             |          |
|           | Sidewalks - Internal Walks                  | Entire Site       | 440      | LF      | 6      | 10+ years   |          |
|           | Sidewalks - Internal Walks                  | Entire Site       | 5        | LF      | 5      | 2-5 years   |          |
|           | Sidewalks - Perimeter Sidewalks             | Entire Site       | 18,566   | SF      | 6      | 10+ years   |          |
| Signage   |   |                   |          |         |        |             |          |
| 0 0       | Flag Pole - Building Mounted Flag Pole      | South             | 1        | EA      | 6      | 6-10 years  |          |
|           | Marquee - Free Standing Back Lighted        | South             | 1        | EA      | 6      | 6-10 years  |          |
|           | Monument - Building Mounted Cut Letter Sign | South             | 3        | EA      | 6      | 10+ years   |          |

#### **Definitions**

- Quantity means, for each item, the total number (or amount) of that item that exists and was evaluated
- Unit means the generally accepted standard unit of measure for each item. Some items, like doors, are measured individually and use the unit of measurement "EA" for "each." Other items, like chimneys, are measured in terms of linear feet ("LF"). Still other items, like flooring, are generally measured in square feet ("SF").

Campus Name: Pulaski Page : 39 of 41 Assessment Date: 07/19/2021

<sup>&</sup>lt;sup>1</sup> It is very rare for assessors to find a feature in this condition. If assessors do, they are required to report it to CPS right away, and CPS facilities will address it immediately. As a result, no features should be ranked "1" in this report; by the time the report is compiled, they will have been resolved.

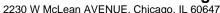



**Classroom Summary** 

| Classroom Summary |                         |               |        | Floor Plan |       | Glazed | Operable |        |        |
|-------------------|-------------------------|---------------|--------|------------|-------|--------|----------|--------|--------|
|                   |                         |               | Room   | Room       | Area  | Window | Window   | Window | Smart- |
| Current Usage     | Intended Usage          | Room Location | Number | Number     | (SF)  | Area   | Area     | Stop   | Board  |
| Building : Main   |                         |               |        |            |       |        |          |        |        |
| Art Room          | Regular Classroom       | 2nd Floor     | 207    | 207        | 700   | 144    | 24       | Υ      | N      |
| Computer Lab      | Regular Classroom       | 2nd Floor     | 205    | 205        | 700   | 144    | 24       | Υ      | Υ      |
| Kindergarten      | Kindergarten            | 1st Floor     | 105    | 105        | 898   | 182    | 60       | Υ      | N      |
| Kindergarten      | Kindergarten            | 1st Floor     | 108    | 108        | 809   | 182    | 60       | Υ      | N      |
| Music Room        | Lunch Room              | 1st Floor     | 114    | Lunchroom  | 1,042 | 234    | 60       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 1st Floor     | 110    | 110        | 898   | 208    | 104      | N      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 200    | 200        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 203    | 203        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 204    | 204        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 208    | 208        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 209    | 209        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 211    | 211        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 2nd Floor     | 213    | 213        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 300    | 300        | 700   | 148    | 24       | N      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 301    | 301        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 302    | 302        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 304    | 304        | 700   | 148    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 305    | 305        | 700   | 148    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 306    | 306        | 700   | 148    | 24       | N      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 309    | 309        | 710   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 310    | 310        | 710   | 148    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 311    | 311        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 312    | 312        | 710   | 105    | 24       | Y      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 313    | 313        | 700   | 144    | 24       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 3rd Floor     | 314    | 314        | 710   | 48     | 24       | Y      | N      |
| Science           | Regular Classroom       | 3rd Floor     | 303    | 303        | 710   | 144    | 24       | Y      | N      |
| Science           | Science                 | 3rd Floor     | 307    | 307        | 700   | 148    | 24       | Y      | N      |
| Special Education | Office                  | 3rd Floor     | 308    | 308        | 390   | 74     | 12       | Y      | N      |
| Special Education | Regular Classroom       | 2nd Floor     | 206    | 206        | 700   | 144    | 24       | Y      | N      |
|                   | 1 -9                    |               |        | 1          |       |        |          |        |        |
| Building : Annex  |                         |               |        |            |       |        |          |        |        |
| Kindergarten      | Regular Classroom       | 1st Floor     | 001    | 136, 137   | 1,490 | 180    | 90       | Υ      | N      |
| Kindergarten      | Regular Classroom       | 1st Floor     | 002    | 138, 139   | 1,490 | 180    | 90       | Υ      | N      |
| Kindergarten      | Regular Classroom       | 1st Floor     | 003    | 107, 108   | 1,490 | 162    | 81       | Υ      | N      |
| Regular Classroom | Other Instructional Use | 2nd Floor     | 013    | 206        | 708   | 90     | 45       | Υ      | N      |
| Regular Classroom | Other Instructional Use | 2nd Floor     | 014    | 206        | 665   | 90     | 45       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 1st Floor     | 004    | 109        | 740   | 90     | 45       | Υ      | N      |
| Regular Classroom | Regular Classroom       | 1st Floor     | 005    | 110        | 740   | 90     | 45       | Υ      | N      |



**Classroom Summary** 

| Current Usage     | Intended Usage    | Room Location | Room<br>Number | Floor Plan<br>Room<br>Number | Area<br>(SF) | Glazed<br>Window<br>Area | Operable<br>Window<br>Area | Window<br>Stop | Smart-<br>Board |
|-------------------|-------------------|---------------|----------------|------------------------------|--------------|--------------------------|----------------------------|----------------|-----------------|
| Regular Classroom | Regular Classroom | 2nd Floor     | 007            | 215                          | 730          | 90                       | 45                         | Υ              | N               |
| Regular Classroom | Regular Classroom | 2nd Floor     | 800            | 216                          | 730          | 90                       | 45                         | Υ              | N               |
| Regular Classroom | Regular Classroom | 2nd Floor     | 009            | 217                          | 742          | 90                       | 45                         | Υ              | N               |
| Regular Classroom | Regular Classroom | 2nd Floor     | 010            | 218                          | 708          | 90                       | 45                         | Υ              | N               |
| Regular Classroom | Regular Classroom | 2nd Floor     | 011            | 204                          | 744          | 90                       | 45                         | Υ              | N               |
| Regular Classroom | Regular Classroom | 2nd Floor     | 012            | 205                          | 730          | 90                       | 45                         | Y              | N               |
| Store Room        | Regular Classroom | 1st Floor     | 006            |                              | 740          | 90                       | 45                         |                |                 |

Campus Name: Pulaski Page : 41 of 41 Assessment Date: 07/19/2021