

Facility Assessment Report

This report contains the detailed findings of the facility condition assessment completed on the date noted in the document footer. Assessors rate each facility item by visual observation only; they do not test the operation of equipment or perform destructive testing of walls, ceilings, or floors. Each facility item is ranked on a 7-point scale: a rank 7 means the item is new or in like-new condition and no work is required while rank 1 means the item has failed and has led to an immediate life safety condition. The remaining ranks generally mean that the item requires regular maintenance (rank 5 or 6) or full replacement (rank 2, 3 or 4). To enhance reporting and capital planning analysis, each assessed item must also be assigned a recommended replacement range (used to specify the time span, in years, before replacement is recommended). Definitions for Quantity and Unit of Measure (UOM) can be found at the end of this report.

For additional detail and definition on rank values as they relate to each assessed item or the recommended replacement range, please visit the "CPS Guide to Biennial Facility Assessments" found on the Facilities Standards webpage under CPS Policies and Guidelines at http://www.cps.edu/facilityassessment.

Campus Summary			
BuildingName	Year Constructed	Number of Floors	Building Area (Sq Ft)
Main	1927	4	156,248
Campus Total			156,248

Category : Exterior Building : Main


	.y . Exterior			ununig		Recommend	
up	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
ance	}		<u> </u>				
	Entrance Control - Audio and Video	Door 1 - Northeast	1	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 1 - Northeast	2	EΑ	6	10+ years	
	Exterior Doors - Side lite	Door 1 - Northeast	2	EA	7	10+ years	
	Exterior Doors - Transom Lite	Door 1 - Northeast	3	EA	6	10+ years	
	Exterior Stairs - Concrete	Door 1 - Northeast	12	LF	6	10+ years	
	Exterior Stairs - Stone	Door 1 - Northeast	48	LF	5	10+ years	
	Power Door Operator and Controls	Door 1 - Northeast	2	EΑ	7	10+ years	
	Ramp Handrail - Steel_Ramp Handrail	Door 1 - Northeast	60	LF	7	6-10 years	Repaired
	Ramps - Concrete	Door 1 - Northeast	38	LF	6	10+ years	•
	Ramps - Concrete	Door 1 - Northeast	2	LF	4	0-1 year	Concrete base chipped
	Stair Handrail - Steel_Stair Handrail	Door 1 - Northeast	30	LF	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 10 - Southeast	2	EA	7	10+ years	
	Exterior Doors - Exterior Steel Door	Door 11 - Southeast	2	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 12 - Southeast	2	EΑ	7	10+ years	
	Exterior Doors - Exterior Steel Door	Door 13 - East	1	EΑ	6	10+ years	
	Entrance Control - Audio and Video	Door 2 - North center	1	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 2 - North center	4	EA	6	10+ years	
	Exterior Doors - Transom Lite	Door 2 - North center	2	EΑ	6	10+ years	
	Exterior Stairs - Stone	Door 2 - North center	48	LF	6	10+ years	
	Stair Handrail - Steel_Stair Handrail	Door 2 - North center	18	LF	6	10+ years	
	Entrance Control - Audio and Video	Door 3 - Northwest	1	EA	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 3 - Northwest	2	EA	7	10+ years	
	Exterior Doors - Side lite	Door 3 - Northwest	2	EA	6	10+ years	
	Exterior Doors - Transom Lite	Door 3 - Northwest	3	EA	7	10+ years	

Campus Name: Raby HS Page : 1 of 44 Assessment Date: 05/20/2024



Catego	Category : Exterior		В	uilding	: Main		
_						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Exterior Stairs - Stone	Door 3 - Northwest	40	LF	6	10+ years	
	Power Door Operator and Controls	Door 3 - Northwest	2	EΑ	7	10+ years	
	Ramp Handrail - Steel_Ramp Handrail	Door 3 - Northwest	40	LF	6	10+ years	
	Ramps - Concrete	Door 3 - Northwest	40	LF	6	10+ years	
	Stair Handrail - Steel_Stair Handrail	Door 3 - Northwest	21	LF	6	10+ years	
	Stair Handrail - Steel_Stair Handrail	Door 3 - Northwest	9	LF	3	0-1 year	Missing railing
	Entrance Control - Audio and Video	Door 4 - West	1	EΑ	6	10+ years	
	Exterior Doors - Exterior FRP Door	Door 4 - West	4	EA	6	10+ years	
	Exterior Doors - Transom Lite	Door 4 - West	2	EΑ	7	10+ years	
	Exterior Stairs - Stone	Door 4 - West	36	LF	6	10+ years	
	Stair Handrail - Steel_Stair Handrail	Door 4 - West	15	LF	3	1-2 years	Missing railing
	Exterior Doors - Exterior FRP Door	Door 5 - Southwest	2	EA	6	10+ years	0 0
	Exterior Doors - Side lite	Door 5 - Southwest	2	EA	7	10+ years	
	Exterior Doors - Transom Lite	Door 5 - Southwest	3	EA	7	10+ years	
	Exterior Stairs - Concrete	Door 5 - Southwest	12	LF	5	10+ years	
	Exterior Stairs - Stone	Door 5 - Southwest	48	LF	5	10+ years	
	Stair Handrail - Steel Stair Handrail	Door 5 - Southwest	14	LF	5	2-5 years	
	Stair Handrail - Steel_Stair Handrail	Door 5 - Southwest	7	LF	3	0-1 year	Missing railing
	Entrance Control - Audio and Video	Door 6 - South	1	EΑ	6	10+ years	3 3
	Exterior Doors - Exterior FRP Door	Door 6 - South	2	EΑ	6	10+ years	
	Exterior Doors - Transom Lite	Door 6 - South	1	EA	7	10+ years	
	Exterior Stairs - Stone	Door 6 - South	12	LF	6	10+ years	
	Power Door Operator and Controls	Door 6 - South	2	EΑ	7	10+ years	
	Exterior Doors - Exterior FRP Door	Door 7 - South center	6	EA	7	10+ years	
	Exterior Doors - Transom Lite	Door 7 - South center	3	EΑ	7	10+ years	
	Exterior Stairs - Concrete	Door 7 - South center	112	LF	5	6-10 years	
	Exterior Stairs - Concrete	Door 7 - South center	20	LF	5	1-2 years	Severe cracking
	Exterior Stairs - Stone	Door 7 - South center	18	LF	6	10+ years	3
	Stair Handrail - Steel_Stair Handrail	Door 7 - South center	16	LF	6	10+ years	
	Stair Handrail - Steel Stair Handrail	Door 7 - South center	16	LF	4	0-1 year	Bent railing
	Entrance Control - Audio and Video	Door 8 - South	1	EΑ	6	10+ years	3
	Exterior Doors - Exterior FRP Door	Door 8 - South	2	EA	7	10+ years	
	Exterior Doors - Transom Lite	Door 8 - South	1	EΑ	7	10+ years	
	Power Door Operator and Controls	Door 8 - South	2	ΕA	7	10+ years	
	Ramp Handrail - Steel_Ramp Handrail	Door 8 - South	16	LF	6	10+ years	
	Ramps - Concrete	Door 8 - South	8	LF	5	1-2 years	Cracking
	Exterior Doors - Exterior Steel Door	Door 9 - East courtyard	4	EΑ	6	10+ years	
	Exterior Stairs - Stone	Door 9 - East courtyard	48	LF	6	10+ years	
	Exterior Doors - Exterior Steel Door	Doors 14a - d: Roof #1	3	EA	6	10+ years	
	Exterior Stairs - Concrete	Doors 14a - d: Roof #1	9	LF	6	10+ years	
Foundati	on						
	Foundation - Concrete	Entire Building	1,042	LF	7	10+ years	
	Foundation - Concrete	Entire Building	10	LF	6	10+ years	Crack in foundation
	. canadion control	Entire Danding	10		J	ioi youis	Crack in roundation



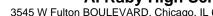



Categor	ategory : Exterior		В	uilding	: Main		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Superstructure - Concrete	Entire Building	156,248	SF	7	10+ years	
Lighting							
0 0	Exterior Lighting - Parapet or Roof Mounted	Entire Building	13	EA	7	10+ years	
	Exterior Lighting - Wall Mounted	Entire Building	14	EA	6	10+ years	
Roof Sys	tem						
,	Access Ladder - Metal	Roof 1	1	EA	7	10+ years	
	Access Ladder - Wood	Roof 1	1	EA	5	2-5 years	
	Coping - Terra Cotta	Roof 1	1,159	LF	6	10+ years	
	Downspouts - Interior Downspouts	Roof 1	650	LF	6	10+ years	
	Parapet - 16" - 30" Height	Roof 1	240	LF	6	10+ years	
	Parapet - Parapet > 30"	Roof 1	919	LF	6	10+ years	
	Roof - Asphalt Gravel Ballast	Roof 1	25,390	SF	6	2-5 years	
	Roof Hatch - Metal	Roof 1	25,390	EA	7		
	Roof Structure - Concrete	Roof 1	1 25 200	SF	7	10+ years	
			25,390			10+ years	
	Access Ladder - Metal	Roof 2	2	EΑ	7	10+ years	
	Access Ladder - Metal	Roof 2	1	EA	7	10+ years	Auditorium roof ladder is unsafe do to no extension. Per engineer unsafe
	Access Ladder - Metal	Roof 2	1	EA	4	0-1 year	Not extended. Unsafe ladder
	Access Ladder - Wood	Roof 2	1	EA	4	0-1 year	Obsolete/unsafe
	Coping - Terra Cotta	Roof 2	540	LF	6	10+ years	
	Downspouts - Interior Downspouts	Roof 2	360	LF	6	10+ years	
	Parapet - 16" - 30" Height	Roof 2	480	LF	6	10+ years	
	Parapet - Parapet < 16" Height	Roof 2	60	LF	6	10+ years	
	Roof - Asphalt Gravel Ballast	Roof 2	10,518	SF	6	10+ years	
	Roof - Modified Bitumen	Roof 2	1,169	SF	6	10+ years	
	Roof Hatch - Metal	Roof 2	3	EA	7	10+ years	
			_				
	Roof Structure - Concrete	Roof 2	11,687	SF	7	10+ years	
	Access Ladder - Metal	Roof 3	2	EΑ	7	10+ years	0
	Chimney - Brick Chimney- Concrete/ Mortar Liner	Roof 3	40	LF	7	6-10 years	Capped
	Chimney - Metal Flue	Roof 3	175	LF	7	10+ years	
	Coping - Terra Cotta	Roof 3	391	LF	6	10+ years	
	Downspouts - Exterior Downspouts	Roof 3	15	LF	6	10+ years	
	Downspouts - Interior Downspouts	Roof 3	120	LF	6	10+ years	
	Parapet - 16" - 30" Height	Roof 3	341	LF	6	10+ years	
	Parapet - Parapet < 16" Height	Roof 3	50	LF	6	10+ years	
	Roof - Asphalt Gravel Ballast	Roof 3	7,661	SF	6	,	
						10+ years	
	Roof Hatch - Metal	Roof 3	7 004	EA	7	10+ years	
	Roof Structure - Concrete	Roof 3	7,661	SF	7	10+ years	
Valls							

Campus Name: Raby HS Page : 3 of 44 Assessment Date: 05/20/2024





Category : Exterior

Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Cheek-Wall - Concrete	Entire Building	48	SF	6	10+ years	
	Exterior Walls - Brick	Entire Building	78,522	SF	6	10+ years	
	Exterior Walls - Concrete Block	Entire Building	650	SF	6	10+ years	
	Exterior Walls - Terra Cotta	Entire Building	4,049	SF	6	10+ years	
		·				•	
Vindows							
	Guard - Guards perforated	Entire Building	5,893	SF	6	10+ years	
	Lintels - Steel	Entire Building	2,113	LF	6	10+ years	
	Lintels - Terra Cotta	Entire Building	75	LF	6	10+ years	
	Skylite - Glass Double-Pane	Entire Building	123	SF	6	10+ years	
	Windows - Decorative	Entire Building	240	SF	6	10+ years	
	Windows - Louver	Entire Building	40	SF	6	10+ years	
	Windows - Sash Aluminum Double-pane	Entire Building	21,154	SF	6	10+ years	
`ateno	ry : Electrical		R	uilding	· Main		
alcgo	y . Licetrical			ununig	. Walli	Recommend	
Froup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
merger	ncy System						
	Automatic Transfer Switch	EM Electrical Room	1	EA	7	6-10 years	
	Automatic Transfer Switch	EM Electrical Room	1	EA	7	6-10 years	
	Automatic Transfer Switch	EM Electrical Room	1	EA	7	6-10 years	
	Emergency Battery Packs - Auditoium and	Entire Building	10	EA	6	6-10 years	
	Aisle Lighting						
	Emergency Battery Packs - Gym	Entire Building	1	EA	6	6-10 years	
	Emergency Battery Packs - Gym	Entire Building	1	EA	6	0-1 year	Cover missing
	Emergency Battery Packs - Lunchrooms	Entire Building	1	EA	6	6-10 years	-
	Exit Signs - Auditoium	Entire Building	18	EA	6	6-10 years	
	Exit Signs - Corridors and Stairs	Entire Building	47	EA	6	6-10 years	
	Exit Signs - Gym	Entire Building	3	EA	6	6-10 years	
	Exit Signs - Lunchroom	Entire Building	2	EA	6	6-10 years	
	Security System - CCTV	Entire Building	156,248	SF	6	6-10 years	
	Security System - Intrusion Detection	Entire Building	156,248	SF	6	6-10 years	
	Emergency A/C Power - Auditoium and	Entire Building	3,958	SF	6	6-10 years	
	Aisle Lighting	Entire Building	5,950	OI.	U	0-10 years	
	Emergency A/C Power - Corridors and	Entire Building	24,710	SF	6	6-10 years	
	Stairs Emergency A/C Power - Gym	Entire Building	4,724	SF	6	6 10 years	
					6	6-10 years	
	Emergency A/C Power - Lunchrooms	Entire Building	4,898	SF	6	6-10 years	
	Emergency Generator- Indoor- Natural Gas - 101 - 150 KW	Generator Room	1	EA	6	6-10 years	
	vice						
1ain Sei							
/lain Ser	Independent Electrical Service for	EM Electrical Room	1	EA	6	6-10 years	

Building: Main

Recommend

Campus Name: Raby HS Page : 4 of 44 Assessment Date: 05/20/2024



Catego	ry : Electrical		В	uilding	: Main		
roup	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
	emergency power Main Electrical Service - 2001 to 3000 A	Entire Building	1	EA	6	10+ years	
	120/208/3PH Main Electrical Service - 2001 to 3000 A 277/480/3PH	Entire Building	1	EA	7	10+ years	
	PA System	Entire Building	156,248	SF	6	6-10 years	
ower D	istribution						
	Lighting and Power Panels - 100 A	Entire Building	1	EA	6	6-10 years	
	Lighting and Power Panels - 100 A	Entire Building	1	EA	6	6-10 years	
	Lighting and Power Panels - Above 100 A	Entire Building	2	EA	7	10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EΑ	7	10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	7	•	
			1			10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EΑ	7	10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	7	10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	7	10+ years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	6	6-10 years	
	Lighting and Power Panels - Above 100 A	Entire Building	28	EA	6	6-10 years	
	Lighting and Power Panels - Above 100 A	Entire Building	5	EA	6	6-10 years	
	Lighting and Power Panels - Above 100 A	Entire Building	1	EA	4	0-1 year	Panel is missing cover over open slots.
	Main Distribution Panels - 400 - 600 amp	Entire Building	2	EA	7	6-10 years	Siots.
	Main Distribution Panels - 400 - 600 amp	Entire Building	2	EA	6	10+ years	
	Main Distribution Panels - 400 - 600 amp	Entire Building	3	EA	6	6-10 years	
	Main Distribution Panels - Less than 400 amp	Entire Building	2	EA	7	6-10 years	
	Main Distribution Panels - Less than 400 amp	Entire Building	1	EA	7	10+ years	
	Main Distribution Panels - Less than 400 amp	Entire Building	2	EA	7	6-10 years	
	Transformers - 277/480 - 120/208	Entire Building	1	EA	7	6-10 years	
	Transformers - 277/480 - 120/208	Entire Building	1	EA	6	6-10 years	
		9					
	Transformers - 277/480 - 120/208	Entire Building	1	EΑ	6	6-10 years	
	Transformers - 277/480 - 120/208	Entire Building	1	EA	6	6-10 years	
atego	ry : Fire Protection		В	uilding	: Main	Danam: '	
roup	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
ire Alar			•			•	
	Fire ALarm Anunciator	Entire Building	1	EA	7	6-10 years	
	Fire Alarm Panel	Entire Building	1	EA	7	6-10 years	
	Fire Alarm Strobe Lights	Entire Building	156,248	SF	7	6-10 years	
	Fire Alarm_System	Entire Building	156,248	SF	7	6-10 years	



Building: Main Category : Mechanical Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Air Conditioning EΑ 6 Chemical Pot Feeder **Entire Building** 1 6-10 years Chiller-Air Cooled-Screw Type-Ground **Entire Building** 1 EΑ 6 6-10 years Ch-2 Mounted - 201 - 300 tons Chiller-Air Cooled-Screw Type-Ground 1 EΑ 6 CH-1 **Entire Building** 6-10 years Mounted - 201 - 300 tons Pipes - Chilled Water Pipe- Steel 100 LF 6 6-10 years **Entire Building** Pressure Fill System **Entire Building** 1 EΑ 6 6-10 years Condensing Unit- Roof Mounted - Less Roof EΑ 7 6-10 years Not previously assessed. Serves 1 than 5 tons shop room 135. Condensing Unit- Roof Mounted - Less Roof 1 EΑ 7 6-10 years Not previously assessed than 5 tons EΑ Condensing Unit- Roof Mounted - Less Roof 1 7 6-10 years Serves MDF room. than 5 tons Air Handling Systems Fan Coil Unit- Celing Mounted - Electric 2 7 1st Floor EΑ 10+ years Serves room 135. Air Handling Unit Package Multi Zone-EΑ 7 Mechanical Room - AHU-1 1 6-10 years AHU-1; serves gym & locker rooms Indoor- Dual Temperature Coils - 10001-15000 cfm Air Intake Mechanical Room - AHU-1 1 EΑ 6 10+ years **Zone Dampers** Mechanical Room - AHU-1 8 EΑ 6 6-10 years Zone dampers are internal Air Handling Unit- Package Single Zone-Mechanical Room - AHU-2 1 EΑ 7 6-10 years AHU-2, serves auditorium Indoor- Dual Temperature Coils - 20001-30000 cfm EΑ Air Intake Mechanical Room - AHU-2 6 10+ years Air Handling Unit- Built Up- Single Zone w/ Mechanical Room - AHU-3A FΑ 7 6-10 years AHU-3A, serves West part of building Air Tunnel- Dual Temperature Coils - 15001 - 25000 cfm Air Intake Mechanical Room - AHU-3A FΑ 6 10+ years Reheat Boxes - Reheat Boxes with Hot Mechanical Room - AHU-3A 6 4 EΑ 6-10 years Water Coil LF Return Duct Work - Masonry and Ducts-Mechanical Room - AHU-3A 150 6 6-10 years Missing or Existing Shaft Zone Dampers Mechanical Room - AHU-3A 21 EΑ 6 Zone dampers are in the reheat 6-10 years boxes EΑ Air Handling Unit- Built Up- Single Zone w/ Mechanical Room - AHU-3B 7 AHU-3B, serves east part of building 1 6-10 years Air Tunnel- Dual Temperature Coils - 25001 - 35000 cfm Air Intake Mechanical Room - AHU-3B 1 EΑ 6 10+ years 5 Reheat Boxes - Reheat Boxes with Hot Mechanical Room - AHU-3B EΑ 6 6-10 years Water Coil LF Return Duct Work - Masonry and Ducts-Mechanical Room - AHU-3B 150 6 6-10 years Missing or Existing Shaft



Catego	ry : Mechanical		В	uilding	: Main		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Zone Dampers	Mechanical Room - AHU-3B	30	EA	6	6-10 years	Zone dampers for air handler are in reheat boxes
	Air Handling Unit Package Multi Zone- Indoor- Dual Temperature Coils - Greater than 30,000 cfm	Mechanical Room - AHU-4	1	EA	7	6-10 years	AHU-4, serves north west side of the building
	Air Intake	Mechanical Room - AHU-4	1	EA	6	6-10 years	
	Zone Dampers	Mechanical Room - AHU-4	25	EA	6	6-10 years	Zone dampers are internal
	Air Handling Unit Package Multi Zone- Indoor- Dual Temperature Coils - 10001- 15000 cfm	Mechanical Room - AHU-5	1	EA	7	6-10 years	AHU-5, serves kitchen and lunchroom
	Air Intake	Mechanical Room - AHU-5	1	EA	6	6-10 years	
	Zone Dampers	Mechanical Room - AHU-5	3	EA	6	6-10 years	Zone dampers are internal
	Outdoor Return Fans- Air Handling Unit Type - 10001 - 20000 CFM	Roof	1	EA	7	6-10 years	ER-3A
	Outdoor Return Fans- Air Handling Unit Type - 10001 - 20000 CFM	Roof	1	EA	7	6-10 years	ER-2
	Outdoor Return Fans- Air Handling Unit Type - Greater than 20000 CFM	Roof	1	EA	7	6-10 years	ER-4
	Outdoor Return Fans- Air Handling Unit Type - Greater than 20000 CFM	Roof	1	EA	5	0-1 year	ER-3B. Motor is bad shape. In the process of being replaced. Work order in place.
	Make Up Air Unit- Roof Mounted- Gas Heating - Less than 6000 cfm	Roof	1	EA	7	6-10 years	order in place.
Boiler Sy	estems						
	Boiler Auxiliary- Condensing Hot Water - Less than 500 HP	Boiler Room	3	EA	7	6-10 years	
	Chemical Pot Feeder	Boiler Room	1	EA	6	6-10 years	
	Combustion Dampers	Boiler Room	2	EΑ	7	10+ years	
	Condensing- Hot Water Boiler - Less than 500 MBH	Boiler Room	3	EA	7	6-10 years	
Heating							
	Unit Heater - Gas	Boiler Room	1	EA	6	6-10 years	
	Unit Heater - Hot Water	Entire Building	1	EA	6	6-10 years	
	Unit Heater - Hot Water	Entire Building	2	EA	6	6-10 years	
	Unit Heater - Hot Water	Entire Building	3	EA	6	6-10 years	
	Cabinet Heaters - With Hot Water Coil	Entire Building	12	EA	6	6-10 years	
	Fin Tube - Hot Water	Entire Building	750	LF	6	6-10 years	
	Wall Heater - Electric	Entire Building	21	EA	6	6-10 years	
_Mechani	cal Plumbing						
	Dual Temperature Pump - 21 - 50 HP	Boiler Room	1	EA	7	10+ years	P-3



Sategoi Broup	ry : Mechanical		В	uilding	: Main		
troup							
TOUR	Ham. Turns	Lagation	Ougustitus	LIOM	Dank	Recommend	Commonto
поир	Item - Type Dual Temperature Pump - 21 - 50 HP	Location Poiler Poom	Quantity	UOM	Rank	Replacement 10+ years	Comments P-2
	Dual Temperature Pump - 21 - 50 HP	Boiler Room Boiler Room	1	EA EA	7 7	10+ years 10+ years	P-2 P-1
				LF		•	F-1
	Hydronic Supply and Return - Copper Hydronic Supply and Return - Steel	Entire Building	1,000	LF LF	7 7	6-10 years	
	nydronic Supply and Return - Steel	Entire Building	500	LF	/	6-10 years	
empera	ture Control						
	DDC System	Entire Building	156,248	SF	6	6-10 years	
	Electric Thermostat	Entire Building	13	EA	6	6-10 years	
	Thermostats - DDC	Entire Building	72	EA	6	6-10 years	
entilatio	on						
	Exhaust Fans- Indoor - 1501 - 8000 CFM	Entire Building	1	EA	7	6-10 years	
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	7	6-10 years	
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	7	6-10 years	MDF Room
	Exhaust Fans- Indoor - 500 - 1500 CFM	Entire Building	1	EA	7	6-10 years	
	Exhaust Fans- Roof Mounted - 1501 - 8000 CFM	Entire Building	7	EA	7	6-10 years	No deficiencies
	Exhaust Fans- Roof Mounted - 500 - 1500 CFM	Entire Building	6	EA	6	6-10 years	
	Exhaust Fans- Roof Mounted - Less than 500 CFM	Entire Building	2	EA	6	6-10 years	
	Roof Mounted Duct Work	Entire Building	350	LF	7	6-10 years	
	Type I Exhaust Hood- Kitchen	Entire Building	1	ĒΑ	7	6-10 years	
	Type I Exhaust Hood- Kitchen	Entire Building	1	EΑ	7	10+ years	
	Type II Exhaust Hood- Warming Kitchen	Entire Building	1	EΑ	7	10+ years	
	Type II Exhaust Hood- Warming Kitchen	Entire Building	1	EA	7	10+ years	
atego	ry : Plumbing		В	uilding	· Main		
ulogo.	y			unung		Recommend	
roup	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
ot Wate	er Gas Heater - Greater than 600000 BTU/HR	Entire Building	1	EA	6	6-10 years	
	Gas Heater - Greater than 600000 BTU/HR	Entire Building	1	EΑ	6	6-10 years	
	Hot Water Storage Tank_Gas - 201 - 500	Entire Building	2	EA	5	1-2 years	Insulation worn
	Gallons	Little building	2	LA	3	1-2 years	insulation wom
ping							
. 5 –	Domestic Piping-Hot Water Return Lines	Entire Building	156,248	SF	6	6-10 years	
	Domestic Piping-Hot Water Return Risers	Entire Building	156,248	SF	6	6-10 years	
	Domestic Piping-Hot Water from Risers to	Entire Building	156,248	SF	6	6-10 years	
	Fixtures		100,210	٥.	•	5 .5 youro	
		Entire Building	156,248	SF	6	6-10 years	



Catego	ry : Plumbing		В	uilding	: Main		
Group	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
•	Domestic Piping-Hot/Cold Water Supply (Risers)	Entire Building	156,248	SF	6	6-10 years	
	Domestic Piping-Hot/Cold Water Supply (from Risers to Fixtures)	Entire Building	156,248	SF	6	6-10 years	
	Sanitary Piping	Entire Building	156,248	SF	6	6-10 years	
	Storm Piping	Entire Building	156,248	SF	6	6-10 years	
	Vent Piping	Entire Building	156,248	SF	6	10+ years	
Pumps							
•	Pumps - Domestic Booster Pump-Duplex	Entire Building	1	EA	6	6-10 years	
	Pumps - Ejector-Duplex	Entire Building	1	EA	6	6-10 years	
	Pumps - Sump-Duplex	Entire Building	1	EA	6	6-10 years	
	Pumps - Sump-Simplex	Entire Building	1	EA	6	6-10 years	Pump is in an elevator pit, and not visible.

Category : Room Building : Main

Group	Item - Type	Location	Quantity	UOM	Rank	Recommend Replacement	Comments
	trative Suites/Offices	Location	Quantity	OOM	Italik	Replacement	Comments
_/\diffilli	Ceiling - Lay-in	102	315	SF	7	10+ years	
	Doors - Wood Doors inclu hw	102	1	EA	7	10+ years	
	Floor - Tile	102	315	SF	7	10+ years	
	Lighting - Lay-in	102	5	EA	7	10+ years	
	Power Distribution	102	10	EΑ	7	10+ years	
	Walls - Plaster/Drywall	102	700	SF	7	10+ years	
	Walls - Plaster/Drywall	102	10	SF	5	1-2 years	Cracked drywall
	Ceiling - Lay-in	102 - #1	160	SF	7	10+ years	Cracked ally mail
	Doors - Wood Doors inclu hw	102 - #1	1	EΑ	7	10+ years	
	Floor - Tile	102 - #1	160	SF	7	10+ years	
	Lighting - Lay-in	102 - #1	3	ĒΑ	7	10+ years	
	Power Distribution	102 - #1	6	EA	7	10+ years	
	Walls - Plaster/Drywall	102 - #1	498	SF	6	10+ years	
	Ceiling - Lay-in	102 - #2	160	SF	7	10+ years	
	Doors - Wood Doors inclu hw	102 - #2	1	EA	7	10+ years	
	Floor - Tile	102 - #2	160	SF	7	10+ years	
	Lighting - Lay-in	102 - #2	4	EA	7	10+ years	
	Power Distribution	102 - #2	6	EA	7	10+ years	
	Walls - Plaster/Drywall	102 - #2	398	SF	7	10+ years	
	Ceiling - Lay-in	102 - #3	110	SF	7	10+ years	
	Doors - Wood Doors inclu hw	102 - #3	1	EA	7	10+ years	
	Floor - Tile	102 - #3	110	SF	7	10+ years	
	Lighting - Lay-in	102 - #3	2	EA	7	10+ years	
	Power Distribution	102 - #3	6	EA	7	10+ years	
	Walls - Plaster/Drywall	102 - #3	285	SF	7	10+ years	
	•					•	

Campus Name: Raby HS Page: 9 of 44 Assessment Date: 05/20/2024



Building: Main Category: Room Recommend Group Item - Type Location Quantity **UOM** Rank Replacement **Comments** Ceiling - Lav-in 102 - #4 110 SF 10+ years 7 Doors - Wood Doors inclu hw 102 - #4 EΑ 7 10+ years 1 Floor - Tile 102 - #4 108 SF 7 10+ years Floor - Tile 2 SF 102 - #4 4 0-1 year Damaged tiles 7 Lighting - Lay-in 102 - #4 2 EΑ 10+ years 7 Power Distribution 102 - #4 6 EΑ 10+ years Storage/ Closet 102 - #4 40 SF 5 10+ years SF Walls - Plaster/Drywall 102 - #4 385 7 10+ years Ceiling - Lay-in 104 - Teacher's Work Room 360 SF 7 10+ years SF Doors - Transom Window 104 - Teacher's Work Room 8 7 10+ years Doors - Wood Doors inclu hw 104 - Teacher's Work Room 1 EΑ 7 10+ years Floor - Tile 104 - Teacher's Work Room 355 SF 6 10+ years Floor - Tile 5 SF 4 1-2 years 104 - Teacher's Work Room Damaged tiles Lighting - Lay-in 7 7 104 - Teacher's Work Room EΑ 10+ years Power Distribution 8 7 104 - Teacher's Work Room EΑ 10+ years SF Walls - Plaster/Drywall 104 - Teacher's Work Room 724 6 10+ years SF 7 Ceiling - Lav-in 106 - Counselor's Suite 425 10+ years Doors - Wood Doors inclu hw 106 - Counselor's Suite 1 EΑ 7 10+ years Floor - Tile SF 106 - Counselor's Suite 401 7 10+ years SF Floor - Tile 106 - Counselor's Suite 24 4 0-1 year Damaged tiles Lighting - Lay-in 106 - Counselor's Suite 6 EΑ 7 10+ years Power Distribution 106 - Counselor's Suite 7 10+ years 8 EΑ SF 106 - Counselor's Suite 7 Walls - Plaster/Drywall 905 10+ years SF 7 Walls - Tile Ceramic/ Porcelain 106 - Counselor's Suite 55 10+ years Ceiling - Lay-in 106A - Conference Room 185 SF 7 10+ years Doors - Wood Doors inclu hw 106A - Conference Room 1 EΑ 7 10+ years SF Floor - Tile 106A - Conference Room 175 7 6-10 years Floor - Tile 106A - Conference Room SF 1-2 years Damaged tiles 10 4 7 Lighting - Lay-in 106A - Conference Room 4 EΑ 10+ years Power Distribution 106A - Conference Room 8 EΑ 7 10+ years Walls - Plaster/Drywall 106A - Conference Room 320 SF 7 10+ years SF Walls - Plaster/Drywall 106A - Conference Room 50 5 0-1 vear Missing wall base SF 7 Ceiling - Lay-in 106B - Counselor's Office 228 10+ years Doors - Wood Doors inclu hw 106B - Counselor's Office FΑ 7 10+ years 1 Floor - Tile SF 7 106B - Counselor's Office 208 10+ years SF Damaged tiles Floor - Tile 106B - Counselor's Office 20 4 1-2 years 106B - Counselor's Office Lighting - Lay-in 4 EΑ 7 10+ years Power Distribution 6 106B - Counselor's Office EΑ 7 10+ years Walls - Plaster/Drywall 106B - Counselor's Office 441 SF 7 10+ years SF Walls - Plaster/Drywall 106B - Counselor's Office 50 5 0-1 vear Missing wall base SF Ceiling - Plaster/Drywall 110 - Social Room 856 6 10+ years Doors - Transom Window SF 7 110 - Social Room 16 10+ years Doors - Wood Doors inclu hw 110 - Social Room 2 EΑ 7 10+ years SF 7 Floor - Tile 110 - Social Room 856 10+ years

Campus Name: Raby HS Page : 10 of 44 Assessment Date: 05/20/2024



Catego	Category : Room		В	uilding	: Main		
				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Lighting - Pendent/Surface	110 - Social Room	14	EA	7	10+ years	
	Power Distribution	110 - Social Room	18	EA	7	10+ years	
	Storage/ Closet	110 - Social Room	30	SF	7	10+ years	
	Walls - Plaster/Drywall	110 - Social Room	1,540	SF	7	10+ years	
	Ceiling - Plaster/Drywall	110C	230	SF	7	10+ years	
	Doors - Transom Window	110C	20	SF	7	10+ years	
	Doors - Wood Doors inclu hw	110C	4	EA	7	10+ years	
	Floor - Tile	110C	230	SF	7	10+ years	
	Lighting - Pendent/Surface	110C	4	ĒΑ	7	10+ years	
	Power Distribution	110C	10	EA	7	10+ years	
	Walls - Plaster/Drywall	110C	480	SF	7	10+ years	
	Work SInk	110C	1	ĒΑ	7	10+ years	
	AC Unit	114 - Main Office	1	EA	7	6-10 years	
	Ceiling - Plaster/Drywall	114 - Main Office	913	SF	6	10+ years	
	Doors - Side-lite	114 - Main Office	24	SF	7	10+ years	
	Doors - Transom Window	114 - Main Office	24	SF	7	10+ years	
	Doors - Wood Doors inclu hw	114 - Main Office	1	EA	7	10+ years	
	Floor - Tile	114 - Main Office	903	SF	7	10+ years	
	Floor - Tile	114 - Main Office	10	SF	4		Damaged tiles
	Lighting - Pendent/Surface	114 - Main Office	13	EA	7	1-2 years	Damaged tiles
	•	114 - Main Office	24	EA		10+ years	
	Power Distribution				7	10+ years	
	Storage/ Closet	114 - Main Office	64	SF	7	10+ years	
	Walls - Plaster/Drywall	114 - Main Office	1,594	SF	7	10+ years	
	AC Unit	118 - Attendance	1	EA	7	6-10 years	
	AC Unit	118 - Attendance	1	EA	5	6-10 years	
	Ceiling - Plaster/Drywall	118 - Attendance	890	SF	6	10+ years	
	Doors - Wood Doors inclu hw	118 - Attendance	1	EA	7	10+ years	
	Floor - Tile	118 - Attendance	870	SF	7	10+ years	
	Floor - Tile	118 - Attendance	20	SF	4	1-2 years	Damaged tiles
	Lighting - Pendent/Surface	118 - Attendance	16	EA	7	10+ years	
	Power Distribution	118 - Attendance	16	EA	7	10+ years	
	Walls - Plaster/Drywall	118 - Attendance	880	SF	7	10+ years	
	Work SInk	118 - Attendance	1	EA	7	10+ years	
	Ceiling - Plaster/Drywall	135 - Shop	250	SF	7	10+ years	
	Doors - Steel Doors incl hw	135 - Shop	1	EA	7	10+ years	
	Floor - Tile	135 - Shop	245	SF	6	10+ years	
	Floor - Tile	135 - Shop	5	SF	4	1-2 years	Damaged tiles
	Lighting - Pendent/Surface	135 - Shop	2	EA	7	6-10 years	
	Lighting - Pendent/Surface	135 - Shop	2	EA	6	6-10 years	
	Power Distribution	135 - Shop	4	EA	7	10+ years	
	Walls - Plaster/Drywall	135 - Shop	761	SF	7	10+ years	
	Ceiling - Plaster/Drywall	137	201	SF	7	10+ years	
	Doors - Transom Window	137	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	137	2	ĒΑ	7	10+ years	
	· · · · ·		_		-	,	

Campus Name: Raby HS Page : 11 of 44 Assessment Date: 05/20/2024



Category : Room

Building : Main

Catego	ry:Room		В	uilding	: Main		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Floor - Wood	137	201	SF	6	10+ years	
	Lighting - Pendent/Surface	137	2	EA	7	10+ years	
	Power Distribution	137	8	EA	7	10+ years	
	Walls - Plaster/Drywall	137	450	SF	7	10+ years	
	AC Unit	1st Floor - Engineer	1	EA	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor - Engineer	300	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - Engineer	1	EA	7	10+ years	
	Floor - Carpet	1st Floor - Engineer	250	SF	7	10+ years	
	Floor - Terrazzo	1st Floor - Engineer	50	SF	6	10+ years	
	Lighting - Pendent/Surface	1st Floor - Engineer	3	EA	7	10+ years	
	Power Distribution	1st Floor - Engineer	8	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - Engineer	955	SF	7	10+ years	
	AC Unit	1st Floor - Kitchen	1	EA	7	6-10 years	
	Ceiling - Splined	1st Floor - Kitchen	69	SF	7	10+ years	
	Ceiling - Splined	1st Floor - Kitchen	1	SF	5	1-2 years	Damaged tiles
	Doors - Side-lite	1st Floor - Kitchen	72	SF	7	10+ years	-
	Doors - Transom Window	1st Floor - Kitchen	12	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - Kitchen	2	EA	7	10+ years	
	Floor - Terrazzo	1st Floor - Kitchen	70	SF	7	10+ years	
	Lighting - Pendent/Surface	1st Floor - Kitchen	1	EA	7	10+ years	
	Power Distribution	1st Floor - Kitchen	2	EA	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor - Kitchen	189	SF	7	10+ years	
	AC Unit	1st Floor - Principal	1	EA	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor - Principal	290	SF	5	10+ years	
	Doors - Transom Window	1st Floor - Principal	16	SF	7	10+ years	
	Floor - Tile	1st Floor - Principal	290	SF	7	6-10 years	
	Lighting - Pendent/Surface	1st Floor - Principal	4	EA	7	10+ years	
	Power Distribution	1st Floor - Principal	10	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - Principal	620	SF	7	10+ years	
	Ceiling - Plaster/Drywall	1st Floor-110A Office	500	SF	7	10+ years	
	Doors - Transom Window	1st Floor-110A Office	12	SF	6	10+ years	
	Doors - Wood Doors inclu hw	1st Floor-110A Office	1	EA	6	10+ years	
	Floor - Tile	1st Floor-110A Office	500	SF	7	10+ years	
	Lighting - Pendent/Surface	1st Floor-110A Office	2	EA	7	6-10 years	
	Power Distribution	1st Floor-110A Office	18	EA	6	10+ years	
	Walls - Plaster/Drywall	1st Floor-110A Office	918	SF	7	10+ years	
	Ceiling - Plaster/Drywall	243 Book Room	350	SF	7	10+ years	
	Doors - Wood Doors inclu hw	243 Book Room	1	EA	7	10+ years	
	Floor - Wood	243 Book Room	350	SF	7	10+ years	
	Lighting - Chandelier, Incandescent	243 Book Room	6	EA	7	6-10 years	
	Power Distribution	243 Book Room	10	EA	7	10+ years	
	Walls - Plaster/Drywall	243 Book Room	700	SF	7	10+ years	
	Ceiling - Lay-in	2nd Floor-211 Office	250	SF	7	10+ years	Qty updated
	Doors - Wood Doors inclu hw	2nd Floor-211 Office	2	EA	7	10+ years	
						, , , , ,	

Campus Name: Raby HS Page : 12 of 44 Assessment Date: 05/20/2024



Building: Main Category: Room Recommend Group Item - Type Location Quantity **UOM** Rank Replacement **Comments** Floor - Wood 2nd Floor-211 Office 250 SF 10+ vears Qtv updated 7 2nd Floor-211 Office 5 EΑ 7 6-10 years Qtv updated Lighting - Pendent/Surface Power Distribution 2nd Floor-211 Office 10 FΑ 7 10+ years Walls - Plaster/Drywall SF 7 2nd Floor-211 Office 580 10+ years Ceiling - Lay-in SF 2nd Floor-211A Office 46 7 10+ years Doors - Wood Doors inclu hw 7 2nd Floor-211A Office EΑ 10+ years 1 Floor - Wood 2nd Floor-211A Office SF 7 10+ years 46 Lighting - Lay-in 2nd Floor-211A Office 2 EΑ 7 6-10 years Power Distribution 2nd Floor-211A Office 8 EΑ 7 10+ years SF Walls - Plaster/Drywall 2nd Floor-211A Office 160 7 10+ years SF Ceiling - Plaster/Drywall 2nd Floor-213 Health Office 488 7 10+ years Doors - Side-lite 2nd Floor-213 Health Office 50 SF 7 10+ years Doors - Steel Doors incl hw EΑ 7 2nd Floor-213 Health Office 1 10+ years SF 7 Doors - Transom Window 2nd Floor-213 Health Office 24 10+ years SF 7 Floor - Terrazzo 2nd Floor-213 Health Office 488 10+ years FΑ 7 Lighting - Pendent/Surface 2nd Floor-213 Health Office 10 6-10 years 7 Power Distribution 2nd Floor-213 Health Office 12 EΑ 10+ years Storage/ Closet 2nd Floor-213 Health Office 42 SF 7 10+ years SF Walls - Plaster/Drywall 2nd Floor-213 Health Office 1.142 7 10+ years Ceiling - Plaster/Drywall SF 2nd Floor-Gym Office 144 7 10+ years Doors - Side-lite 2nd Floor-Gym Office 48 SF 7 10+ years 2 7 Doors - Wood Doors inclu hw 2nd Floor-Gym Office EΑ 10+ years SF 7 Floor - Concrete Epoxy/ Painted 2nd Floor-Gym Office 139 6-10 years SF Floor - Concrete Epoxy/ Painted 2nd Floor-Gym Office 5 4 1-2 years Damaged flooring Lighting - Pendent/Surface 2nd Floor-Gvm Office 2 EΑ 7 6-10 years Power Distribution 2nd Floor-Gvm Office 4 EΑ 7 10+ years SF Storage/ Closet 2nd Floor-Gym Office 176 7 10+ years Walls - Plaster/Drywall 2nd Floor-Gym Office 270 SF 6 10+ years 7 Work SInk 2nd Floor-Gym Office 1 EΑ 10+ years Ceiling - Plaster/Drywall 409 - Work Room 272 SF 7 10+ years Doors - Wood Doors inclu hw 409 - Work Room 2 FΑ 7 10+ years Floor - Tile 409 - Work Room 272 SF 7 10+ years FΑ 7 Lighting - Pendent/Surface 409 - Work Room 2 10+ years Power Distribution 409 - Work Room 14 FΑ 7 10+ years 567 SF 7 Walls - Plaster/Drywall 409 - Work Room 10+ years EΑ 7 Work SInk 409 - Work Room 10+ years 1 SF Ceiling - Plaster/Drywall 416 325 6 10+ years Ceiling - Plaster/Drywall SF 5 416 15 1-2 years Water damage SF Doors - Transom Window 416 8 7 10+ years Doors - Wood Doors inclu hw 416 1 EΑ 7 10+ years Floor - Tile 416 328 SF 7 10+ years SF Floor - Tile 416 12 4 0-1 vear Chipping Lighting - Pendent/Surface 416 4 EΑ 7 10+ years 7 Power Distribution 416 12 EΑ 10+ years



Building: Main Category: Room Recommend Group Item - Type Location Quantity **UOM** Rank Replacement Comments Storage/ Closet 416 13 SF 10+ years 7 Walls - Plaster/Drvwall 416 745 SF 7 10+ years Ceiling - Plaster/Drywall Main Office - Clerk 80 SF 7 10+ years Doors - Wood Doors inclu hw Main Office - Clerk EΑ 7 1 10+ years SF Floor - Tile Main Office - Clerk 80 7 10+ years Lighting - Pendent/Surface 7 Main Office - Clerk 1 EΑ 10+ years Power Distribution Main Office - Clerk 2 EΑ 7 10+ years Walls - Plaster/Drywall SF Main Office - Clerk 180 7 10+ years AC Unit Main Office - Teacher's Lounge 1 EΑ 5 0-1 year Not working Ceiling - Plaster/Drywall SF Main Office - Teacher's Lounge 120 7 10+ years Doors - Wood Doors inclu hw Main Office - Teacher's Lounge 2 EΑ 7 10+ years Floor - Tile Main Office - Teacher's Lounge 120 SF 7 10+ years Lighting - Pendent/Surface Main Office - Teacher's Lounge 2 EΑ 7 10+ years 7 Power Distribution Main Office - Teacher's Lounge 14 EΑ 10+ years Walls - Plaster/Drywall Main Office - Teacher's Lounge SF 7 260 10+ years Work SInk Main Office - Teacher's Lounge FΑ 7 1 10+ years Auditorium & Theater 7 Balcony Seating 1st Floor 260 EΑ 10+ years Ceiling - Plaster/Drywall 1st Floor 3,898 SF 7 10+ years SF Ceiling - Plaster/Drywall 1st Floor 50 6 10+ years Ceiling - Plaster/Drywall 1st Floor 10 SF 5 0-1 vear Damaged plaster 7 Doors - Steel Doors incl hw 1st Floor 6 FΑ 10+ years Doors - Wood Doors inclu hw 1st Floor 20 EΑ 7 10+ vears Floor - Tile 1st Floor 3.758 SF 6 6-10 years Floor - Tile 200 SF 1-2 years Damaged tiles 1st Floor 4 7 Lighting - Chandelier, Incandescent 1st Floor 5 EΑ 10+ years Lighting - Pendent/Surface 33 7 1st Floor EΑ 10+ years Lighting - Pendent/Surface 1st Floor 1 FΑ 6 10+ years Lighting - Wall Mounted 1st Floor 16 EΑ 7 10+ years Main Floor Seating 1st Floor 460 EΑ 7 10+ years Sound System 1st Floor EΑ 7 10+ years 1 Stage 1st Floor 860 SF 7 10+ years Stage Curtain 1st Floor 8 EΑ 7 10+ years Stage Lighting System 1st Floor 2 EΑ 7 10+ years LF Stage-Stairs - Wood 7 1st Floor 68 10+ years LF Stairs - Terrazzo 1st Floor 240 5 10+ years Storage/ Closet 188 SF 5 1st Floor 10+ years SF Walls - Plaster/Drywall 1st Floor 9.520 7 10+ years _Gvmnasia Bleacher Seating 2nd Floor EΑ 7 10+ years 7 No occupancy signage SF Ceiling - Plaster/Drywall 2nd Floor 4.795 7 10+ years Ceiling - Plaster/Drywall 2nd Floor 20 SF 4 1-2 years Water damage



Catego	Category : Room		В	uilding	: Main				
				_		Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Doors - Wood Doors inclu hw	2nd Floor	5	EA	7	10+ years			
	Floor - Concrete Epoxy/ Painted	2nd Floor	650	SF	7	10+ years			
	Floor - Wood	2nd Floor	4,165	SF	7	10+ years			
	Lighting - Metal Halide/Sodium Vapor	2nd Floor	12	EA	7	6-10 years			
	Lighting - Pendent/Surface	2nd Floor	4	EA	7	6-10 years			
	Scoreboards	2nd Floor	1	EA	7	10+ years			
	Storage/ Closet	2nd Floor	225	SF	7	10+ years			
	Walls - Plaster/Drywall	2nd Floor	4,290	SF	7	10+ years			
	Walls - Structural Glazed Tile	2nd Floor	1,956	SF	7	10+ years			
Kitchen									
	Ceiling - Plaster/Drywall	1st Floor	1,160	SF	7	10+ years			
	Ceiling - Splined	1st Floor	1,994	SF	7	10+ years			
	Ceiling - Splined	1st Floor	6	SF	4	0-1 year	Water damage		
	Doors - Side-lite	1st Floor	55	SF	7	10+ years	ŭ		
	Doors - Transom Window	1st Floor	72	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	6	ĒΑ	7	10+ years			
	Floor - Terrazzo	1st Floor	3,150	SF	6	10+ years			
	Floor - Terrazzo	1st Floor	10	SF	4	0-1 year	Damaged.		
	Lighting - Pendent/Surface	1st Floor	62	EA	7	10+ years	Damagoa		
	Storage/ Closet	1st Floor	24	SF	7	10+ years			
	Storage/ Closet	1st Floor	215	SF	5	10+ years			
	Walls - Plaster/Drywall	1st Floor	795	SF	7	10+ years			
	Walls - Structural Glazed Tile	1st Floor	4,975	SF	7	10+ years			
Library									
	AC Unit	2nd Floor-222 Library	4	EA	7	6-10 years			
	Casework	2nd Floor-222 Library	128	LF	7	10+ years			
	Ceiling - Lay-in	2nd Floor-222 Library	2,909	SF	7	10+ years			
	Doors - Transom Window	2nd Floor-222 Library	24	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor-222 Library	2	EA	7	10+ years			
	Floor - Carpet	2nd Floor-222 Library	2,909	SF	7	6-10 years			
	Lighting - Lay-in	2nd Floor-222 Library	24	EA	7	6-10 years			
	Walls - Plaster/Drywall	2nd Floor-222 Library	3,025	SF	7	10+ years			
	AC Unit	2nd Floor-College and Career Suite	3,023	EA	7	6-10 years	AC Units still covered from the winter		
	AC CHIL	· ·			,	•	season		
	Casework	2nd Floor-College and Career Suite	8	LF	7	10+ years			
	Ceiling - Lay-in	2nd Floor-College and Career Suite	2,909	SF	7	6-10 years			
	Doors - Transom Window	2nd Floor-College and Career Suite	24	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor-College and Career Suite	2	EA	7	10+ years			
	Floor - Tile	2nd Floor-College and Career Suite	2,909	SF	7	6-10 years			
	Lighting - Lay-in	2nd Floor-College and Career Suite	24	EA	7	6-10 years			
	Lighting - Pendent/Surface	2nd Floor-College and Career Suite	2	EA	7	6-10 years			
	Walls - Plaster/Drywall	2nd Floor-College and Career Suite	3,025	SF	7	10+ years			

Campus Name: Raby HS Page : 15 of 44 Assessment Date: 05/20/2024



Category : Room			В	uilding	: Main				
				J		Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
ocker/S	hower Room								
	Accessories	1st Floor	735	SF	7	6-10 years			
	Ceiling - Plaster/Drywall	1st Floor	735	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	3	EA	7	10+ years			
	Floor - Concrete	1st Floor	100	SF	5	1-2 years	Damage wall base at locker base		
	Floor - Terrazzo	1st Floor	510	SF	7	10+ years			
	Floor - Terrazzo	1st Floor	100	SF	5	10+ years			
	Floor - Tile/Sheet	1st Floor	25	SF	7	10+ years			
	Floor Drain	1st Floor	4	EA	7	10+ years			
	Lighting - Pendent/Surface	1st Floor	14	EA	7	10+ years			
	Lighting - Pendent/Surface	1st Floor	2	EA	6	10+ years			
	Showers	1st Floor	13	EA	5	10+ years			
	Storage/ Closet	1st Floor	75	SF	7	10+ years			
	Student Lockers - One Tier	1st Floor	8	EA	7	10+ years			
	Student Lockers - Two Tier	1st Floor	284	EA	7	10+ years			
	Walls - Concrete Block	1st Floor	300	SF	7	10+ years			
	Walls - Plaster/Drywall	1st Floor	1,312	SF	7	10+ years			
	Walls - Tile Ceramic/ Porcelain	1st Floor	878	SF	7	10+ years			
	Accessories	1st Floor	2,620	SF	7	6-10 years			
	Benches, ped mounted	1st Floor	70	LF	7	10+ years			
	Ceiling - Plaster/Drywall	1st Floor	2,620	SF	7	10+ years			
	Doors - Wood Doors inclu hw	1st Floor	2	EΑ	7	10+ years			
	Floor - Terrazzo	1st Floor	705	SF	5	10+ years			
	Floor - Terrazzo	1st Floor	100	SF	4	1-2 years	Cracking		
	Floor - Tile Ceramic/ Porcelain	1st Floor	1,185	SF	7	10+ years	G. a.cg		
	Floor - Tile Ceramic/ Porcelain	1st Floor	100	SF	4	1-2 years	Damaged tiles		
	Floor - Tile/Sheet	1st Floor	510	SF	7	10+ years	Damagoa moo		
	Floor - Tile/Sheet	1st Floor	10	SF	4	1-2 years	Damaged tiles		
	Floor Drain	1st Floor	10	EA	7	10+ years	Damagoa moo		
	Hand Dryer	1st Floor	1	EΑ	7	6-10 years			
	Lavatory	1st Floor	2	EΑ	7	10+ years			
	Lighting - Pendent/Surface	1st Floor	28	EA	6	10+ years			
	Partitions	1st Floor	22	EA	7	10+ years			
	Storage/ Closet	1st Floor	52	SF	7	10+ years			
	Student Lockers - One Tier	1st Floor	46	EA	7	10+ years			
	Student Lockers - Two Tier	1st Floor	334	EA	7	10+ years			
	Walls - Concrete Block	1st Floor	1,145	SF	7	10+ years			
	Walls - Plaster/Drywall	1st Floor	1,810	SF	7	10+ years			
	Walls - Structural Glazed Tile	1st Floor	1,104	SF	7	10+ years			
	Walls - Tile Ceramic/ Porcelain	1st Floor	262	SF	7	10+ years			
	Water Closet	1st Floor	6	EA	7	10+ years			
	Accessories	1st Floor - Men's Locker Room	116	SF	7	6-10 years			
	/ 10000001100	Office	110	51	'	o io years			



Building: Main Category: Room Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments SF 10+ years Ceiling - Plaster/Drywall 1st Floor - Men's Locker Room 116 7 Office Doors - Side-lite 1st Floor - Men's Locker Room 25 SF 7 10+ years Office Doors - Transom Window 1st Floor - Men's Locker Room 10 SF 7 10+ years Office Doors - Wood Doors inclu hw 1st Floor - Men's Locker Room 2 EΑ 7 10+ years Office Floor - Tile Ceramic/ Porcelain 1st Floor - Men's Locker Room 60 SF 7 10+ years Office Floor - Tile Ceramic/ Porcelain 1st Floor - Men's Locker Room 5 SF 4 1-2 years Missing tiles Office Floor - Tile/Sheet SF 7 1st Floor - Men's Locker Room 51 10+ years Office Floor Drain 1st Floor - Men's Locker Room 1 EΑ 7 10+ years Office Hand Dryer 1st Floor - Men's Locker Room 1 EΑ 7 10+ years Office EΑ 1st Floor - Men's Locker Room 2 7 Lavatory 10+ years Office Lighting - Pendent/Surface 1st Floor - Men's Locker Room 2 EΑ 7 10+ years Office Lighting - Pendent/Surface 1st Floor - Men's Locker Room 1 EΑ 5 6-10 years Office **Partitions** 6 EΑ 1st Floor - Men's Locker Room 5 6-10 years Office Power Distribution 1st Floor - Men's Locker Room 2 EΑ 7 10+ years Office Walls - Plaster/Drywall 1st Floor - Men's Locker Room 415 SF 7 10+ years Office SF Walls - Tile Ceramic/ Porcelain 1st Floor - Men's Locker Room 50 7 10+ years Office Water Closet 1st Floor - Men's Locker Room EΑ 7 10+ years Office Lunch & Multipurpose Room Ceiling - Lay-in 1st Floor 4.898 SF 7 10+ years No occupancy signage Doors - Side-lite 1st Floor SF 7 10+ years 72 SF Doors - Transom Window 1st Floor 32 7 10+ years Doors - Wood Doors inclu hw 1st Floor 8 EΑ 7 10+ years Floor - Terrazzo 4,798 SF 7 1st Floor 10+ years SF Floor - Terrazzo 1st Floor 100 4 0-1 year Cracking Lighting - Lay-in 1st Floor 52 EΑ 7 10+ years Lighting - Pendent/Surface 1st Floor 18 EΑ 7 10+ years



Catego	egory : Room Building : Main						
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Serving Line	1st Floor	70	LF	7	10+ years	
	Walls - Concrete Block	1st Floor	835	SF	7	10+ years	
	Walls - Plaster/Drywall	1st Floor	1,876	SF	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor	2,854	SF	7	10+ years	
	Ceiling - Lay-in	1st Floor - Faculty Lounge (used as Garden)	734	SF	7	10+ years	
	Ceiling - Lay-in	1st Floor - Faculty Lounge (used as Garden)	16	SF	4	1-2 years	Damaged tiles
	Doors - Side-lite	1st Floor - Faculty Lounge (used as Garden)	18	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - Faculty Lounge (used as Garden)	1	EA	7	10+ years	
	Floor - Terrazzo	1st Floor - Faculty Lounge (used as Garden)	730	SF	6	10+ years	
	Floor - Terrazzo	1st Floor - Faculty Lounge (used as Garden)	20	SF	4	1-2 years	Cracked terrazzo
	Lighting - Lay-in	1st Floor - Faculty Lounge (used as Garden)	12	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - Faculty Lounge (used as Garden)	590	SF	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor - Faculty Lounge (used as Garden)	620	SF	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor - Faculty Lounge (used as Garden)	160	SF	7	10+ years	
_MDF_ID	F						
<u></u>	Doors - Steel Doors incl hw	2nd Floor	1	EA	7	10+ years	
	Finishes	2nd Floor	64	SF	7	10+ years	
	Other Cooling Unit	2nd Floor	1	ĒΑ	5	1-2 years	Ductless Worn and missing cover
_Mechan	ical/ Service Rooms						
	Janitor's Closet	1st Floor	12	SF	7	10+ years	155
	Janitor's Closet	1st Floor	14	SF	5	10+ years	124b
	Janitor's Closet	1st Floor	12	SF	5	10+ years	141a
	Mechanical/ Service Rooms	1st Floor	15	SF	7	10+ years	
	Mechanical/ Service Rooms	1st Floor	135	SF	7	10+ years	
	Storage Room	1st Floor	6	SF	7	10+ years	156
	Storage Room	1st Floor	100	SF	7	10+ years	136
	Storage Room	1st Floor	8	SF	5	10+ years	
	Storage Room	1st Floor	8	SF	5	10+ years	
	Vaults	1st Floor	60	SF	5	10+ years	
	Janitor's Closet	2nd Floor	24	SF	5	10+ years	
	Janitor's Closet	2nd Floor	24	SF	5	10+ years	
	Janitor's Closet	3rd Floor	17	SF	7	10+ years	



Building: Main Category: Room Recommend Group Item - Type Location Quantity **UOM** Rank Replacement Comments Janitor's Closet 3rd Floor 10 SF 10+ years 7 Mechanical/ Service Rooms 3rd Floor 46 SF 7 10+ years Storage Room 3rd Floor 48 SF 7 10+ years Janitor's Closet 20 SF 7 4th Floor 10+ years SF Janitor's Closet 4th Floor 15 5 10+ years SF 7 Mechanical/ Service Rooms 4th Floor 10 10+ years Storage Room 4th Floor 125 SF 7 10+ years SF Boiler Room Basement 2.265 7 10+ years Crawl Space - Unfinished Basement 135.450 SF 7 10+ years SF Mechanical/ Service Rooms 482 7 10+ years Basement SF Mechanical/ Service Rooms Basement 12.505 7 10+ years Mechanical/ Service Rooms Basement 223 SF 7 10+ years Mechanical/ Service Rooms 410 SF 7 Basement 10+ years SF 7 Storage Room Basement 144 10+ years Storage Room SF 7 Basement 294 10+ years Storage Room SF Basement 178 7 10+ years SF Storage Room Basement 266 7 10+ years Prep Room 413A 68 LF 6 10+ years Casework SF Ceiling - Plaster/Drywall 413A 307 6 10+ years Doors - Side-lite 413A 40 SF 7 10+ years Doors - Wood Doors inclu hw 413A 2 EΑ 6 10+ years Floor - Tile 413A 282 SF 7 10+ years Floor - Tile 413A 25 SF 4 1-2 years Chipping Lighting - Pendent/Surface 6 EΑ 7 10+ years 413A SF Walls - Plaster/Drywall 413A 856 6 10+ years Work Sink 2 EΑ 7 413A 10+ years 41 LF Casework 414B 7 10+ years SF Ceiling - Lay-in 414B 176 7 10+ years SF Ceiling - Lay-in 414B 6 4 1-2 years Damaged tiles Doors - Wood Doors inclu hw 414B 1 EΑ 7 10+ years Floor - Tile 414B 182 SF 7 10+ years Lighting - Lay-in 414B 4 EΑ 7 10+ years Walls - Plaster/Drywall 414B 465 SF 6 10+ years 7 Work Sink 414B 1 EΑ 10+ years Restroom 104 - Teacher's Workroom 28 SF 7 6-10 years Accessories SF Ceiling - Lay-in 104 - Teacher's Workroom 28 6 6-10 years Doors - Wood Doors inclu hw EΑ 7 104 - Teacher's Workroom 1 10+ years Floor - Tile 104 - Teacher's Workroom 18 SF 6 6-10 years SF Floor - Tile 104 - Teacher's Workroom 10 4 1-2 years Damaged tiles Floor Drain 104 - Teacher's Workroom 1 EΑ 7 10+ years



3545 W Fulton BOULEVARD, Chicago, IL 60624

Catego	ry : Room		Building : Main							
	_					Recommend				
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments			
	Lavatory	104 - Teacher's Workroom	1	EA	7	10+ years				
	Lighting - Lay-in	104 - Teacher's Workroom	1	EA	7	10+ years				
	Lighting - Wall Mounted	104 - Teacher's Workroom	1	EA	7	10+ years				
	Walls - Plaster/Drywall	104 - Teacher's Workroom	56	SF	7	10+ years				
	Water Closet	104 - Teacher's Workroom	1	EA	7	10+ years				
	Accessories	1st Floor	464	SF	7	6-10 years				
	Ceiling - Plaster/Drywall	1st Floor	464	SF	7	10+ years				
	Doors - Wood Doors inclu hw	1st Floor	1	EA	7	10+ years				
	Floor - Tile Ceramic/ Porcelain	1st Floor	464	SF	7	10+ years				
	Floor Drain	1st Floor	1	EA	7	10+ years				
	Lavatory	1st Floor	2	EA	7	10+ years				
	Lighting - Pendent/Surface	1st Floor	4	EA	7	10+ years				
	Partitions	1st Floor	12	EA	7	10+ years				
	Walls - Plaster/Drywall	1st Floor	645	SF	7	10+ years				
	Walls - Vinyl Coated Gypsum Panel	1st Floor	485	SF	7	10+ years				
	Water Closet	1st Floor	12	EA	7	10+ years				
	Accessories	1st Floor	379	SF	7	6-10 years				
	Ceiling - Plaster/Drywall	1st Floor	379	SF	7	10+ years				
	Doors - Wood Doors inclu hw	1st Floor	1	EA	7	10+ years				
	Floor - Tile Ceramic/ Porcelain	1st Floor	369	SF	7	10+ years				
	Floor - Tile Ceramic/ Porcelain	1st Floor	10	SF	4	1-2 years	Damaged tiles			
	Floor Drain	1st Floor	1	EA	7	10+ years				
	Hand Dryer	1st Floor	1	EA	7	6-10 years				
	Lavatory	1st Floor	2	EA	7	10+ years				
	Lighting - Pendent/Surface	1st Floor	5	EA	7	10+ years				
	Partitions	1st Floor	3	EA	7	10+ years				
	Urinals	1st Floor	3	EA	7	10+ years				
	Walls - Concrete Block	1st Floor	422	SF	7	10+ years				
	Walls - Structural Glazed Tile	1st Floor	343	SF	7	10+ years				
	Walls - Tile Ceramic/ Porcelain	1st Floor	500	SF	7	10+ years				
	Water Closet	1st Floor	3	EA	7	10+ years				
	Accessories	1st Floor - Auditorium Men's	98	SF	7	6-10 years				
	Ceiling - Plaster/Drywall	1st Floor - Auditorium Men's	98	SF	7	10+ years				
	Doors - Wood Doors inclu hw	1st Floor - Auditorium Men's	1	EA	7	10+ years				
	Floor - Tile	1st Floor - Auditorium Men's	93	SF	7	10+ years				
	Floor - Tile	1st Floor - Auditorium Men's	5	SF	4	1-2 years	Damaged or missing tiles			
	Lavatory	1st Floor - Auditorium Men's	2	EA	6	10+ years				
	Lighting - Pendent/Surface	1st Floor - Auditorium Men's	2	EA	7	10+ years				
	Partitions	1st Floor - Auditorium Men's	1	EA	5	0-1 year	Partition Door damaged			
	Urinals	1st Floor - Auditorium Men's	2	EA	7	10+ years	ŭ			
	Walls - Plaster/Drywall	1st Floor - Auditorium Men's	15	SF	7	10+ years				
	Walls - Vinyl Coated Gypsum Panel	1st Floor - Auditorium Men's	135	SF	7	10+ years				
	Water Closet	1st Floor - Auditorium Men's	1	ĒΑ	7	10+ years				
	Accessories	1st Floor - Auditorium Women's	125	SF	7	6-10 years				
			.20		•	3 .0 ,00.0				

Campus Name: Raby HS Page: 20 of 44 Assessment Date: 05/20/2024



3545 W Fulton BOULEVARD, Chicago, IL 60624

Category : Room			B	uilding	: Main		
			•			Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Plaster/Drywall	1st Floor - Auditorium Women's	125	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - Auditorium Women's	1	EA	7	10+ years	
	Floor - Tile	1st Floor - Auditorium Women's	125	SF	7	10+ years	
	Lavatory	1st Floor - Auditorium Women's	2	ΕA	7	10+ years	
	Lighting - Pendent/Surface	1st Floor - Auditorium Women's	2	EA	7	10+ years	
	Partitions	1st Floor - Auditorium Women's	2	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - Auditorium Women's	185	SF	7	10+ years	
	Walls - Vinyl Coated Gypsum Panel	1st Floor - Auditorium Women's	235	SF	7	10+ years	
	Water Closet	1st Floor - Auditorium Women's	2	EA	6	6-10 years	
	Accessories	1st Floor - Central Women's	152	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor - Central Women's	152	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - Central Women's	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	1st Floor - Central Women's	152	SF	7	10+ years	
	Lavatory	1st Floor - Central Women's	1	EA	6	10+ years	
	Lighting - Pendent/Surface	1st Floor - Central Women's	2	ΕA	6	10+ years	
	Partitions	1st Floor - Central Women's	2	ΕA	7	10+ years	
	Student Lockers - One Tier	1st Floor - Central Women's	9	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - Central Women's	380	SF	7	10+ years	
	Water Closet	1st Floor - Central Women's	2	EA	7	10+ years	
	Accessories	1st Floor - East Unisex	50	SF	7	6-10 years	
	Ceiling - Lay-in	1st Floor - East Unisex	44	SF	7	10+ years	
	Ceiling - Lay-in	1st Floor - East Unisex	6	SF	7	6-10 years	
	Doors - Wood Doors inclu hw	1st Floor - East Unisex	1	EA	7	10+ years	
	Floor - Terrazzo	1st Floor - East Unisex	6	SF	7	10+ years	
	Floor - Tile	1st Floor - East Unisex	44	SF	7	10+ years	
	Floor Drain	1st Floor - East Unisex	1	ΕA	7	10+ years	
	Lavatory	1st Floor - East Unisex	1	EA	7	10+ years	
	Lighting - Lay-in	1st Floor - East Unisex	1	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - East Unisex	40	SF	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor - East Unisex	50	SF	7	10+ years	
	Water Closet	1st Floor - East Unisex	1	EA	7	10+ years	
	Accessories	1st Floor - East Women's	206	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor - East Women's	206	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor - East Women's	1	EA	7	10+ years	5 14 1 1
	Floor - Tile Ceramic/ Porcelain	1st Floor - East Women's	206	SF	4	0-1 year	Damaged throughout.
	Lavatory	1st Floor - East Women's	2	ΕA	7	10+ years	
	Lighting - Pendent/Surface	1st Floor - East Women's	2	EA	7	10+ years	
	Partitions	1st Floor - East Women's	2	EA	7	10+ years	
	Walls - Plaster/Drywall	1st Floor - East Women's	736	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	1st Floor - East Women's	64	SF	7	10+ years	
	Water Closet	1st Floor - East Women's	2	EA	7	10+ years	
	Accessories	1st Floor - Engineer	50	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	1st Floor - Engineer	50	SF	7	10+ years	
	Doors - Side-lite	1st Floor - Engineer	12	SF	7	10+ years	

Campus Name: Raby HS Page : 21 of 44 Assessment Date: 05/20/2024



Building: Main Category: Room Recommend Group Item - Type Location Quantity **UOM** Rank Replacement Comments Doors - Transom Window 1st Floor - Engineer 12 SF 10+ years 7 1st Floor - Engineer EΑ 7 Doors - Wood Doors inclu hw 1 10+ years Floor - Tile Ceramic/ Porcelain 1st Floor - Engineer 50 SF 7 10+ years EΑ Lavatory 1st Floor - Engineer 1 6 10+ years 1st Floor - Engineer 7 Lighting - Pendent/Surface 1 EΑ 10+ years Walls - Plaster/Drywall SF 7 1st Floor - Engineer 40 10+ years Walls - Vinyl Coated Gypsum Panel 1st Floor - Engineer 50 SF 7 10+ years Water Closet 1st Floor - Engineer 1 EΑ 7 10+ years Accessories 2nd Floor-Boy's Restroom 520 SF 7 6-10 years SF Ceiling - Plaster/Drywall 2nd Floor-Boy's Restroom 520 7 10+ years 2nd Floor-Boy's Restroom Doors - Wood Doors inclu hw 1 EΑ 7 10+ years Floor - Tile Ceramic/ Porcelain 2nd Floor-Boy's Restroom 520 SF 7 10+ years Floor Drain EΑ 7 6-10 years 2nd Floor-Boy's Restroom 1 7 Lavatory 2nd Floor-Boy's Restroom 2 EΑ 10+ years Lighting - Pendent/Surface 2nd Floor-Boy's Restroom 7 4 EΑ 6-10 years 2nd Floor-Boy's Restroom 11 **Partitions** FΑ 7 10+ years 7 Urinals 2nd Floor-Boy's Restroom 3 EΑ 10+ years Walls - Plaster/Drywall 2nd Floor-Boy's Restroom 700 SF 6 10+ years SF Walls - Structural Glazed Tile 2nd Floor-Boy's Restroom 225 7 10+ years SF Walls - Tile 2nd Floor-Boy's Restroom 75 7 10+ years Water Closet 2nd Floor-Boy's Restroom 10 EΑ 7 10+ years Water Closet 2nd Floor-Boy's Restroom 1 EΑ 4 0-1 year Out of order 70 SF 7 Accessories 2nd Floor-Unisex Staff Toilet 6-10 years SF Ceiling - Plaster/Drywall 2nd Floor-Unisex Staff Toilet 70 7 10+ years Doors - Wood Doors inclu hw FΑ 7 2nd Floor-Unisex Staff Toilet 1 10+ years SF Floor - Tile Ceramic/ Porcelain 2nd Floor-Unisex Staff Toilet 70 7 6-10 years Floor Drain 2nd Floor-Unisex Staff Toilet EΑ 7 10+ years 1 Hand Dryer EΑ 7 2nd Floor-Unisex Staff Toilet 1 10+ years Lavatory 2nd Floor-Unisex Staff Toilet 1 EΑ 7 10+ years Lighting - Pendent/Surface 2nd Floor-Unisex Staff Toilet 2 EΑ 7 6-10 years Walls - Plaster/Drvwall 2nd Floor-Unisex Staff Toilet 70 SF 7 10+ vears SF Walls - Tile Ceramic/ Porcelain 2nd Floor-Unisex Staff Toilet 95 7 10+ years FΑ 7 Water Closet 2nd Floor-Unisex Staff Toilet 10+ vears Accessories 3rd Floor-Boy's Restroom, former 440 SF 7 6-10 years Girl's Restroom 3rd Floor-Boy's Restroom, former SF Accessories 10 5 0-1 year Damaged towel dispenser Girl's Restroom 3rd Floor-Boy's Restroom, former Ceiling - Plaster/Drywall 450 SF 7 10+ years Girl's Restroom Doors - Wood Doors inclu hw 3rd Floor-Boy's Restroom, former 1 EΑ 7 10+ years Girl's Restroom SF Floor - Tile Ceramic/ Porcelain 3rd Floor-Boy's Restroom, former 450 7 6-10 years Girl's Restroom Floor Drain 3rd Floor-Boy's Restroom, former EΑ 7 10+ years



Category : Room

Category : Room		В	uilding	: Main			
_				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
_	•	Girl's Restroom				<u>.</u>	
	Lavatory	3rd Floor-Boy's Restroom, former	2	EA	7	10+ years	
	•	Girl's Restroom				,	
	Lighting - Pendent/Surface	3rd Floor-Boy's Restroom, former	4	EA	7	6-10 years	
	3 . 3	Girl's Restroom				,	
	Partitions	3rd Floor-Boy's Restroom, former	7	EA	7	10+ years	
		Girl's Restroom				, , , , ,	
	Urinals	3rd Floor-Boy's Restroom, former	5	EA	7	10+ years	
		Girl's Restroom				,	
	Walls - Masonry	3rd Floor-Boy's Restroom, former	280	SF	7	10+ years	
	•	Girl's Restroom				,	
	Walls - Plaster/Drywall	3rd Floor-Boy's Restroom, former	9	SF	6	10+ years	
	•	Girl's Restroom				,	
	Walls - Structural Glazed Tile	3rd Floor-Boy's Restroom, former	195	SF	7	10+ years	
		Girl's Restroom				,	
	Water Closet	3rd Floor-Boy's Restroom, former	7	EA	7	10+ years	
		Girl's Restroom				,	
	Accessories	3rd Floor-Girl's Restroom, across	520	SF	7	6-10 years	
		from 322				,	
	Ceiling - Plaster/Drywall	3rd Floor-Girl's Restroom, across	520	SF	7	10+ years	
	,	from 322				·	
	Doors - Wood Doors inclu hw	3rd Floor-Girl's Restroom, across	1	EA	7	10+ years	
		from 322				•	
	Floor - Tile Ceramic/ Porcelain	3rd Floor-Girl's Restroom, across	520	SF	7	6-10 years	
		from 322				•	
	Floor Drain	3rd Floor-Girl's Restroom, across	1	EA	7	10+ years	
		from 322					
	Lavatory	3rd Floor-Girl's Restroom, across	2	EA	7	10+ years	
		from 322					
	Lighting - Pendent/Surface	3rd Floor-Girl's Restroom, across	3	EA	7	6-10 years	
		from 322					
	Partitions	3rd Floor-Girl's Restroom, across	14	EA	7	10+ years	
		from 322					
	Walls - Masonry	3rd Floor-Girl's Restroom, across	445	SF	7	10+ years	
		from 322					
	Walls - Plaster/Drywall	3rd Floor-Girl's Restroom, across	640	SF	6	10+ years	
		from 322					
	Walls - Tile Ceramic/ Porcelain	3rd Floor-Girl's Restroom, across	40	SF	7	10+ years	
		from 322					
	Water Closet	3rd Floor-Girl's Restroom, across	13	EA	7	10+ years	
		from 322					
	Water Closet	3rd Floor-Girl's Restroom, across	1	EA	4	0-1 year	Out of order
		from 322				•	
	Accessories	3rd Floor-Staff Restroom	83	SF	7	10+ years	

Campus Name: Raby HS Page : 23 of 44 Assessment Date: 05/20/2024



Category : Room

Catego	ry : Room		Building : Main				
				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Ceiling - Plaster/Drywall	3rd Floor-Staff Restroom	83	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor-Staff Restroom	1	EA	7	10+ years	
	Floor - Terrazzo	3rd Floor-Staff Restroom	10	SF	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	3rd Floor-Staff Restroom	73	SF	7	6-10 years	
	Floor Drain	3rd Floor-Staff Restroom	1	EΑ	7	10+ years	
	Hand Dryer	3rd Floor-Staff Restroom	1	EΑ	7	10+ years	
	Lavatory	3rd Floor-Staff Restroom	1	EA	7	10+ years	
	Lighting - Pendent/Surface	3rd Floor-Staff Restroom	1	EΑ	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor-Staff Restroom	103	SF	7	10+ years	
	Walls - Structural Glazed Tile	3rd Floor-Staff Restroom	28	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	3rd Floor-Staff Restroom	146	SF	7	10+ years	
	Water Closet	3rd Floor-Staff Restroom	1	EΑ	7	10+ years	
	Accessories	3rd Floor-Women's Staff Restroom	214	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	3rd Floor-Women's Staff Restroom	214	SF	7	10+ years	
	Doors - Transom Window	3rd Floor-Women's Staff Restroom	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor-Women's Staff Restroom	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	3rd Floor-Women's Staff Restroom	214	SF	7	6-10 years	
	Lavatory	3rd Floor-Women's Staff Restroom	2	EA	7	10+ years	
	Lighting - Pendent/Surface	3rd Floor-Women's Staff Restroom	2	EA	7	6-10 years	
	Partitions	3rd Floor-Women's Staff Restroom	3	EA	7	10+ years	
	Walls - Masonry	3rd Floor-Women's Staff Restroom	52	SF	7	10+ years	
	Walls - Plaster/Drywall	3rd Floor-Women's Staff Restroom	686	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	3rd Floor-Women's Staff Restroom	59	SF	7	10+ years	
	Water Closet	3rd Floor-Women's Staff Restroom	3	EΑ	7	10+ years	
	Accessories	416	27	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	416	27	SF	7	10+ years	
	Doors - Wood Doors inclu hw	416	1	EΑ	7	10+ years	
	Floor - Tile	416	27	SF	7	10+ years	
	Lavatory	416	1	EA	7	10+ years	
	Lighting - Pendent/Surface	416	1	EA	7	10+ years	
	Lighting - Wall Mounted	416	1	EA	7	10+ years	
	Walls - Plaster/Drywall	416	80	SF	6	10+ years	
	Water Closet	416	1	EΑ	7	10+ years	
	Accessories	4th Floor	520	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	4th Floor	520	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	4th Floor	520	SF	6	10+ years	
	Floor Drain	4th Floor	1	EA	7	10+ years	
	Lavatory	4th Floor	2	EA	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	4	EA	7	10+ years	
	Partitions	4th Floor	14	EA	7	10+ years	
	Walls - Plaster/Drywall	4th Floor	860	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	4th Floor	40	SF	7	10+ years	
	Walls - Vinyl Coated Gypsum Panel	4th Floor	570	SF	7	10+ years	
	2 -21 21		- -	•		,	

Campus Name: Raby HS Page : 24 of 44 Assessment Date: 05/20/2024



Catego	ry : Room		R	uilding	· Main	3343	W Fulton BOULEVARD, Chicago, IL 60624
Calego	iy.ixooni		D	unung	. iviaiii	Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Oroup	Water Closet	4th Floor	14	EA	7	10+ years	Comments
	Accessories	4th Floor	450	SF	7	6-10 years	
	Ceiling - Plaster/Drywall	4th Floor	450	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	1	EA	7	10+ years	
	Floor - Tile Ceramic/ Porcelain	4th Floor	450	SF	7	10+ years	
	Floor Drain	4th Floor	1	EA	7	10+ years	
		4th Floor		EA	7		
	Lavatory	4th Floor	2 4			10+ years	
	Lighting - Pendent/Surface		·-	EΑ	7	10+ years	
	Partitions	4th Floor	7	EΑ	7	10+ years	
	Urinals	4th Floor	5	EA	7	10+ years	
	Walls - Plaster/Drywall	4th Floor	580	SF	6	10+ years	
	Walls - Structural Glazed Tile	4th Floor	125	SF	7	10+ years	
	Walls - Vinyl Coated Gypsum Panel	4th Floor	304	SF	7	10+ years	
	Water Closet	4th Floor	7	EA	7	10+ years	
Catego	ry : Classroom		В	uilding	: Main		
_				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Classroo	om #108 (Weight)		-			•	
	Casework	1st Floor	9	LF	7	10+ years	
	Ceiling - Plaster/Drywall	1st Floor	500	SF	7	10+ years	
	Chalk Board	1st Floor	6	LF	4	2-5 years	
	Doors - Transom Window	1st Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	2	EA	7	10+ years	
	Floor - Sport Flooring	1st Floor	500	SF	7	10+ years	
	Lighting - Pendent/Surface	1st Floor	16	EA	7	10+ years	
	Marker Board	1st Floor	6	LF	7	6-10 years	
	Wall Mirrors	1st Floor	90	SF	7	10+ years	
	Walls - Plaster/Drywall	1st Floor	918	SF	7	10+ years	
	Walls - Plastel/Drywall	151 F1001	910	SF	,	10+ years	
Classroo	m #120 (Other Instructional Use)						
	AC Units	1st Floor	2	EA	7	6-10 years	
	Ceiling - Lay-in	1st Floor	1,025	SF	7	10+ years	
	Doors - Transom Window	1st Floor	24	SF	7	10+ years	
	Doors - Wood Doors inclu hw	1st Floor	3	EA	7	10+ years	
	Floor - Tile	1st Floor	1,022	SF	7	10+ years	
	Floor - Tile	1st Floor	3	SF	4	0-1 year	Cracked tiles
	Lighting - Lay-in	1st Floor	36	ĒΑ	7	10+ years	
	Marker Board	1st Floor	24	LF	7	6-10 years	
	Walls - Plaster/Drywall	1st Floor	1,275	SF	6	10+ years	
Classra	om #120A (Other Instructional Use)						
_CiaSSIO0	AC Units	1st Floor	1	EA	7	6-10 years	
						,	



Building: Main Category: Classroom Recommend Group Item - Type Location Quantity **UOM** Rank Replacement Comments 216 Ceiling - Lay-in 1st Floor SF 10+ years 7 Doors - Side-lite 1st Floor SF 7 24 10+ years Doors - Wood Doors inclu hw 1st Floor FΑ 7 10+ years 1 Floor - Carpet SF 7 1st Floor 216 6-10 years Lighting - Lay-in 1st Floor 6 EΑ 7 10+ years Storage/ Closet SF 7 1st Floor 64 10+ years Walls - Plaster/Drywall 375 SF 1st Floor 6 10+ years Classroom #120B (Other Instructional Use) AC Units 1st Floor 1 EΑ 7 6-10 years Ceiling - Lay-in 1st Floor 216 SF 7 10+ years Doors - Wood Doors inclu hw 1st Floor 1 EΑ 7 10+ years Floor - Carpet 1st Floor 216 SF 7 6-10 years Lighting - Lay-in 1st Floor 6 EΑ 7 10+ years Walls - Plaster/Drywall 375 SF 7 1st Floor 10+ years Classroom #206 (Other Instructional Use) Casework 2nd Floor 8 LF 7 10+ years 2nd Floor SF Ceiling - Plaster/Drywall 977 7 10+ years Chalk Board 2nd Floor 14 LF 4 2-5 years 7 Doors - Wood Doors inclu hw 2nd Floor 1 EΑ 10+ years SF Floor - Tile 2nd Floor 977 7 6-10 years Lighting - Pendent/Surface 2nd Floor 16 EΑ 7 6-10 years Marker Board 2nd Floor LF 7 16 6-10 years Walls - Plaster/Drywall 2nd Floor 1,286 SF 7 10+ years Classroom #208 (Faculty Lounge) 2nd Floor 9 LF Casework 7 10+ years Ceiling - Plaster/Drywall 2nd Floor 700 SF 7 10+ years Doors - Wood Doors inclu hw 2nd Floor 7 1 EΑ 10+ years Floor - Tile SF 7 6-10 years 2nd Floor 700 Lighting - Pendent/Surface 7 2nd Floor 12 EΑ 6-10 years Marker Board 2nd Floor 50 LF 7 6-10 years SF Walls - Plaster/Drywall 2nd Floor 1.174 7 10+ years Classroom #209 (Office) 2nd Floor LF Casework 19 7 10+ years SF Ceiling - Plaster/Drywall 2nd Floor 760 7 10+ years SF Doors - Transom Window 2nd Floor 18 7 10+ years Doors - Wood Doors inclu hw EΑ 7 2nd Floor 2 10+ years Floor - Tile 2nd Floor 760 SF 5 6-10 years Lighting - Pendent/Surface 2nd Floor 12 EΑ 7 6-10 years Marker Board 1 F 7 2nd Floor 42 6-10 years



Catego	Category : Classroom		В	uilding	: Main		W Tulion Boole VAILB, Officago, ie 0002-
	,					Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Plaster/Drywall	2nd Floor	1,282	SF	7	10+ years	
Classroo	om #210 (Regular Classroom)						
	Casework	2nd Floor	9	LF	7	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	700	SF	6	10+ years	
	Doors - Transom Window	2nd Floor	9	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	5	1-2 years	Door Finish cracked
	Floor - Wood	2nd Floor	700	SF	6	10+ years	
	Lighting - Pendent/Surface	2nd Floor	12	EA	7	6-10 years	
	Marker Board	2nd Floor	46	LF	7	6-10 years	
	Walls - Plaster/Drywall	2nd Floor	1,174	SF	7	10+ years	
Classroo	om #212 (Regular Classroom)						
	Casework	2nd Floor	9	LF	7	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	700	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years	
	Floor - Tile	2nd Floor	700	SF	7	10+ years	
	Lighting - Pendent/Surface	2nd Floor	12	EA	7	6-10 years	
	Marker Board	2nd Floor	50	LF	7	6-10 years	
	Walls - Plaster/Drywall	2nd Floor	1,174	SF	6	10+ years	
Classroo	om #214 (Regular Classroom)						
	Casework	2nd Floor	9	LF	7	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	700	SF	7	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	6	10+ years	
	Floor - Wood	2nd Floor	700	SF	6	10+ years	
	Lighting - Pendent/Surface	2nd Floor	12	EA	7	6-10 years	
	Marker Board	2nd Floor	50	LF	7	6-10 years	
	Walls - Plaster/Drywall	2nd Floor	1,174	SF	7	10+ years	
Classroo	om #215 (Regular Classroom)						
	AC Units	2nd Floor	2	EA	7	6-10 years	
	Casework	2nd Floor	9	LF	7	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	685	SF	6	10+ years	
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	7	10+ years	
	Floor - Wood	2nd Floor	685	SF	7	10+ years	
	Lighting - Pendent/Surface	2nd Floor	11	EA	7	6-10 years	
	Lighting - Pendent/Surface	2nd Floor	1	EA	5	0-1 year	Damaged assembly
	Marker Board	2nd Floor	50	LF	7	6-10 years	-
	Walls - Plaster/Drywall	2nd Floor	1,144	SF	6	10+ years	
Classroo	om #216 (Faculty Lounge)						
	AC Units	2nd Floor	2	EA	7	6-10 years	
			_		•	3 . 5 , 5	

Campus Name: Raby HS Page : 27 of 44 Assessment Date: 05/20/2024



Catego	Category : Classroom		В	uilding	: Main				
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
	Casework	2nd Floor	18	LF	7	10+ years			
	Ceiling - Lay-in	2nd Floor	1,050	SF	7	10+ years			
	Doors - Transom Window	2nd Floor	18	SF	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	2	EA	7	10+ years			
	Floor - Tile	2nd Floor	1,050	SF	7	6-10 years			
	Lighting - Lay-in	2nd Floor	40	EA	7	6-10 years			
	Marker Board	2nd Floor	50	LF	7	6-10 years			
	Storage/ Closet	2nd Floor	160	SF	7	10+ years			
	Walls - Plaster/Drywall	2nd Floor	1,650	SF	7	10+ years			
Classroc	om #221 (Computer Lab)								
	Casework	2nd Floor	39	LF	7	10+ years			
	Ceiling - Plaster/Drywall	2nd Floor	1,243	SF	7	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	.,	ĒΑ	7	10+ years			
	Doors - Wood Doors inclu hw	2nd Floor	1	EA	7	10+ years			
	Floor - Tile	2nd Floor	743	SF	7	6-10 years			
	Floor - Tile	2nd Floor	500	SF	4	1-2 years	Cracked tiles		
	Lighting - Pendent/Surface	2nd Floor	29	EA	7	6-10 years	Gradita tilos		
	Marker Board	2nd Floor	8	LF	7	6-10 years			
	Walls - Plaster/Drywall	2nd Floor	1,596	SF	7	10+ years			
	Wireless System	2nd Floor	1,000	EA	7	10+ years			
	,					, , , , , ,			
Classroc	om #225 (Store Room)								
	AC Units	2nd Floor	1	EA	7	6-10 years			
	Casework	2nd Floor	10	LF	7	10+ years			
	Ceiling - Plaster/Drywall	2nd Floor	650	SF	7	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1	EA	7	10+ years			
	Floor - Tile	2nd Floor	640	SF	7	10+ years			
	Floor - Tile	2nd Floor	10	SF	4	1-2 years	Damaged		
	Lighting - Pendent/Surface	2nd Floor	6	EA	7	6-10 years	•		
	Lighting - Pendent/Surface	2nd Floor	2	EA	6	6-10 years			
	Storage/ Closet	2nd Floor	4	SF	7	10+ years			
	Walls - Plaster/Drywall	2nd Floor	1,150	SF	6	10+ years			
_Classroo	om #226 (Office)								
	Casework	2nd Floor	10	LF	7	10+ years			
	Ceiling - Plaster/Drywall	2nd Floor	1,108	SF	7	10+ years			
	Doors - Steel Doors incl hw	2nd Floor	1,100	EA	7	10+ years			
	Floor - Tile	2nd Floor	1,108	SF	7	6-10 years			
	Lighting - Pendent/Surface	2nd Floor	30	EA	7	6-10 years			
	Marker Board	2nd Floor	12	LF	7	6-10 years			
	Storage/ Closet	2nd Floor	24	SF	7	6-10 years			
	Walls - Plaster/Drywall	2nd Floor	1,360	SF	7	10+ years			
	vvalio - i lastei/Diywali	2110 1 1001	1,300	OI.	,	10+ years			



Category : Classroom			В	uilding	: Main		
Craun	Item - Type	Location	Quantity	UOM	Rank	Recommend	Comments
Group	item - Type	Location	Quantity	OOW	Kalik	Replacement	Comments
Classroo	m #306 (Regular Classroom)						
	Casework	3rd Floor	10	LF	7	10+ years	
	Ceiling - Plaster/Drywall	3rd Floor	995	SF	7	10+ years	
	Chalk Board	3rd Floor	50	LF	4	2-5 years	
	Doors - Transom Window	3rd Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
	Floor - Wood	3rd Floor	995	SF	7	10+ years	
	Lighting - Pendent/Surface	3rd Floor	16	ĒΑ	7	6-10 years	
	Marker Board	3rd Floor	16	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	1,340	SF	7	10+ years	Water damage repaired
lassroo	m #308 (Regular Classroom)						
	AC Units	3rd Floor	1	EA	5	1-2 years	Old and worn Cover missing
	Casework	3rd Floor	10	LF	7	6-10 years	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
	Ceiling - Plaster/Drywall	3rd Floor	700	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
	Floor - Tile	3rd Floor	680	SF	7	6-10 years	
	Floor - Tile	3rd Floor	20	SF	4	1-2 years	Cracks
	Lighting - Pendent/Surface	3rd Floor	12	EA	7	6-10 years	Cracks
	Marker Board	3rd Floor	20	LF	7	6-10 years	
	Storage/ Closet	3rd Floor	18	SF	7	10+ years	
	Walls - Plaster/Drywall	3rd Floor	833	SF	6	10+ years	
Classroo	m #309 (Regular Classroom)						
	Casework	3rd Floor	10	LF	7	10+ years	
	Ceiling - Plaster/Drywall	3rd Floor	725	SF	6	10+ years	
	Chalk Board	3rd Floor	20	ĹF	4	2-5 years	
	Doors - Transom Window	3rd Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
	Floor - Wood	3rd Floor	725	SF	7	10+ years	
	Lighting - Pendent/Surface	3rd Floor	12	ĒΑ	7	6-10 years	
	Marker Board	3rd Floor	20	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	1,020	SF	6	10+ years	
lassroo	m #310 (Other Instructional Use)						
	AC Units	3rd Floor	1	EA	7	6-10 years	
	Ceiling - Plaster/Drywall	3rd Floor	515	SF	7	10+ years	
	Chalk Board	3rd Floor	4	LF	4	2-5 years	
	Doors - Transom Window	3rd Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	1	EA	7	10+ years	
			•	SF	•	,	

Campus Name: Raby HS Page : 29 of 44 Assessment Date: 05/20/2024



Category: Classroom **Building: Main** Recommend Group Item - Type Location Quantity UOM Rank Replacement **Comments** Floor - Tile 3rd Floor 10 SF 4 1-2 years Missina Lighting - Pendent/Surface 3rd Floor EΑ 7 6-10 years 4 Walls - Plaster/Drywall 3rd Floor 1,040 SF 7 10+ years Classroom #311 (Other Instructional Use) AC Units 3rd Floor 1 FΑ 7 6-10 years Casework 3rd Floor 10 LF 7 10+ years SF Ceiling - Plaster/Drywall 3rd Floor 725 7 10+ years Doors - Wood Doors inclu hw EΑ 3rd Floor 7 10+ years 1 SF Floor - Wood 3rd Floor 725 7 10+ years Lighting - Pendent/Surface EΑ 7 6-10 years 3rd Floor 12 Marker Board 3rd Floor 20 LF 7 6-10 years Walls - Plaster/Drywall SF 7 3rd Floor 1.020 10+ years Classroom #312 (Regular Classroom) Casework 3rd Floor 30 LF 7 10+ years Ceiling - Plaster/Drywall 3rd Floor SF 865 6 10+ years Chalk Board LF 2-5 years 3rd Floor 10 4 Doors - Wood Doors inclu hw FΑ 7 3rd Floor 10+ years 1 Floor - Tile 3rd Floor 865 SF 7 6-10 years Lighting - Pendent/Surface 3rd Floor 16 FΑ 7 6-10 years LF Marker Board 3rd Floor 10 7 6-10 years SF Walls - Plaster/Drywall 3rd Floor 1,020 10+ years Classroom #313 (Office) AC Units 3rd Floor 1 EΑ 7 6-10 years 3rd Floor 10 LF 7 Casework 10+ years SF Ceiling - Plaster/Drywall 3rd Floor 725 7 10+ years Doors - Transom Window 3rd Floor 8 SF 7 10+ years Doors - Wood Doors inclu hw 7 3rd Floor 1 EΑ 10+ years SF 7 10+ years Floor - Wood 3rd Floor 725 7 Lighting - Pendent/Surface 3rd Floor 12 EΑ 6-10 years Marker Board 3rd Floor 30 LF 7 6-10 years Walls - Plaster/Drywall SF 3rd Floor 1,020 7 10+ years Classroom #314 (Regular Classroom) Casework 3rd Floor LF 30 7 10+ years SF Ceiling - Lav-in 3rd Floor 1.025 7 10+ years SF Doors - Transom Window 3rd Floor 7 10+ years EΑ Doors - Wood Doors inclu hw 3rd Floor 1 7 10+ years Floor - Wood 3rd Floor 1.025 SF 7 10+ years Lighting - Lay-in 3rd Floor 16 EΑ 7 6-10 years Marker Board 20 1 F 7 3rd Floor 6-10 years



Building: Main Category: Classroom Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments SF Walls - Plaster/Drywall 3rd Floor 1.532 6 10+ years Classroom #315 (Store Room) AC Units 3rd Floor 2 EΑ 7 6-10 years Casework 3rd Floor 10 LF 7 10+ years Ceiling - Plaster/Drywall 725 SF 3rd Floor 6 10+ years Doors - Wood Doors inclu hw 3rd Floor FΑ 7 10+ years 1 SF Floor - Wood 3rd Floor 725 7 10+ years Lighting - Pendent/Surface 3rd Floor 12 EΑ 7 6-10 years Lighting - Pendent/Surface 3rd Floor 2 EΑ 5 0-1 year Does not work. Marker Board 24 LF 7 6-10 years 3rd Floor Walls - Plaster/Drywall 3rd Floor 1,020 SF 6 10+ years Classroom #318 (Regular Classroom) AC Units 3rd Floor 2 7 EΑ 6-10 years Casework 3rd Floor 30 LF 7 10+ years SF 7 Ceiling - Lay-in 3rd Floor 1,015 10+ years Ceiling - Lav-in SF 3rd Floor 10 1-2 years Water damage Doors - Wood Doors inclu hw FΑ 7 3rd Floor 1 10+ years Floor - Wood 3rd Floor 1.025 SF 7 10+ years Lighting - Lay-in 3rd Floor 14 FΑ 7 6-10 years LF Marker Board 3rd Floor 20 7 6-10 years SF Walls - Plaster/Drywall 3rd Floor 1,532 10+ years Classroom #320 (Regular Classroom) LF Casework 3rd Floor 30 7 10+ years 3rd Floor SF Ceiling - Lav-in 1.105 7 10+ years Doors - Transom Window SF 3rd Floor 8 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 EΑ 7 10+ years SF 7 Floor - Tile 3rd Floor 1.105 6-10 years EΑ 7 6-10 years Lighting - Pendent/Surface 3rd Floor 18 1 F 7 Marker Board 3rd Floor 8 6-10 years Storage/ Closet 3rd Floor 35 SF 7 10+ years SF Walls - Plaster/Drywall 3rd Floor 1,520 7 10+ years SF Walls - Tile Ceramic/ Porcelain 3rd Floor 30 7 10+ years Classroom #321 (Regular Classroom) **AC Units** 2 3rd Floor EΑ 7 6-10 years Casework 3rd Floor 10 LF 7 10+ years 3rd Floor SF Ceiling - Lav-in 725 7 10+ years Doors - Wood Doors inclu hw 3rd Floor 1 FΑ 7 10+ years Floor - Wood 3rd Floor 725 SF 7 10+ years 7 Lighting - Lay-in 3rd Floor 12 EΑ 6-10 years



Catego	ory : Classroom		В	uilding	: Main		VV I ditori BOOLE VAIXB, Officago, ile 00024
Juliogo	i y i Giacorcom		_	anamg	· maiii	Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Marker Board	3rd Floor	40	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	835	SF	7	10+ years	
	•					,	
Classroo	om #322 (Regular Classroom)						
	AC Units	3rd Floor	2	EA	7	6-10 years	
	Casework	3rd Floor	16	LF	7	10+ years	
	Ceiling - Lay-in	3rd Floor	1,092	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	1,092	SF	7	6-10 years	
	Lighting - Pendent/Surface	3rd Floor	30	EA	7	6-10 years	
	Marker Board	3rd Floor	20	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	1,189	SF	7	10+ years	
_Classroo	om #324 (Other Instructional Use)	0.151				0.40	
	AC Units	3rd Floor	2	EA	7	6-10 years	
	Casework	3rd Floor	70	LF	7	10+ years	
	Ceiling - Lay-in	3rd Floor	1,076	SF	7	10+ years	
	Doors - Transom Window	3rd Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	3rd Floor	2	EA	7	10+ years	
	Floor - Tile	3rd Floor	1,066	SF	7	6-10 years	
	Floor - Tile	3rd Floor	10	SF	4	1-2 years	Damaged
	Lighting - Pendent/Surface	3rd Floor	30	EA	7	6-10 years	
	Marker Board	3rd Floor	16	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	1,171	SF	7	10+ years	
	Work Sink	3rd Floor	4	EA	7	10+ years	
Classro	om #325 (Regular Classroom)						
	AC Units	3rd Floor	2	EA	7	6-10 years	
	Casework	3rd Floor	10	LF	7	10+ years	
	Ceiling - Lay-in	3rd Floor	725	SF	7	10+ years	
	Doors - Steel Doors incl hw	3rd Floor	1	EΑ	7	10+ years	
	Floor - Wood	3rd Floor	725	SF	7	10+ years	
	Lighting - Lay-in	3rd Floor	12	EΑ	7	6-10 years	
	Marker Board	3rd Floor	40	LF	7	6-10 years	
	Walls - Plaster/Drywall	3rd Floor	835	SF	7	10+ years	
OI-	(1007 (Damiles Cl						
Classroo	om #327 (Regular Classroom) AC Units	Ord Floor		EA	7	6.10 40075	
		3rd Floor	2	LF	7	6-10 years	
	Casework	3rd Floor	10		7	10+ years	
	Ceiling - Lay-in	3rd Floor	725	SF	7	10+ years	
	Doors - Steel Doors incl hw	3rd Floor	1	EA	7	10+ years	
	Floor - Wood	3rd Floor	725	SF	7	10+ years	

Campus Name: Raby HS Page : 32 of 44 Assessment Date: 05/20/2024



Building: Main Category: Classroom Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Lighting - Lay-in 3rd Floor 12 FΑ 6-10 years 7 Marker Board 3rd Floor 20 LF 7 6-10 years Walls - Plaster/Drywall 3rd Floor 750 SF 7 10+ years Classroom #330 (Regular Classroom) AC Units 3rd Floor 3 FΑ 7 6-10 years Casework 3rd Floor 10 LF 7 10+ years SF Ceiling - Plaster/Drywall 3rd Floor 725 6 10+ years Doors - Steel Doors incl hw EΑ 7 3rd Floor 10+ years 1 SF Floor - Tile 3rd Floor 715 7 6-10 years Floor - Tile SF 3rd Floor 10 4 1-2 years Cracks Lighting - Pendent/Surface 3rd Floor 12 EΑ 7 6-10 years Marker Board 3rd Floor 20 LF 7 6-10 years SF Walls - Plaster/Drywall 3rd Floor 1.025 7 10+ years Classroom #406 (Other Instructional Use) 4th Floor LF 7 Casework 18 10+ years Ceiling - Plaster/Drywall 4th Floor 525 SF 7 10+ years Doors - Transom Window 4th Floor SF 7 8 10+ years Doors - Wood Doors inclu hw 4th Floor FΑ 7 10+ years 1 520 SF Floor - Tile 4th Floor 7 10+ years SF Floor - Tile 4th Floor 5 0-1 year Cracks 4 Lighting - Pendent/Surface 4th Floor 16 EΑ 7 10+ years Walls - Plaster/Drywall 4th Floor SF 7 1.010 10+ years Walls - Tile Ceramic/ Porcelain 4th Floor 53 SF 7 10+ years Work Sink 4th Floor EΑ 7 1 10+ years Classroom #406A (Office) Ceiling - Plaster/Drywall 4th Floor 331 SF 6 10+ years Doors - Transom Window 4th Floor SF 7 8 10+ years Doors - Wood Doors inclu hw EΑ 7 4th Floor 1 10+ years SF 7 Floor - Tile 4th Floor 329 10+ years Floor - Tile 4th Floor 2 SF 0-1 year 4 Chipping 7 Lighting - Pendent/Surface 4th Floor 8 FΑ 10+ years LF Marker Board 4th Floor 10 7 6-10 years SF Walls - Plaster/Drywall 4th Floor 912 10+ years Classroom #408 (Store Room) LF Casework 4th Floor 30 7 10+ years Ceiling - Plaster/Drywall 4th Floor SF 1.025 6 10+ years LF Chalk Board 4th Floor 15 4 2-5 years Doors - Transom Window 4th Floor 16 SF 7 10+ years 7 Doors - Wood Doors inclu hw 4th Floor EΑ 10+ years



Category : Classroom

Building : Main

Recommend

Overtity | UOM | Book | Booksement | Comments

Catego	ry : Classroom		В	uilding	: Main		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Floor - Wood	4th Floor	1,025	SF	6	10+ years	
	Kiln	4th Floor	1	EΑ	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	15	EA	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	1	EA	5	0-1 year	Missing cover
	Walls - Plaster/Drywall	4th Floor	1,532	SF	6	10+ years	•
	Walls - Tile Ceramic/ Porcelain	4th Floor	48	SF	7	10+ years	
	Work Sink	4th Floor	1	EA	7	10+ years	
Classroo	om #410 (Other Instructional Use)						
	Casework	4th Floor	30	LF	7	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	1,005	SF	6	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	20	SF	5	1-2 years	Water damage
	Doors - Transom Window	4th Floor	8	SF	7	10+ years	ŭ
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Floor - Wood	4th Floor	1,025	SF	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	16	EA	7	10+ years	
	Marker Board	4th Floor	16	LF	7	6-10 years	
	Walls - Plaster/Drywall	4th Floor	1,532	SF	7	10+ years	
	Walls - Structural Glazed Tile	4th Floor	30	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	4th Floor	48	SF	7	10+ years	
	Work Sink	4th Floor	1	EA	5	1-2 years	Missing faucet handles
Classro	om #411 (Science Lab Level 3)						
	Casework	4th Floor	148	LF	7	10+ years	
	Ceiling - Lay-in	4th Floor	1,172	SF	7	10+ years	
	Doors - Transom Window	4th Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Eye Wash Station	4th Floor	1	ΕA	7	10+ years	
	Floor - Tile	4th Floor	1,172	SF	7	10+ years	
	Gas Line	4th Floor	1	ĒΑ	7	10+ years	
	Lighting - Lay-in	4th Floor	18	ĒΑ	7	10+ years	
	Marker Board	4th Floor	30	LF	7	6-10 years	
	Science Lab Elements	4th Floor	1,172	SF	7	10+ years	
	Science Lab Shower	4th Floor	, 1	ĒΑ	7	10+ years	
	Storage/ Closet	4th Floor	87	SF	7	10+ years	Locked
	Walls - Plaster/Drywall	4th Floor	1,770	SF	7	10+ years	
	Work Sink	4th Floor	5	ĒΑ	7	10+ years	
Classro	om #414 (Science Lab Level 1)						
	Casework	4th Floor	175	LF	7	10+ years	
	Ceiling - Lay-in	4th Floor	1,444	SF	7	10+ years	
	Doors - Transom Window	4th Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	20013 WOOG 20013 IIIOIG IIW	Tu 1 1001	2	LA	,	ioi yeais	

Campus Name: Raby HS Page : 34 of 44 Assessment Date: 05/20/2024



Catego	ry : Classroom		В	uilding	: Main		· • • • • • • • • • • • • • • • • • • •
_				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Eye Wash Station	4th Floor	1	EA	7	10+ years	
	Floor - Tile	4th Floor	1,444	SF	7	10+ years	
	Gas Line	4th Floor	10	EA	7	10+ years	
	Lighting - Lay-in	4th Floor	21	EA	7	10+ years	
	Marker Board	4th Floor	12	LF	7	6-10 years	
	Science Lab Elements	4th Floor	1,444	SF	7	10+ years	
	Science Lab Fume Hood	4th Floor	1	EA	7	10+ years	
	Science Lab Shower	4th Floor	1	EA	7	10+ years	
	Storage/ Closet	4th Floor	95	SF	7	10+ years	Locked
	Walls - Plaster/Drywall	4th Floor	1,450	SF	7	10+ years	
	Walls - Structural Glazed Tile	4th Floor	30	SF	7	10+ years	
	Work Sink	4th Floor	10	ĒΑ	7	10+ years	
						,	
_Classroo	om #415 (Store Room)						
	Casework	4th Floor	120	LF	6	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	1,172	SF	6	10+ years	
	Chalk Board	4th Floor	20	LF	4	2-5 years	
	Doors - Transom Window	4th Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Floor - Tile	4th Floor	1,162	SF	7	10+ years	
	Floor - Tile	4th Floor	10	SF	4	0-1 year	Cracks
	Gas Line	4th Floor	5	EA	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	16	EA	7	10+ years	
	Science Lab Elements	4th Floor	1,172	SF	7	10+ years	
	Storage/ Closet	4th Floor	87	SF	7	10+ years	
	Walls - Plaster/Drywall	4th Floor	1,770	SF	7	10+ years	
	Work Sink	4th Floor	3	EA	7	10+ years	
Classro	om #420 (Culinary)						
_Classiot	AC Units	4th Floor	3	EA	7	6-10 years	
	Ceiling - Lay-in	4th Floor	1,786	SF	7	10+ years	
	Culinary Exhaust Hood - Type I	4th Floor	3	EA	7	10+ years	
	Culinary Kitchen Equipment	4th Floor	1,786	EA	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	3	EA	7		
	Floor - Tile	4th Floor	1,584	SF	7	10+ years	
	Floor - Tile	4th Floor		SF	4	10+ years	Crooks
			2	SF SF		0-1 year	Cracks
	Floor - Tile Quarry	4th Floor	200		7	10+ years	
	Lighting - Lay-in	4th Floor	36	EA LF	7	10+ years	
	Marker Board	4th Floor	8		7	6-10 years	
	Storage/ Closet	4th Floor	356	SF	7	10+ years	
	Walls - Metal Panel	4th Floor	1,612	SF	7	10+ years	
	Walls - Plaster/Drywall	4th Floor	788	SF	7	10+ years	
	Work Sink	4th Floor	5	EA	7	10+ years	



Catego	ry : Classroom		В	W Fulloff BOOLE VARD, Chicago, IL 60024			
				_		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Classroo	om #421 (Science Lab Level 2)						
	Casework	4th Floor	100	LF	6	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	1,025	SF	6	10+ years	
	Doors - Transom Window	4th Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Floor - Tile	4th Floor	1,025	SF	7	10+ years	
	Gas Line	4th Floor	7	EA	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	16	EA	7	10+ years	
	Marker Board	4th Floor	24	LF	7	6-10 years	
	Science Lab Elements	4th Floor	1,025	SF	7	10+ years	
	Storage/ Closet	4th Floor	13	SF	7	10+ years	Locked
	Walls - Plaster/Drywall	4th Floor	1,532	SF	7	10+ years	
	Work Sink	4th Floor	3	EA	7	10+ years	
Classroo	om #422A (Regular Classroom)						
<u> </u>	Casework	4th Floor	10	LF	7	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	710	SF	7	10+ years	
	Chalk Board	4th Floor	16	LF	4	2-5 years	
	Doors - Transom Window	4th Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	1	ĒΑ	7	10+ years	
	Floor - Terrazzo	4th Floor	10	SF	7	10+ years	
	Floor - Wood	4th Floor	700	SF	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	12	ĒΑ	7	10+ years	
	Marker Board	4th Floor	15	LF	7	6-10 years	
	Walls - Plaster/Drywall	4th Floor	1,208	SF	6	10+ years	
	Walls - Structural Glazed Tile	4th Floor	30	SF	7	10+ years	
	Walls - Tile Ceramic/ Porcelain	4th Floor	23	SF	7	10+ years	
	Work Sink	4th Floor	1	EA	7	10+ years	
Classroo	om #422B (Regular Classroom)						
	AC Units	4th Floor	2	EA	7	6-10 years	
	Casework	4th Floor	30	LF	7	10+ years	
	Ceiling - Lay-in	4th Floor	900	SF	7	10+ years	
	Doors - Transom Window	4th Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Floor - Tile	4th Floor	890	SF	7	10+ years	
	Floor - Tile	4th Floor	10	SF	4	1-2 years	Cracks
	Lighting - Lay-in	4th Floor	20	EA	7	10+ years	-
	Lighting - Lay-in	4th Floor	1	EΑ	5	1-2 years	Loose fixture
	Marker Board	4th Floor	6	LF	7	6-10 years	
	Walls - Plaster/Drywall	4th Floor	1,054	SF	7	10+ years	
	Walls - Structural Glazed Tile	4th Floor	30	SF	7	10+ years	
						•	



Catego	ry : Classroom		P	uilding	· Main	3343	W Fulton BOULEVARD, Chicago, IL 60624
Calego	ry . Classicolli		ь	ullullig	. IVIAIII	Recommend	
Group	Itom - Typo	Location	Quantity	UOM	Rank	Replacement	Comments
•	Item - Type	Location	Quantity	UOIVI	Kalik	Replacement	Comments
Classroo	m #425 (Regular Classroom)						
	AC Units	4th Floor	2	EA	7	6-10 years	
	Casework	4th Floor	16	LF	7	10+ years	
	Ceiling - Lay-in	4th Floor	1,105	SF	7	10+ years	
	Doors - Transom Window	4th Floor	16	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	2	EA	7	10+ years	
	Floor - Tile	4th Floor	1,105	SF	7	10+ years	
	Lighting - Lay-in	4th Floor	33	EA	7	10+ years	
	Marker Board	4th Floor	20	LF	7	6-10 years	
	Walls - Plaster/Drywall	4th Floor	1,520	SF	7	10+ years	
Classroo	m #426 (Regular Classroom)						
	AC Units	4th Floor	2	EA	7	6-10 years	
	Casework	4th Floor	16	LF	7	10+ years	
	Ceiling - Lay-in	4th Floor	740	SF	7	10+ years	
	Chalk Board	4th Floor	7	ĹF	4	2-5 years	
	Doors - Transom Window	4th Floor	8	SF	7	10+ years	
	Doors - Wood Doors inclu hw	4th Floor	1	ĒA	7	10+ years	
	Floor - Tile	4th Floor	740	SF	7	10+ years	
	Lighting - Lay-in	4th Floor	18	ĒΑ	7	10+ years	
	Marker Board	4th Floor	20	LF	7	6-10 years	
	Walls - Plaster/Drywall	4th Floor	1,010	SF	7	10+ years	
Catego	ry : Interior		В	uilding	: Main		
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
Corridor						•	
	Ceiling - Plaster/Drywall	1st Floor	6,951	SF	7	10+ years	
	Doors - Side-lite	1st Floor	90	SF	7	10+ years	
	Doors - Steel Doors incl hw	1st Floor	6	EΑ	7	10+ years	
	Doors - Transom Window	1st Floor	144	SF	7	10+ years	
	Doors - Wood Doors include hw	1st Floor	14	ĒA	7	10+ years	
	Drinking Fountains - Single Fountain	1st Floor	1	EA	5	0-1 year	Not working
	Drinking Fountains - Single Water Cooler	1st Floor	3	EA	7	10+ years	
	Floor - Terrazzo	1st Floor	3,135	SF	5	10+ years	
	Floor - Tile/Sheet	1st Floor	3,733	SF	7	10+ years	
	Floor - Tile/Sheet	1st Floor	33	SF	5	1-2 years	Cracking
	Floor - Tile/Sheet	1st Floor	50	SF	4	1-2 years	Damaged tiles
	Lighting - Chandelier, Incandescent	1st Floor	4	EA	7	10+ years	godoo
	Lighting - Pendent/Surface	1st Floor	106	EΑ	7	10+ years	
	Lighting - Pendent/Surface	1st Floor	2	EA	5	1-2 years	Refurbish assembly
	Stairs - Terrazzo	1st Floor	36	LF	7	10+ years	. to and our addominity
	Student Lockers - One Tier	1st Floor	366	EA	7	10+ years	
	2.55 250.010 0110 1101		200		•	.o. yould	



Catego	ry : Interior		R	uilding	: Main	55-5	W Fullon BOOLE VARD, Chicago, IL 60624
Jalogo	. ,			uiig		Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Plaster/Drywall	1st Floor	8,408	SF	7	10+ years	
	Walls - Plaster/Drywall	1st Floor	246	SF	7	10+ years	
	Walls - Structural Glazed Tile	1st Floor	8,774	SF	7	10+ years	
	Ceiling - Plaster/Drywall	2nd Floor	5,550	SF	7	10+ years	
	Doors - Side-lite	2nd Floor	150	SF	7	10+ years	
	Doors - Steel Doors incl hw	2nd Floor	8	EA	7	10+ years	
	Doors - Transom Window	2nd Floor	144	SF	7	10+ years	
	Drinking Fountains - Single Water Cooler	2nd Floor	3	EA	7	10+ years	
	Floor - Terrazzo	2nd Floor	2,514	SF	7	10+ years	
	Floor - Tile/Sheet	2nd Floor	3,036	SF	7	6-10 years	
	Lighting - Pendent/Surface	2nd Floor	52	EA	7	6-10 years	
	Stairs - Concrete Stairs	2nd Floor	12	LF	7	10+ years	
	Student Lockers - One Tier	2nd Floor	289	EA	7	10+ years	
	Walls - Plaster/Drywall	2nd Floor	5,488	SF	7	10+ years	
	Walls - Structural Glazed Tile	2nd Floor	6,310	SF	7	10+ years	
	Ceiling - Plaster/Drywall	3rd Floor	4,085	SF	7	10+ years	
	Doors - Wood Doors include hw	3rd Floor	10	EA	7	10+ years	
	Drinking Fountains - Single Water Cooler	3rd Floor	2	EA	7	10+ years	
	Floor - Terrazzo	3rd Floor	1,905	SF	7	10+ years	
	Floor - Terrazzo	3rd Floor	100	SF	4	1-2 years	Cracks
	Floor - Tile/Sheet	3rd Floor	2,080	SF	7	6-10 years	
	Lighting - Pendent/Surface	3rd Floor	38	EA	7	6-10 years	
	Student Lockers - One Tier	3rd Floor	248	EA	7	10+ years	
	Walls - Concrete Block	3rd Floor	5,276	SF	7	10+ years	
	Walls - Structural Glazed Tile	3rd Floor	3,022	SF	7	10+ years	
	Ceiling - Plaster/Drywall	4th Floor	4,085	SF	6	10+ years	
	Doors - Side-lite	4th Floor	80	SF	7	10+ years	
	Doors - Transom Window	4th Floor	192	SF	7	10+ years	
	Doors - Wood Doors include hw	4th Floor	10	EA	7	10+ years	
	Drinking Fountains - Single Water Cooler	4th Floor	3	EA	7	10+ years	Qty updated
	Floor - Terrazzo	4th Floor	1,905	SF	7	10+ years	•
	Floor - Terrazzo	4th Floor	100	SF	4	1-2 years	Cracks
	Floor - Tile/Sheet	4th Floor	2,080	SF	7	10+ years	
	Lighting - Pendent/Surface	4th Floor	39	EA	7	10+ years	
	Student Lockers - One Tier	4th Floor	199	EA	7	10+ years	
	Walls - Plaster/Drywall	4th Floor	3,022	SF	7	10+ years	
	Walls - Structural Glazed Tile	4th Floor	5,276	SF	7	10+ years	
						·	
Safety							
-	Camera Viewing Station	1st Floor	3	EA	7	6-10 years	
	Metal Detector	1st Floor	1	EA	7	6-10 years	
	Security Cameras	1st Floor	48	EA	7	6-10 years	
	Security Cameras	1st Floor	4	EA	7	6-10 years	
	-					-	



Building: Main Category: Interior Recommend Group Item - Type Location Quantity UOM Rank Replacement Comments Stairs Ceiling - Plaster/Drywall SF 6 #1 NE 1,005 10+ years Floor - Terrazzo #1 NE 838 SF 7 10+ years Handrails 238 LF 7 #1 NE 10+ years Lighting - Pendent/Surface EΑ 7 10+ years #1 NE 13 Stairs - Terrazzo LF 7 #1 NF 590 10+ years Walls - Plaster/Drywall #1 NE 1.570 SF 6 10+ years SF Walls - Structural Glazed Tile #1 NF 1,570 7 10+ years SF Ceiling - Plaster/Drywall #2 N 1.480 6 10+ years Floor - Terrazzo SF #2 N 1,180 7 10+ years Handrails #2 N LF 7 364 10+ years Lighting - Pendent/Surface #2 N 16 EΑ 7 10+ years Qty updated Stairs - Terrazzo #2 N 700 LF 7 10+ years Walls - Plaster/Drywall SF #2 N 1.650 6 10+ years Walls - Structural Glazed Tile #2 N SF 7 1.650 10+ years Ceiling - Plaster/Drywall #3 NW 1.005 SF 6 10+ years Floor - Terrazzo SF 7 #3 NW 823 10+ years Floor - Terrazzo #3 NW 15 SF 5 1-2 years Cracks LF 7 Handrails #3 NW 238 10+ years Lighting - Pendent/Surface EΑ 7 10+ years #3 NW 13 Lighting - Wall Mounted #3 NW 1 EΑ 7 6-10 years Stairs - Terrazzo #3 NW 590 LF 7 10+ vears SF Walls - Plaster/Drywall 1.570 7 10+ years #3 NW Walls - Structural Glazed Tile SF 7 #3 NW 1.570 10+ years Ceiling - Plaster/Drywall #5 SW 720 SF 7 10+ years Floor - Terrazzo #5 SW 550 SF 7 10+ years LF 7 Handrails #5 SW 204 10+ years Lighting - Pendent/Surface EΑ 7 #5 SW 12 10+ years Lighting - Pendent/Surface #5 SW 2 EΑ 6 10+ years Stairs - Terrazzo LF #5 SW 590 7 10+ years Qty updated SF Walls - Plaster/Drywall #5 SW 1.020 7 10+ years SF Walls - Structural Glazed Tile #5 SW 1.020 7 10+ years SF Ceiling - Plaster/Drywall #6 S 226 7 10+ years Floor - Terrazzo #6 S 76 SF 7 10+ years Handrails #6 S 58 LF 7 10+ years EΑ 7 Lighting - Pendent/Surface #6 S 4 10+ years Qty updated LF Stairs - Terrazzo #6 S 144 7 10+ years Qty updated #6 S 300 SF 7 Walls - Plaster/Drywall 10+ years Walls - Structural Glazed Tile SF #6 S 300 7 10+ years SF Ceiling - Plaster/Drywall 226 10+ years #8 S 6 Floor - Terrazzo #8 S 76 SF 7 10+ years LF Handrails #8 S 58 7 10+ years Lighting - Pendent/Surface #8 S 2 EΑ 7 10+ years Stairs - Terrazzo LF 7 #8 S 144 10+ years Qty updated





Catego	ry : Interior	В	uilding	: Main		-	
						Recommend	
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments
	Walls - Plaster/Drywall	#8 S	300	SF	6	10+ years	
	Walls - Structural Glazed Tile	#8 S	300	SF	7	10+ years	
	Ceiling - Exposed	Boiler Room Stairs	136	SF	7	10+ years	
	Floor - Concrete	Boiler Room Stairs	36	SF	7	10+ years	
	Handrails	Boiler Room Stairs	44	LF	7	10+ years	
	Lighting - Wall Mounted	Boiler Room Stairs	1	EA	7	10+ years	
	Stairs - Concrete	Boiler Room Stairs	110	LF	7	10+ years	
	Walls - Concrete Block	Boiler Room Stairs	240	SF	6	10+ years	
	Ceiling - Plaster/Drywall	Gym Stairs, to Balcony	170	SF	6	10+ years	
	Floor - Concrete Epoxy/ Painted	Gym Stairs, to Balcony	170	SF	7	10+ years	
	Handrails	Gym Stairs, to Balcony	38	LF	7	10+ years	
	Lighting - Pendent/Surface	Gym Stairs, to Balcony	1	EA	6	10+ years	
	Stairs - Terrazzo	Gym Stairs, to Balcony	160	LF	7	10+ years	Qty updated
	Walls - Plaster/Drywall	Gym Stairs, to Balcony	565	SF	7	10+ years	
	Ceiling - Plaster/Drywall	SE Gym Stairs	430	SF	7	10+ years	
	Floor - Terrazzo	SE Gym Stairs	345	SF	7	10+ years	
	Handrails	SE Gym Stairs	124	LF	7	10+ years	
	Lighting - Pendent/Surface	SE Gym Stairs	4	EA	7	10+ years	
	Lighting - Pendent/Surface	SE Gym Stairs	4	EA	6	10+ years	
	Stairs - Terrazzo	SE Gym Stairs	290	LF	7	10+ years	
	Walls - Plaster/Drywall	SE Gym Stairs	465	SF	7	10+ years	
	Walls - Structural Glazed Tile	SE Gym Stairs	465	SF	7	10+ years	
_Vertical (Conveyance						
	Elevator - Elevator- Machine Roomless	1st Floor	1	EA	7	10+ years	

Campus Name: Raby HS Page : 40 of 44 Assessment Date: 05/20/2024



Category : Site Building : Site

Category : Site		Building : Site							
						Recommend			
Group	Item - Type	Location	Quantity	UOM	Rank	Replacement	Comments		
Civil/Dra	- 0								
	Civil/ Drainage - Catch Basin	Entire Site	3	EA	6	10+ years			
	Civil/ Drainage - Site Manhole	Entire Site	13	EA	6	10+ years			
Fencing									
	Fencing - Chain Link	Entire Site	66	LF	6	10+ years			
	Fencing - Iron and Concrete Post	Entire Site	100	LF	6	10+ years			
	Fencing - Iron and Concrete Post	Entire Site	5	LF	4	1-2 years	Bent/damaged fence		
	Fencing - New Standard Ornamental	Entire Site	708	LF	6	10+ years			
Landsca	no								
Lanusta	Landscape - Hardscape- Concrete	Entire Site	2,376	SF	7	10+ years			
	Landscape - Hardscape- Concrete	Entire Site	15,567	SF	6	10+ years			
	Parkway trees	Entire Site	6	EA	6	10+ years			
	Planting Beds/ Area	Entire Site	1,000	SF	6	10+ years			
	Walking Path - Crushed Stone	Entire Site	250	SF	6	10+ years			
	3				-	, , , , , ,			
Parking	Lot								
·	Concrete Curbs	Entire Site	558	LF	6	10+ years			
	Interior Plantings	Entire Site	2,170	LF	6	10+ years			
	Surface - Asphalt	Entire Site	16,164	SF	6	10+ years			
	Surface - Asphalt	Entire Site	2,000	SF	4	1-2 years	Cracked asphalt		
	Surface - Concrete	Entire Site	2,191	SF	6	10+ years	·		
	Trash Compactor	Entire Site	1	EA	6	10+ years			
	Trash Enclosure - Chain Links	Entire Site	654	SF	6	10+ years			
	Vehicular Screening	Entire Site	565	LF	6	10+ years			
Sidewall		Futing Oite	0=0		-	40			
	Sidewalks - Perimeter Sidewalks	Entire Site	250	SF SF	7	10+ years			
	Sidewalks - Perimeter Sidewalks	Entire Site	5,280	5F	6	10+ years			
Signage									
5 5	Flag Pole - Flag Pole	Entire Site	1	EA	6	10+ years			
	Marquee - Free Standing Back lighted w/	Entire Site	1	EA	6	10+ years			
	LED								
	Monument - Building Mounted Cut Letter	Entire Site	3	EA	6	10+ years			
	Sign								

Campus Name: Raby HS Page : 41 of 44 Assessment Date: 05/20/2024

¹ It is very rare for assessors to find a feature in this condition. If assessors do, they are required to report it to CPS right away, and CPS facilities will address it immediately. As a result, no features should be



ranked "1" in this report; by the time the report is compiled, they will have been resolved.

Definitions

- Quantity means, for each item, the total number (or amount) of that item that exists and was evaluated
- Unit means the generally accepted standard unit of measure for each item. Some items, like doors, are measured individually and use the unit of measurement "EA" for "each." Other items, like chimneys, are measured in terms of linear feet ("LF"). Still other items, like flooring, are generally measured in square feet ("SF").

Campus Name: Raby HS Page: 42 of 44 Assessment Date: 05/20/2024



Classroom Summary

Classroom Summary				Flara Dian		Oleman	0		
			Daam	Floor Plan	A	Glazed Window	Operable Window	Window	Smart-
Comment Hears	Interview II to an	Doom Location	Room	Room Number	Area				
Current Usage	Intended Usage	Room Location	Number	Number	(SF)	Area	Area	Stop	Board
Building : Main	Decider Classics	Ond Floor	204	004	4.040	204	00	Υ	Υ
Computer Lab	Regular Classroom	2nd Floor 4th Floor	221	221	1,243	201	96	Y	
Culinary	Culinary		420	420	1,786	40,218	40	Y	N
Faculty Lounge	Other Instructional Use	2nd Floor	216	216	1,050	248	128		N
Faculty Lounge	Regular Classroom	2nd Floor	208	208	700	124	64	Y	N
Office	Office	4th Floor	406A	406A	331	84	4	Y	N
Office	Regular Classroom	2nd Floor	209	209	760	186	96	Y	Y
Office	Regular Classroom	2nd Floor	226	226	1,108	279	144	Υ	N
Office	Regular Classroom	3rd Floor	313	313	725	106	66	Υ	Υ
Other Instructional Use	Art Room	4th Floor	410	410	1,025	252	12	Υ	Υ
Other Instructional Use	Health	2nd Floor	206	206	977	248	157	Υ	N
Other Instructional Use	Office	1st Floor	120	120	1,025	420	210	Υ	N
Other Instructional Use	Office	1st Floor	120A	120A	216	28	14	Υ	N
Other Instructional Use	Office	1st Floor	120B	120B	216	28	14	Υ	N
Other Instructional Use	Regular Classroom	3rd Floor	311	311	725	148	24	Υ	Υ
Other Instructional Use	Regular Classroom	4th Floor	406	406	525	228	10	Υ	N
Other Instructional Use	Science Classroom	3rd Floor	324	324	1,076	210	8	Υ	Υ
Other Instructional Use	Store Room	3rd Floor	310	310	515	132	6	Υ	N
Regular Classroom	Other Instructional Use	3rd Floor	308	308	700	176	8	Υ	Υ
Regular Classroom	Other Instructional Use	3rd Floor	312	312	865	220	10	Υ	Υ
Regular Classroom	Other Instructional Use	3rd Floor	320	320	1,105	348	18	Υ	Υ
Regular Classroom	Regular Classroom	2nd Floor	210	210	700	124	64	Υ	Y
Regular Classroom	Regular Classroom	2nd Floor	212	212	700	124	64	Υ	N
Regular Classroom	Regular Classroom	2nd Floor	214	214	700	124	64	Υ	Υ
Regular Classroom	Regular Classroom	2nd Floor	215	215	685	124	64	Υ	N
Regular Classroom	Regular Classroom	3rd Floor	306	306	995	352	16	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	309	309	725	132	66	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	314	314	1,025	252	12	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	318	318	1,025	252	12	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	321	321	725	126	4	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	322	322	1,092	210	8	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	325	323	725	126	88	Υ	Υ
Regular Classroom	Regular Classroom	3rd Floor	327	327	725	252	8	Y	Υ
Regular Classroom	Regular Classroom	3rd Floor	330	326	725	308	154	Y	Y
Regular Classroom	Regular Classroom	4th Floor	422A	422A	710	168	8	Ϋ́	Y
Regular Classroom	Regular Classroom	4th Floor	422B	422B	900	168	6	Ý	Y
Regular Classroom	Regular Classroom	4th Floor	425	425	1,105	336	14	N	Y
Regular Classroom	Regular Classroom	4th Floor	426	426	740	252	10	Y	N
Science Lab Level 1	Science Lab Level 1	4th Floor	414	414	1,444	336	16	Y	N

Campus Name: Raby HS Page : 43 of 44 Assessment Date: 05/20/2024







Classroom Summary

			Room	Floor Plan Room	Area	Glazed Window	Operable Window	Window	Smart-
Current Usage	Intended Usage	Room Location	Number	Number	(SF)	Area	Area	Stop	Board
Science Lab Level 2	Science Lab Level 2	4th Floor	421	421	1,025	252	12	Υ	Y
Science Lab Level 3	Science Lab Level 3	4th Floor	411	411	1,172	212	12	Υ	Y
Store Room	Regular Classroom	2nd Floor	225	225	650	120	60	Υ	
Store Room	Regular Classroom	3rd Floor	315	315	725	192	12	Υ	N
Store Room	Regular Classroom	4th Floor	408	408	1,025	252	12	Υ	Y
Store Room	Science Lab Level 2	4th Floor	415	415	1,172	256	12	Y	N
Weight	Regular Classroom	1st Floor	108	108	500	93	45	Y	N

Campus Name: Raby HS Page : 44 of 44 Assessment Date: 05/20/2024